MACADAM










Volkswagen Caddy: VRT67H

Vinnumber:	**WV1ZZZSK3PX009069**	Versionname:	**Caddy 1.5 TSI 98kW CNG Maxi (o.v. voor PostNL-Post) klant-spec.**
First Registrationdate:	**19/10/2022**	Fiscalpower:	
Expertise Mileage:	**133783**	Power Kw:	**98**
Bodytype:		Body colour	**Candy white**
Gearbox:	**MAN 6 VIT**	Paint type	**Opaque**
Transmission:		Type of rims (mounted)	**Steel**
Fueltype:	**Gas**	Parking lot	**891**
Number of seats	**2**		
Type of rims (mounted)	**Steel**		
Maintenance needed	**No**		

Options

Number of keys total	**2**	Rear parking sensors	
Manual climate control		Sliding door right-side	
Radio multimedia			

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	215 / 55 / 17 / 91 / V / Steel	6,9 mm	Continental	All season
	Right	215 / 55 / 17 / 91 / V / Steel	5,2 mm	Continental	All season
Rear	Left	215 / 55 / 17 / 91 / V / Steel	7,7 mm	Continental	All season
	Right	215 / 55 / 17 / 91 / V / Steel	4,2 mm	Continental	All season

Assistance equipment

Interior, Smell, Ozone treatment

No pictures to display

Seat, Worn, Replace






Interior, Dirty, Cleaning




Floor mat(s), Missing, Replace



Floor covering, Worn, Replace




Backrest cover FR, Burned, Smart repair





Door FL, Dent(s) and scratch(es), Repair and paint (complete)







Wing FL, Dent(s) and scratch(es), Replace and paint








Wing RL, Dent(s) and scratch(es), Repair and paint (complete)










Outside rear-view mirror housing L, Scratch(es), Replace and paint




Outer sill L, Dent(s) and scratch(es), Repair and paint (complete)





Wheel cover FL, Missing, Replace



Bonnet, Dent(s) and scratch(es), Repair and paint (complete)





Headlight L, Scratch(es), Replace




Bumper F, Deformed / Strained, Replace





Bumper grille FR, Scratch(es), Replace




Sliding door R, Dent(s) and scratch(es), Repair and paint (complete)









Wing FR, Dent(s), Repair and paint (complete)



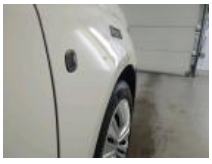


Outer sill R, Dent(s) and scratch(es), Repair and paint (complete)








Outside rear-view mirror housing R, Scratch(es), Replace and paint




Wing RR, Dent(s), Paintless dent repair






Boot door panel RL, Dent(s) and scratch(es), Repair and paint (complete)






Bumper R, Scratch(es), Smart repair




Boot door panel RR, Dent(s), Repair and paint (complete)





Bull bar R, Dent(s), Replace





Bodywork, Chemical polution, Polish









Onderhoudshistorie van: WV1ZZZSK3PX009069

ALPHABET

Kenteken	VRT67H
Merk Model	Volkswagen Caddy 1.5 TSI 98kW CNG Maxi (o.v. PostNL-Post) klantspec.
Brandstofsoort	CNG
Datum deel1	10/19/22

Datum reparatie	Kilometerstand	Reparatie omschrijving
10/12/26	132,606	Boordcomputer
10/5/26	132,111	Vervanging band
10/1/26	131,000	Remschijf + blokken achter
10/1/26	131,000	Vervanging band
7/9/26	130,101	Inspuitcomputer
7/3/26	130,042	Boordcomputer
5/11/26	127,199	APK
5/11/26	127,199	Boordcomputer
5/11/26	127,199	Koppeling compleet
5/11/26	127,199	Luchtfilter
5/11/26	127,199	Onderhoudsbeurt
5/11/26	127,199	Ruitenwisserblad(en) achterzijde
5/11/26	127,199	Ruitenwisserblad(en) voorzijde
5/11/26	127,199	Vervanging band
4/20/26	125,170	Vervanging band
2/16/26	119,134	Remschijf + blokken achter
2/16/26	119,134	Remschijf + blokken voor
2/2/26	117,656	Vervanging band
2/2/26	117,679	Bougie
2/2/26	117,679	Onderhoudsbeurt
11/24/25	110,006	Vervanging band
10/16/25	107,936	Reparatie band(en)
10/6/25	107,122	APK
10/6/25	107,122	Remblokken achterzijde
10/6/25	107,122	Remklauw(en) achterzijde
9/4/25	103,661	Vervanging band
8/8/25	101,474	Reparatie band(en)
6/30/25	97,004	Onderhoudsbeurt
6/30/25	97,004	Remblokken voorzijde
6/13/25	95,485	Remschijf + blokken achter
6/6/25	94,600	Vervanging band
5/7/25	92,032	Reparatie band(en)
4/15/25	89,623	Reparatie band(en)
4/1/25	88,433	Vervanging band
2/3/25	82,231	Luchtfilter
2/3/25	82,231	Onderhoudsbeurt
2/3/25	82,231	Remblokken achterzijde
2/3/25	82,231	Remblokken voorzijde
2/3/25	82,231	Remvloeistof
2/3/25	82,231	Sleutelbatterij

Datum reparatie	Kilometerstand	Reparatie omschrijving
12/20/24	78,501	Vervanging band
11/6/24	73,364	Vervanging band
11/1/24	72,926	Remschijf + blokken achter
11/1/24	72,926	Sleutelbatterij
8/26/24	69,091	Onderhoudsbeurt
8/26/24	69,091	Remschijf + blokken voor
8/26/24	69,091	Ruitenwisserblad(en) voorzijde
8/26/24	69,091	Vervanging band
7/17/24	62,860	Remblokken achterzijde
4/8/24	53,355	Bougie
4/8/24	53,355	Onderhoudsbeurt
4/8/24	53,355	Remblokken voorzijde
4/8/24	53,355	Ruitenwisserblad(en) achterzijde
4/8/24	53,355	Vervanging band
3/22/24	51,560	Ruitenwisserblad(en) achterzijde
3/19/24	51,184	Remblokken achterzijde
1/11/24	45,299	Vervanging band
1/2/24	44,851	Reparatie band(en)
11/16/23	40,593	Remblokken voorzijde
11/16/23	40,593	Remschijf + blokken achter
10/9/23	42,555	Vervanging band
10/2/23	35,638	Sleutel/Kaart
9/11/23	33,866	Onderhoudsbeurt
9/11/23	33,866	Ruitenwisserblad(en) voorzijde
9/11/23	33,866	Vervanging band
7/31/23	31,177	Remblokken achterzijde
6/6/23	23,761	Remblokken voorzijde
6/6/23	23,761	Reparatie band(en)
6/6/23	23,761	Vervanging band
5/12/23	21,435	Reparatie band(en)
4/17/23	18,464	Onderhoudsbeurt
4/17/23	18,464	Remblokken achterzijde
4/17/23	18,464	Vervanging band
3/14/23	12,122	Vervanging band