



## Peugeot Expert (Segm. B2): 1XXR066

|                                   |                                 |                        |                                                     |
|-----------------------------------|---------------------------------|------------------------|-----------------------------------------------------|
| Vinnumber:                        | <b>VF3VFAHKKL7021670</b>        | Versionname:           | <b>Expert Standard Premium 2.0 BlueHDi 120pk/cv</b> |
| First Registrationdate:           | <b>24/06/2020</b>               | Fiscalpower:           |                                                     |
| Expertise Mileage:                | <b>139727</b>                   | Power Kw:              | <b>88</b>                                           |
| Bodytype:                         |                                 | Type of rims (mounted) | <b>Steel</b>                                        |
| Gearbox:                          | <b>MAN 6 VIT</b>                |                        |                                                     |
| Transmission:                     |                                 |                        |                                                     |
| Fueltype:                         | <b>Diesel</b>                   |                        |                                                     |
| Maintenance                       | <b>OK</b>                       |                        |                                                     |
| Maintenance                       | <b>plus 30680 km</b>            |                        |                                                     |
| Battery functioning               | <b>Yes</b>                      |                        |                                                     |
| Type of rims (mounted)            | <b>Steel</b>                    |                        |                                                     |
| Certificate of Conformity         | <b>Yes</b>                      |                        |                                                     |
| Category                          | <b>Light Commercial Vehicle</b> |                        |                                                     |
| Registration Certificate Car (BE) | <b>Yes</b>                      |                        |                                                     |

## Options

|                          |                            |                 |                      |
|--------------------------|----------------------------|-----------------|----------------------|
| Number of keys total     | <b>2</b>                   | Type of Tow bar | <b>Tow bar fixed</b> |
| GPS                      |                            |                 |                      |
| Type of Maintenance book | <b>Digital maintenance</b> |                 |                      |
| Type of GPS storage      | <b>HD</b>                  |                 |                      |

## Tyres

|                       |                        |                       |       |                          |
|-----------------------|------------------------|-----------------------|-------|--------------------------|
|                       | <b>215/65/16/107 R</b> |                       |       |                          |
| Winter tyres:         | Fr.L.                  | <b>Semperit: 5 mm</b> | Fr.R. | <b>Semperit: 4 mm</b>    |
|                       | Re.L.                  | <b>Semperit: 7 mm</b> | Re.R. | <b>Semperit: 9 mm</b>    |
| Tyre profile depth FL |                        |                       |       | <b>5.0</b>               |
| Tyre profile depth FR |                        |                       |       | <b>4.0</b>               |
| Tyre profile depth RL |                        |                       |       | <b>7.0</b>               |
| Tyre profile depth RR |                        |                       |       | <b>9.0</b>               |
| Tyre size FL          |                        |                       |       | <b>215/65 R 16 107 R</b> |
| Tyre size FR          |                        |                       |       | <b>215/65 R 16 107 R</b> |
| Tyre size RL          |                        |                       |       | <b>215/65 R 16 107 R</b> |
| Tyre size RR          |                        |                       |       | <b>215/65 R 16 107 R</b> |
| Tyre type FL          |                        |                       |       | <b>Winter</b>            |
| Tyre type FR          |                        |                       |       | <b>Winter</b>            |
| Tyre type RL          |                        |                       |       | <b>Winter</b>            |
| Tyre type RR          |                        |                       |       | <b>Winter</b>            |
| Tyre make FL          |                        |                       |       | <b>2477</b>              |
| Tyre make FR          |                        |                       |       | <b>2477</b>              |
| Tyre make RL          |                        |                       |       | <b>2477</b>              |
| Tyre make RR          |                        |                       |       | <b>2477</b>              |

## Assistance equipment

|             |            |      |            |
|-------------|------------|------|------------|
| Spare wheel | <b>Yes</b> | Jack | <b>Yes</b> |
|-------------|------------|------|------------|

MOT certificate, Non-conforme, Replace



Dashboard, Hole, Smart repair



Roof liner, Burned, Smart repair



Seat cover FL, Worn, Acceptable



Seat cover FL, Burned, Smart repair



Seat cover FR, Stain, Cleaning



Bumper F, Scratch(es), Acceptable



Wing FL, Scratch(es), Acceptable




Door FL, Scratch(es), Acceptable



Central pillar L, Scratch(es), Acceptable



Wing RL, Dent(s) and scratch(es), Acceptable

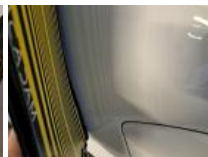

Shutter / cover R, Broken, Replace



Boot door panel RL, Dent(s) and scratch(es), Repair and paint (complete)



Boot door panel RR, Dent(s) and scratch(es), Repair and paint (complete)



Bumper R, Scratch(es), Acceptable




Wing RR, Dent(s) and scratch(es), Repair and paint (complete)




Sliding door R, Dent(s), Acceptable



Door FR, Dent(s), Repair and paint (complete)

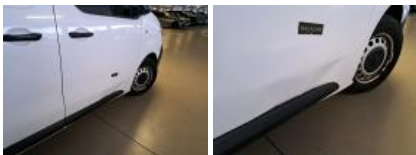

Door trim FR, Broken, Replace

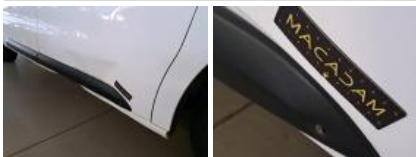

Outer sill R, Dent(s) and scratch(es), Repair and paint (complete)



Outside rear-view mirror housing R, Scratch(es), Acceptable



Wing FR, Dent(s), Acceptable



Roof, Dent(s), Acceptable



|                       |                                                      |
|-----------------------|------------------------------------------------------|
| <b>Kenteken</b>       | 1XXR066                                              |
| <b>Merk Model</b>     | Peugeot Expert Standard Premium 2.0 BlueHDi 120pk/cv |
| <b>Brandstofsoort</b> | Diesel                                               |
| <b>Datum deel1</b>    | 6/24/20                                              |

| Datum reparatie | Kilometerstand | Reparatie omschrijving     | Bewerking |
|-----------------|----------------|----------------------------|-----------|
| 10/13/25        | 135,617        | ruitensproeier             | Vervangen |
| 7/11/25         | 131,242        | brandstof hoofdfilter      | Vervangen |
| 7/11/25         | 131,242        | luchtfiler                 | Vervangen |
| 7/11/25         | 131,242        | luchtfiler interieur       | Vervangen |
| 7/11/25         | 131,242        | nazicht technische keuring | Uitvoeren |
| 7/11/25         | 131,242        | oliezeef                   | Vervangen |
| 5/9/25          | 125,381        | accu                       | Vervangen |
| 5/9/25          | 125,381        | universele lampen          | Vervangen |
| 1/16/25         | 116,061        | AdBlue injector            | Vervangen |
| 7/11/24         | 111,908        | airco vulling              | Uitvoeren |
| 7/11/24         | 111,908        | controle niveaus           | Uitvoeren |
| 7/11/24         | 111,908        | nazicht technische keuring | Uitvoeren |
| 10/9/23         | 94,399         | 100000 km                  | Uitvoeren |
| 10/9/23         | 94,399         | brandstof hoofdfilter      | Vervangen |
| 10/9/23         | 94,399         | luchtfiler                 | Vervangen |
| 10/9/23         | 94,399         | luchtfiler interieur       | Vervangen |
| 10/9/23         | 94,399         | oliezeef                   | Vervangen |
| 10/9/23         | 94,399         | vliegwiél                  | Vervangen |
| 6/23/23         | 79,229         | controle niveaus           | Uitvoeren |
| 6/23/23         | 79,229         | klein materiaal            | Uitvoeren |
| 6/23/23         | 79,229         | nazicht technische keuring | Uitvoeren |
| 6/23/23         | 79,229         | remblokken achter          | Vervangen |
| 6/23/23         | 79,229         | remblokken vooraan         | Vervangen |
| 10/27/22        | 52,991         | AdBlue injector            | Vervangen |
| 10/27/22        | 52,991         | foutencodes uitlezen       | Uitvoeren |
| 7/4/22          | 44,317         | 45000 km                   | Uitvoeren |
| 7/4/22          | 44,317         | brandstof hoofdfilter      | Vervangen |
| 7/4/22          | 44,317         | luchtfiler                 | Vervangen |
| 7/4/22          | 44,317         | luchtfiler interieur       | Vervangen |
| 7/4/22          | 44,317         | nazicht technische keuring | Uitvoeren |
| 7/4/22          | 44,317         | oliezeef                   | Vervangen |
| 6/9/21          | 21,228         | nazicht technische keuring | Uitvoeren |