



RENAULT Clio: 5085-KRB

Vinnumber:	VF1R9800361563038	Versionname:	Sport Tou. Limited En. TCe 66kW (90CV) familiar
First Registrationdate:	23/10/2018	Fiscalpower:	66kW 5P manual
Expertise Mileage:	93111	Power Kw:	
Bodytype:	Break	Body colour	White
Gearbox:	MAN 5 VIT	Type of rims (mounted)	Aluminium
Transmission:			
Fueltype:	Petrol		
Engine functioning	Yes		
Battery functioning	Yes		
Vehicle running	Yes		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	1	Luggage cover
Number keys remote	1	Roof bar alu
Windows electric F		
Cruise Control		
Steering wheel multifunctional		
Steering wheel leather		
Radio multimedia		
Type of climate control	Manual climate control	

Tyres

195/55/16/91 V				
Summer tyres:	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 5 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				195/55 R 16 91 V
Tyre size FR				195/55 R 16 91 V
Tyre size RL				195/55 R 16 91 V
Tyre size RR				195/55 R 16 91 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Repair kit	Yes
------------	------------

Ignition key, Missing, Repair/replace (lump sum)



Seat cover FR, Burned, Replace



Glove compartment lid, Scratch(es), Acceptable



Dashboard, Tear, Replace



Boot lid covering R, Scratch(es), Replace



Outside rear-view mirror housing L, Scratch(es), Repair and paint (complete)



Outer door handle FL, Scratch(es), Paint



Door RL, Scratch(es), Repair and paint (complete)



Wing RL, Scratch(es), Repair and paint (complete)



Brand badge F, Broken, Replace



Alloy rim FR, Scratch(es), Acceptable



Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)



Door FR, Scratch(es), Repair and paint (complete)



Door RR, Scratch(es), Repair and paint (complete)




Wing RR, Scratch(es), Repair and paint (complete)



Tailgate / Boot, Dent(s) and scratch(es), Repair and paint (complete)



Bumper R, Scratch(es), Repair and paint (complete)

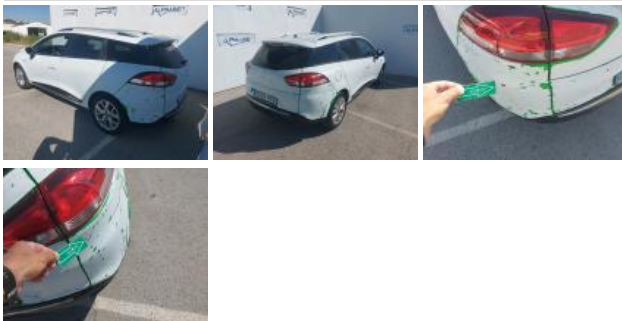

Bumper moulding RM, Broken, Replace



Brand badge R, Missing, Replace



Tyres, No damage, Check



Aerial, Missing, Replace

