
MACADAM



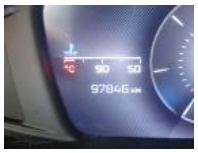

Peugeot 308 (UKL): 2EHZ759

Vinnumber:	**VR3FBYHZTPY612073**	Versionname:	**308 Allure 1.5 BlueHDi S&S 130pk/cv 5p EAT8**
First Registrationdate:	**18/10/2023**	Fiscalpower:	
Expertise Mileage:	**97846**	Power Kw:	**96**
Bodytype:		Type of rims (mounted)	**Aluminium**
Gearbox:	**Automatic**		
Transmission:			
Fueltype:	**Diesel**		
Maintenance	**OK**		
Maintenance	**geen melding**		
Battery functioning	**Yes**		
Type of rims (mounted)	**Aluminium**		
Certificate of Conformity	**Yes**		
Category	**Passenger Car**		
Registration Certificate Car (BE)	**Yes**		

Options

Number of keys total	**2**	Luggage cover	
GPS		Type of Tow bar	**No Tow bar**
Type of Maintenance book	**Maintenance book present**		
Type of GPS storage	**HD**		

Tyres

Summer tyres:	**225/45/17/94 V**			
	Fr.L.	**Michelin: 4 mm**	Fr.R.	**Michelin: 3 mm**
	Re.L.	**Michelin: 6 mm**	Re.R.	**Michelin: 5 mm**

Tyre profile depth FL	**4.0**
Tyre profile depth FR	**3.0**
Tyre profile depth RL	**6.0**
Tyre profile depth RR	**5.0**
Tyre size FL	**225/45 R 17 94 V**
Tyre size FR	**225/45 R 17 94 V**
Tyre size RL	**225/45 R 17 94 V**
Tyre size RR	**225/45 R 17 94 V**
Tyre type FL	**Summer**
Tyre type FR	**Summer**
Tyre type RL	**Summer**
Tyre type RR	**Summer**
Tyre make FL	**261**
Tyre make FR	**261**
Tyre make RL	**261**
Tyre make RR	**261**

Assistance equipment

Repair kit	**Yes**	Compressor	**Yes**

Seat cover R, Stain, Cleaning




Engine insulation, Hole, Replace






Windscreen, Stone chip(s), Windscreen repair





Bumper F, Stone chip(s), Acceptable





Alloy rim RL polished, Scratch(es), Repair and paint (complete)




Door RL, Dent(s) and scratch(es), Acceptable




Alloy rim FL polished, Scratch(es), Acceptable




Rear bulkhead lining, Scratch(es), Acceptable





Boot lid covering R, Scratch(es), Acceptable





Bumper R, Scratch(es), Acceptable







Alloy rim FR polished, Scratch(es), Repair and paint (complete)










Onderhoudshistorie van: VR3FBYHZTPY612073

ALPHABET

Kenteken	2EHZ759
Merk Model	Peugeot 308 Allure 1.5 BlueHDi S&S 130pk/cv 5p EAT8
Brandstofsoort	Diesel
Datum deel1	10/18/23

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
9/2/26	94,956	90000 km	Uitvoeren
9/2/26	94,956	oliezeef	Vervangen
3/13/26	79,841	diagnose	Uitvoeren
11/24/25	76,187	75000 km	Uitvoeren
11/24/25	76,187	diagnose	Uitvoeren
11/24/25	76,187	klein materiaal	
11/24/25	76,187	oliezeef	Vervangen
11/13/25	75,325	remblokken vooraan	Vervangen
11/13/25	75,325	ruitenwisserrubber achter	Vervangen
11/13/25	75,325	ruitenwisserrubber vooraan	Vervangen
7/3/25	63,866	oliewissel	Uitvoeren
7/3/25	63,866	oliezeef	Vervangen
2/12/25	50,577	batterij	Vervangen
2/12/25	50,577	brandstof hoofdfilter	Vervangen
2/12/25	50,577	diagnose	Uitvoeren
2/12/25	50,577	luchtfilter	Vervangen
2/12/25	50,577	luchtfilter interieur	Vervangen
2/12/25	50,577	oliezeef	Vervangen
2/12/25	50,577	onderhoud 2e jaar	Uitvoeren
7/18/24	25,937	luchtfilter interieur	Vervangen
7/18/24	25,937	oliezeef	Vervangen
7/18/24	25,937	onderhoud 1e jaar	Uitvoeren
7/18/24	25,937	ruitenwisserrubber achter	Vervangen
7/18/24	25,937	ruitenwisserrubber vooraan	Vervangen