



Expertise

Protocol number: 45914293
Order No. / Reference: 26415281
Inspection date: 12 Jun 2026

Manufacturer: Skoda
VIN: TMBLN7PS3ST062895

Model: Kodiahq 2.0 TDI 4x4 DSG Selection



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiahq 2.0 TDI 4x4 DSG Selection	
Vehicle Identification number	TMBLN7PS3ST062895
Mileage (Read)	30,905 km
First registration	2 Apr 2025
Number of holders	1
Next periodical technical inspection	04/2028
(Report not on hand)	
Power / Engine displacement	142 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Velvet rot metallic (F3P)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	-800 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HM597948
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AYH 00257		
Emission standard	EURO6;WLTP;EA;PI/CI;M, N1, N2	fine dust sticker	
Permitted total weight	2,330 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/55 R18 104H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100V	Summer tyres on Light alloy	Kumho	5mm / 5mm
2)	235/55 R18 100V	Summer tyres on Light alloy	Kumho	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Turning assistant including evasive steering support
- Airbag, center airbag front
- Airbag, driver and passenger
- Airbag, front and rear head airbags
- Permanent all-wheel drive
- Trailer hitch preparation
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors
- Hill start assist
- Glasses compartment in the headliner
- Diesel particulate filter
- Digital rotary controls (Smart Dials)
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Front radar assistant including city emergency braking function with pedestrian and cyclist detection
- Illuminated glove compartment
- rear window wiper
- Intelligent Speed Assist (ISA)
- Interior Design Selection Loft
- Isofix anchorage on the outer rear seats including top tether
- Front and rear headrests are height-adjustable.
- Paint finish: Uni Energy Blue
- LED headlights with driving light assistant
- Rear center armrest with cup holders
- Front center armrest including cup holder
- Multi-collision brake
- Phonebox with inductive fast charging function for 2 smartphones including cooling
- Radio accessories: 2 x USB-C ports in the front and 2 x USB-C charging ports in the rear.
- Rain sensor and driving light assistant (Easy Light Assist)
- Tire pressure monitoring
- Rear view camera
- Seat belts
- Seats: Remote release of the rear seat backrests (2nd row) in the boot
- Skoda Care Connect
- Sun visors with illuminated make-up mirror on driver and passenger side
- 12V power outlet in the luggage compartment and on the back of the center console
- Textile floor mats
- Traffic sign recognition
- Preparation for an alcohol test
- Central locking including remote control integrated into the key
- Storage compartments in the door panels with bottle holders (1.5 l) and compartments for high-visibility vests, front and back.
- Airbag, front side airbags
- Ambient lighting inside and logo projector outside
- Anti-lock braking system (ABS)
- Attention and fatigue detection
- Exterior mirrors and door handles painted in body color
- Hydraulic brake assist
- Roof rails, black
- Digital Cockpit Plus (10")
- Third brake light
- Electronic transverse differential lock (XDS+)
- Electric windows front and rear
- Cruise control
- Transmission: 7-speed dual-clutch transmission (DSG)
- Heated rear window
- Automatically dimming interior mirror with sensors, frameless
- Isofix anchorage on the front passenger seat
- Electric child safety lock for the rear doors and windows
- Climatronic air conditioning (3-zone)
- Crossroad Assist
- LED taillights with black strip between the lights
- Steering wheel: Leather steering wheel with multifunction buttons including paddle shifters.
- Engine drag torque control (MSR)
- Front and rear parking sensors with maneuvering brake function
- Radio: Basic infotainment system
- Radio accessories: Wireless SmartLink
- Umbrella compartment in the driver's door
- Tire Mobility Kit
- Wheels: 18" Mazeno Aero alloy wheels, silver polished
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Rear seat backrest split 40:20:40, foldable
- Seats: Front seats are height-adjustable, including manually adjustable lumbar support.
- Lane keeping assistant (Lane Assist)
- Lane change assist (Side Assist) and parking assist, as well as exit warning.
- Pockets on the back of the front seats including smartphone pockets
- Lashing eyes in the luggage compartment
- Immobiliser
- Electric auxiliary heater



Extra equipment

- Acoustic glazing in the front side windows and Sunset ((rear window and rear side windows dark tinted))
- Paint finish: Metallic
- Package: Infotainment Plus (Navigation system - 13" infotainment display - Display cleaner - Head-up display - Infotainment Online (3-year subscription) - ChatGPT integration)
- Package: Light & Sight Plus (Matrix LED headlights - Dynamic Light Assist - LED taillights with animated turn signals and red crystal structure strip between the lights - Front grille with horizontal light strip (Selection - with Unique Dark Chrome elements))
- Auxiliary heater with remote control
- Swiveling trailer hitch including trailer stabilization (with trailer maneuvering assistant (Trailer Assist))
- Package: Driving Assistance Plus (Proactive occupant protection Travel Assist Plus with: - Adaptive Cruise Control ACC (cruise control system deleted) - Adaptive Lane Assist (Lane Assist+) - Traffic Jam and Emergency Assist - Intelligent Park Assist 5.0 - Trained Park Assist - Remote Park Assist - 360° Surround View Cameras)
- Panoramic sliding sunroof, electric, including sunshade (no glasses compartment in the headliner)
- Wheels: 18" alloy wheels Soira Aero, anthracite polished (7.5Jx18, ET40, with tires 235/55 R18 100V)
- Variable loading floor in the luggage compartment

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - Smart repair
2	Door - front left side	Door - dent(s) - Smart repair
3	Side panel - rear left side	Side panel (Verätzungen-Mehrkosten möglich) - Paint defect - Conditioning
4	Misc.	Inspection / maintenance - Due - Perform
5	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

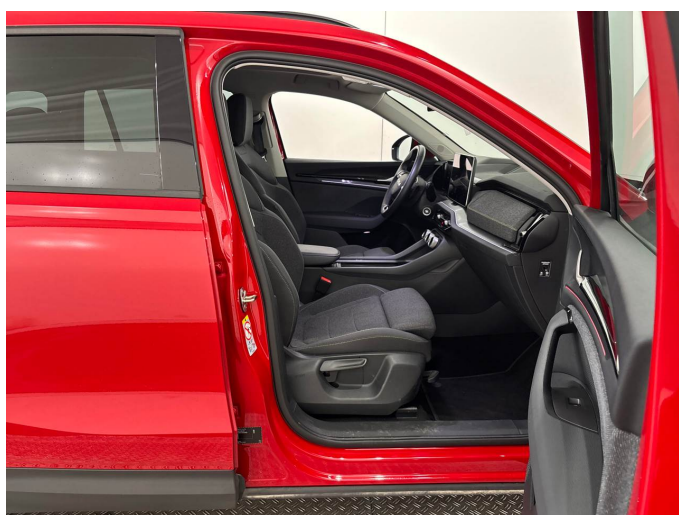


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument cluster



Figure 9: Instrument panel



Figure 10: Interior 360° view



Figure 11: Cargo area



Figure 12: VIN



Figure 13: Mounted tyres

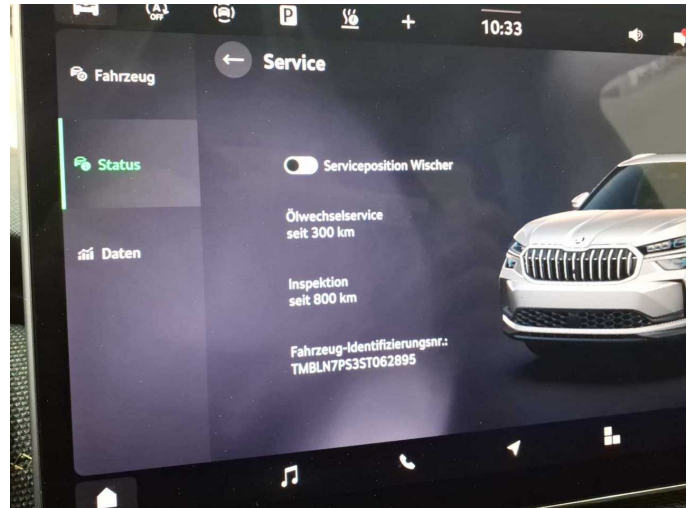


Figure 14: Documents

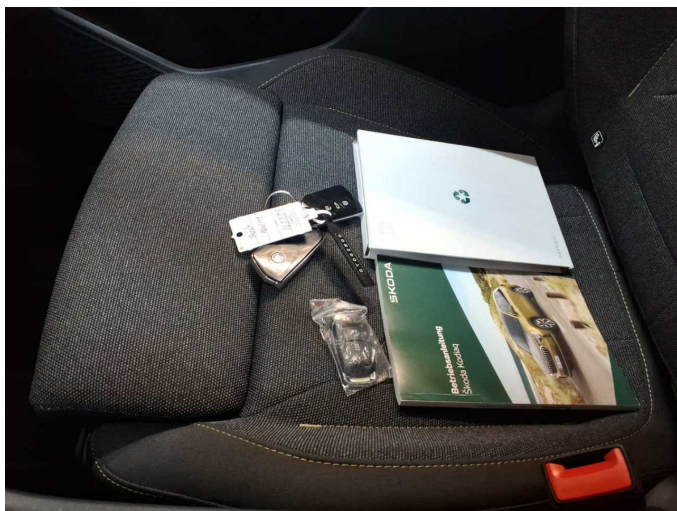


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.

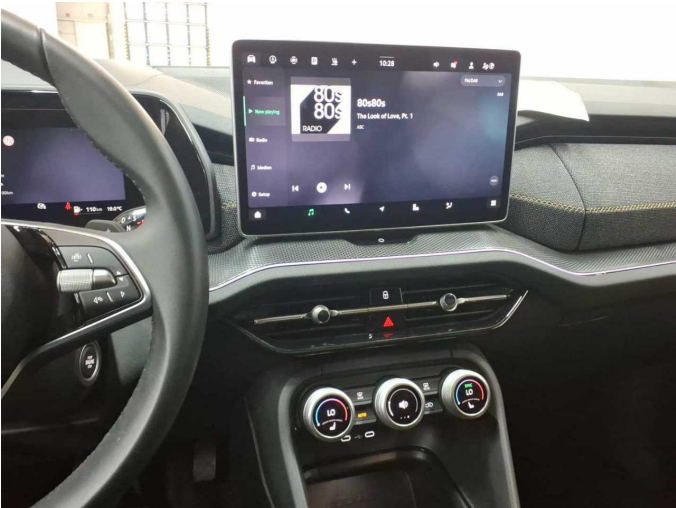


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.




Figure 37: Misc.




Damage 1: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 1: Rear bumper: Rear bumper - Scratch(es) - Smart repair

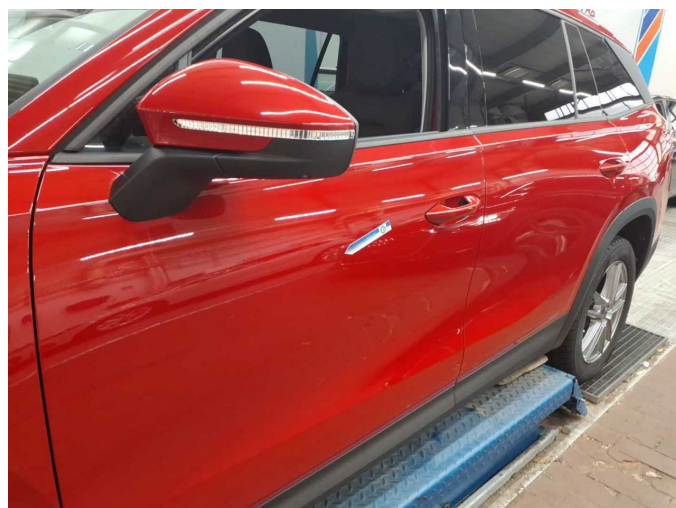

Damage 2: Door - front left side: Door - dent(s) - Smart repair

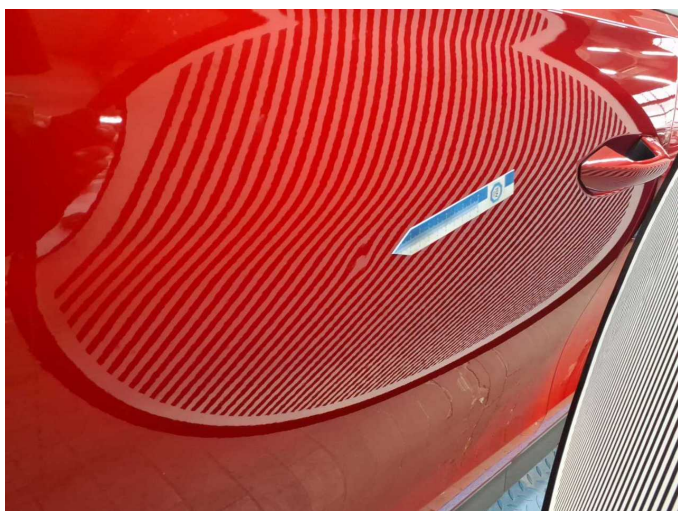


Damage 2: Door - front left side: Door - dent(s) - Smart repair




Damage 3: Side panel - rear left side: Side panel (Verätzungen-Mehrkosten möglich) - Paint defect - Conditioning




Damage 3: Side panel - rear left side: Side panel (Verätzungen-Mehrkosten möglich) - Paint defect - Conditioning

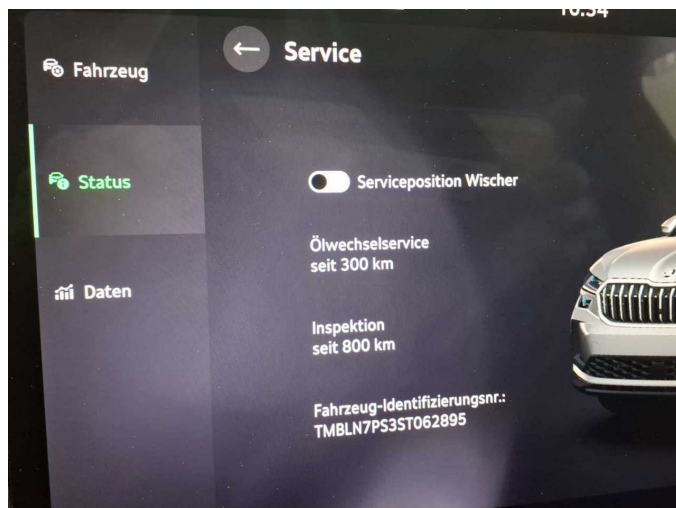

Damage 4: Misc.: Inspection / maintenance - Due - Perform

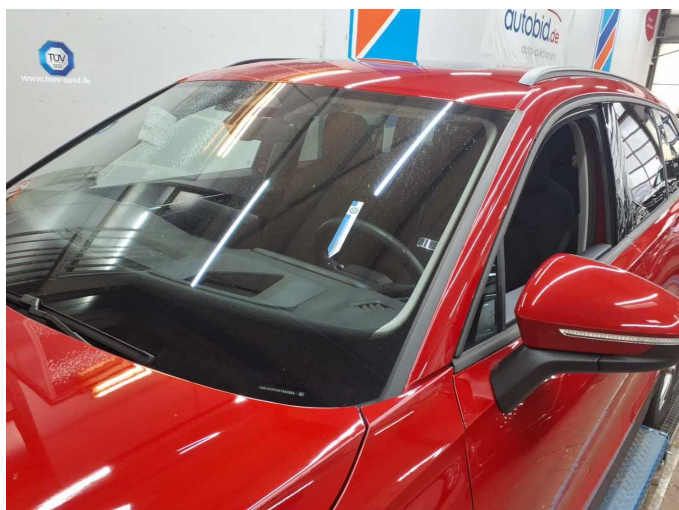

Damage 5: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace

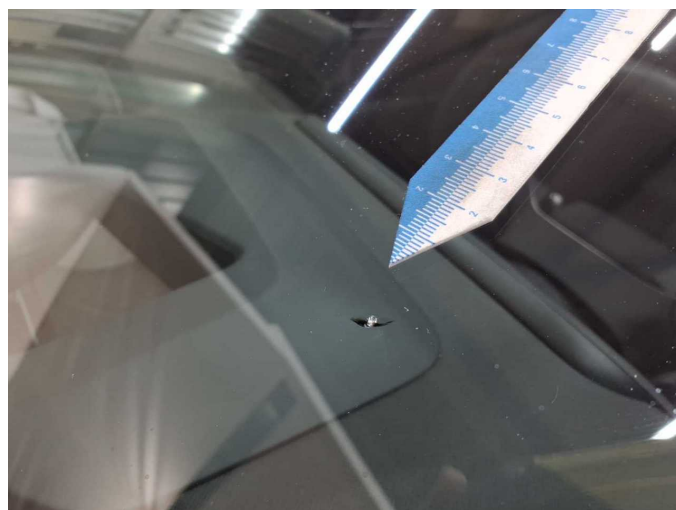

Damage 5: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace