



Expertise

Protocol number: 46919262
Order No. / Reference: 26687499
Inspection date: 5 Aug 2026

Manufacturer: Mercedes-Benz

Model: GLC-Coupe 200 d 4Matic 9G-TRONIC AMG Line

VIN: W1N2533161G114182



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC-Coupe 200 d 4Matic 9G-TRONIC AMG Line	
Vehicle Identification number	W1N2533161G114182
Mileage (Read)	113,707 km
First registration	11 Jul 2022
Number of holders	1
Next periodical technical inspection	05/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,950 ccm / 4
Power	120 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	Car hatchback
Colour / colour code	Obsidianschwarz metallic
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	230 Tag(e)
Last service on / at	03/2026 at 110,008 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ488137
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AKJ 00125		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,500 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	235/60 R18 107H	Winter tyres on Light alloy	Continental	8mm / 8mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/55 R19 101V	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments
- Airbag: Kneebag for driver
- Airbag: Windowbags
- 4MATIC all-wheel drive
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Tachometer
- DYNAMIC SELECT
- EASY-Pack cargo cover (removable)
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Black floor mats with AMG lettering
- Rear window heated
- Instrument panel and door sills in ARTICO man-made leather
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display
- Headrests 5-way
- LED High Performance Headlights
- Steering column mechanically adjustable in height and length
- Navigation accessories: Extended MBUX functions
- Package: AMG Line Exterior
- Package: Interior light
- Radio accessories: Digital radio
- Radio accessories: Touchpad
- Remote Services Plus
- Windscreen wipers with rain sensor
- Seats: Rear seat backrests foldable
- Seats: Front seats electrically adjustable
- Pre-installation for roof rack systems
- Immobiliser
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- AMG pedal assembly made of brushed stainless steel with rubber studs
- Automatic passenger airbag deactivation
- On-board computer
- Diesel particulate filter
- Third brake light in LED technology
- EASY-Pack tailgate with electric operation for opening and closing
- Driving light assistant
- electric parking brake
- Transmission: 9G-TRONIC
- Black fabric headliner
- KEYLESS-GO start function
- Climate: THERMATIC automatic climate control with 2 climate zones
- Communication module (LTE) for the use of Mercedes me connect services
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black Nappa leather
- Mercedes-Benz emergency call system
- Package: Storage
- Package: Chrome
- Upholstery: ARTICO leatherette/DINAMICA microfiber
- Radio accessories: Remote Online
- Tire pressure monitoring system (TPMS)
- Rear view camera
- Seat: Front sports seats
- Seats: i-Size child restraint system on the outer rear seats
- Cruise control
- High-visibility vest for drivers
- Central locking



Extra equipment

- Ambient lighting (Design the interior according to your personal preference or current mood. With a total of 64 colors, the ambient lighting offers almost unlimited possibilities for lighting design and has the right color for every situation. Illuminated door sills on the driver and passenger sides.)
- Electric sunroof (glass design with anti-pinch protection).
- Fully digital instrument display (The fully digital instrument display with Classic, Progressive and Sport display styles lets you decide which information is important to you and how it is displayed. The 31.2 cm (12.3") display delivers a crisp image that is easy to read in all lighting conditions.)
- Heated windshield washer system
- Navigation accessories: Pre-installation for Live Traffic Information (With Live Traffic Information, your navigation system receives real-time traffic data and optimizes dynamic route guidance. Thanks to precise and up-to-date information on traffic jams, stop-and-go traffic, and more, you are supported in reducing travel times.)
- Package: Comfort (Seat heating for driver and front passenger, electric and manual adjustment options for driver and front passenger seats, electro-pneumatic 4-way lumbar support and lateral support adjustment with control element on the seat, electric seat cushion tilt adjustment, electric height adjustment, electric backrest adjustment, mechanical seat cushion depth adjustment by 6 cm with leg rest pad, mechanical longitudinal adjustment, mechanical headrest adjustment)
- Package: Mirrors (Electrically folding exterior mirrors, lowering right exterior mirror, automatic dimming function)
- Running boards in aluminum look with rubber studs
- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4-piece set in 5-twin-spoke design (high-gloss black painted and polished with 235/55 R19 tires on 8 J x 19 ET 38 rims)
- AMG spoiler lip (The AMG Line's spoiler lip, painted in the car's color, makes a strong statement about your pursuit of superior performance: The clearly visible aerodynamic element on the trunk lid gives your Mercedes-Benz an even sportier appearance.)
- Decorative elements: open-pored black ash wood
- Head-up display
- KEYLESS-GO
- Package: Advanced Light (LED High Performance headlights and adaptive LED taillights, Adaptive Highbeam Assist)
- Package: Advanced Park (Parking package with reversing camera, active parking assistant with PARKTRONIC)
- Package: Business (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats; larger fuel tank capacity)
- Package: Night for AMG Line Exterior (radiator grille with diamond pattern, silver pins and high-gloss black louvre, 48.3 cm (19") AMG 5-spoke light-alloy wheels painted high-gloss black and polished with front axle 235/55 R 19 on 8J x 19 ET 38 and rear axle 255/50 R 19 on 9J x 19 ET 20, front and rear underguards painted black, exterior mirror housings painted high-gloss black, beltline trim strip and window surrounds in high-gloss black, heat-insulating dark tinted glass from the B-pillar back)
- Paint finish: Metallic
- Type designation removed from tailgate

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratched - Smart repair
2	Door - rear right side	Door - Scratch(es) - Smart repair
3	Body	A-pillar - right side - Stone chips - Smart repair
4	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
5	2nd wheel set	1 tyre - Broken / torn - Replace
6	Sill - right side	Cat walk - Deformed - Replace
7	2nd wheel set	1 alloy rim - Scratched - Loss in value
8	Bonnet	Bonnet (Sandstrahleffekt) - Stone chips - Paint
9	2nd wheel set	1 alloy rim - Scratched - Replace
10	Front bumper	Front bumper (+ Blende+Leiste erneuern) - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front right side - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 27 Oct 2025	1.084,25 €
2	Side - left, Provided by user / customer, from 14 Jun 2023	1.774,10 €

Repainting

No.	Repainting
1	Side panel - rear left side
2	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear left side	165 µm	Door - rear left side	362 µm
-----------------------------	--------	-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

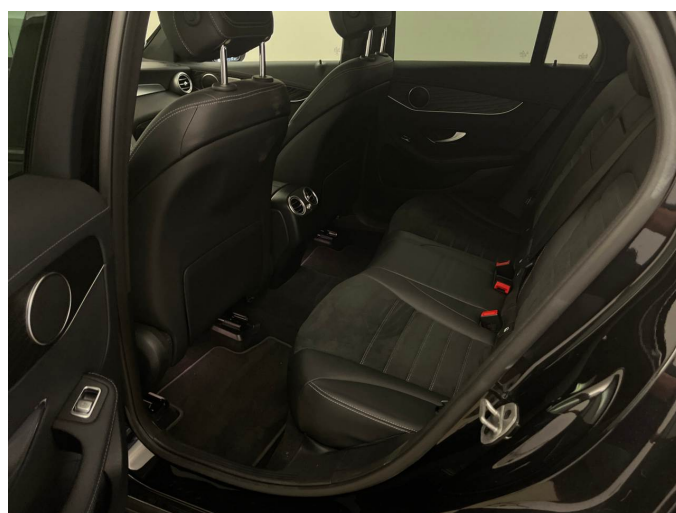


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

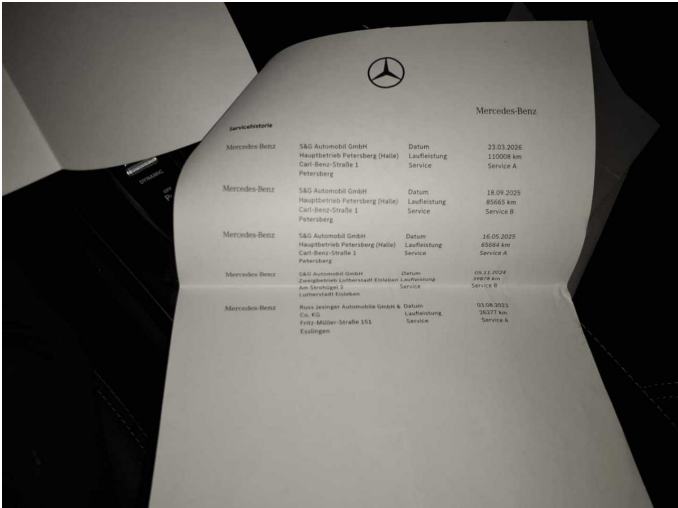


Figure 14: Documents



Figure 15: Additional tyres

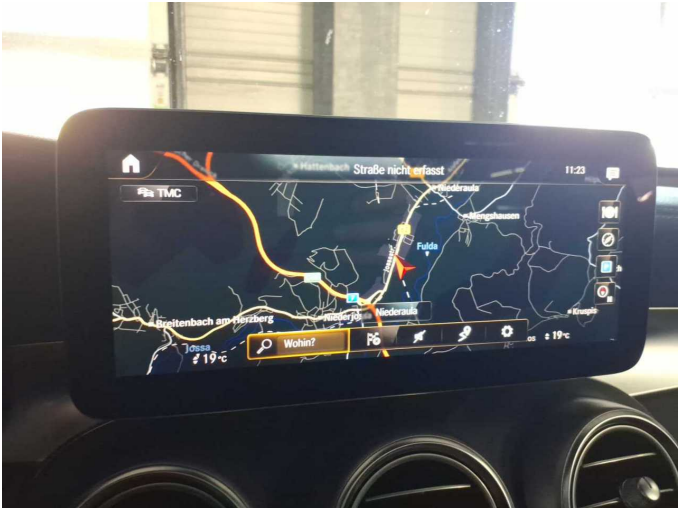


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

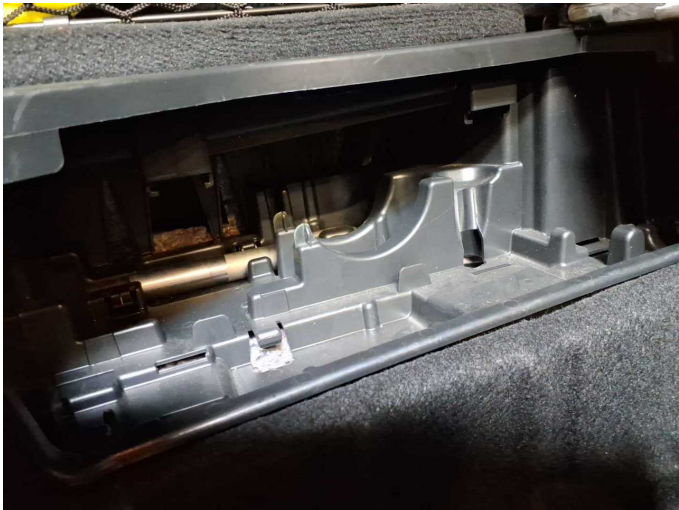


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

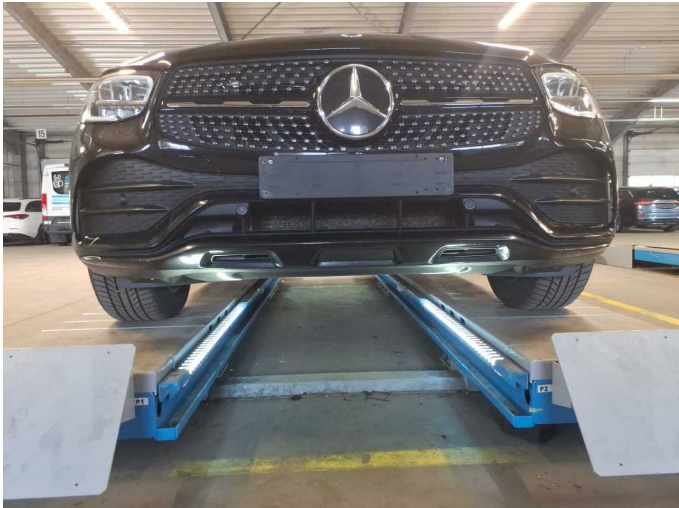


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.



Damage 1: Trim / covers: Boot lid - interior trim - Scratched - Smart repair




Damage 1: Trim / covers: Boot lid - interior trim - Scratched - Smart repair

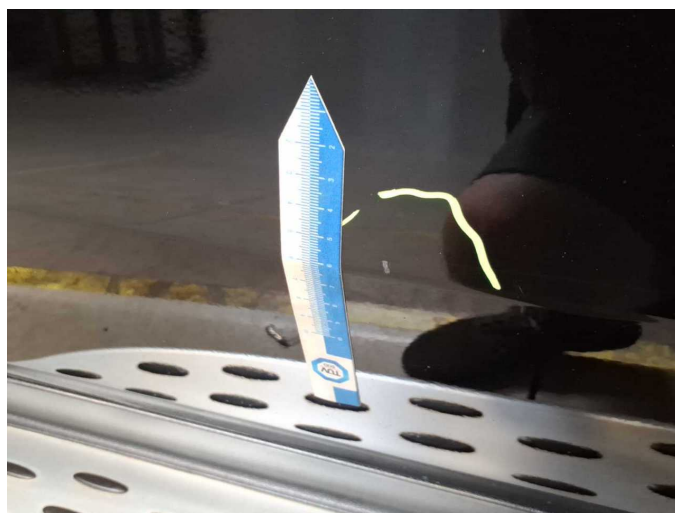

Damage 2: Door - rear right side: Door - Scratch(es) - Smart repair




Damage 2: Door - rear right side: Door - Scratch(es) - Smart repair

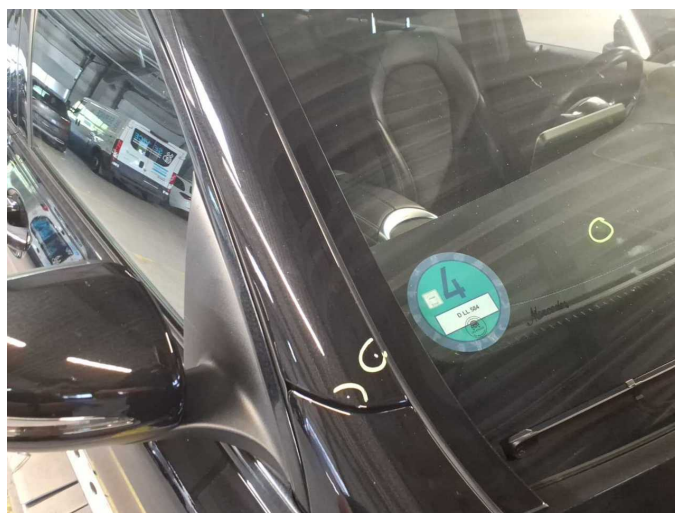


Damage 3: Body: A-pillar - right side - Stone chips - Smart repair



Damage 3: Body: A-pillar - right side - Stone chips - Smart repair

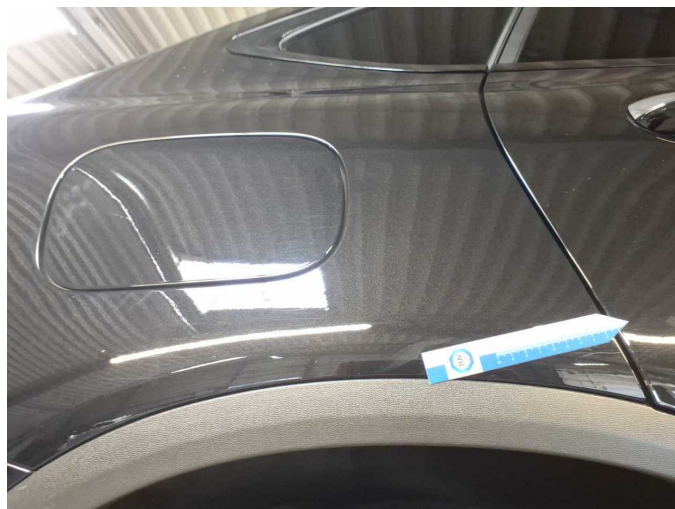


Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

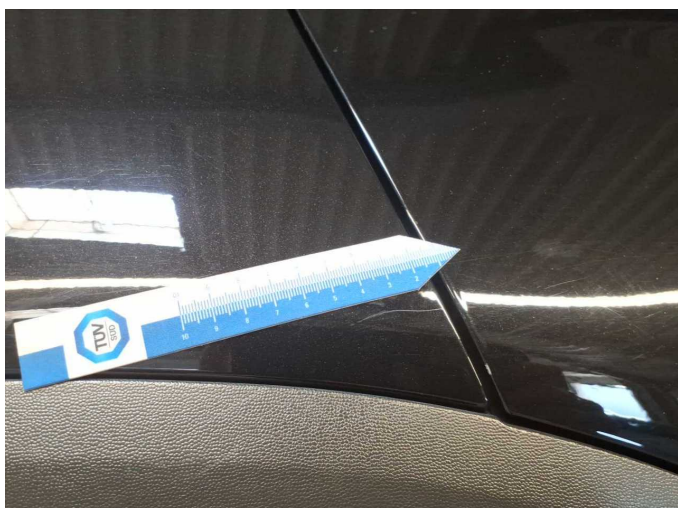


Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair




Damage 5: 2nd wheel set: 1 tyre - Broken / torn - Replace

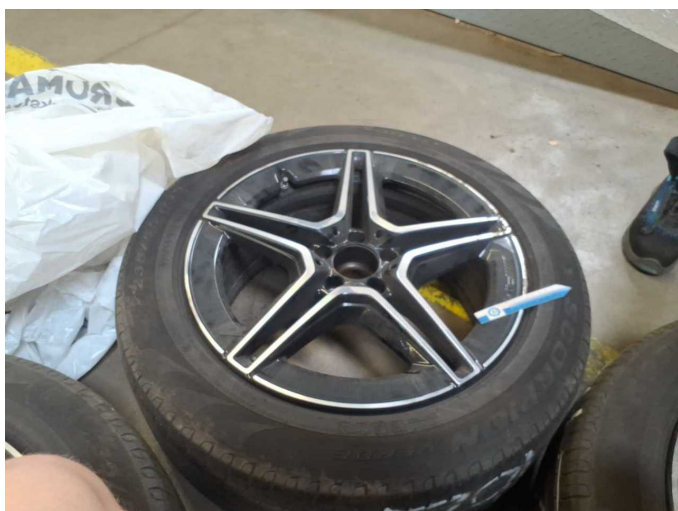

Damage 5: 2nd wheel set: 1 tyre - Broken / torn - Replace

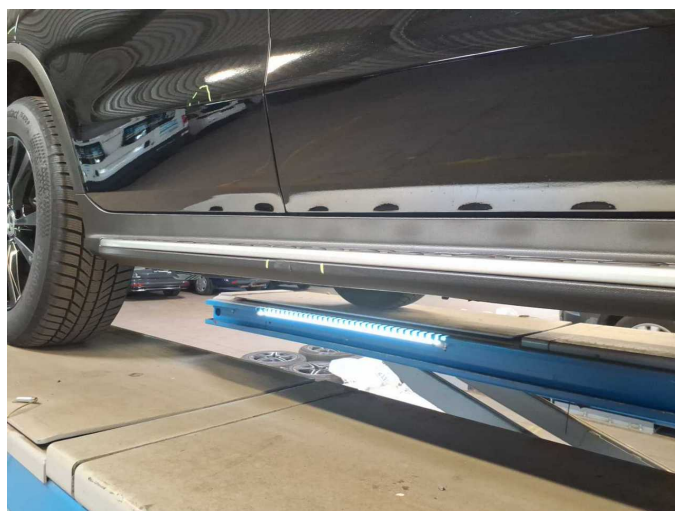

Damage 6: Sill - right side: Cat walk - Deformed - Replace

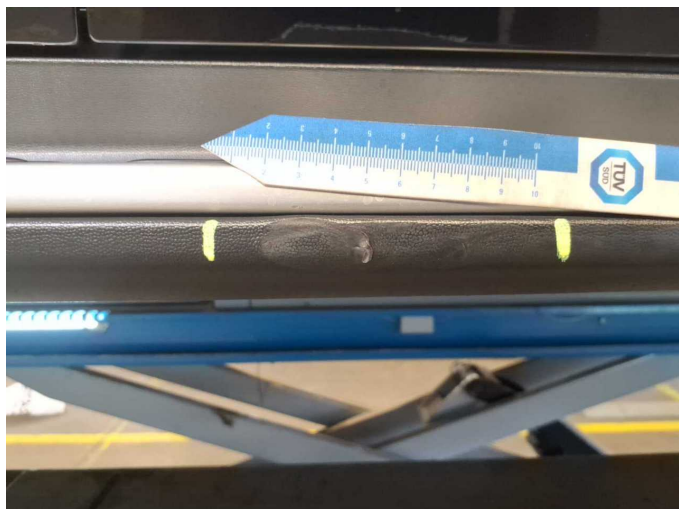

Damage 6: Sill - right side: Cat walk - Deformed - Replace




Damage 7: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 7: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 8: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

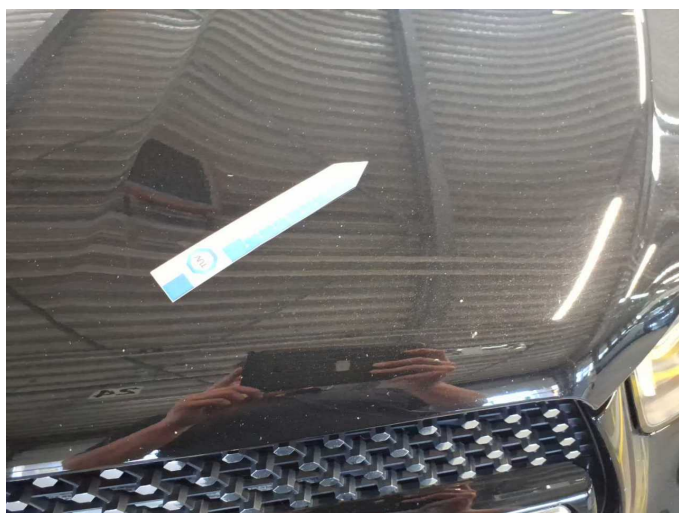

Damage 8: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint



Damage 8: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint



Damage 8: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint



Damage 9: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 9: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 9: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 9: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 10: Front bumper: Front bumper (+ Blende+Leiste erneuern) - Scratched - Paint



Damage 10: Front bumper: Front bumper (+ Blende+Leiste erneuern) - Scratched - Paint



Damage 10: Front bumper: Front bumper (+ Blende+Leiste erneuern) - Scratched - Paint



Damage 10: Front bumper: Front bumper (+ Blende+Leiste erneuern) - Scratched - Paint



Damage 10: Front bumper: Front bumper (+ Blende+Leiste erneuern) - Scratched - Paint




Wear and tear 1: Wheel / tyres: Alloy rim - front right side - Scratched - No deduction



Wear and tear 1: Wheel / tyres: Alloy rim - front right side - Scratched - No deduction



Repainting 1: Side panel - rear left side

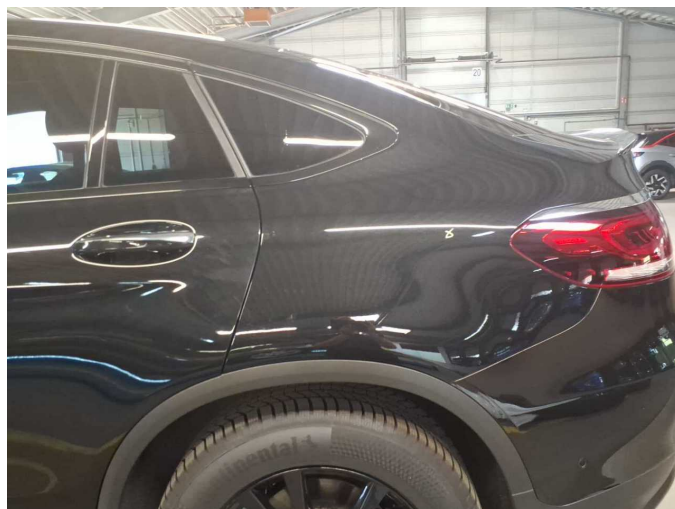

Repainting 1: Side panel - rear left side



Repainting 2: Door - rear left side



Repainting 2: Door - rear left side



Side panel - rear left side: 165 µm



Door - rear left side: 362 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2533161G114182

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLC-Coupe 200 d 4Matic
9G-TRONIC AMG Line

Datum	KM-Stand	Beschreibung
29.04.2026	110.008	Systemtest/Eigendiagnose
27.03.2026	0	Wartung Sonstiges
23.03.2026	110.008	Regelwartungsdienst
14.11.2025	94.272	Bremsklötze hinten
27.10.2025	85.665	Systemtest/Eigendiagnose
18.09.2025	85.665	Regelwartungsdienst
30.05.2025	65.664	HU + AU; HU + AU
16.05.2025	65.664	Regelwartungsdienst; Reparatur Sonstiges
31.03.2025	50.342	Systemtest/Eigendiagnose; Wartung Sonstiges
07.01.2025	47.931	Bremsscheiben+Beläge v+h; Bremsscheiben vorne
05.11.2024	39.878	Regelwartungsdienst
03.08.2023	26.277	Regelwartungsdienst