



Expertise

Protocol number: 46336076
Order No. / Reference: 26605601
Inspection date: 1 Jul 2026

Manufacturer: Ford

Model: Galaxy 2.0 EcoBlue S&S TREND

VIN: WF0KXXWPCKLS02741



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Galaxy 2.0 EcoBlue S&S TREND	
Vehicle Identification number	WF0KXXWPCKLS02741
Mileage (Read)	117,239 km
First registration	1 Mar 2021
Number of holders	1
Next periodical technical inspection	03/2028
(Report not on hand)	
Power / Engine displacement	110 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Chroma-Blau Metallic
Doors / Seats	5 / 7
Upholstery type	Cloth
Colour of upholstery	Black
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	Available / complete	Next maintenance in	3,700 km
Last service on / at	09/2025 at 101,741 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FY063760
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BKM 00967		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,510 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103H	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/55 R17 103H	Summer tyres on Light alloy	Continental	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103V	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	235/55 R17 103V	Winter tyres on Light alloy	Continental	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2024		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag: Passenger airbag deactivation
- Exterior mirrors painted in body color, electrically adjustable and heated (with integrated turn signals and ambient lighting)
- Tires: 7.5 J x 17 alloy wheels (4) with 235/55 R 17 tires (in 10-spoke design)
- Hill start assist
- third brake light
- Diesel particulate filter (DPF)
- Driver information system display 10.7cm color (on-board computer with fuel consumption and mileage information as well as outside temperature display)
- Ford Power Start function (keyless start, including two passive keys with remote control)
- Removable luggage compartment cover
- Luggage compartment lighting
- Cruise control system with intelligent speed limiter (interior mirror, automatically dimming - traffic sign recognition system)
- Transmission: 6-speed manual transmission
- rear window wiper
- Intelligent Protection System (IPS) including: - Front airbags for driver and front passenger - Knee airbag for driver - Head and shoulder airbags in the front and for the 2nd and 3rd rows of seats - Side airbags for driver and front passenger - Side airbags on the outer seats of the 2nd row - Seat belt tensioners and belt force limiters in the front - 3-point seat belts in all seats, height-adjustable in the front)
- Steering wheel: Multifunction leather steering wheel
- Front center console with padded armrest (storage compartment and 2 cup holders)
- Fog light
- Emergency brake light (pulsating illumination of the brake lights during hard braking)
- Front and rear parking pilot system
- Upholstery: Cloth
- Rain sensor
- Tire Pressure Monitoring System (TPMS)
- Headlight dipped beam with switch-off delay including "greeting function"
- Headlight assistant with day/night sensor (high beam assistant - interior mirror, automatically dimming)
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Seats: 2nd row of seats with 3 individual seats (FoldFlat System) (adjustable longitudinally - seat backrests individually foldable - headrests retractable - easy entry to the 3rd row of seats (Easy Entry))
- Seats: Driver and front passenger seats, 4-way manually adjustable (including manually adjustable lumbar support)
- Start-stop system
- Anti-lock braking system (ABS) (with Electronic Stability Program (ESP), Roll Stability Control (RSC) and Traction Control System (TCS))
- Attachment points for safety partition grilles (attachment points 1st row of seats)
- Tires: Tire repair kit ((maximum speed of 80 km/h when used))
- Roof rails, black
- Tachometer
- Electric front and rear windows (with all-around closing function)
- Electronic parking brake
- FordPass Connect including eCall and Wi-Fi hotspot (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - eCall emergency call system to send an emergency call in the event of an accident or when manually activated - Wi-Fi hotspot (up to 4G/LTE7, for up to 10 mobile devices))
- Back window, heater
- Interior lighting with delay circuit
- Isofix mounting (on all seats in the 2nd row)
- Electric child safety lock
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Leather gear knob
- Steering wheel: Steering column, adjustable in height and reach
- Front and rear reading lights (with LED technology)
- MyKey key system (individually programmable second key) (setting options include: limiting the maximum speed and radio volume, speed warning (when the set speed limit is exceeded), safety assistance systems cannot be deactivated, extended warning system for unfastened seat belts)
- Radio features: Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+ and FordPass Connect (communication and entertainment system with voice control, support for Android Auto and Apple CarPlay, Bluetooth hands-free calling and audio streaming, 14 different languages, graphic and audible, eCall emergency call system for sending an emergency call in the event of an accident or manual activation, live traffic information, Wi-Fi hotspot, radio/CD player, 2 USB ports, 8 speakers and steering wheel controls, 20.3 cm screen diagonal, digital radio reception DAB/DAB+)
- Seats: 3rd row of seats with 2 individual seats (FoldFlatSystem) (seat backrests fold down individually - headrests retractable)
- Seats: Comfort seats, front
- Power outlet: 12-volt connection in the luggage compartment and in the center console
- Daytime running light
- Lashing eyes in the luggage compartment
- Electronic immobilizer
- Central locking with remote control (remote luggage compartment release - second folding vehicle key)



- Front bumper painted in body color (rear bumper top painted in body color, bottom painted black)
- Velour carpet floor mats (for the 1st, 2nd and 3rd row of seats)
- thermal insulation glazing

Extra equipment

- Detachable towbar (including ESP trailer stabilization)
- Package: Business I (Ford navigation system incl. Ford SYNC 3, AppLink, 20.3 cm touchscreen, DAB/DAB+, voice control, support for Android Auto and Apple CarPlay, Bluetooth hands-free system and audio streaming, FordPass Connect, eCall emergency call system, live traffic information, Wi-Fi hotspot, radio/CD player, 2 USB ports, 8 speakers, steering wheel controls, LED daytime running lights, park assist with automatic parallel and perpendicular parking function, pre-collision assist, forward collision warning, active emergency braking, reversing camera)
- Paint finish: Metallic
- Package: Family (Sunshade blinds integrated into the rear side doors - Trays on the front seat backrests - 230-volt socket - Cigarette lighter and ashtray in the center console)
- Package: Winter (Heated windscreen - Heated leather steering wheel - Individually and variably heated front seats)
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Safety partition net behind the 2nd row of seats for the luggage compartment

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - rear right side	Door handle - outside - Scratch(es) - Smart repair
3	Roof	Roof rail - right side - Scratch(es) - Smart repair
4	Boot lid / rear door	Boot lid (Innen) - Scratch(es) - Smart repair
5	Door - rear right side	Door edge - Scratch(es) - Smart repair
6	Door - front left side	Door - Scratch(es) - Smart repair
7	Body	C-pillar - right side - Scratch(es) - Smart repair
8	Body	C-pillar - left side - Dent / paintcoat damage - Smart repair
9	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Smart repair
10	Headlight	Headlight - left side - Scratch(es) - Loss in value
11	Door - rear left side	Door handle - outside - Scratch(es) - Paint
12	Side panel - rear left side	Side panel - Scratch(es) - Paint
13	Door - rear left side	Door - Scratch(es) - Paint
14	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint



Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Rear of vehicle - Trailer hitch - removable

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 22 Oct 2025	636,80 €
2	Front, Provided by user / customer, from 12 Aug 2024	1.061,62 €
3	Rear, Provided by user / customer, from 12 Oct 2025	1.487,74 €
4	Rear, Provided by user / customer, from 20 Jul 2023	1.596,04 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Servicerestlauf wird nicht angezeigt



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

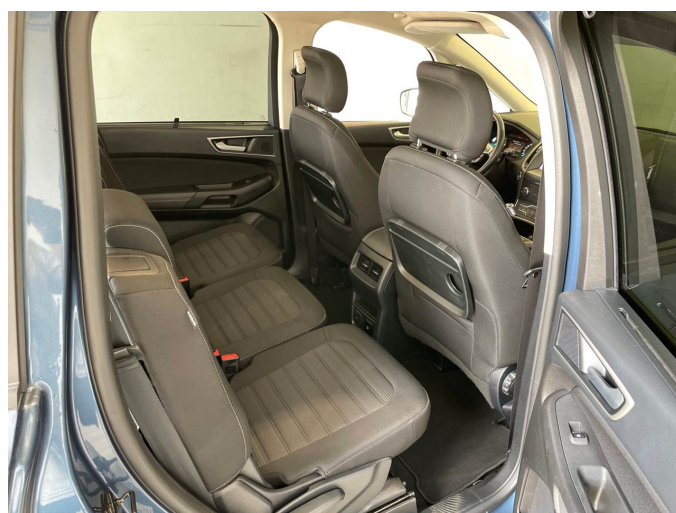


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

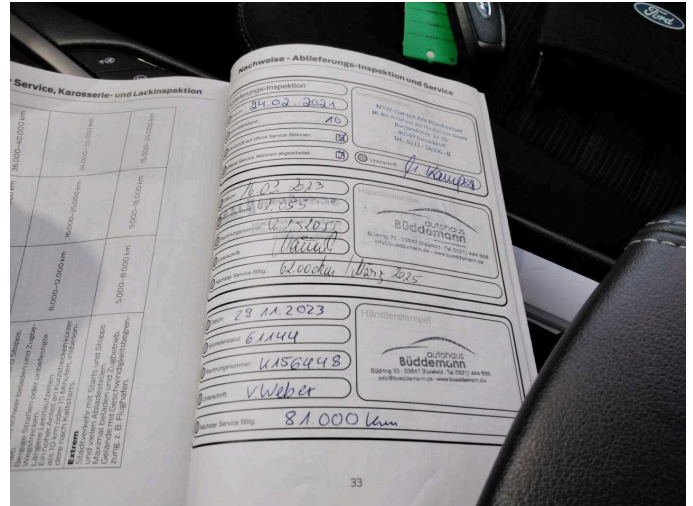


Figure 14: Documents

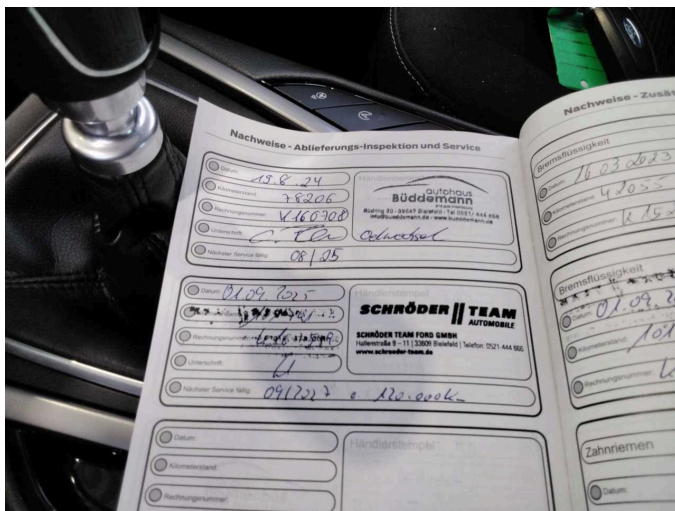


Figure 15: Documents

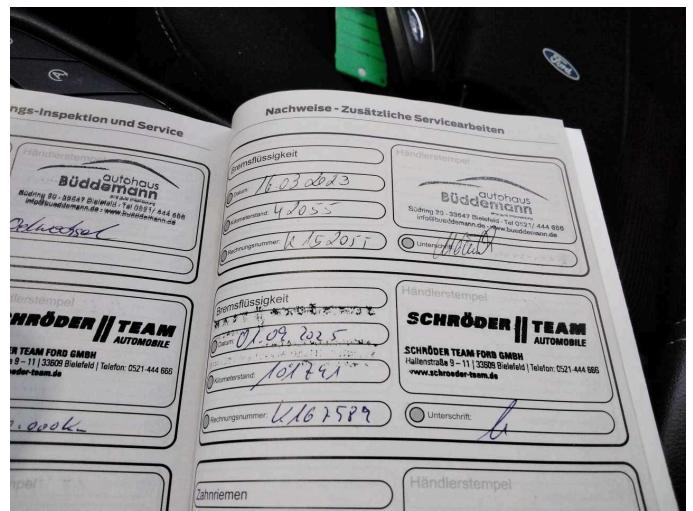


Figure 16: Documents



Figure 17: Additional tyres

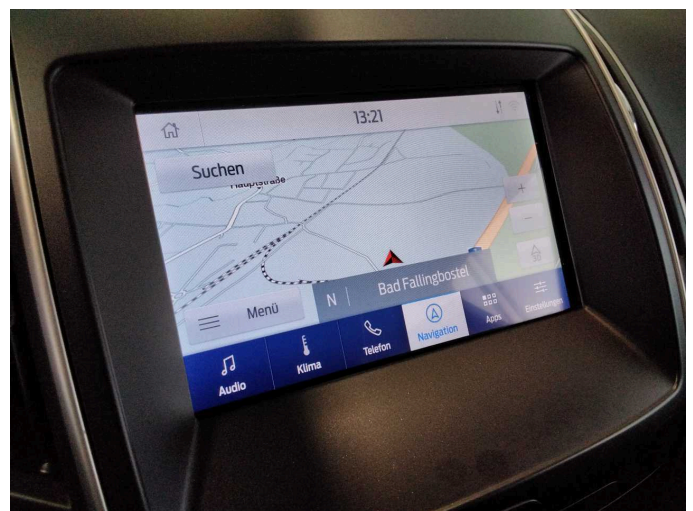


Figure 18: Navigation

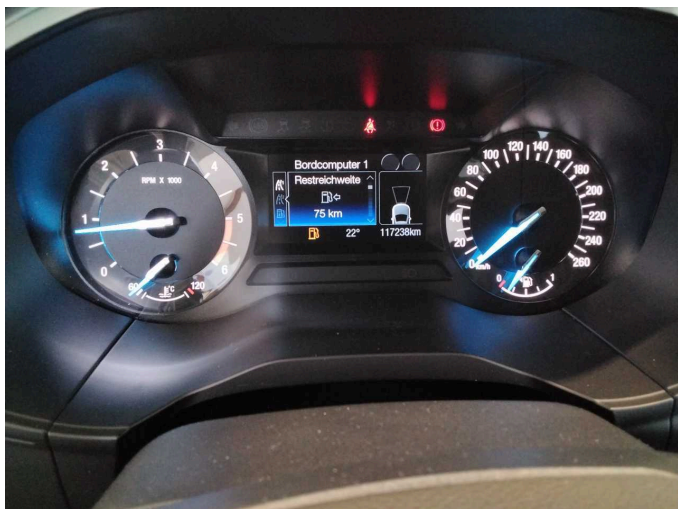


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

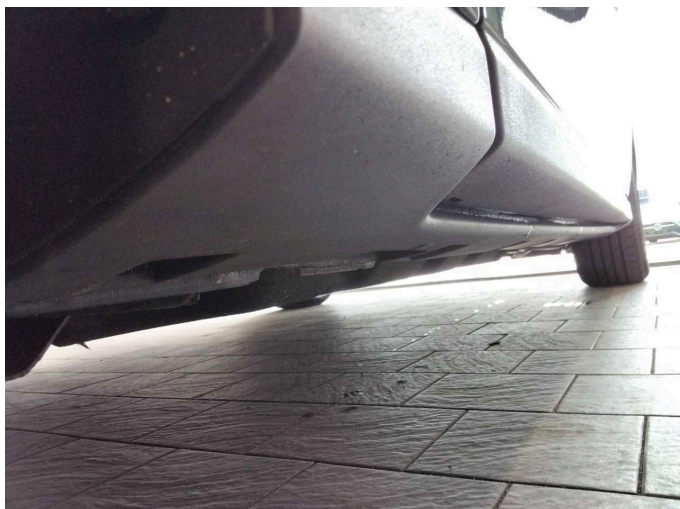


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Door - rear right side: Door handle - outside - Scratch(es) - Smart repair



Damage 2: Door - rear right side: Door handle - outside - Scratch(es) - Smart repair



Damage 3: Roof: Roof rail - right side - Scratch(es) - Smart repair

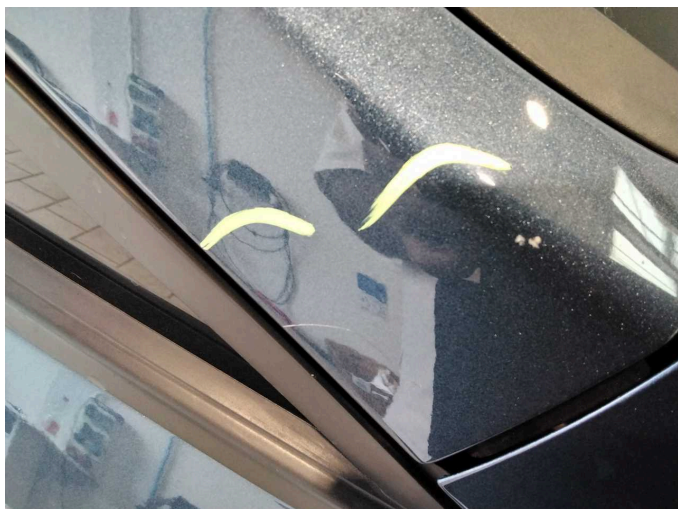


Damage 3: Roof: Roof rail - right side - Scratch(es) - Smart repair



Damage 3: Roof: Roof rail - right side - Scratch(es) - Smart repair




Damage 4: Boot lid / rear door: Boot lid (Innen) - Scratch(es) - Smart repair

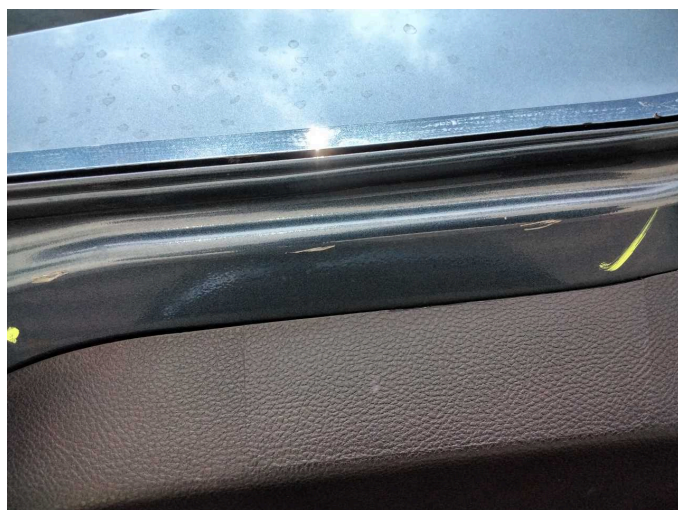


Damage 4: Boot lid / rear door: Boot lid (Innen) - Scratch(es) - Smart repair




Damage 4: Boot lid / rear door: Boot lid (Innen) - Scratch(es) - Smart repair

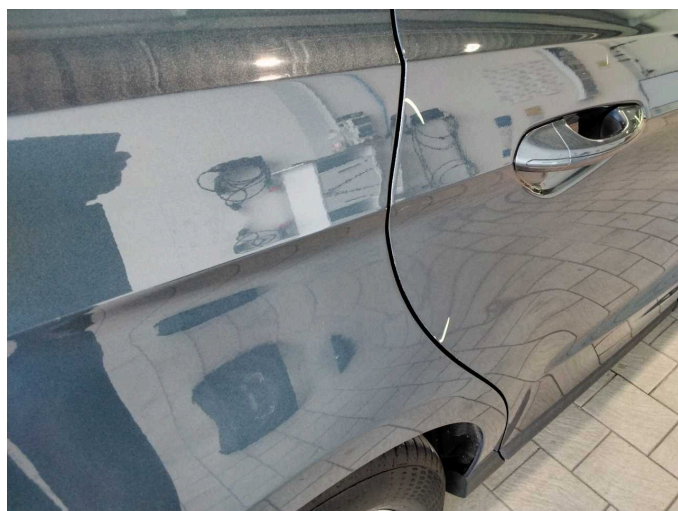

Damage 5: Door - rear right side: Door edge - Scratch(es) - Smart repair

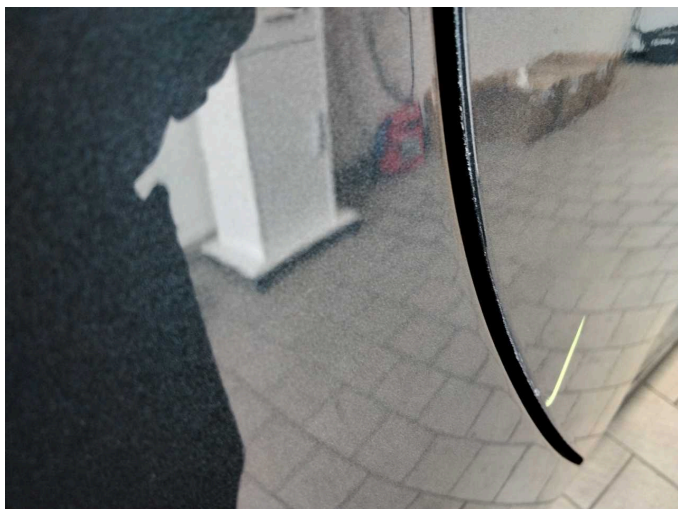

Damage 5: Door - rear right side: Door edge - Scratch(es) - Smart repair

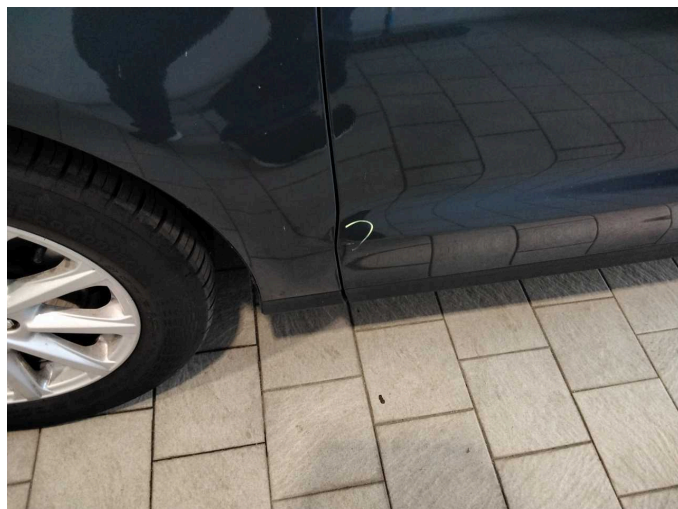


Damage 6: Door - front left side: Door - Scratch(es) - Smart repair



Damage 6: Door - front left side: Door - Scratch(es) - Smart repair



Damage 7: Body: C-pillar - right side - Scratch(es) - Smart repair

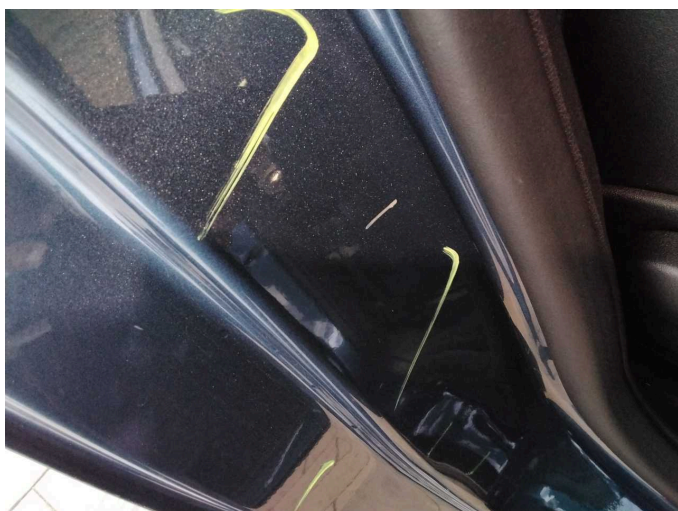

Damage 7: Body: C-pillar - right side - Scratch(es) - Smart repair




Damage 7: Body: C-pillar - right side - Scratch(es) - Smart repair



Damage 8: Body: C-pillar - left side - Dent / paintcoat damage - Smart repair




Damage 8: Body: C-pillar - left side - Dent / paintcoat damage - Smart repair

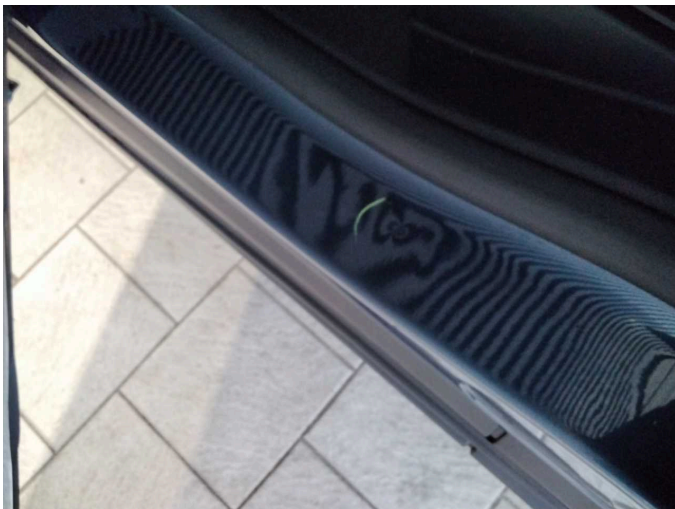

Damage 8: Body: C-pillar - left side - Dent / paintcoat damage - Smart repair




Damage 8: Body: C-pillar - left side - Dent / paintcoat damage - Smart repair

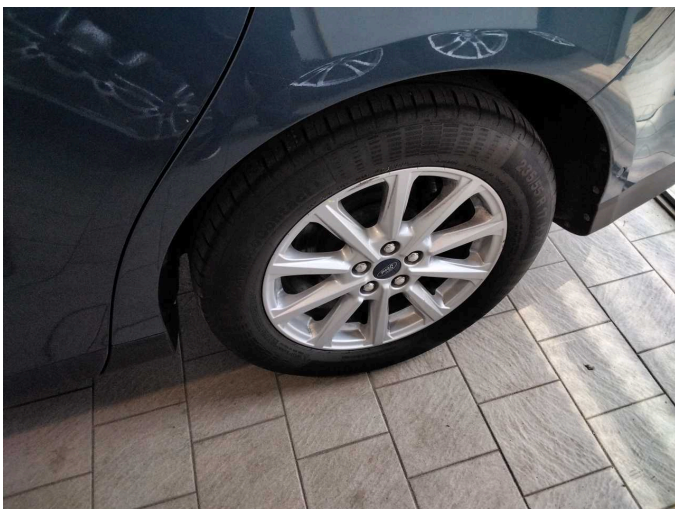

Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Smart repair



Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Smart repair

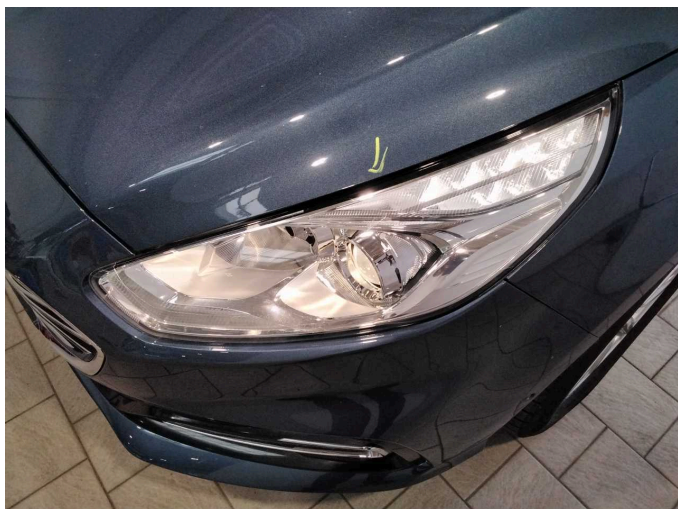


Damage 10: Headlight: Headlight - left side - Scratch(es) - Loss in value




Damage 10: Headlight: Headlight - left side - Scratch(es) - Loss in value



Damage 11: Door - rear left side: Door handle - outside - Scratch(es) - Paint

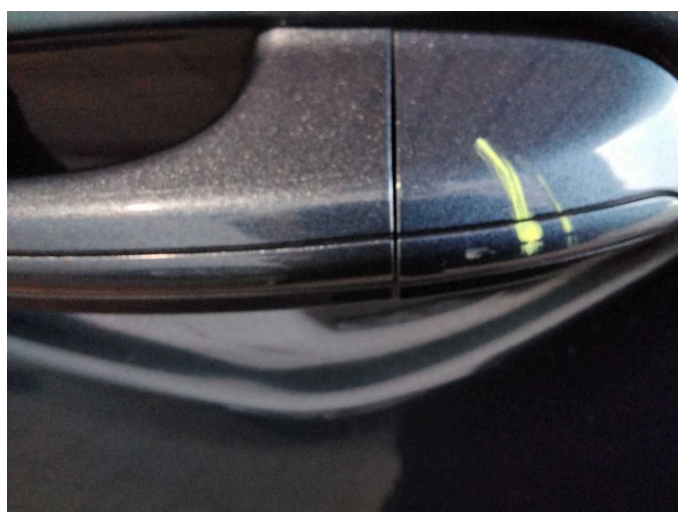


Damage 11: Door - rear left side: Door handle - outside - Scratch(es) - Paint

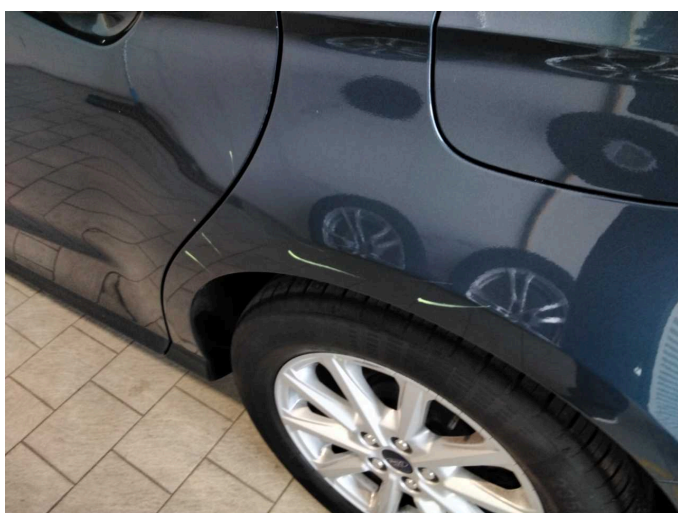


Damage 12: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 12: Side panel - rear left side: Side panel - Scratch(es) - Paint

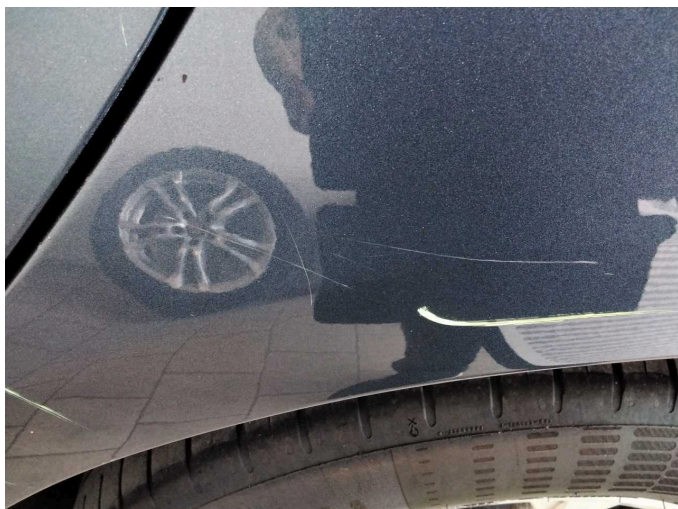

Damage 12: Side panel - rear left side: Side panel - Scratch(es) - Paint

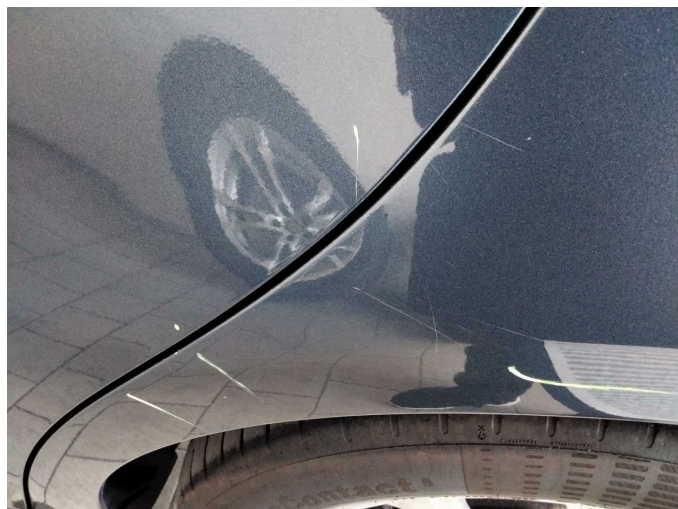

Damage 12: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 13: Door - rear left side: Door - Scratch(es) - Paint




Damage 13: Door - rear left side: Door - Scratch(es) - Paint



Damage 13: Door - rear left side: Door - Scratch(es) - Paint



Damage 13: Door - rear left side: Door - Scratch(es) - Paint

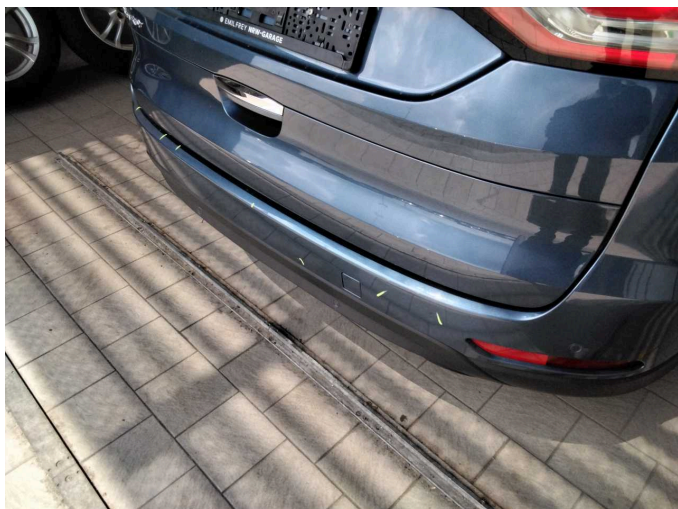


Damage 14: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 14: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 14: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

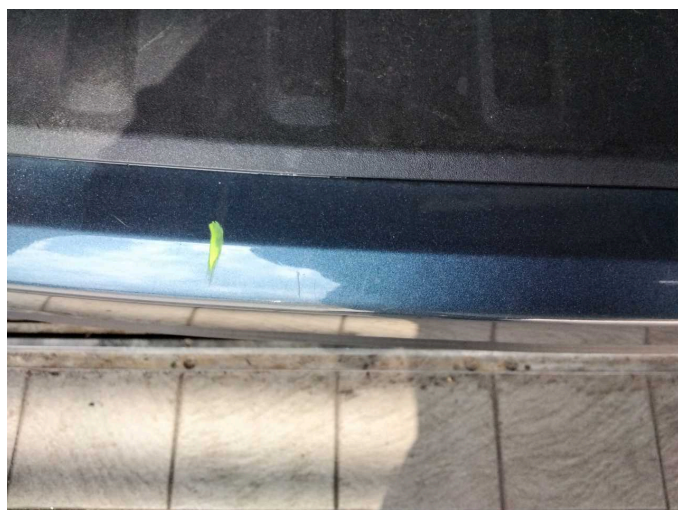

Damage 14: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

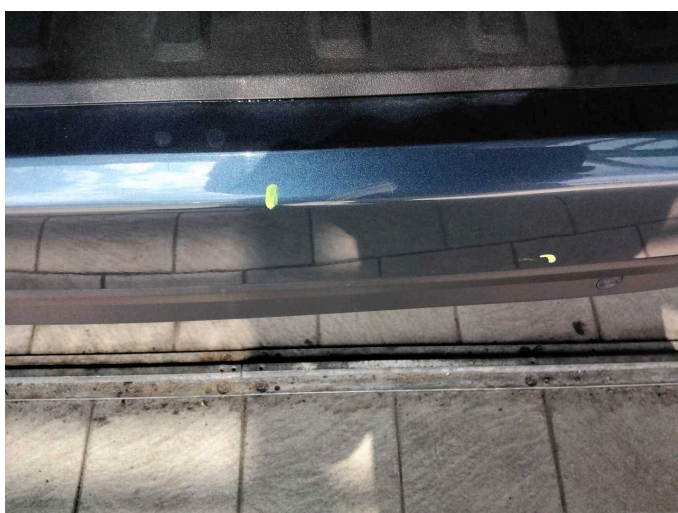

Damage 14: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

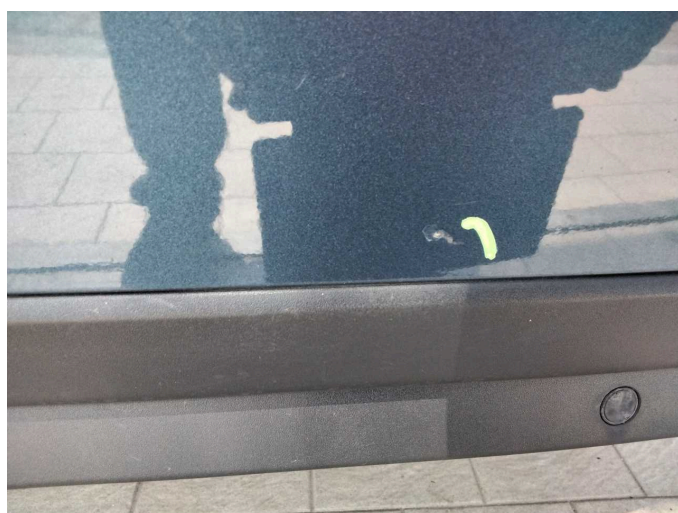

Damage 14: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction