



Expertise

Protocol number: 46403593
Order No. / Reference: 26464652
Inspection date: 6 Jul 2026

Manufacturer: Ford

Model: Mondeo Turnier 2.0 EcoBlue Aut. Trend

VIN: WF0FXXWPCFNY68534



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Mondeo Turnier 2.0 EcoBlue Aut. Trend	
Vehicle Identification number	WF0FXXWPCFNY68534
Mileage (Read)	185,199 km
First registration	28 Apr 2022
Number of holders	1
Next periodical technical inspection	04/2027
(Report on hand)	
Power / Engine displacement	110 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Magnetic-Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	Available / incomplete	Next maintenance in	9 Monat(e)
Last service on / at	04/2026 at 179,714 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH427153
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BJB 00111		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,330 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99V	Summer tyres on Light alloy	Goodyear	4mm / 4mm
2)	215/60 R16 99V	Summer tyres on Light alloy	Goodyear	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R18 99H	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 07/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Activated carbon filter
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Attachment points for safety partition grilles
- Tires: 6.5 J x 16 alloy wheels (4) with 215/60 R 16 tires
- Tires: Tire pressure monitoring system (TPMS)
- third brake light
- Roof rails, black
- Tachometer
- Electronic Safety and Stability Program (ESP)
- Lane keeping assist including lane keeping assist and driver fatigue warning
- Electronic parking brake
- Ford Power Start function
- luggage compartment cover
- Cruise control system with intelligent speed limiter
- Back window, heater
- Interior lighting with delay circuit
- Intelligent security system
- Electric child safety lock
- Rear headrests (3), height adjustable
- Steering wheel: Multifunction leather steering wheel
- Reading lights front and rear
- MyKey key system (individually programmable second key)
- Emergency brake light
- Pre-Collision Assist
- LED taillights
- Rear seat backrest, foldable, 60:40 split
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor
- Electromechanical speed-dependent power steering
- Seats: Map pocket on the back of the front passenger seat
- Seats: Map pocket on the driver's seat backrest
- 12-volt power outlet in the luggage compartment
- Front bumper painted in body color
- Carpet floor mats front and rear
- Lashing eyes in the luggage compartment floor
- Immobiliser
- Central locking
- Ambient lighting in the front, including door storage compartment, front door handle and footwell lighting.
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated
- Tires: Tire repair kit
- Hill start assist
- headliner, light
- Diesel particulate filter (DPF)
- Electronic Shifter
- Driver information system - 10.7 cm color display
- Electric windows front and rear
- High Beam Assist
- Ford Easy Fuel
- FordPass Connect including eCall and Wi-Fi hotspot
- Luggage compartment lighting
- Transmission: 8-speed automatic transmission
- rear window wiper
- Interior mirror automatically dimming
- Isofix bracket
- Air conditioning with automatic temperature control
- Front headrests, 4-way height and tilt adjustable
- Adjustable steering column
- Front center console with padded armrests
- Fog light
- Upholstery: Cloth
- Radio equipment: Ford SYNC 3 audio system with AppLink and touchscreen and digital radio reception DAB/DAB+
- Headlight dipped beam with switch-off delay including "greeting function"
- Seats: Driver and passenger seats, 4-way manually adjustable
- Start-stop system
- 12-volt socket in the front interior
- Daytime running light
- Traffic sign recognition system
- Warning system for unfastened seat belts in the front and second row of seats
- Cigarette lighter



Extra equipment

- Detachable towbar (ESP trailer stabilization - continuous power supply - switched power supply - hill start assist)
- Package: Winter (Heated windscreen - Heated leather steering wheel - 230-volt socket in center console (not in conjunction with hybrid engine) - Individually and variably heated front seats - Variably heated rear bench seat)
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Safety partition net behind the 2nd row of seats for the luggage compartment
- Seats: Ford ergonomic seat (driver's seat 18-way adjustable: - length, height and tilt of the seat - extendable thigh support - adjustable backrest - lumbar support 4-way electrically adjustable - passenger seat, 4-way manually adjustable, incl. manually adjustable lumbar support)
- Paint finish: Magnetic Grey Metallic
- Package: Business 3 (Ford navigation system incl. Ford SYNC 3 with AppLink, 8" touchscreen (20.3 cm) with DAB/DAB+ - 8 speakers - Steering wheel controls - Bluetooth hands-free system and audio streaming - 2 USB ports - Voice control for audio and telephone - SMS text-to-speech function - Front and rear parking sensors - Adaptive LED headlights - LED headlights, adaptively steering, incl. automatic headlight range control - Sequential LED turn signals at the front - LED daytime running lights - Rearview camera)
- Blind Spot Information System (including Cross Traffic Alert and dynamic distance detection, exterior mirrors with additional memory function)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Documents	Service book - Incomplete - No deduction
2	2nd wheel set	2 tyres (fehlen - kein Bestandteil der Ausstattung) - Incomplete - No deduction
3	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
4	Front bumper	Front bumper - Scratch(es) - Smart repair
5	Rear bumper	Rear bumper - Scratch(es) - Paint
6	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
7	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Door - front right side	Door - Scratch(es) - No deduction
2	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Provided by user / customer, from 15 Apr 2025	8.556,74 €



Repainting

No. Repainting

1 Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Door - rear left side 162 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig und eingeschränkt möglich, Mehrkosten möglich.
- Der vorliegende Winterradsatz/ Felgensatz ist kein Bestandteil der Ausstattungsliste.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres

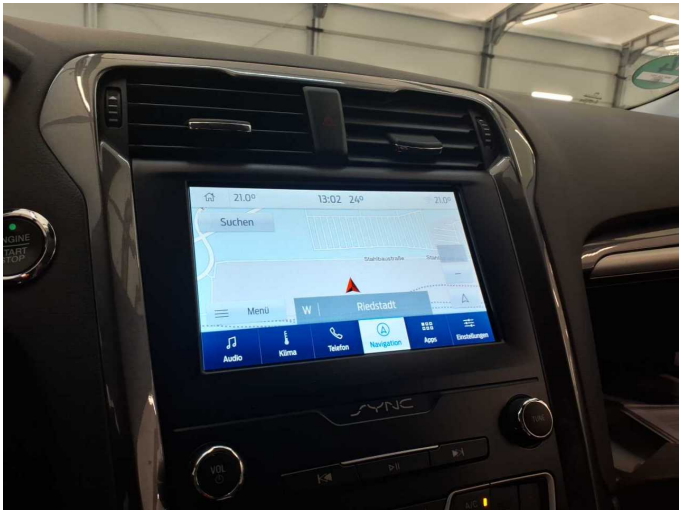


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

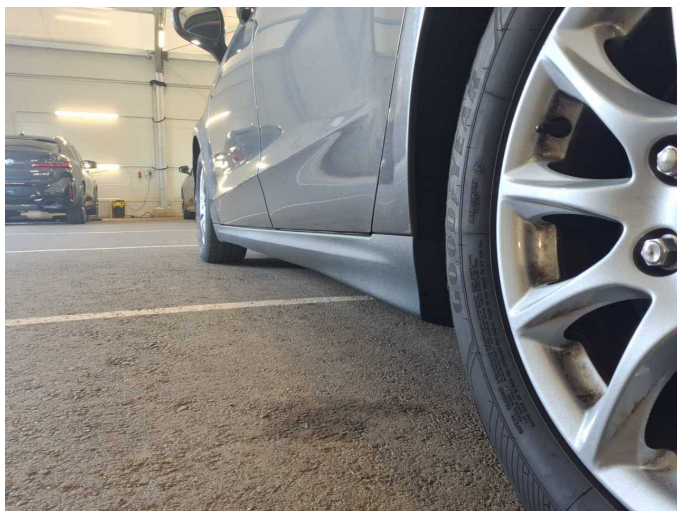


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

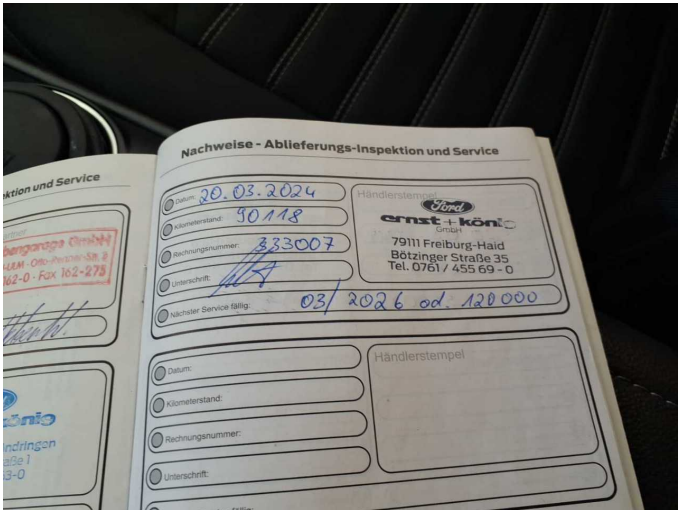

Damage 1: Documents: Service book - Incomplete - No deduction



Damage 2: 2nd wheel set: 2 tyres (fehlen - kein Bestandteil der Ausstattung) - Incomplete - No deduction



Damage 3: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 4: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 4: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 4: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 4: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint

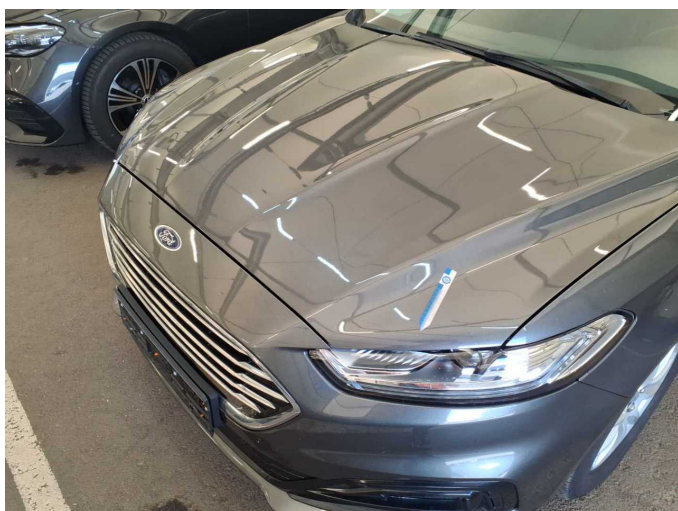

Damage 6: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

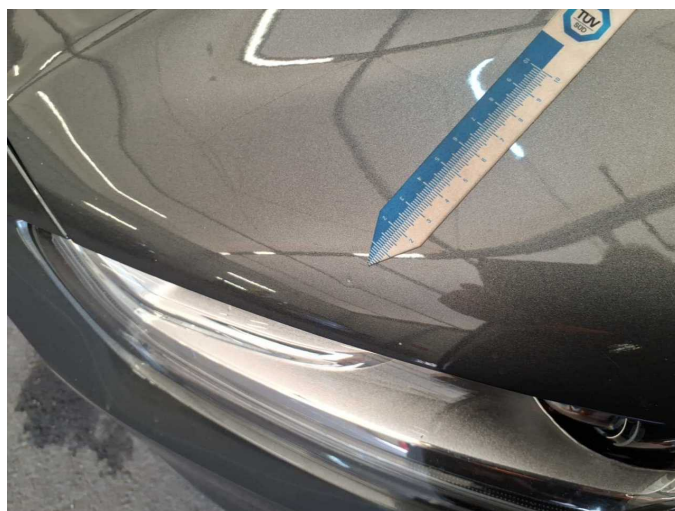

Damage 6: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 6: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 6: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 6: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

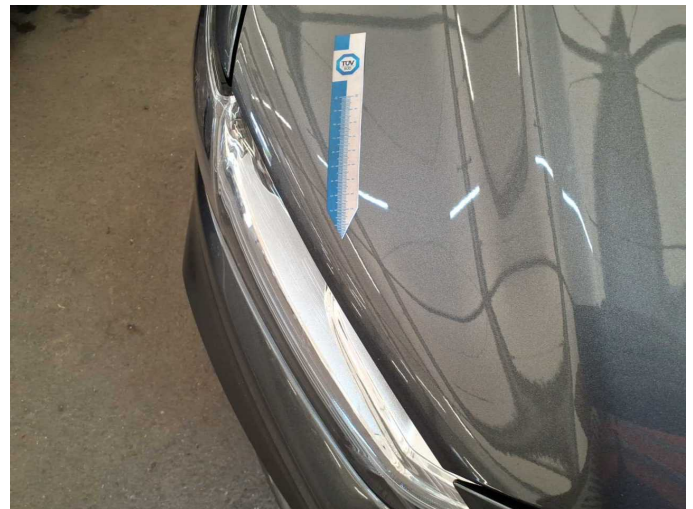

Damage 6: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace




Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 7: Vehicle glazing: Windscreen - Stone chips - Replace

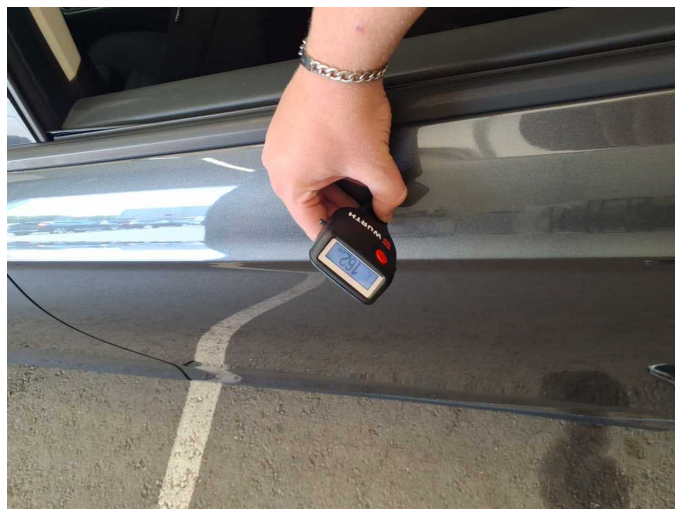

Repainting 1: Door - rear left side

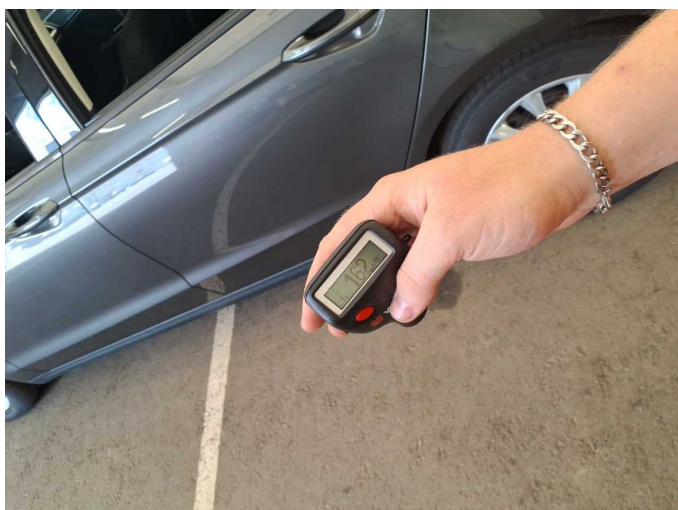

Repainting 1: Door - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0FXXWPCFNY68534
Hersteller / Modell: FORD FORD Mondeo Turnier 2.0 EcoBlue Aut. Trend

Datum	KM-Stand	Beschreibung
07.04.2026	179.714	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.02.2026	172.532	Reparatur Sonstiges
18.07.2025	150.783	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.05.2025	135.026	Reparatur Sonstiges; Systemtest/Eigendiagnose
07.04.2025	135.026	AU; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Getriebeöl ern/prüfen
03.04.2025	51.253	Getriebeöl ern/prüfen; Systemtest/Eigendiagnose
14.01.2025	120.130	Reparatur Sonstiges; Systemtest/Eigendiagnose
13.01.2025	127.689	Batterie ern; Systemtest/Eigendiagnose
10.01.2025	120.130	Keilriemen ern; Reparatur Sonstiges
30.10.2024	120.130	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
25.05.2024	98.656	Systemtest/Eigendiagnose
20.03.2024	51.253	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.09.2023	60.695	Bremse Sonstiges; Bremsklötze vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.12.2022	30.771	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges