



Expertise

Protocol number: 46326309
Order No. / Reference: 26605115
Inspection date: 3 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLB 200 d 8G-DCT Progressive

VIN: W1N2476121W164959



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLB 200 d 8G-DCT Progressive	
Vehicle Identification number	W1N2476121W164959
Mileage (Read)	114,714 km
First registration	2 Mar 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Galaxyblau Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	94 Tag(e)
Last service on / at	09/2025 at 99,787 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF746066
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AHY 00097		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,195 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 103H	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	215/65 R17 103H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99W	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	235/50 R19 99W	Summer tyres on Light alloy	Pirelli	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Roof rails in polished aluminum
- Double cup holder
- Third brake light in LED technology
- ECO start/stop function
- Electronic Stability Program (ESP)
- Electric window regulators (4)
- Luggage net on driver and passenger seatbacks
- Transmission: 8G-DCT dual-clutch automatic transmission, 8-speed
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control
- Headrests (2)
- Rear headrests (3)
- Cargo area cover (roller blind)
- Steering column mechanically adjustable lengthwise and heightwise.
- Navigation accessories: Extended MBUX functions
- Package: Seating comfort
- Radio accessories: Digital radio
- Rain and light sensor
- Remote Services Plus
- Power steering
- Seats: Comfort seats
- 12V power outlet in center console
- High-visibility vest for drivers
- Decorative elements spiral look
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- Rear armrest
- Automatic passenger airbag deactivation
- On-board computer
- Brake assist
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT
- Door sills with "Mercedes-Benz" lettering
- Chassis: Comfort chassis
- Velour floor mats
- Speed Limit Assistant
- Halogen headlights including integrated LED daytime running lights
- rear window wiper
- KEYLESS-GO start function
- Communication module (LTE) for the use of Mercedes me connect services
- Loading floor height-adjustable and removable
- Steering wheel: Multifunction sports steering wheel in leather
- Mercedes-Benz emergency call system
- Package: Light and Visibility Package
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Seats: Rear seat backrests foldable
- Seats: Front seats mechanically adjustable
- Cruise control
- Immobiliser



Extra equipment

- Active Parking Assist (The Active Parking Assist with PARKTRONIC can not only find parking spaces - it also supports you when parking and exiting. It assists you with steering and, in vehicles with automatic transmission, also with accelerating, braking and gear changes.)
- Towbar with ESP trailer stabilization
- Velour floor mats
- Paint finish: Metallic
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Steering Assist - Active Speed Limit Assist - Active Brake Assist with Cross-Traffic Function - Evasive Steering Assist - Active Blind Spot Assist - Active Lane Keeping Assist - Active Emergency Stop Assist - Route-Based Speed Adaptation - Extended Automatic Restart on Motorways)
- Upholstery: ARTICO man-made leather
- Wheels: 48.3 cm (19") alloy wheels, 4-piece set in 5-twin-spoke design (aerodynamically optimized, painted matte black and polished, 235/50 R19 on 7.5 J x 19 ET 53)
- Seats: Adjustable rear seats (A multi-talent - with the longitudinal adjustment of the rear seats, you can transform your vehicle in just a few moments from a small space miracle for rear passengers to a compact premium transporter. If required, you can slide the entire rear bench seat forward by up to 90 millimeters and back by 50 millimeters.)
- Ambient lighting (in 64 colors, all colors are individually selectable - eight color worlds consisting of two colors each - the colors are statically set or slowly exchange each other in dynamic mode - the brightness of the LEDs can be adjusted in ten steps and three zones - the interior of the air vents is finished in silver chrome and illuminated - AMG Line and Progressive: additional lighting of the piping of the instrument panel above the trim element and in the doors)
- Package: MBUX Advanced Package (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Preparation for live traffic information)
- Package: Mirror package (Exterior mirrors electrically fold in and out via a button in the driver's door control panel - the menu allows you to set the exterior mirrors to fold in automatically when locking the vehicle and unfold again when unlocking - the exterior mirror on the driver's side and the interior mirror dim automatically and continuously depending on the incident glare and ambient light)
- Heated seats for driver and front passenger
- Ambient lighting with projection of the brand logo (one LED projector in each front door - taking over the function of the exit lights)
- Heat-insulating dark tinted glass

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Roof lining - Soiled - Clean
2	Door - front left side	Door - Scratch(es) - Smart repair
3	Front bumper	Front bumper - Scratch(es) - Smart repair
4	Side panel - rear right side	Wheel arch - Damaged - Replace
5	2nd wheel set	1 alloy rim - Scratched - Loss in value
6	Door - rear right side	Door - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Mudguard - left side	Mudguard - left side - Stone chips - No deduction
5	Door - front right side	Door - dent(s) - No deduction
6	Rear bumper	Rear bumper (Verladebereich) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

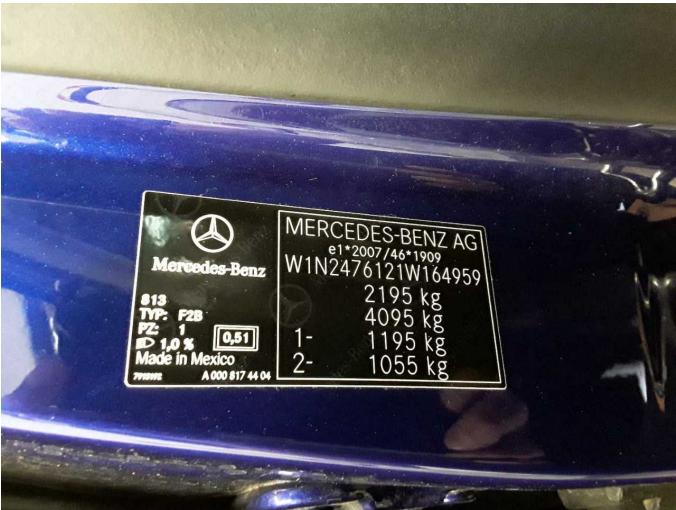


Figure 11: VIN



Figure 12: Mounted tyres

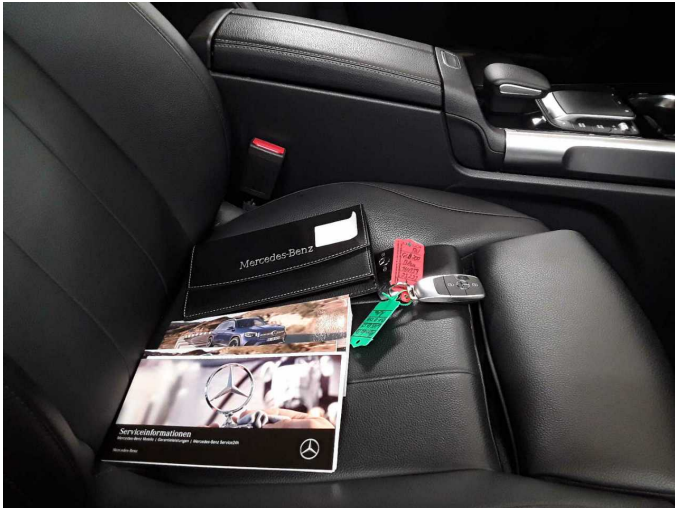


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

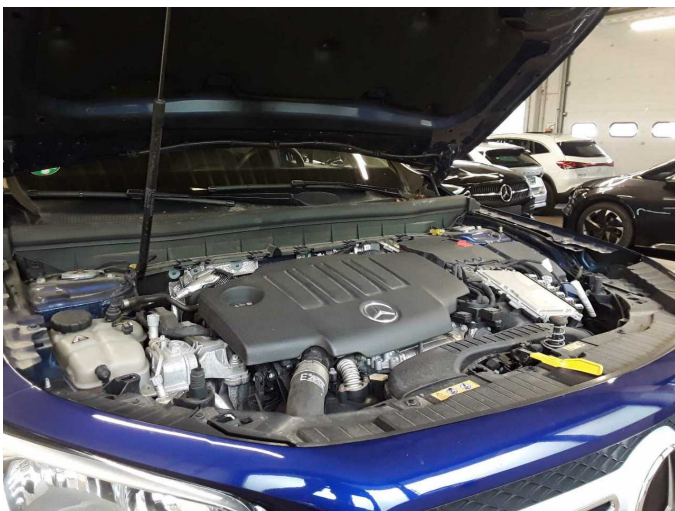


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

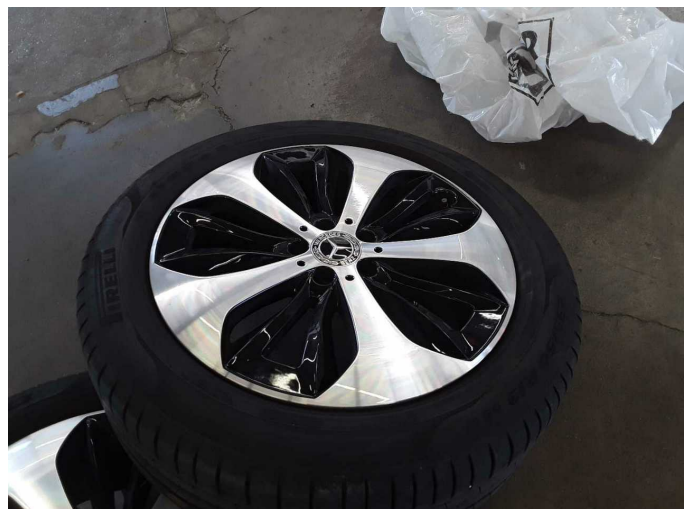


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Damage 1: Trim / covers: Roof lining - Soiled - Clean



Damage 1: Trim / covers: Roof lining - Soiled - Clean




Damage 2: Door - front left side: Door - Scratch(es) - Smart repair




Damage 2: Door - front left side: Door - Scratch(es) - Smart repair




Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair

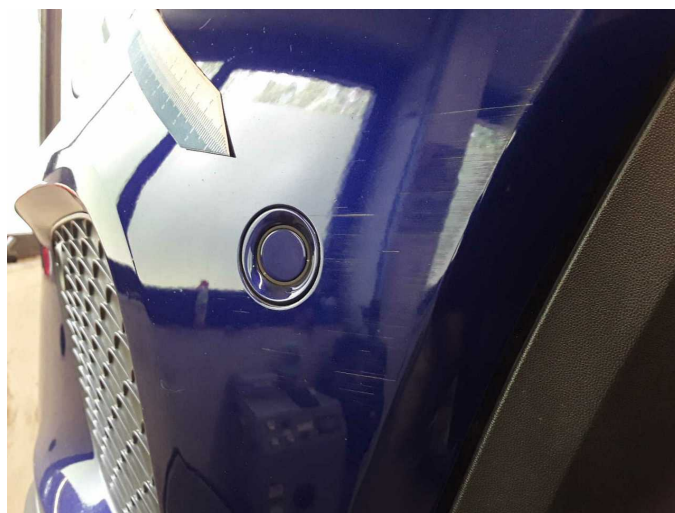


Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair

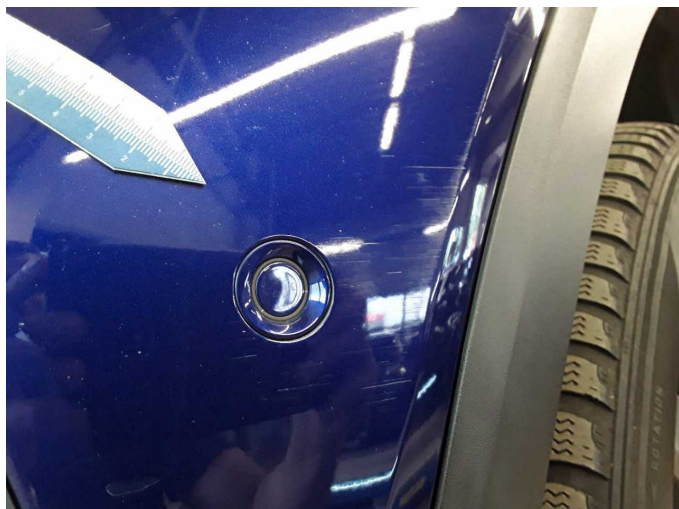

Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair

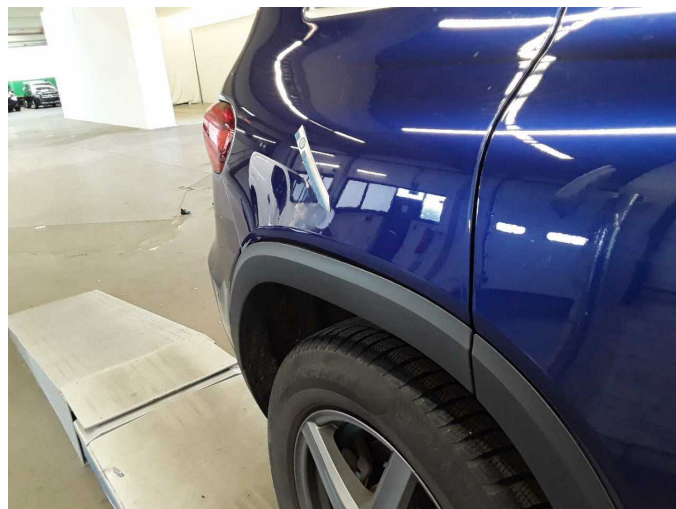


Damage 4: Side panel - rear right side: Wheel arch - Damaged - Replace

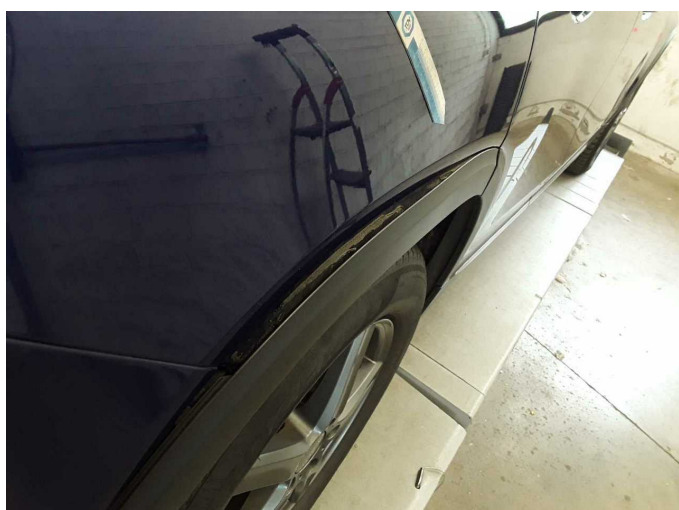

Damage 4: Side panel - rear right side: Wheel arch - Damaged - Replace



Damage 5: 2nd wheel set: 1 alloy rim - Scratched - Loss in value

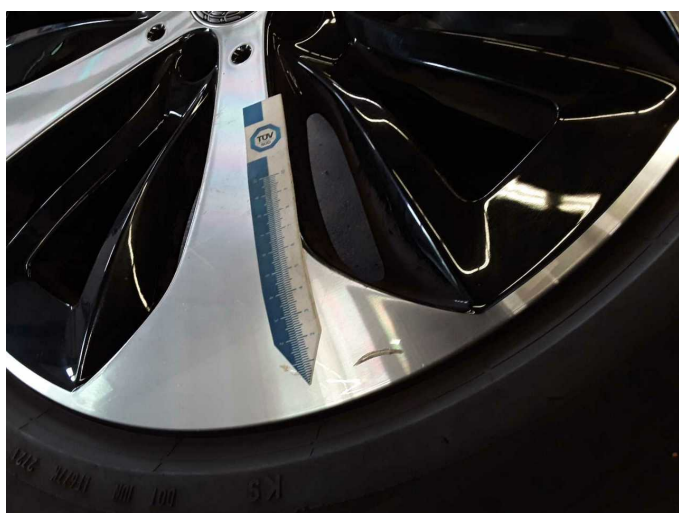


Damage 5: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 6: Door - rear right side: Door - Scratch(es) - Paint




Damage 6: Door - rear right side: Door - Scratch(es) - Paint

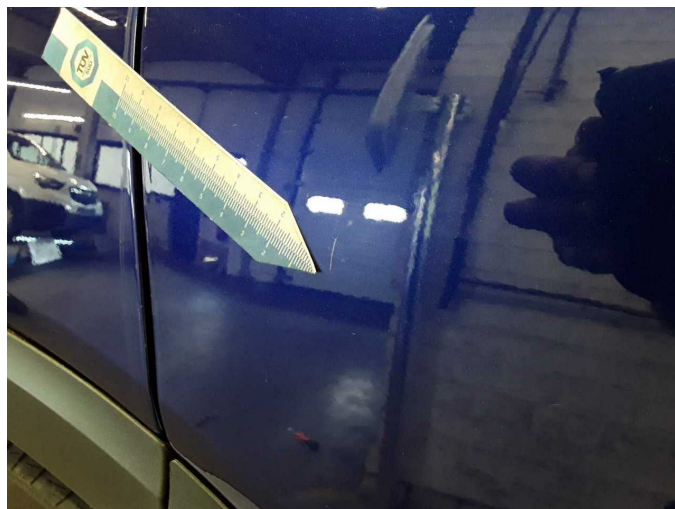


Damage 6: Door - rear right side: Door - Scratch(es) - Paint




Wear and tear 5: Door - front right side: Door - dent(s) - No deduction

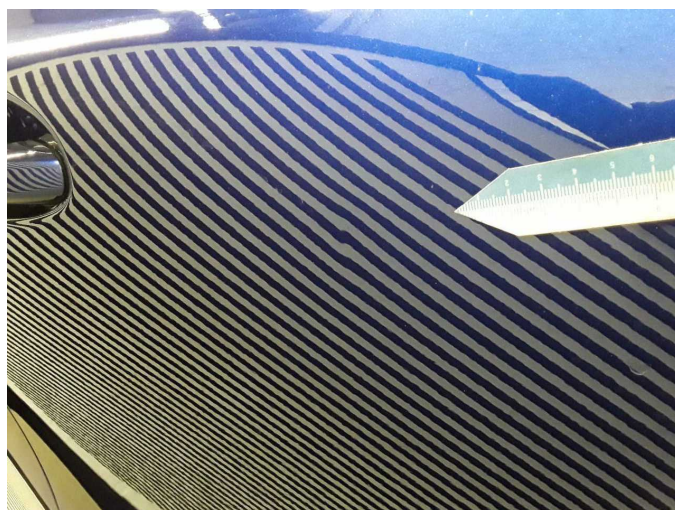

Wear and tear 5: Door - front right side: Door - dent(s) - No deduction

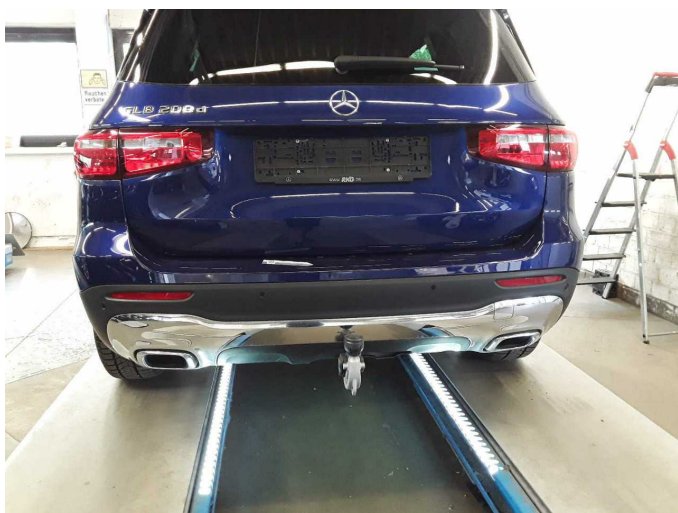

Wear and tear 6: Rear bumper: Rear bumper (Verladebereich) - Scratch(es) - No deduction

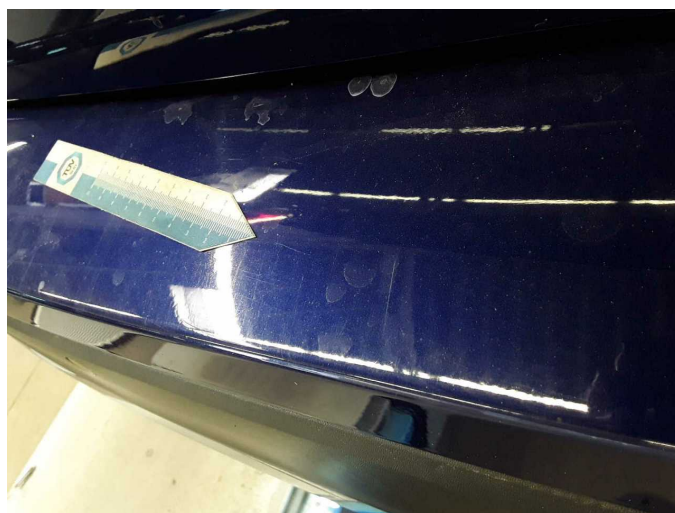

Wear and tear 6: Rear bumper: Rear bumper (Verladebereich) - Scratch(es) - No deduction



Wear and tear 6: Rear bumper: Rear bumper (Verladebereich) -
Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2476121W164959

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLB 200 d 8G-DCT
Progressive

Datum	KM-Stand	Beschreibung
18.09.2025	99.787	Bremsscheiben+Beläge v+h; Regelwartungsdienst
15.03.2025	77.509	HU + AU
14.12.2024	77.509	Regelwartungsdienst
17.01.2024	49.958	Regelwartungsdienst
24.03.2023	23.092	Regelwartungsdienst