



Expertise

Protocol number: 46423657
Order No. / Reference: 26657457
Inspection date: 8 Jul 2026

Manufacturer: Mercedes-Benz

Model: C 300 e T 9G-TRONIC Avantgarde

VIN: W1KAH5EB6PF121262



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz C 300 e T 9G-TRONIC Avantgarde	
Vehicle Identification number	W1KAH5EB6PF121262
Mileage (Read)	188,033 km
First registration	29 Jun 2023
Number of holders	1
Power / Engine displacement	150 kw / 1,999 ccm
Fuel type / Cylinder	Hybr.B/E ext.auf / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Station wagon
Colour / colour code	SCHWARZ - UNILACK
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	319 Tag(e)
Last service on / at	05/2026 at 184,779 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV703181
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BEP 00065		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,655 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94Y	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	245/45 R17 99Y	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	245/45 R17 99H	Winter tyres on Light alloy	Continental	3mm / 3mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Center airbag
- Airbag: Windowbag for driver and front passenger
- Ambient lighting with 64 light colors
- Basic services
- Brake assist, active
- Double cup holder at the front
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Velour floor mats
- Transmission: 9-speed automatic, 9G-TRONIC
- Rear bumper in body color
- Interior headliner fabric crystal grey
- KEYLESS-GO start function
- THERMATIC automatic climate control with 2 climate zones
- Front headrests
- Charging cable for household socket, 5m, smooth
- Charging system: AC charging system 11kW
- Steering wheel: Multifunction sports steering wheel in leather
- Otto particulate filter
- Package: AVANTGARDE Exterior (300e)
- Package: Park
- Radio: Extended MBUX functions
- Radio accessories: Digital radio (DAB)
- Radio accessories: Central display
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Seats: Rear seat backrests foldable
- Cruise control
- Electronic immobilizer
- Decorative elements in diamond pattern, silver-grey
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Acoustic environmental protection
- Left and right exterior mirrors are heated and electrically adjustable
- Roof rails in polished aluminum
- DYNAMIC SELECT
- ECO start/stop function
- Electric windows (4-way)
- Speed Limit Assistant
- rear window wiper
- Heated rear window
- ISOFIX child seat attachment with top tether in the rear
- Mechanical child safety lock for the rear doors
- Rear headrests (3)
- Paint finish: Solid
- Cargo area cover including EASY-PACK safety net
- LED High Performance Headlights
- Mercedes-Benz emergency call system
- Center console in high-gloss black
- Package: Storage
- Package: Interior lighting package
- Upholstery: ARTICO leatherette/fabric
- Radio: MBUX
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Remote Services Plus
- Power steering
- Lane Keeping Assist, active
- High-visibility vest for drivers
- Central locking with remote control



Extra equipment

- Charging cable for wallbox and public charging station, 5m, smooth 11kW (This charging cable, also called Mode 3 cable, allows you to charge the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 16 A).)
- Package: Advanced Comfort Package (Heated seats for driver and front passenger - Seat Comfort Package: - Numerous electric and manual adjustment options for the front seats to adapt to the specific body and comfort requirements of the driver and front passenger - Electro-pneumatic 4-way lumbar support and lateral support adjustment with control element on the seat - Electric seat cushion tilt adjustment - Electric height adjustment - Electric backrest adjustment - Electric seat cushion depth adjustment - Mechanical longitudinal adjustment - Mechanical headrest adjustment)
- Package: Assistance (Blind Spot Assist: The system can warn you of side collisions with other road users in your blind spot, especially as soon as you activate the turn signal. Even after driving, the system remains vigilant and warns you if you open the door at the wrong moment. An important safety feature – especially for cyclists.)
- Package: Light (Adaptive Highbeam Assist - automatic switching of the high beams, camera on the inside of the windshield, detects oncoming and preceding illuminated vehicles, activated by pressing the steering wheel control lever to the high beam position)
- Seats: Comfort seats
- Package: Advanced Infotainment Package (MBUX Navigation Premium (hard drive navigation, pre-installation for Live Traffic Information), Traffic Sign Assist, Smartphone Integration (connects the mobile phone wirelessly to the multimedia system via Apple CarPlay and Android Auto), Driver Display - 31.2 cm (12.3") color LCD display, Central Display - 30.2 cm (11.9") touch display with LCD technology)
- Package: Advanced Parking Package (12 ultrasonic sensors - 360° camera - Active Parking Assist with PARKTRONIC: detects free parking spaces, assisted parking, visual and acoustic warning, display of camera and ultrasonic data in the media display - Cross traffic warning: can provide visual and acoustic warnings when reversing out of a parking space and, if necessary, automatically initiate emergency braking - Reverse maneuvering brake: can trigger a braking process - Drive-away assist)
- Package: Business (300e) (Mirror Package: Electrically folding exterior mirrors with automatic dimming function, ambient lighting with Mercedes-Benz logo projection - Advanced Comfort Package: Heated seats for driver and front passenger, 4-way lumbar support, seat comfort package - Infotainment Package: MBUX Navigation Premium, traffic sign assist, smartphone integration - Public Charging Package)
- Wheels: 43.2 cm (17") light alloy wheels in 5-spoke design (vanadium silver painted with front axle 225/50 R 17 on 7 J x 17 ET 44.5, rear axle 245/45 R 17 on 8 J x 17 ET 49.5)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
2	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Smart repair
3	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
4	Indicator - front	Mirror - left side - Scratch(es) - Replace
5	Front bumper	Grille (Stern) - Broken / torn - Replace
6	Interior	Boot cover / roller cover - Broken / torn - Replace
7	Headlight	Headlight - left side - Scratch(es) - Loss in value
8	Wheel / tyres	Alloy rim - front left side (Hoher Materialabtrag) - Scratched - Replace
9	Boot lid / rear door	Rear spoiler - Scratch(es) - Paint
10	Rear bumper	Rear bumper - Scratch(es) - Paint
11	Bonnet	Bonnet - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Door trim - front left side - dent(s) - No deduction
2	Mudguard - right side	Mudguard - right side - Stone chips - No deduction
3	Door - rear right side	Door - Scratch(es) - No deduction
4	Door - rear left side	Door - Scratch(es) - No deduction
5	Door - front left side	Door edge - Scratch(es) - No deduction
6	Door - front left side	Door - Scratch(es) - No deduction
7	Roof	Roof - Stone chips - No deduction
8	2nd wheel set	1 tyre (Fremdkörper/Kein Teil der Serienausstattung) - Broken / torn - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 5 Sept 2025	2.101,14 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

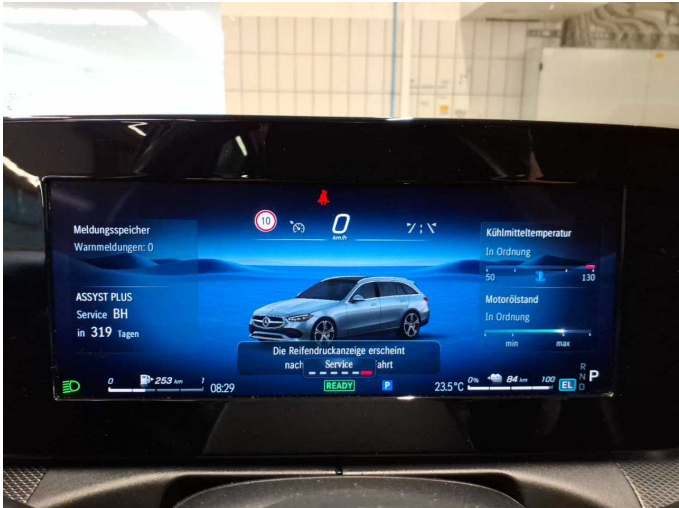


Figure 14: Documents



Figure 15: Additional tyres

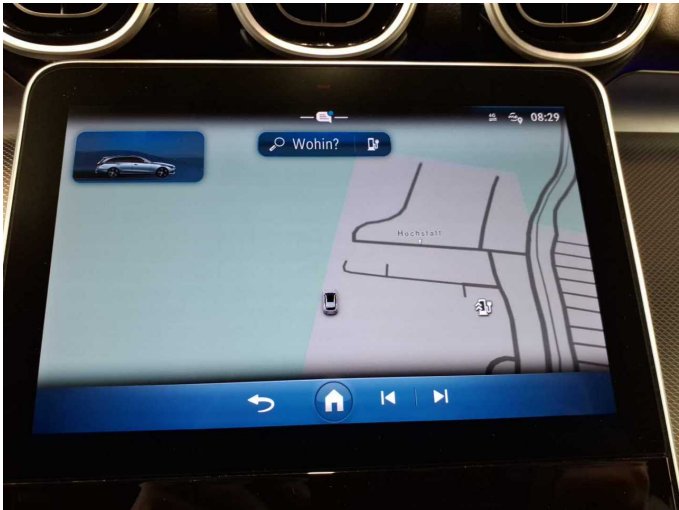


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

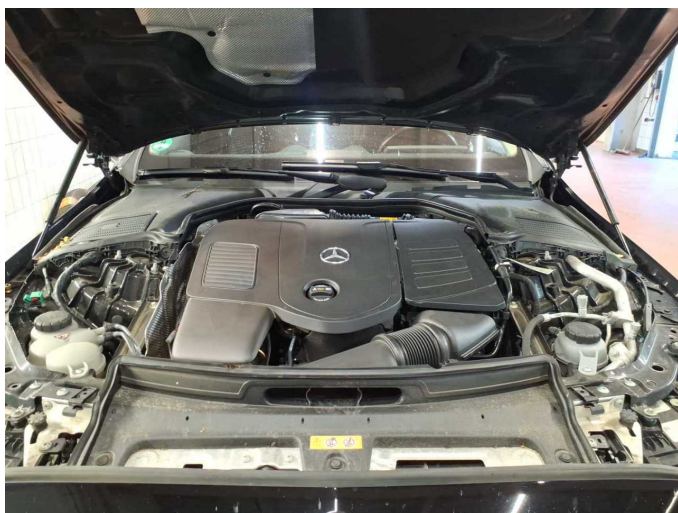


Figure 21: Misc.

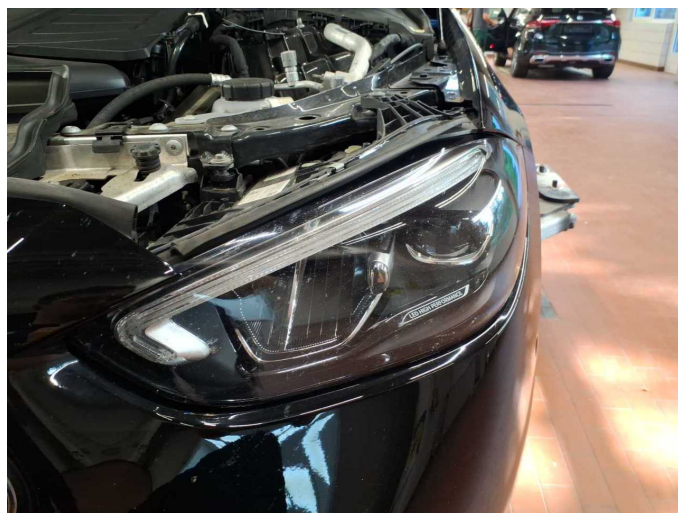


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.


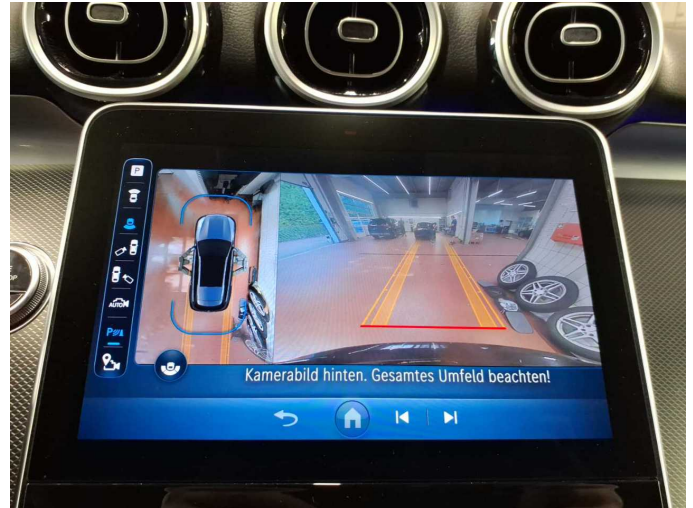



Figure 32: Misc.




Damage 1: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

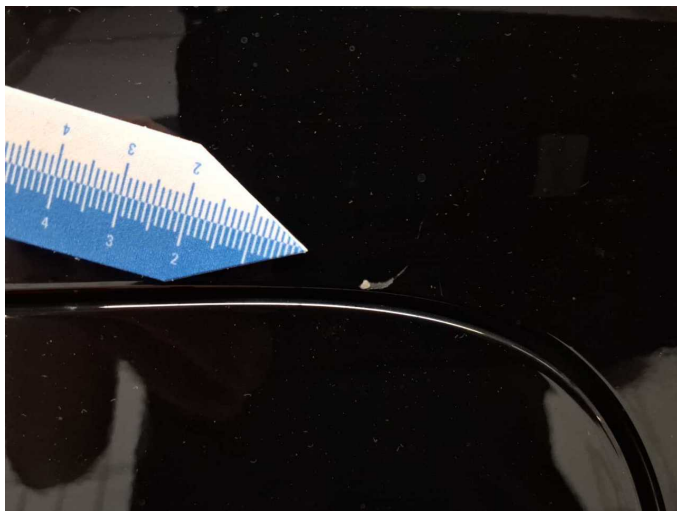

Damage 1: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

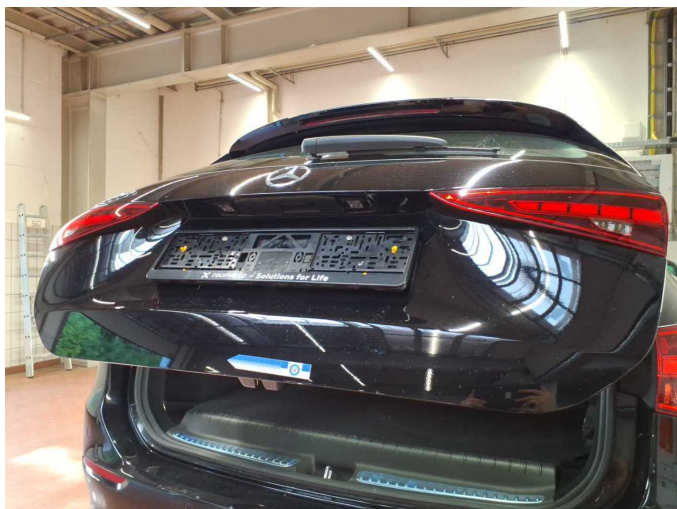

Damage 2: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair

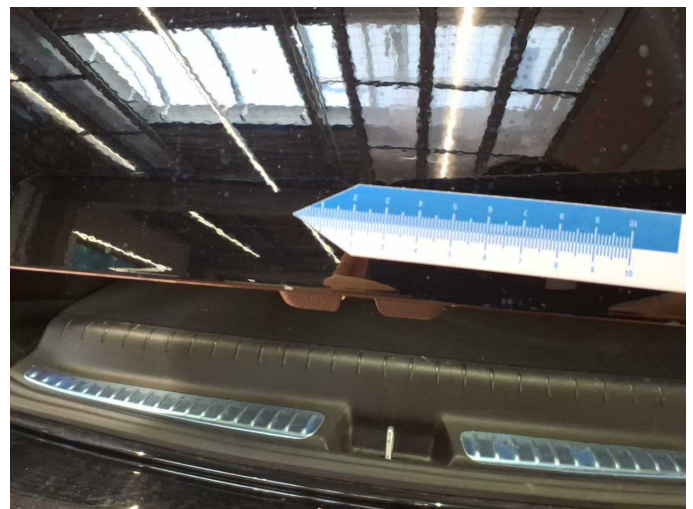


Damage 2: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair




Damage 2: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair




Damage 2: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair

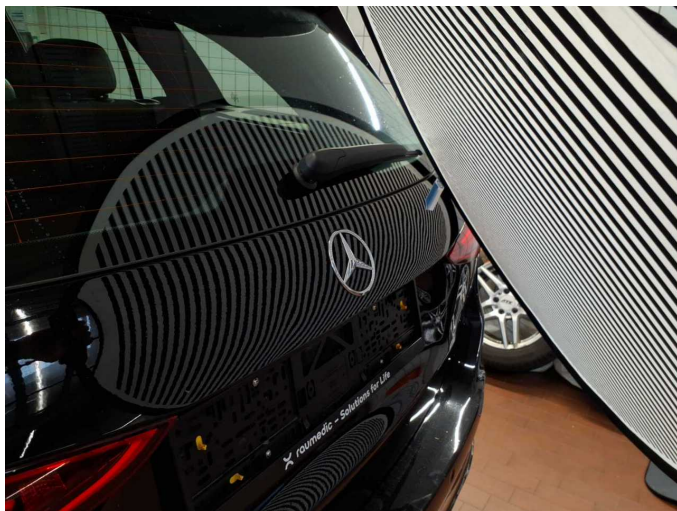

Damage 2: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair

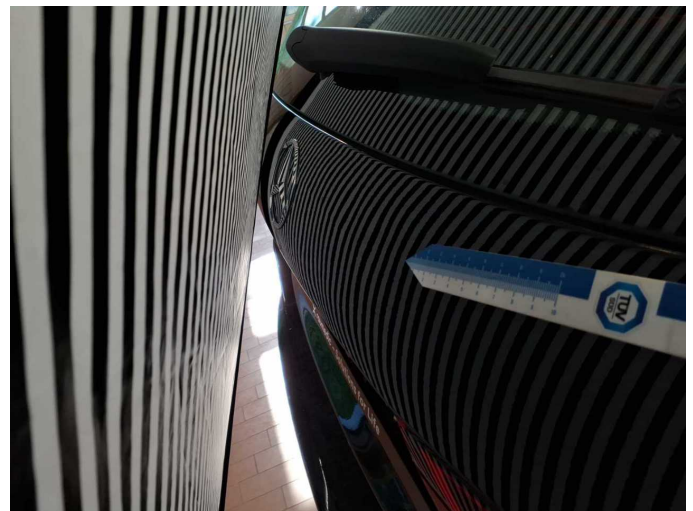

Damage 2: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair

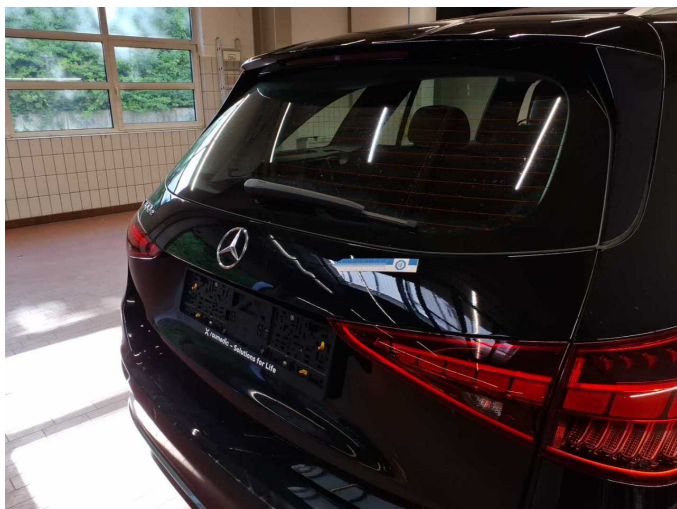

Damage 2: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 4: Indicator - front: Mirror - left side - Scratch(es) - Replace

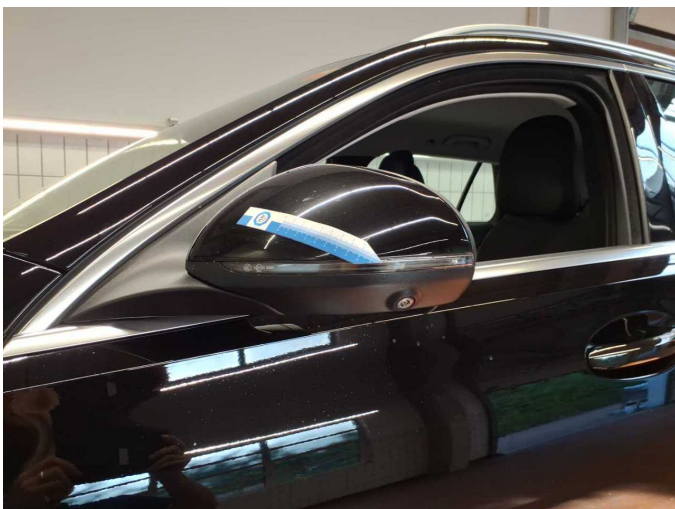

Damage 4: Indicator - front: Mirror - left side - Scratch(es) - Replace



Damage 5: Front bumper: Grille (Stern) - Broken / torn - Replace

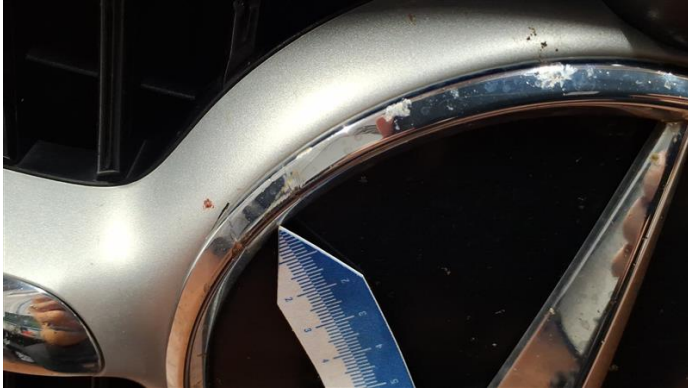

Damage 5: Front bumper: Grille (Stern) - Broken / torn - Replace




Damage 6: Interior: Boot cover / roller cover - Broken / torn - Replace



Damage 6: Interior: Boot cover / roller cover - Broken / torn - Replace



Damage 7: Headlight: Headlight - left side - Scratch(es) - Loss in value

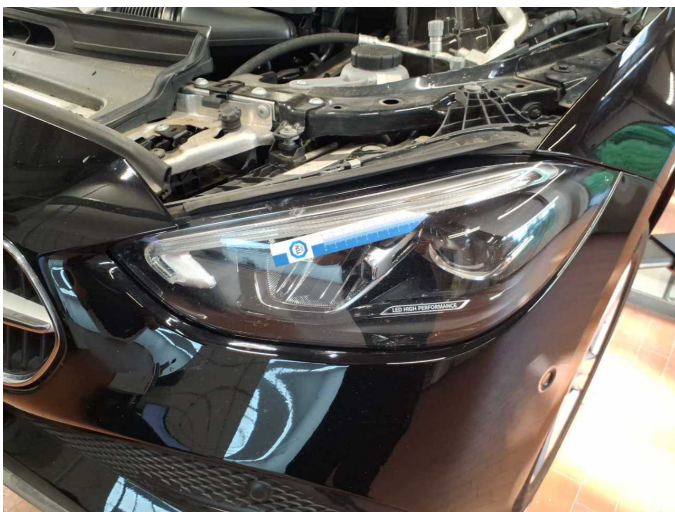

Damage 7: Headlight: Headlight - left side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front left side (Hoher Materialabtrag) - Scratched - Replace



Damage 8: Wheel / tyres: Alloy rim - front left side (Hoher Materialabtrag)
- Scratched - Replace



Damage 9: Boot lid / rear door: Rear spoiler - Scratch(es) - Paint



Damage 9: Boot lid / rear door: Rear spoiler - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 11: Bonnet: Bonnet - Stone chips - Paint



Damage 11: Bonnet: Bonnet - Stone chips - Paint

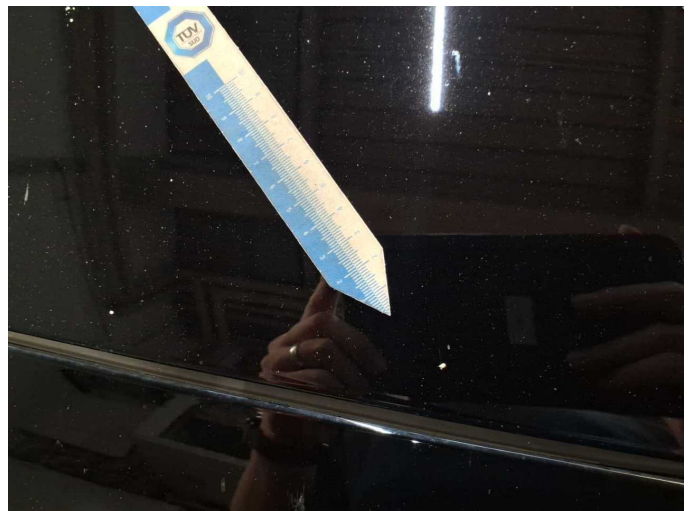

Damage 11: Bonnet: Bonnet - Stone chips - Paint

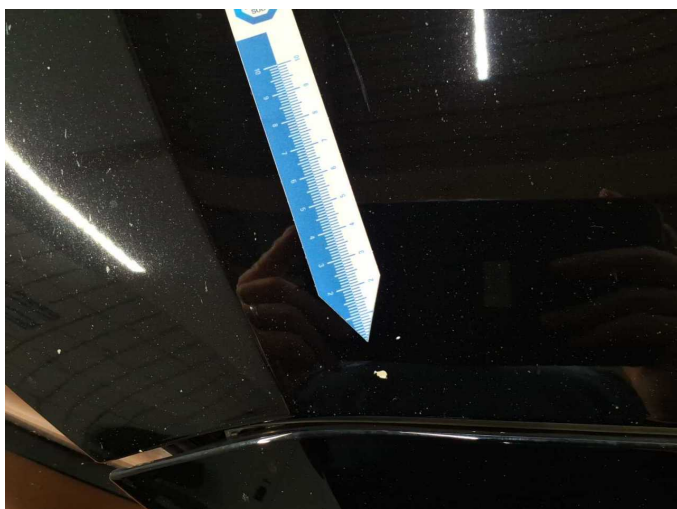

Damage 11: Bonnet: Bonnet - Stone chips - Paint




Wear and tear 1: Trim / covers: Door trim - front left side - dent(s) - No deduction



Wear and tear 1: Trim / covers: Door trim - front left side - dent(s) - No deduction




Wear and tear 2: Mudguard - right side: Mudguard - right side - Stone chips - No deduction

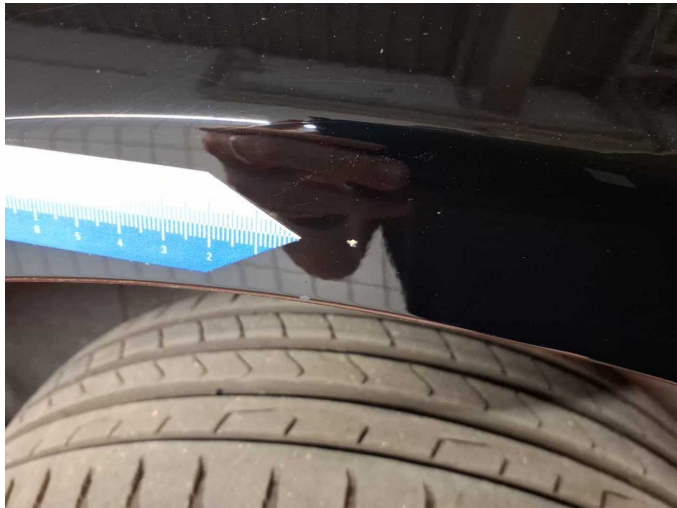


Wear and tear 2: Mudguard - right side: Mudguard - right side - Stone chips - No deduction



Wear and tear 3: Door - rear right side: Door - Scratch(es) - No deduction

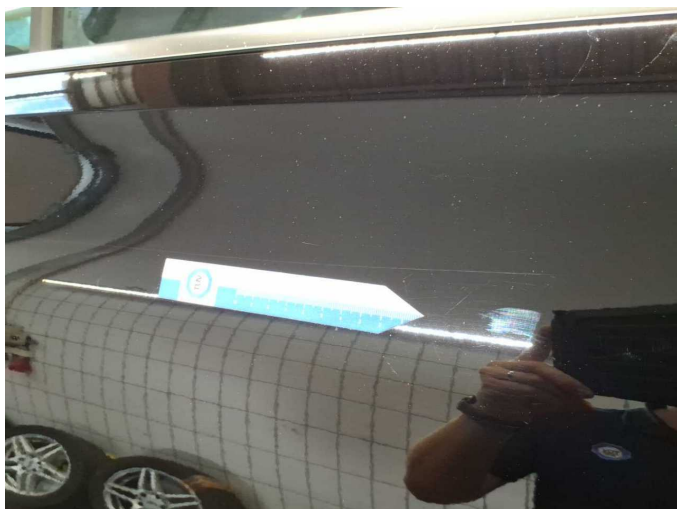

Wear and tear 3: Door - rear right side: Door - Scratch(es) - No deduction

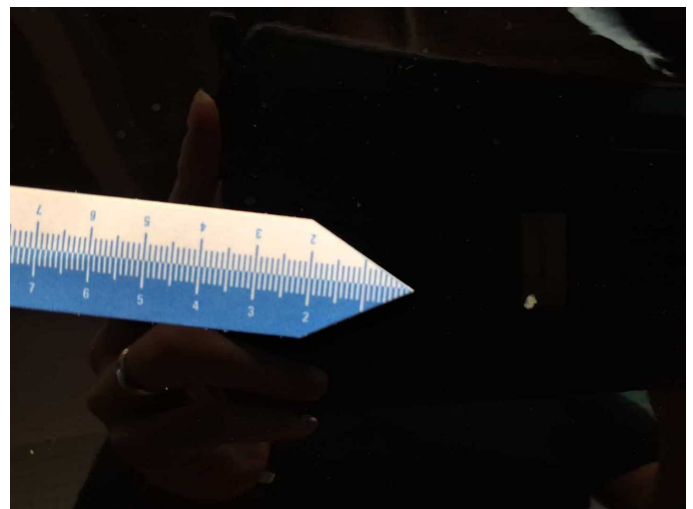

Wear and tear 6: Door - front left side: Door - Scratch(es) - No deduction



Wear and tear 6: Door - front left side: Door - Scratch(es) - No deduction



Wear and tear 7: Roof: Roof - Stone chips - No deduction



Wear and tear 7: Roof: Roof - Stone chips - No deduction



Wear and tear 8: 2nd wheel set: 1 tyre (Fremdkörper/Kein Teil der Serienausstattung) - Broken / torn - No deduction



Wear and tear 8: 2nd wheel set: 1 tyre (Fremdkörper/Kein Teil der Serienausstattung) - Broken / torn - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1KAH5EB6PF121262

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ C 300 e T 9G-TRONIC
Avantgarde

Datum	KM-Stand	Beschreibung
08.05.2026	184.779	Regelwartungsdienst
23.12.2025	159.418	Regelwartungsdienst
08.08.2025	132.585	Bremsscheiben+Beläge v+h; Regelwartungsdienst
24.03.2025	108.052	Regelwartungsdienst
24.10.2024	82.643	Regelwartungsdienst
07.06.2024	58.020	Regelwartungsdienst
04.01.2024	32.061	Regelwartungsdienst