



Expertise

Protocol number: 46884624
Order No. / Reference: 26847823
Inspection date: 4 Aug 2026

Manufacturer: Mercedes-Benz

Model: A 180 d 8G-DCT Lim. Progressive Advanced

VIN: W1K3G1AB4SJ452339



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz A 180 d 8G-DCT Lim. Progressive Advanced	
Vehicle Identification number	W1K3G1AB4SJ452339
Mileage (Read)	51,718 km
First registration	22 May 2024
Number of holders	1
Next periodical technical inspection	05/2027
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,950 ccm / 4
Power	85 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	POLARWEISS - UNILACK
Doors / Seats	4 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	303 Tag(e)
Last service on / at	06/2026 at 47,963		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HB198770
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AWW 00052		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,030 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 91W	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	205/55 R17 91W	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Pirelli	3mm / 3mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Pirelli	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment in center console with roller blind
- Adaptive High Beam Assist (Whenever the Adaptive High Beam Assist does not detect any vehicles ahead or oncoming traffic, it switches on the high beam.)
- Airbag: Driver and front passenger
- Airbag: Kneeairbag for driver
- Airbag: Sideairbag for driver and front passenger (combined thorax/pelvisairbag)
- Airbag: Windowairbag for driver and front passenger
- Traction control (ASR)
- ATTENTION ASSIST (the attention assistant) (can detect typical signs of fatigue through driver behavior and warn the driver of increasing fatigue or inattentiveness)
- Outdoor temperature display
- Basic services (breakdown management, maintenance management, accident management, telediagnosis, remote vehicle diagnostics)
- Diesel particulate filter
- Double cupholder at the front (Removing the double cupholder expands the interior to provide a large storage area.)
- Third brake light
- Door sills with the lettering "Mercedes-Benz"
- Electronic Stability Program (ESP)
- Driving light assistant
- Chassis: Comfort chassis with lowering (with this chassis variant the body is lowered by 15 mm)
- Electric windows (4-way)
- Luggage net on driver and passenger seatbacks
- Speed Limit Assistant (Uses image recognition via camera to determine the maximum permissible speed - traffic signs are displayed symbolically in the instrument cluster / optionally in the head-up display, including restrictive supplementary signs such as speed limits in wet conditions or speed limits for trucks only - the driver can manually accept recognized and suggested speed limits via the steering wheel controls - visual and audible warnings for exceeding the maximum permissible speed are adjustable)
- THERMATIC automatic climate control (1-zone climate control, automatically controlled air distribution, recirculation function, tunnel function in conjunction with navigation system, fine dust filter). Automatic tunnel deactivation in conjunction with activated navigation. It detects tunnel entrances, interrupts the fresh air supply and closes the side windows or the panoramic sunroof. Personalization adjusts the heating, air conditioning and airflow for different driver profiles.)
- Paint finish: Solid
- ABS - Anti-lock Braking System
- Adaptive brake light flashing
- Airbag: Automatic passenger airbag deactivation (The system automatically deactivates the passenger airbag as soon as it detects a rear-facing child seat or registers that the passenger seat is unoccupied. A transponder in the child seat is not necessary. If it detects that an adult is taking the seat, the airbag is automatically activated, reducing the risk of incorrect operation.)
- Foldable armrest in the center console for driver and front passenger
- Heated exterior mirrors on the left and right, electrically adjustable from the inside (with aspherically curved mirror glass and integrated turn signal light)
- Brake assist, active (This assistant can help avoid collisions with vehicles ahead, stationary vehicles, oncoming traffic when turning, and moving pedestrians and cyclists. In addition to distance and collision warnings, the system primarily offers situation-appropriate brake boosting – up to and including autonomous emergency braking.)
- ECO start/stop function (Automatic engine shutdown when stationary, for example in traffic jams or at traffic lights, reduces fuel consumption, lowers emissions and saves fuel costs. The ECO start/stop function works particularly effectively, quickly and quietly.)
- Vehicle key with chrome decorative frame
- Velour floor mats (black with decorative stitching in the respective interior color)
- Transmission: 8G-DCT automatic (8-speed dual-clutch transmission consisting of two sub-transmissions, each with its own clutch; 8 forward gears and 1 reverse gear; DIRECT SELECT selector lever on the steering wheel; High-quality steering wheel shift paddles - left for downshifting and right for upshifting)
- Heated rear window
- Interior headliner fabric crystal grey
- KEYLESS-GO start function
- Mechanical child safety lock (for doors and electric child safety lock for windows)
- Communication module (LTE) for using Mercedes me connect services (offers you a clear increase in comfort and safety. It constantly connects the vehicle to the internet so you can use helpful services like Mercedes me connect Live Traffic Information. Two mobile antennas and an LTE-enabled SIM card ensure a fast connection.)
- Rear headrests (3)
- Front headrests are height-adjustable
- LED High Performance headlights (low beam with LED projection technology, high beam with LED reflection technology, daytime running lights, position lights and direction indicators in LED technology, adaptive full-LED taillights with automatic adjustment of light intensity to the surroundings)
- Steering: Direct steering (with variable steering ratio)



- Steering wheel: Multifunction sports steering wheel in leather (Sporty steering wheel in 3-spoke design, leather finish, steering wheel shift paddles (428), black grained, control via touch control panels: Left: Instrument display, cruise control and limiter or Active Distance Assist DISTRONIC; Right: MBUX multimedia system (e.g. audio volume and track selection, telephony and navigation), touch sensitivity adjustable via media display)
- Navigation: MBUX Navigation Premium (hard drive navigation, high-resolution navigation with satellite view, live traffic information and Car-to-X communication, fast online route calculation, trailer route planner takes into account known restrictions for towing, Send2Car function, map data updates via Mercedes me connect with automatic over-the-air update, via USB stick, at a Mercedes-Benz dealer, navigation services such as local search (POI), online search, displays (weather, etc.))
- Package: Parking package with reversing camera (including Active Parking Assist with PARKTRONIC - reversing camera. This assistant can help you with various tasks related to the parking process: The system assists with signaling, steering, accelerating, braking and changing gears.)
- Package: Progressive Line Advanced (storage compartment in center console with roller blind - multifunction sports steering wheel in leather - preparation for digital key handover - CENTRAL MEDIA DISPLAY - USB package Plus - Remote Services - MBUX Navigation Premium - TIREFIT - heated seats for driver and front passenger - mirror package - parking package with reversing camera - 4-way lumbar support - LED High Performance headlights with adaptive high-beam assist - Progressive Line incl. comfort seats)
- Package: USB Package Plus (2 USB-C ports in the front storage compartment, fast charging and suitable for data transfer - 2 USB-C ports under the center armrest, fast charging and suitable for data transfer - 2 USB-C ports in the rear center console, fast charging)
- Radio: Extended MBUX functions (Personal profiles - Predictive functions - Wi-Fi hotspot and internet radio - Offboard voice control)
- Radio accessories: Central Media Display
- Tire pressure monitoring system (continuously monitors the inflation pressure of all four tires)
- Remote Services (Communication module - Mercedes me services: -Programming of auxiliary heating/ventilation: -Remote door locking and unlocking -Sunroof/windows with remote locking and opening including ventilation function -Personalization -Vehicle location -Vehicle tracking -Geographic vehicle monitoring -Parking service monitoring -Find function (Remote Vehicle Finder))
- Windscreen wipers with rain sensor
- Crosswind Assist (In strong, gusty crosswinds, the system can help the driver stay in their lane. Through targeted braking interventions, the vehicle experiences a significantly reduced lane drift.)
- Seats: 4-way lumbar support (Four settings are possible: higher, lower, weaker or stronger.)
- Seats: Comfort seats
- Mercedes-Benz Emergency Call System (The Mercedes-Benz Emergency Call System can provide a crucial time advantage in an emergency. A communication module with its own SIM card automatically triggers an emergency call via crash sensors when an airbag or seatbelt pretensioner is deployed, thus reducing the time until emergency services arrive. The emergency call can also be triggered manually to organize assistance. In this case, the vehicle's position and direction of travel are also transmitted.)
- Package: Light and Sight Package (Overhead control unit "4 light stones" (including glasses compartment), Interior light/reading light rear in mounting plate (rear/left/right), Touchpad lighting (front), Reading lights (front/left/right), Console ambient light, Make-up lights (front/left/right), Signal and ambient light, Exit signal light (front/left/right), Handle recess/pull handle lighting (front/rear/left/right), Footwell lighting (front/left/right), Cupholder/storage compartment lighting, Spontaneous storage compartment lighting)
- Package: Seating comfort (height adjustment for passenger seat - seat cushion tilt adjustment for driver and passenger seats - seat cushion depth adjustment for improved seating comfort through a 60 mm wider thigh support area - specific seat design)
- Package: Mirror package (interior and exterior mirrors on the driver's side automatically dimming - exterior mirrors left and right electrically folding)
- Upholstery: ARTICO leatherette/Bertrix fabric
- Radio accessories: Digital radio (DAB) (for the DAB, DMB and DAB+ standards)
- Radio accessories: USB interface in the storage compartment & 2 USB interfaces in the rear center console
- Radio: MBUX multimedia system (with two (17.78 cm) 7" touchscreen displays - with a resolution of 960x540 pixels, touch control buttons on the steering wheel, radio (FM/AM), USB interface in the center console under the armrest, Bluetooth telephony with contact transfer and audio streaming of music files, display of vehicle functions (driver assistance systems, driving programs and vehicle settings), favorites storage, smartphone-related voice control - activated by long press on the voice button on the steering wheel)
- Wheels: 43.2 cm (17") alloy wheels, 4-piece set in 5-twin-spoke design (aerodynamically optimized, painted black and polished with 205/55 R17 tires on 6.5J x 17 ET44 rims)
- A-Class safety belts (3-point safety belts including mechanical belt height adjustment - pyrotechnic belt force limiter and belt tensioner for driver and front passenger - pyrotechnic belt tensioner in the rear outer seats)
- Seats: Rear seat backrests foldable 40/20/40 split (If you only fold down the middle segment for longer items, the two outer seats remain fully usable.)
- Lane Keeping Assist, active (If you unintentionally cross a dashed or solid line, the system can warn you by vibrating the steering wheel. In the case of a solid line, or if the lane behind a dashed line is detected as occupied, the system can also intervene by applying the brakes on one side.)



- Seats: Heated seats for driver and front passenger (The intensity can be selected in three levels. Intelligent and comfortable: The seat heating switches off automatically.)
- Power outlet: 12V connection
- Cruise control (with variable speed limiter)
- TIREFIT with tire inflation compressor
- Touchpad (The touchpad lets you control the multimedia system's display like a smartphone. Easily move or zoom content using multi-finger gestures. Haptic feedback accompanies every input. The touchpad recognizes your handwriting if you want to enter addresses or phone numbers silently.)
- Central locking (with interior switch, automatic locking (can be deactivated) and crash sensor with emergency opening)

- Pre-installation for digital key handover (You can also unlock your vehicle remotely via the mobile application. Only then will a stored key be activated.)
- High-visibility vest for drivers
- Electronic immobilizer
- Heat-insulating glass, green all around (rear window single-pane safety glass (ESG))
- Decorative elements in dark carbon look

Extra equipment

- GUARD 360° Vehicle Protection Plus (Break-in and theft warning - Towing protection with visual and audible warning upon detected change in position - Audible alarm - Interior monitoring (triggers upon movement inside the vehicle) - Assistance with vehicle theft (theft assistance), free for 3 years from activation - Emergency key deactivation, free for 3 years from activation - GUARD 360° label on the front side windows - Collision detection, free for 3 years from activation, additionally with camera images in conjunction with 360°)
- Package: Parking package with 360° camera (12 ultrasonic sensors, Active Parking Assist, 360° camera, PARKTRONIC parking assist, Rear Cross Traffic Alert: can provide visual and audible warnings when reversing out of a parking space if rear cross traffic is detected and, if necessary, automatically initiate emergency braking; Drive Away Assist: can briefly limit the approach speed if an obstacle is detected less than approximately 1 meter away when changing gears while the vehicle is stationary)
- Black fabric headliner
- Package: Driving Assistance (Active Distance Assist DISTRONIC (Active Speed Limit Assist, Extended Automatic Restart on Motorways, Route-Based Speed Adaptation with Traffic Jam Radio) - Active Steering Assist (Active Emergency Stop Assist with SOS Radio, Emergency Lane Radio) - Active Brake Assist (Turning and Intersection Function, Traffic Jam Emergency Braking Function) - Evasive Steering Assist - Active Lane Keeping Assist - Active Blind Spot Assist (Exit Warning Function) - Traffic Sign Assist (Pedestrian Warning Function in the Area of Zebra Crossings) - PRE-SAFE PLUS)
- Upholstery: ARTICO man-made leather
- Wheels: 43.2 cm (17") alloy wheels, 4-piece set in 5-twin-spoke design (aerodynamically optimized, vanadium silver painted with 205/55 R 17 tires on 6.5 J x 17 ET 44 rims)
- Traffic Sign Assistant
- Type designation removed from trunk lid

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Roof	Roof rail - left side - dent(s) - Smooth repair work
2	Mudguard - left side	Mudguard - left side - Stone chips - Smart repair
3	Sill - right side	Trim - Scratch(es) - Smart repair
4	Front bumper	Front bumper - Dent / paintcoat damage - Repair and paint



Wear and tear

No.	Component group	Description
1	Sill - left side	Sill - Scratch(es) - No deduction
2	2nd wheel set	Tyres - complete set - does not meet manufacturer specifications - No deduction
3	Rear bumper	Rear bumper - Scratch(es) - No deduction
4	Body	Body (Flugrost) - Stone chips - No deduction
5	Roof	Roof - Stone chips - No deduction
6	Bonnet	Bonnet - Stone chips - Cover / polish

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

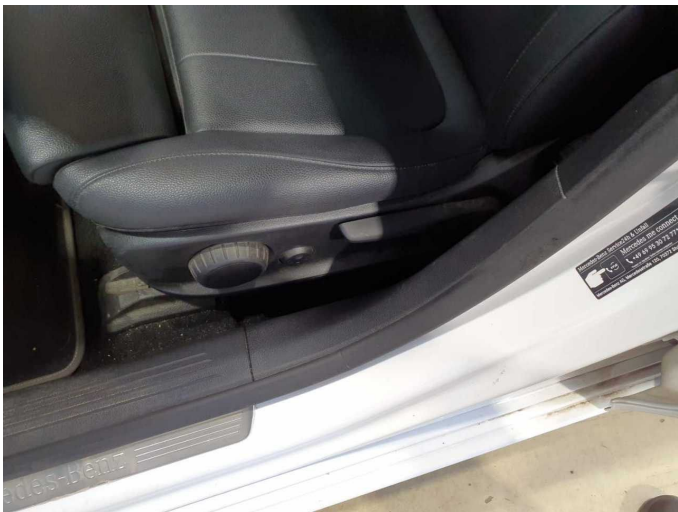


Figure 18: Misc.

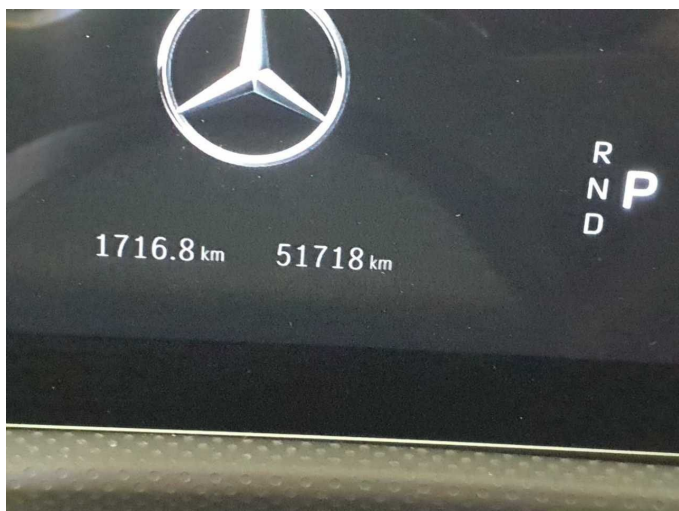


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

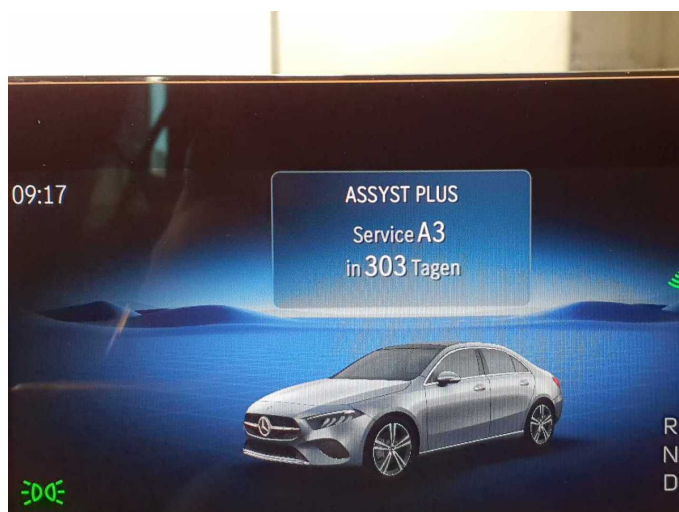


Figure 22: Misc.

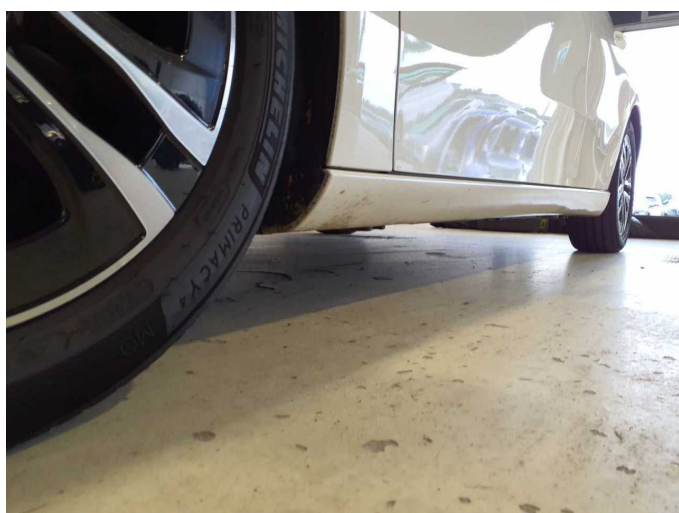


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Damage 1: Roof: Roof rail - left side - dent(s) - Smooth repair work



Damage 1: Roof: Roof rail - left side - dent(s) - Smooth repair work

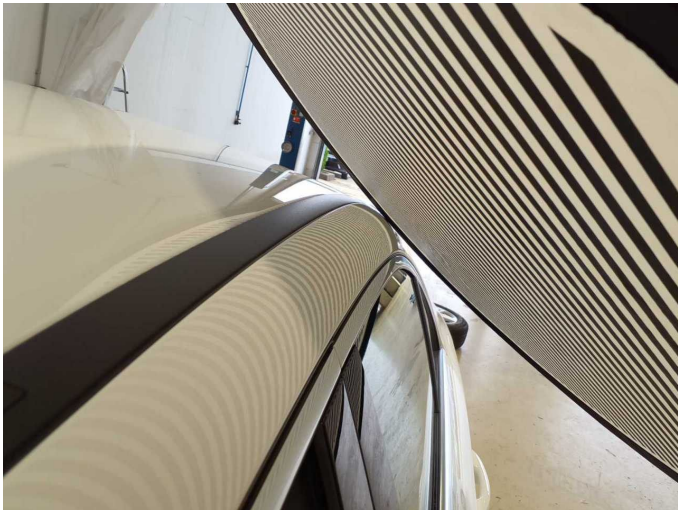

Damage 1: Roof: Roof rail - left side - dent(s) - Smooth repair work



Damage 2: Mudguard - left side: Mudguard - left side - Stone chips - Smart repair




Damage 2: Mudguard - left side: Mudguard - left side - Stone chips - Smart repair



Damage 3: Sill - right side: Trim - Scratch(es) - Smart repair



Damage 3: Sill - right side: Trim - Scratch(es) - Smart repair

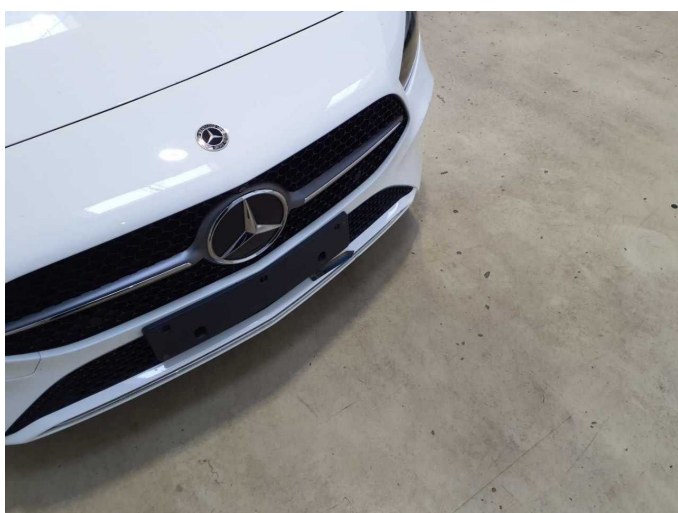

Damage 4: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 4: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 4: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Wear and tear 6: Bonnet: Bonnet - Stone chips - Cover / polish



Wear and tear 6: Bonnet: Bonnet - Stone chips - Cover / polish