



Expertise

Protocol number: 46689914
Order No. / Reference: 26591750
Inspection date: 21 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1K2052151G073983

Model: C 220 d 4Matic T 9G-TRONIC Avantgarde



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz C 220 d 4Matic T 9G-TRONIC Avantgarde	
Vehicle Identification number	W1K2052151G073983
Mileage (Read)	100,977 km
First registration	13 Jan 2021
Number of holders	1
Next periodical technical inspection	02/2028
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,950 ccm / 4
Power	143 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Selenitgrau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	277 Tag(e)
Last service on / at	04/2026 at 98,950 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA316445
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / ALB 00453		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,310 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98V	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	225/50 R17 98V	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	245/40 R18 97Y	Summer tyres on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment under the load floor
- Airbag
- Airbag: Automatic passenger airbag deactivation
- Anti-lock braking system (ABS)
- Rear armrest with storage compartment and cupholder
- ATTENTION ASSIST
- Outdoor temperature display
- Brake Assist, Active
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP) with Crosswind Assist
- Electric windows (4-way)
- Luggage net on the left side of the trunk
- Heated rear window with timer
- Interior headliner fabric crystal grey
- Mechanical child safety lock for the rear doors
- Combination instrument with 2 tubular round instruments
- Cargo area cover including EASY-PACK safety net
- Steering wheel: Multifunction sports steering wheel in black leather, 3-spoke design
- Steering: Direct steering
- Mercedes-Benz emergency call system
- Package: Interior lighting package
- Radio accessories: Digital radio
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Windscreen wipers with rain sensor
- Seat belts C-Class
- Seats: ISOFIX child seat attachment with top tether in the rear
- Pre-installation for vehicle monitoring
- High-visibility vest for drivers
- Green heat-insulating glass all around, including rear window made of single-pane safety glass.
- ADAPTIVE BRAKE with hill start assist, pre-filling and drying braking in wet conditions
- 4MATIC all-wheel drive
- Foldable armrest for driver and front passenger with storage compartment
- Heated and electrically adjustable exterior mirrors (left and right) painted in body color
- Diesel particulate filter
- Third brake light in LED technology
- ECO start/stop function
- Driving light assistant
- Pedestrian protection (active hood)
- Transmission: 9-speed automatic, 9G-TRONIC
- Rear window wiper with intermittent function
- KEYLESS-GO start function
- Remote trunk lid release
- Headrests 5-way adjustable for driver and front passenger, 4-way adjustable, and 2-way adjustable in the rear.
- Steering column mechanically adjustable in height and length
- Package: AVANTGARDE Exterior (4Matic)
- Upholstery: ARTICO leatherette/Norwich fabric
- Radio: Audio 20 GPS
- Tire pressure monitoring system (TPMS)
- Travel calculator in the multifunction display
- Service interval indicator ASSYST
- Seats: Rear seat backrests foldable 40/20/40 split
- Seats: Front seats electrically adjustable
- Cruise control with HOLD function
- Pre-installation for vehicle setup
- Electronic immobilizer
- Central locking
- Decorative elements in piano black finish / aluminum with light longitudinal grain



Extra equipment

- EASY-PACK tailgate (with electric operation for opening and closing and electric cargo area cover)
- THERMOTRONIC automatic climate control with 3 climate zones (The THERMOTRONIC automatic climate control with 3 climate zones and 3 climate styles allows for a personalized comfort climate on board. Driver and front passenger can each set the temperature, air distribution and climate style according to their personal needs. The third climate zone is located in the rear - with separately adjustable temperature and airflow.)
- Package: Advanced Assistance Package (Mirror Package: - Automatically dimming interior and exterior mirrors on the driver's side - Electrically folding exterior mirrors on the left and right - Parking position on the right and ambient lighting in the exterior mirrors - Onboard setting - Automatic lowering of the passenger-side mirror glass to "onboard setting" when reverse gear is engaged Lane Tracking Package: - Active Lane Keeping Assist and Blind Spot Assist Active Distance Assist DISTRONIC including Active Brake Assist)
- Package: Business PLUS (Parking Package - Active Parking Assistant - Advanced Infotainment Package - Smartphone Integration Package - Apple CarPlay, Android Auto, Media Display with high-resolution 10.25" diagonal, SD card navigation, Live Traffic preparation - Comfort Package - Heated seats for driver/front passenger, Seat Comfort Package for driver/front passenger: - 4-way electric pneumatic lumbar support - Electric seat cushion tilt and mechanical seat cushion depth adjustment by 6 cm - Large fuel tank (not for 300e/de) - Lighting Package - LED headlights, LED daytime running lights)
- Package: Comfort Package (Seat heating for driver and front passenger; Seat comfort package for driver and front passenger: - electro-pneumatic 4-way lumbar support with control element on the seat - electric seat cushion tilt adjustment - mechanical seat cushion depth adjustment by 6 cm)
- Package: Lighting (consisting of: LED High Performance headlights including integrated LED daytime running lights)
- Wheels: 45.7 cm (18") light alloy wheels, 4-spoke design (vanadium silver painted and polished, front axle: 7.5 J x 18 ET 49, tire size 225/45 R 18, rear axle: 8.5 J x 18 ET 56, tire size 245/40 R 18)
- Heated windshield washer system (with heated washer fluid reservoir, heated washer nozzles, and washer hoses. The washer nozzles, reservoir, and hoses are heated in this system, providing better protection against icing. This allows for better cleaning of the windshield at low temperatures.)
- Heat-insulating dark tinted glass all around from the B-pillar back
- Decorative elements: open-pore black ash wood/light longitudinally sanded aluminum
- Head-up Display (Keeping the most important driver information in view without taking your eyes off the road - this is made possible by the head-up display. It projects a virtual image, approximately 21 x 7 cm in size, into the driver's field of vision, which appears to float about 2 meters in front of them above the hood.)
- Paint finish: Metallic
- Package: Storage (Luggage net on the side of the trunk, right-hand side panel; net on the trunk floor; folding box under the load floor; double cupholder in the center console for 2 x 500 ml (with 6-speed manual transmission); double cupholder in the center console for 2 x 750 ml (with automatic transmission); luggage net in the front passenger footwell; map pockets on the back of the front seats; 2 USB ports with charging function)
- Package: Advanced Parking Package (12 sensors - Active Parking Assist: Detects parking spaces up to 35 km/h, steering control, in conjunction with automatic transmission assists with acceleration, braking, gear changes - PARKTRONIC: Visual/acoustic warning of detected obstacles in front of/behind the vehicle up to approx. 10 km/h - Rear Cross Traffic Alert warns visually and audibly of detected cross traffic - Drive Away Assist (only in conjunction with automatic transmission) - Button on the center console or on the control panel for the assistance systems - Rearview camera)
- Package: High-End Infotainment Package (Smartphone Integration Package - Apple CarPlay, Android Auto, High-resolution Media Display with 10.25" diagonal, COMAND Online - Touchpad with controller and LINGUATRONIC voice control system - Hard drive navigation with satellite map display - Bluetooth hands-free system - Remote Online - SD interface - 2 USB ports - WLAN/WIFI hotspot, Live Traffic, In-vehicle office functions - Microsoft Office 365 - Functional Concierge Service, Extended Navigation Services including Traffic Sign Assistance)
- Package: Sound comfort in conjunction with head-up display (Burmester surround sound system: 13 speakers, 9-channel DSP amplifier, 590 watts system power - heat and noise-insulating acoustic glass: with acoustic film for the windshield and laminated safety glass with acoustic film in the front side windows. The acoustic film replaces the conventional plastic interlayer of the laminated safety glass. This reduces the noise level in the interior by up to 10 decibels. The acoustic film is specially tuned.)
- 230V power outlet in the rear
- Telephone accessories: Wireless charging system for mobile devices (wireless charging according to Qi standard for compatible mobile phones - fast connection setup between multimedia system and mobile phone via Near Field Communication (NFC) for identification of the mobile device - storage compartment for wireless charging is located in the storage compartment at the front of the center console)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Interior	Interior - Soiled - Clean
2	Side panel - rear left side	Side panel - Dent / paintcoat damage - Smart repair
3	Side panel - rear left side	Sill - Scratch(es) - Smart repair
4	2nd wheel set	1 alloy rim (Felge 1. Achse) - Scratch(es) - Loss in value
5	2nd wheel set	1 alloy rim (Felge 2. Achse) - Scratch(es) - Loss in value
6	2nd wheel set	1 alloy rim (Mit Materialabtrag, Felge 2. Achse) - Scratched - Replace
7	Rear bumper	Rear bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 24 Jul 2024	948,44 €
2	Front, Provided by user / customer, from 2 Sept 2024	2.934,33 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

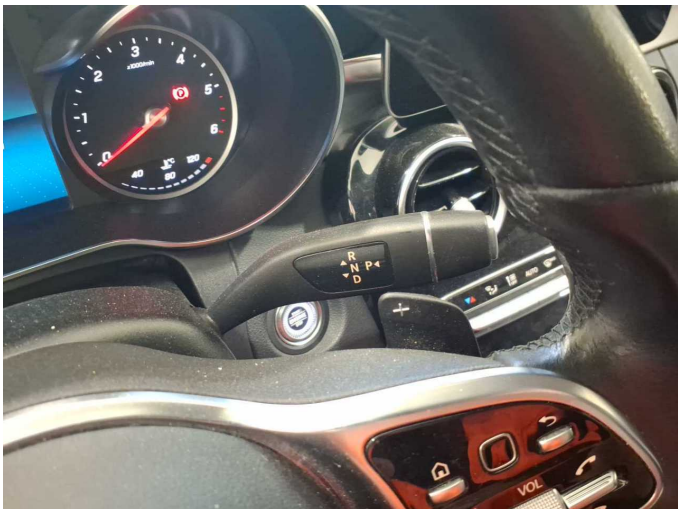


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

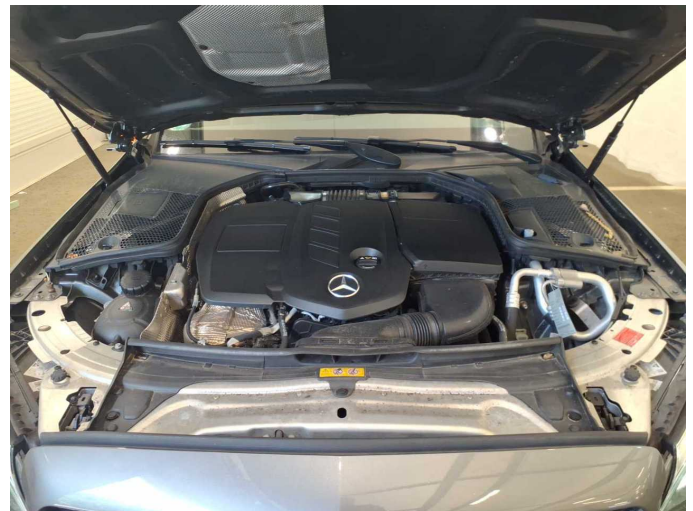


Figure 22: Misc.



Figure 23: Misc.

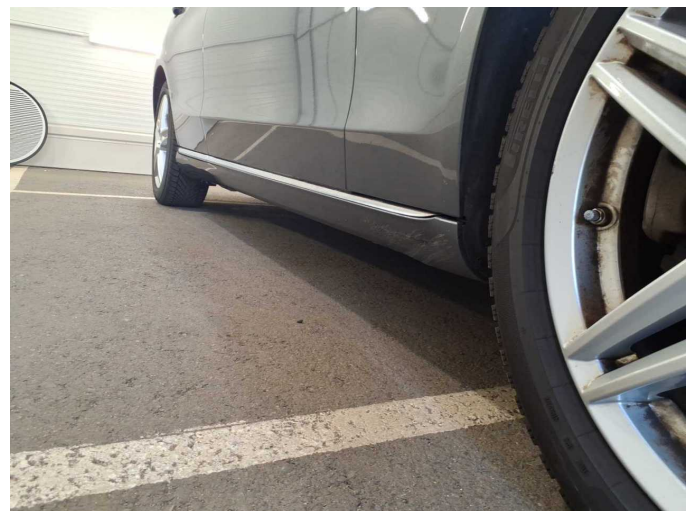


Figure 24: Misc.




Figure 25: Misc.




Figure 26: Misc.




Figure 27: Misc.

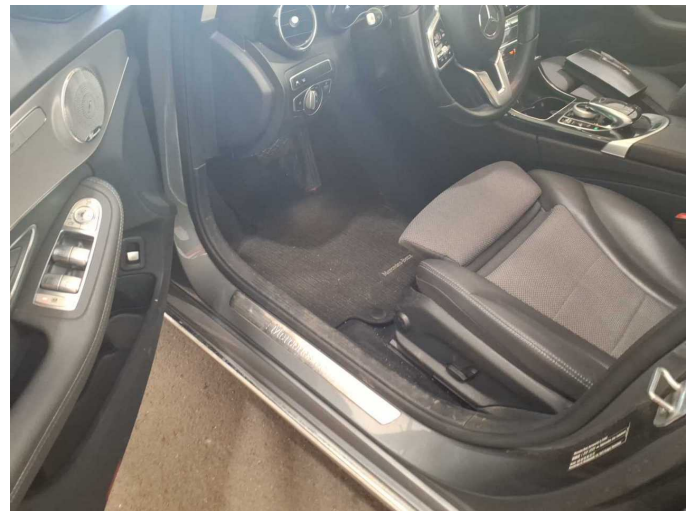

Damage 1: Interior: Interior - Soiled - Clean

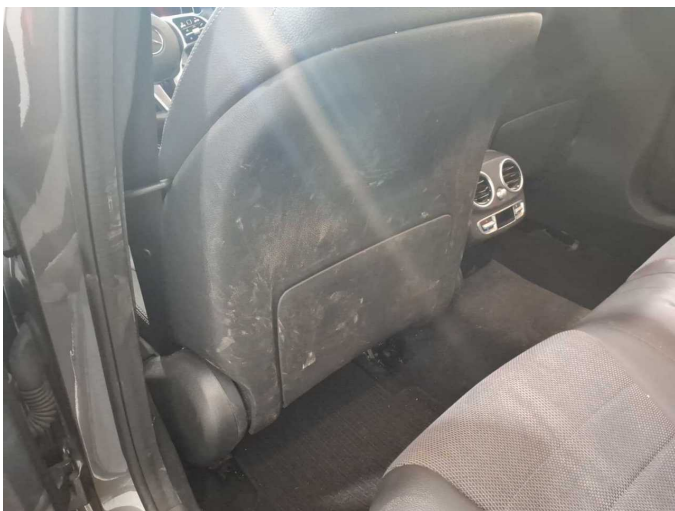

Damage 1: Interior: Interior - Soiled - Clean

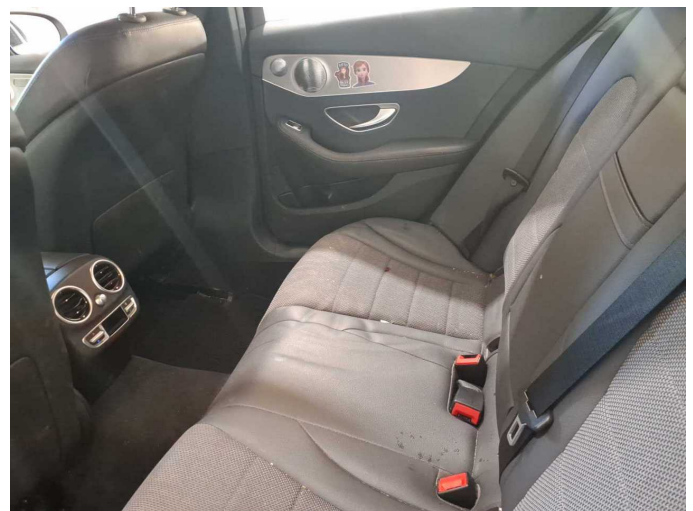


Damage 1: Interior: Interior - Soiled - Clean



Damage 1: Interior: Interior - Soiled - Clean



Damage 2: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair

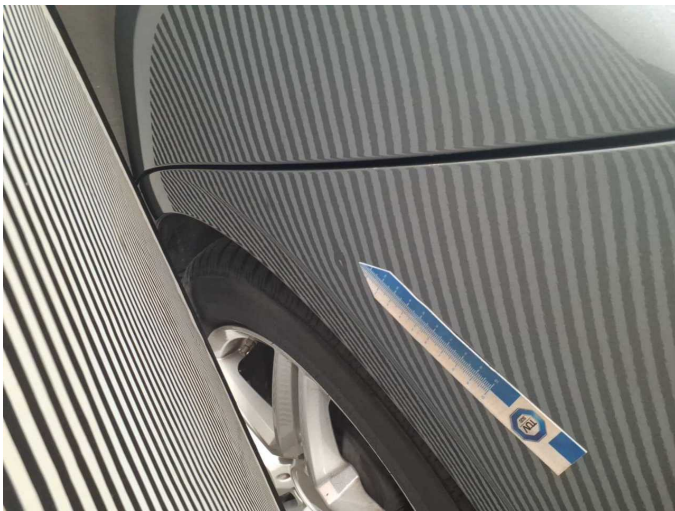

Damage 2: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair



Damage 2: Side panel - rear left side: Side panel - Dent / paintcoat damage - Smart repair



Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 4: 2nd wheel set: 1 alloy rim (Felge 1. Achse) - Scratch(es) - Loss in value



Damage 4: 2nd wheel set: 1 alloy rim (Felge 1. Achse) - Scratch(es) - Loss in value



Damage 5: 2nd wheel set: 1 alloy rim (Felge 2. Achse) - Scratch(es) - Loss in value



Damage 5: 2nd wheel set: 1 alloy rim (Felge 2. Achse) - Scratch(es) - Loss in value



Damage 6: 2nd wheel set: 1 alloy rim (Mit Materialabtrag, Felge 2. Achse) - Scratched - Replace



Damage 6: 2nd wheel set: 1 alloy rim (Mit Materialabtrag, Felge 2. Achse) - Scratched - Replace



Damage 7: Rear bumper: Rear bumper - Scratched - Paint



Damage 7: Rear bumper: Rear bumper - Scratched - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K2052151G073983

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ C 220 d 4Matic T 9G-
TRONIC Avantgarde

Datum	KM-Stand	Beschreibung
24.04.2026	98.950	Regelwartungsdienst
10.02.2026	93.949	AU
09.02.2026	93.949	Bremsscheiben+Beläge v+h
31.03.2025	76.030	Regelwartungsdienst
28.03.2024	57.498	Regelwartungsdienst
05.01.2024	54.027	AU; Bremsklötze hinten
13.09.2023	45.113	Systemtest/Eigendiagnose
08.03.2023	33.353	Regelwartungsdienst; Reparatur Sonstiges
01.02.2022	15.764	Regelwartungsdienst