



Expertise

Protocol number: 46440076  
Order No. / Reference: 26694795  
Inspection date: 10 Jul 2026

Manufacturer: Volvo

Model: XC90 T8 AWD Plug-in Hybrid Core

VIN: YV1LFH7V8S1319827



| Vehicle details                         |                       |
|-----------------------------------------|-----------------------|
| Manufacturer / Type / Model / Equipment |                       |
| Volvo XC90 T8 AWD Plug-in Hybrid Core   |                       |
| Vehicle Identification number           | YV1LFH7V8S1319827     |
| Mileage (Read)                          | 32,563 km             |
| First registration                      | 17 Oct 2024           |
| Number of holders                       | 1                     |
| Next periodical technical inspection    | 10/2027               |
| (Report not on hand)                    |                       |
| Power / Engine displacement             | 228 kw / 1,969 ccm    |
| Fuel type / Cylinder                    | Hybr.B/E ext.aufl / 4 |
| Gearbox / Number of gears               | Automatic / 8         |
| Type of drive                           | All-wheel drive       |
| Type of vehicle                         | SUV                   |
| Colour / colour code                    | Vapour Grey           |
| Doors / Seats                           | 5 / 7                 |
| Upholstery type                         | Leather               |
| Colour of upholstery                    | Anthracite-Black      |
| Vehicle with smoke odor                 | no                    |



## Vehicle details

|                                                  |                               |                                |                                                            |
|--------------------------------------------------|-------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | Non-existent                  | <b>Next maintenance in</b>     | 95 Tag(e)                                                  |
| <b>Key is / should be</b>                        | 2 / 2                         | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                               | <b>Letter No.</b>              | HE330235                                                   |
| <b>Previous damage / Accident</b>                | None detectable               | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                     | sufficient                    | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                | Not performed                 | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/ type code number</b> | 9101 / BUL 00016              |                                |                                                            |
| <b>Emission standard</b>                         | EURO6;WLTP;EA;PI/CI;M, N1, N2 | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 2,950 kg                      | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 235/55 R19 105V | Summer tyres on Light alloy | Continental  | 5mm / 5mm   |
| 2) | 235/55 R19 105V | Summer tyres on Light alloy | Continental  | 5mm / 5mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 08/2028 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment



## Standard equipment

- ABS - Anti-lock Braking System
- Front passenger airbag can be deactivated
- Active safety belts with belt tensioners
- Android infotainment system
- Electrically folding exterior mirrors
- Electrically adjustable exterior mirrors
- Exterior mirror caps in car color
- Attachment system for carrier bags in the luggage compartment
- Fog sensor for automatic activation of the defroster function
- On-board computer
- third brake light
- Chrome applications in the front bumper
- Roof edge spoiler
- Deactivating the high-voltage battery
- Digital Instrumentation 2nd Gen.
- Driver Assistance
- Driver Awareness
- Aluminum door sill plates with Volvo lettering at the front and rear
- Electronic stability control
- Electric windows front and rear
- Chrome window surround
- Bottle holder in the luggage compartment
- Luggage compartment partition net
- Seat belt height adjustment front and rear (2nd row of seats)
- rear window wiper
- Intelligent Speed Assist
- ISOFIX mounting for the outer rear seats
- Keyless Start (electronic engine start system)
- Automatic climate control with 4-zone temperature control
- Headrests (7)
- Paint finish: Solid
- Charging box under the cargo floor
- Stainless steel loading sill protector in the luggage compartment
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Front center armrest with integrated storage compartment and cup holders
- Emergency brake lights
- Otto particulate filter
- Parking ticket holder
- Upholstery: Leather/leatherette comfort seats
- Radio accessories: Smartphone integration Apple CarPlay
- Rain sensor
- Tire pressure monitoring system
- Wheels: 19" 5-spoke alloy wheels, diamond cut/high-gloss black
- Safety Assistance
- Speed-sensitive power steering
- Seats: Third row of seats (7-seater)
- Acoustic Vehicle Alerting System (AVAS)
- Airbags
- All-wheel drive (AWD)
- Armrests with integrated storage compartment and cup holders for the 3rd row of seats (left and right)
- Heated exterior mirrors and rear window (automatic)
- Outdoor temperature display
- Hill Descent Control (HDC)
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- Brake energy recuperation
- Chrome applications on the rear of the vehicle
- Chrome trim strip in the door sill area
- Aluminum roof rails (integrated)
- Digital Services
- Drive Mode (driving mode settings for engine, transmission, steering and brakes)
- Front and rear parking sensors with automatic braking intervention (rear)
- Electronic differential lock
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Automatic emergency braking
- Front grille in waterfall design in chrome
- Transmission: 8-speed automatic transmission
- Automatic tailgate (electric)
- Heated rear window
- Interior and exterior mirrors automatically dimming
- Intelligent driver information system
- Keyless Drive (electronic access system)
- Child safety lock for the rear doors (electric)
- Air conditioning for the 3rd row of seats
- Headrests of the 2nd row of seats can be folded down (electrically)
- Charging cable Schuko/Type 2 (Mode 2)
- Cargo area roller blind (semi-automatic)
- LED headlights "Thor's Hammer"
- Steering wheel: Steering wheel heating
- Illuminated makeup mirror for driver and front passenger
- Model emblem on the rear of the vehicle
- Engine emblem on the rear of the vehicle
- One Pedal Drive
- Electric parking brake
- Pollen filter
- Radio: High Performance Sound audio system
- Radio accessories: Two USB-C ports on the back of the center console
- Run-off Road Protection
- Wheels: Tire sealant
- Rear view camera



- Seats: Driver and front passenger seats are height-adjustable (electrically)
- Seats: Rear bench seat of the 2nd row in a 40/20/40 ratio or completely foldable
- Auxiliary heater with timer (electrically operated)
- Power socket
- Textile floor mats for the 3rd row of seats
- Textile floor mats front and rear
- Glazing: Colored glazing
- Volvo On Call
- Warning tone/indicator when seat belts are not fastened (for all seats)

- Whiplash Protection System (WHIPS)
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Child seat integrated in the middle rear seat (2nd row).
- Seats: Heated rear seats (outer seats of the 2nd row)
- Seats: Heated front seats
- Start/Stop technology
- Phone: Inductive smartphone charging system (Qi standard)
- First aid kit and warning triangle
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- Immobiliser
- Central locking system with two remote controls and integrated emergency keys

### Extra equipment

- Package: Lighting Package (Headlight cleaning system - Full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assist with adaptive headlight range control and integrated LED daytime running lights - Ambient lighting Extended: Ambient lighting front/rear Exit lights front/rear Illuminated door pockets - openers front/rear Footwell lighting rear Reading lights rear Work light on the tailgate)
- Glazing: Side and rear windows tinted (from the B-pillar back)
- Towbar (semi-electric)
- Windscreen, heater

### Retrofitted equipment

- Rear mud flaps
- Front mud flaps

## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |

## Value reducing factors

| No. | Component group | Description                              |
|-----|-----------------|------------------------------------------|
| 1   | Rear bumper     | Rear bumper - Scratch(es) - Smart repair |

## Wear and tear

| No. | Component group             | Description                                              |
|-----|-----------------------------|----------------------------------------------------------|
| 1   | Trim / covers               | Door trim - rear right side - Scratch(es) - No deduction |
| 2   | Rear bumper                 | Spoiler - Scratch(es) - No deduction                     |
| 3   | Side panel - rear left side | Side panel - Scratch(es) - No deduction                  |

The vehicle shows signs of wear and tear commensurate with its age and use.



## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

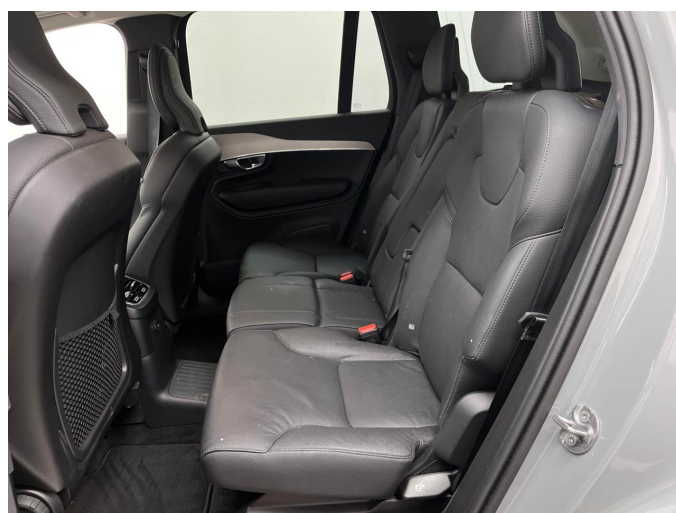


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

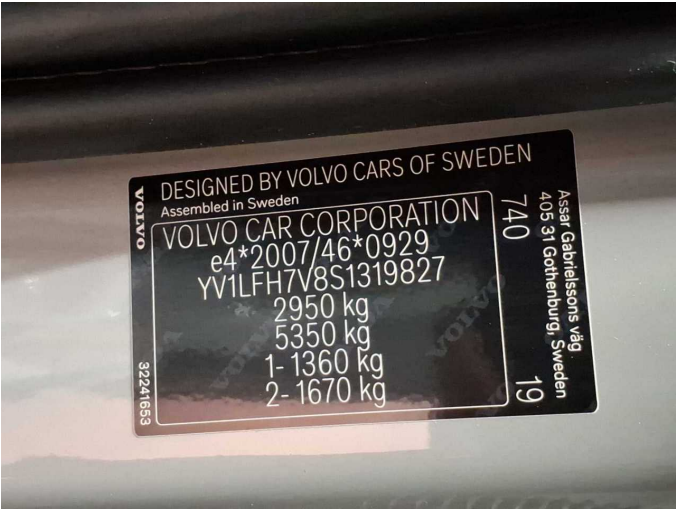


Figure 11: VIN



Figure 12: Mounted tyres

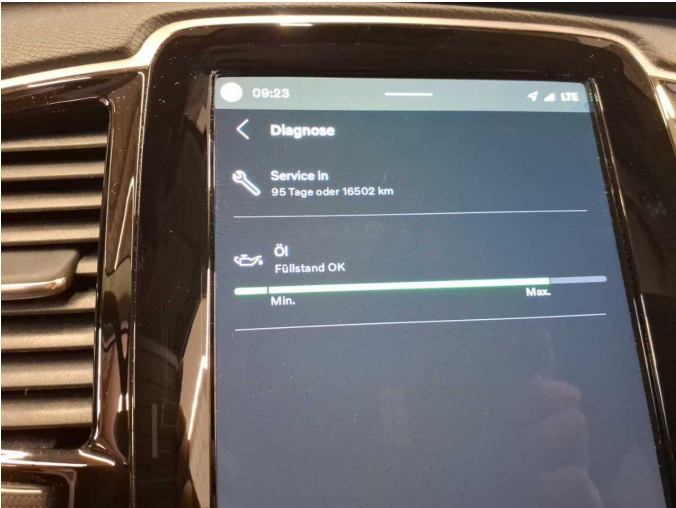


Figure 13: Documents



Figure 14: Documents

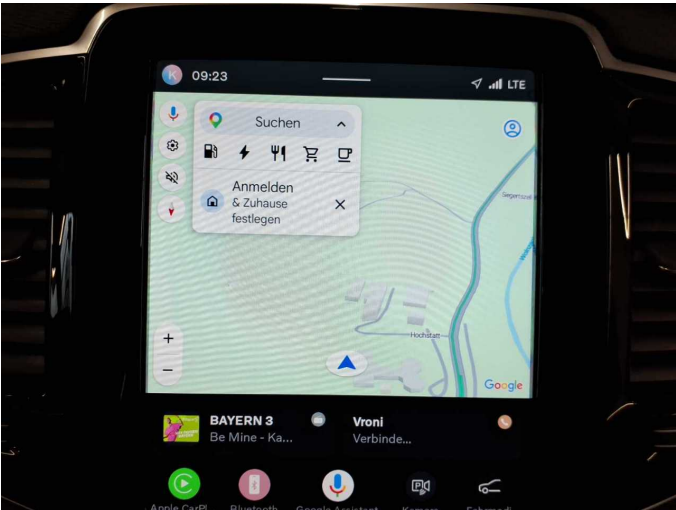


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 1: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Wear and tear 1: Trim / covers: Door trim - rear right side - Scratch(es) - No deduction




Wear and tear 1: Trim / covers: Door trim - rear right side - Scratch(es) - No deduction




**Wear and tear 2:** Rear bumper: Spoiler - Scratch(es) - No deduction



**Wear and tear 2:** Rear bumper: Spoiler - Scratch(es) - No deduction

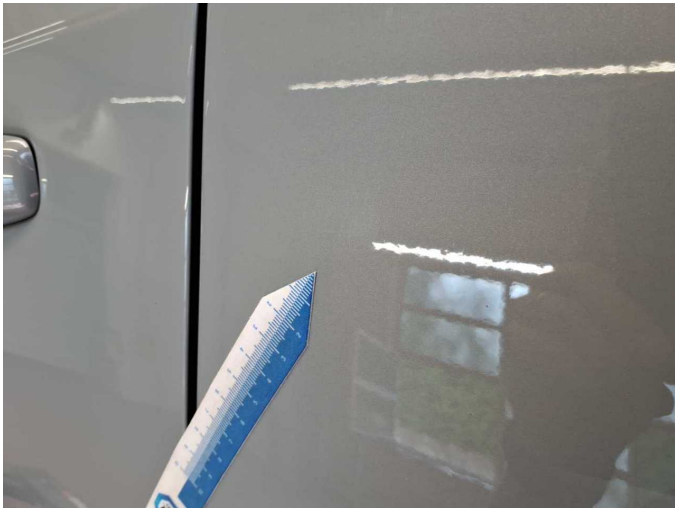

**Wear and tear 3:** Side panel - rear left side: Side panel - Scratch(es) - No deduction

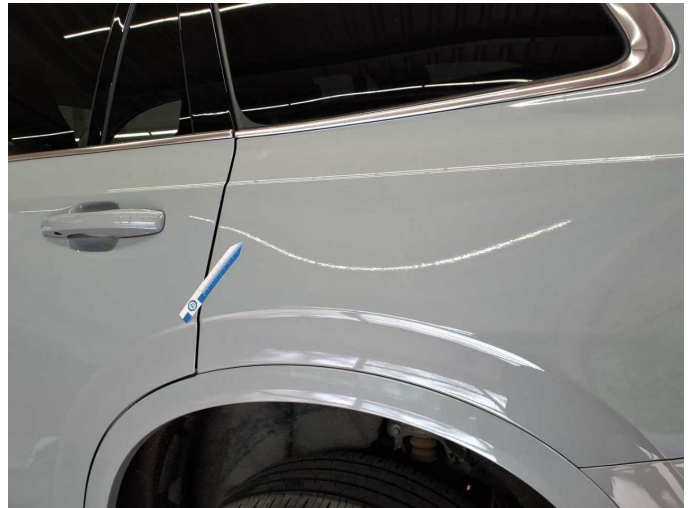

**Wear and tear 3:** Side panel - rear left side: Side panel - Scratch(es) - No deduction