



Expertise

Protocol number: 46606791
Order No. / Reference: 26669376
Inspection date: 20 Jul 2026

Manufacturer: Mercedes-Benz

Model: C 220 T d 9G-TRONIC AMG Line

VIN: W1K2062161F028508



Vehicle details

Manufacturer / Type / Model / Equipment

Mercedes-Benz C 220 T d 9G-TRONIC AMG Line

Vehicle Identification number W1K2062161F028508
Mileage (Read) 98,321 km
First registration 23 Nov 2021
Number of holders 1
Next periodical technical inspection 12/2026
(Report not on hand)

Fuel type Hybrid Diesel / E
Engine displacement / Cylinder 1,993 ccm / 4
Power 147 kW
Gearbox / Number of gears Automatic / 9
Type of drive Rear drive
Type of vehicle Station wagon

Colour / colour code Schwarz
Doors / Seats 5 / 5
Upholstery type Cloth / leather combination
Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	187 Tag(e)
Last service on / at	01/2026 at 87,797 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF743625
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AYH 00003		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,400 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	245/40 R18 97Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	225/45 R18 95H	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Center airbag
- Airbag: Windowbag for driver and front passenger
- AMG floor mats
- Basic services
- Brake system with larger brake discs on the front axle
- black roof rails
- Double cup holder at the front
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Transmission: 9-speed automatic, 9G-TRONIC
- Heated rear window
- Instrument panel and door sills in ARTICO man-made leather in black nappa look
- Mechanical child safety lock for the rear doors
- Rear headrests (3)
- Paint finish: Solid
- LED High Performance Headlights
- Mercedes-Benz emergency call system
- Center console in high-gloss black
- Package: Interior lighting package
- Radio: Extended MBUX functions
- Radio accessories: Digital radio (DAB)
- Radio accessories: Central display
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Lane Keeping Assist, active
- High-visibility vest for drivers
- Central locking with remote control
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Ambient lighting with 64 light colors
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Brake assist, active
- Diesel particulate filter
- DYNAMIC SELECT
- ECO start/stop function
- Chassis: Sport chassis with sport direct steering
- Speed Limit Assistant
- rear window wiper
- Black fabric headliner
- ISOFIX child seat attachment with top tether in the rear
- KEYLESS-GO start function
- THERMATIC automatic climate control with 1 climate zone
- Front headrests
- Cargo area cover including EASY-PACK safety net
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Package: Storage
- Upholstery: ARTICO leatherette/DINAMICA microfiber
- Radio: MBUX
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Remote Services Plus
- Seats: Rear seat backrests foldable
- Cruise control
- Electronic immobilizer
- Decorative elements, metal structure



Extra equipment

- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- Package: Business (for Avantgarde Exterior (P15) or AMG Line Exterior (P31)) (Mirror Package: Electrically folding exterior mirrors with automatic dimming function, ambient lighting with Mercedes-Benz logo projection - Advanced Comfort Package: Heated seats for driver and front passenger, 4-way lumbar support, Seat Comfort Package - Parking Package: Parking package with reversing camera - Infotainment Package: MBUX Navigation Premium, Traffic Sign Assist, Smartphone Integration, Wireless charging system for mobile devices - USB Package - Larger fuel tank)
- Package: Night (for T-Model with AMG Line exterior) (Radiator grille: diamond grille with silver pins and high-gloss black louvre (18") AMG light-alloy wheels in 5-spoke design, aerodynamically optimized, black-painted, high-sheen finish, with front axle 225/45 R18 on 7.5Jx18 ET40, rear axle 245/40 R18 on 8Jx18 ET52 AMG front apron with high-gloss black wing trim. Rear bumper with high-gloss black wing trim. Belt trim strip and window surrounds in high-gloss black. Exterior mirror housings in high-gloss black. Heat-insulating dark-tinted rear glass (from the B-pillar). Roof rails in black.)
- Package: USB (2 USB-C ports under the front center armrest, suitable for data transfer)
- Wheels: 45.7 cm (18") AMG light-alloy wheels in 5-spoke design (aerodynamically optimized, painted black and high-sheen finish with front axle 225/45 R 18 on 7.5 J x 18 ET 40, rear axle 245/40 R 18 on 8.5 J x 18 ET 52)
- Wheels: Complete winter wheel sets fitted at the factory
- Type designation removed from trunk lid
- Interior headliner fabric crystal grey
- Package: Advanced Comfort Package (Heated seats for driver and front passenger - Seat Comfort Package: - Numerous electric and manual adjustment options for the front seats to adapt to the specific body and comfort requirements of the driver and front passenger - Electro-pneumatic 4-way lumbar support and lateral support adjustment with control element on the seat - Electric seat cushion tilt adjustment - Electric height adjustment - Electric backrest adjustment - Electric seat cushion depth adjustment - Mechanical longitudinal adjustment - Mechanical headrest adjustment)
- Package: Infotainment package (MBUX Navigation Premium (hard drive navigation, pre-installation for Live Traffic Information), traffic sign assistant, smartphone integration (connects the mobile phone wirelessly to the multimedia system via Apple CarPlay and Android Auto), wireless charging system for mobile devices in the front)
- Package: Parking (12 ultrasonic sensors - reversing camera - Active Parking Assist with PARKTRONIC: detects free parking spaces, assisted parking, visual and acoustic warning, display of camera and ultrasonic data in the media display - Cross traffic warning: can provide visual and acoustic warnings when reversing out of a parking space and, if necessary, automatically initiate emergency braking - Reverse maneuvering brake: can trigger a braking process - Drive-away assist)
- Wheels: Winter complete set of wheels M+S 4x 45.7 cm (18") multi-spoke alloy wheels (black painted and polished with 225/45 R 18 on 7.5 J x 18 ET 40)
- Seats: Sports seats
- Heat-insulating dark tinted glass

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Smart repair
2	Side panel - rear left side	Side panel - Scratched - Smart repair
3	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
4	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
5	Wheel / tyres	Tyre - front - Broken / torn - Replace
6	2nd wheel set	1 alloy rim - Scratched - Loss in value
7	Wheel / tyres	Alloy rim - front left side - Scratched - Loss in value
8	2nd wheel set	1 alloy rim (Materialabtrag) - Scratched - Loss in value
9	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Scratched - Loss in value
10	2nd wheel set	Tyres - complete set - Broken / torn - Replace
11	Door - rear left side	Door - Scratched - Paint
12	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
13	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
14	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
15	Bonnet	Bonnet - Scratched - Paint
16	2nd wheel set	1 alloy rim - Scratched - Replace
17	Side panel - rear right side	Side panel - Dent / paintcoat damage - Paint
18	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratched - No deduction
2	Mudguard - left side	Mudguard - left side - Stone chips - No deduction
3	Wing mirror - right side	Cap - Scratch(es) - No deduction
4	Roof	Roof rail - right side - Stone chips - Smart repair

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

2nd wheel set - Wheel cover set - complete (Nabendeckel)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer	1.273,51 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

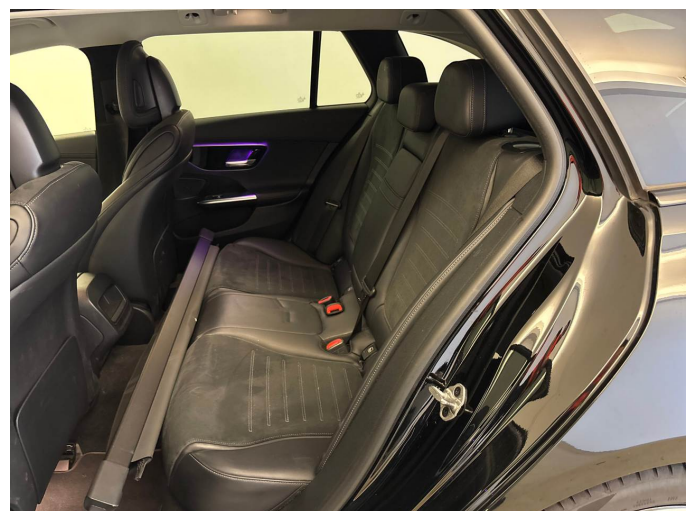


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

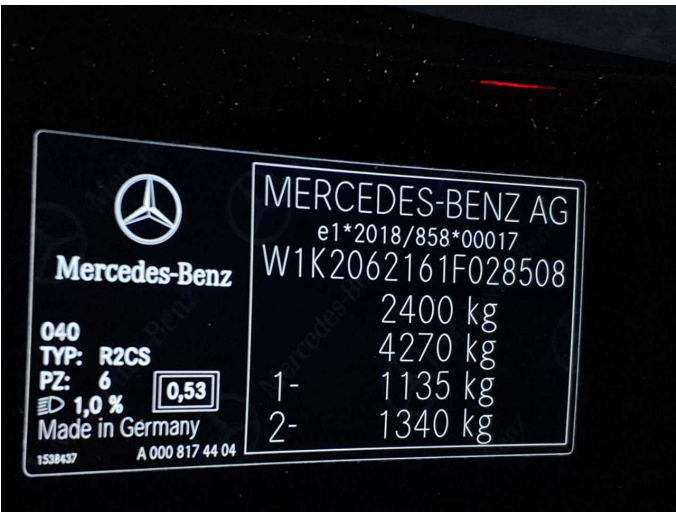


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation

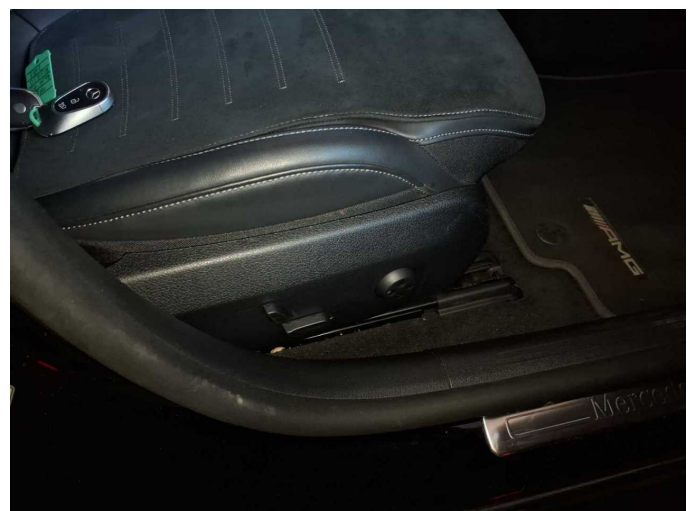


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

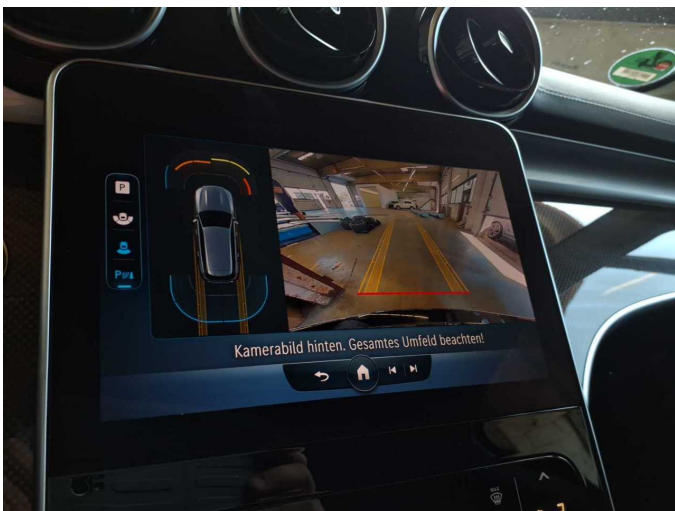


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Damage 1: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 1: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 1: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair

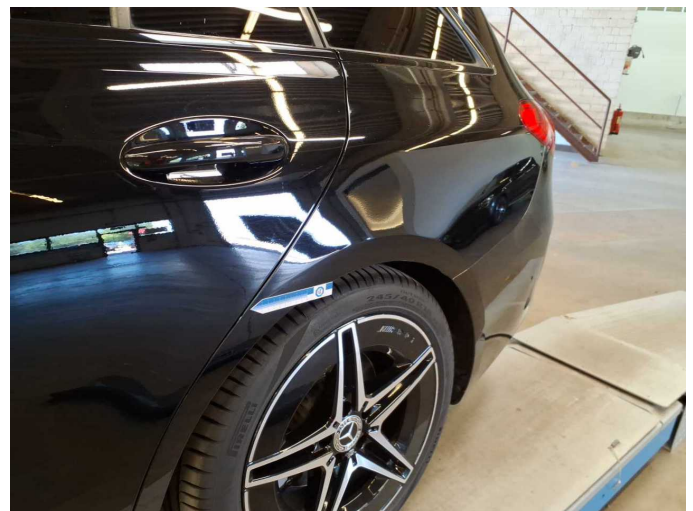

Damage 2: Side panel - rear left side: Side panel - Scratched - Smart repair



Damage 2: Side panel - rear left side: Side panel - Scratched - Smart repair




Damage 3: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 3: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 3: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

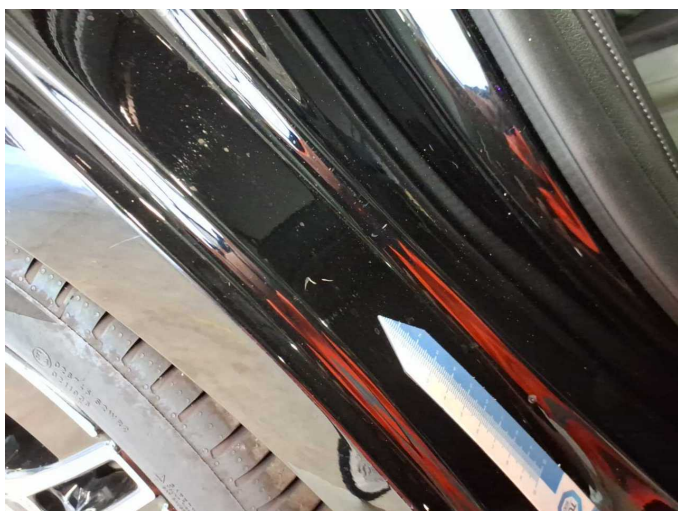

Damage 4: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

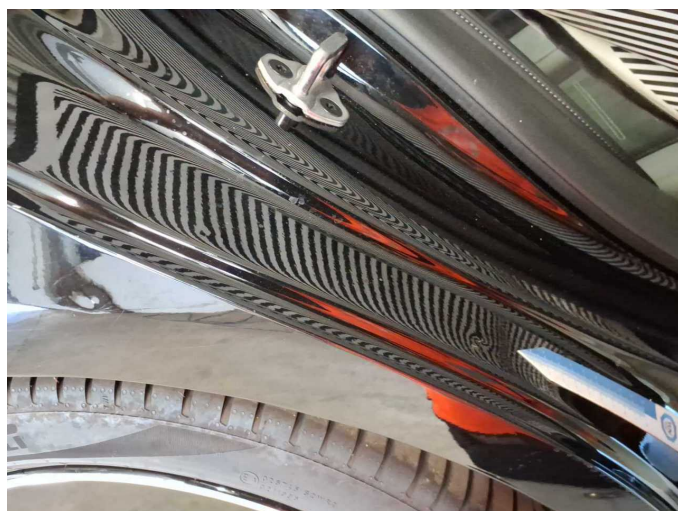

Damage 4: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Wheel / tyres: Tyre - front - Broken / torn - Replace




Damage 5: Wheel / tyres: Tyre - front - Broken / torn - Replace



Damage 5: Wheel / tyres: Tyre - front - Broken / torn - Replace



Damage 5: Wheel / tyres: Tyre - front - Broken / torn - Replace

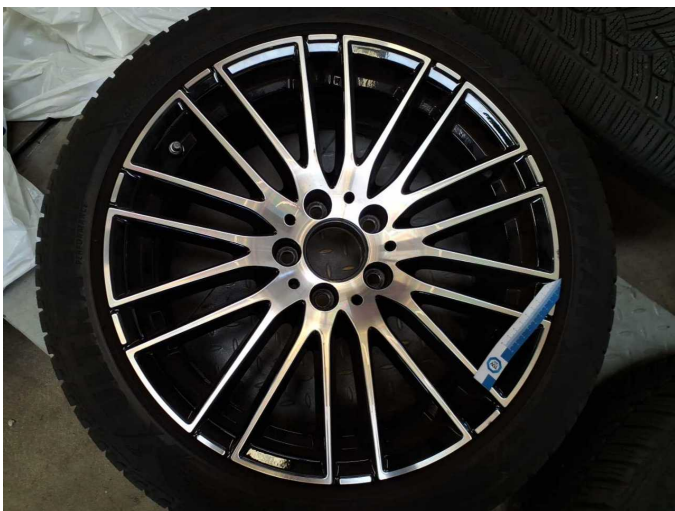

Damage 6: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 6: 2nd wheel set: 1 alloy rim - Scratched - Loss in value




Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value

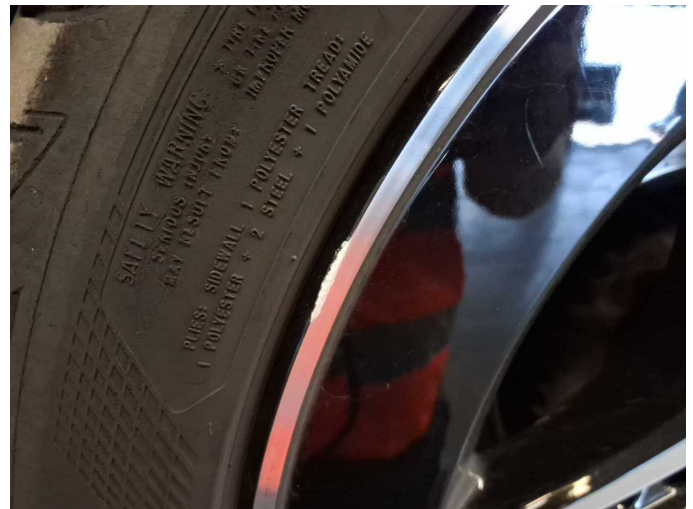

Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 8: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Loss in value



Damage 8: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Loss in value



Damage 8: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Loss in value



Damage 9: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Loss in value



Damage 9: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Loss in value



Damage 9: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Loss in value



Damage 9: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Loss in value



Damage 10: 2nd wheel set: Tyres - complete set - Broken / torn - Replace



Damage 10: 2nd wheel set: Tyres - complete set - Broken / torn - Replace



Damage 10: 2nd wheel set: Tyres - complete set - Broken / torn - Replace



Damage 10: 2nd wheel set: Tyres - complete set - Broken / torn - Replace



Damage 10: 2nd wheel set: Tyres - complete set - Broken / torn - Replace



Damage 10: 2nd wheel set: Tyres - complete set - Broken / torn - Replace



Damage 10: 2nd wheel set: Tyres - complete set - Broken / torn - Replace



Damage 10: 2nd wheel set: Tyres - complete set - Broken / torn - Replace



Damage 10: 2nd wheel set: Tyres - complete set - Broken / torn - Replace




Damage 11: Door - rear left side: Door - Scratched - Paint



Damage 11: Door - rear left side: Door - Scratched - Paint




Damage 11: Door - rear left side: Door - Scratched - Paint

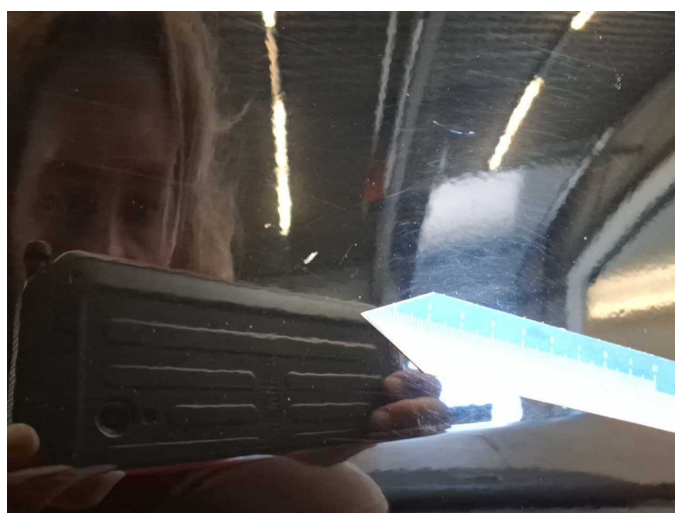

Damage 11: Door - rear left side: Door - Scratched - Paint



Damage 12: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

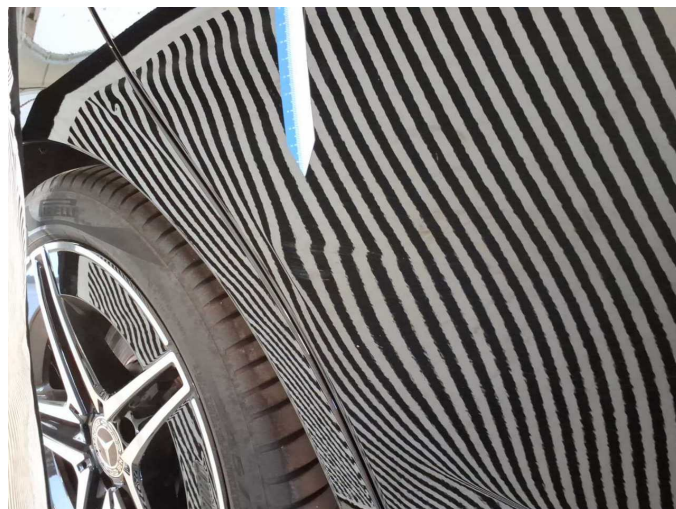


Damage 12: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 12: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 12: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

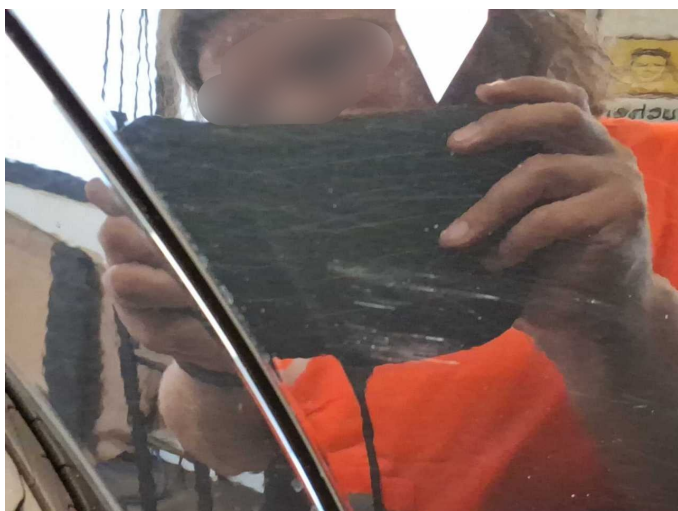

Damage 12: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 13: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 13: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 13: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 14: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 14: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

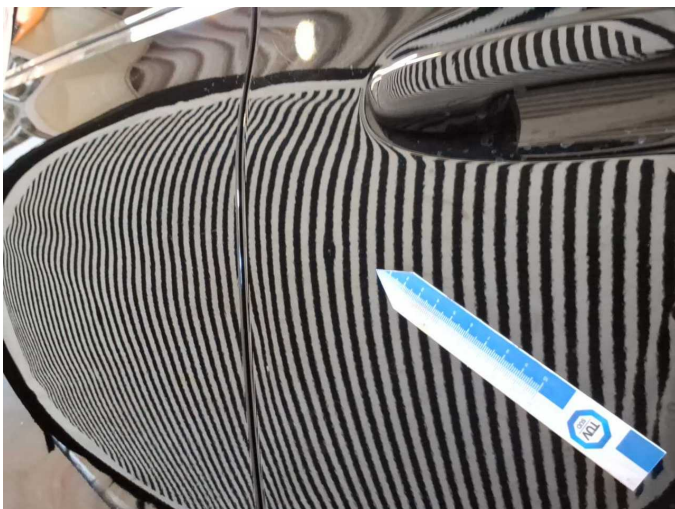


Damage 14: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 14: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 15: Bonnet: Bonnet - Scratched - Paint

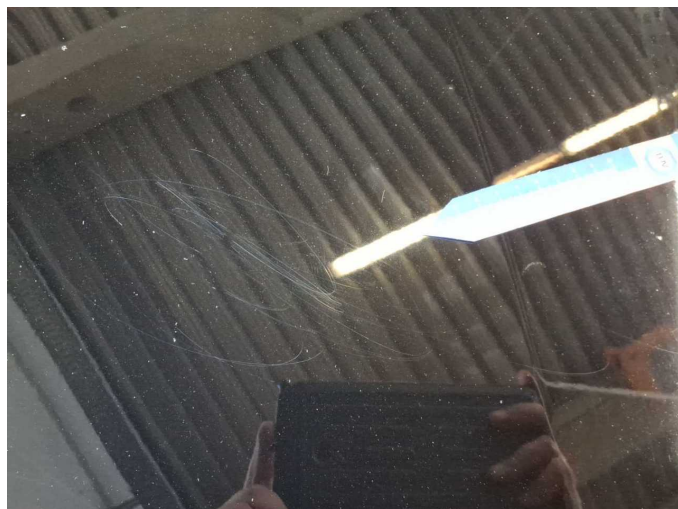


Damage 15: Bonnet: Bonnet - Scratched - Paint

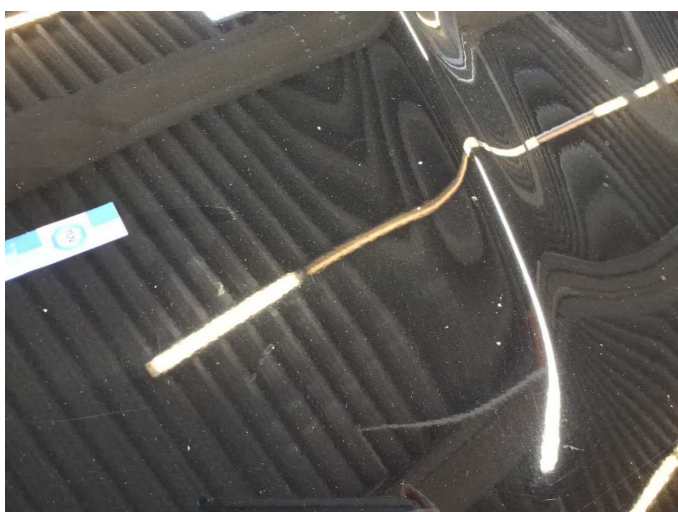

Damage 15: Bonnet: Bonnet - Scratched - Paint



Damage 15: Bonnet: Bonnet - Scratched - Paint

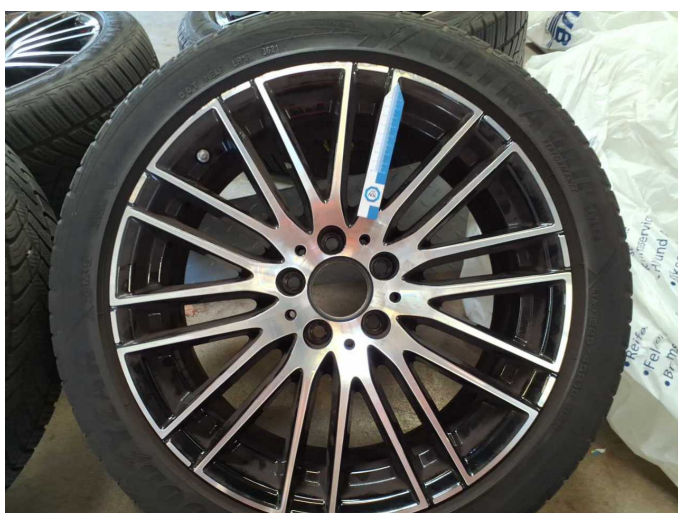


Damage 16: 2nd wheel set: 1 alloy rim - Scratched - Replace




Damage 16: 2nd wheel set: 1 alloy rim - Scratched - Replace




Damage 16: 2nd wheel set: 1 alloy rim - Scratched - Replace

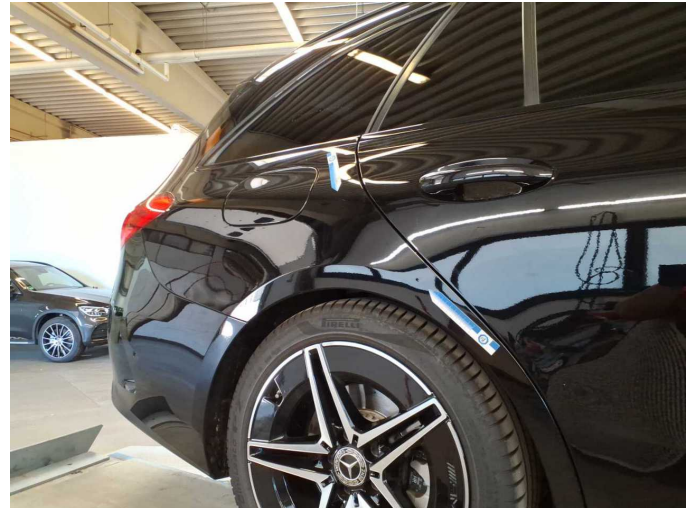

Damage 17: Side panel - rear right side: Side panel - Dent / paintcoat damage - Paint

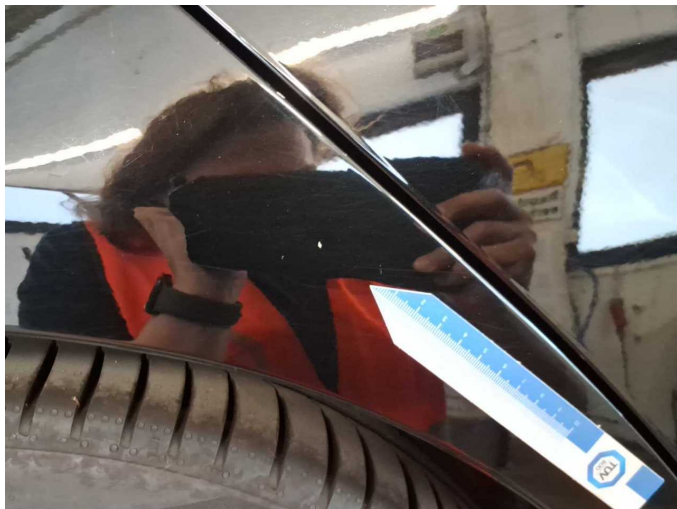


Damage 17: Side panel - rear right side: Side panel - Dent / paintcoat damage - Paint

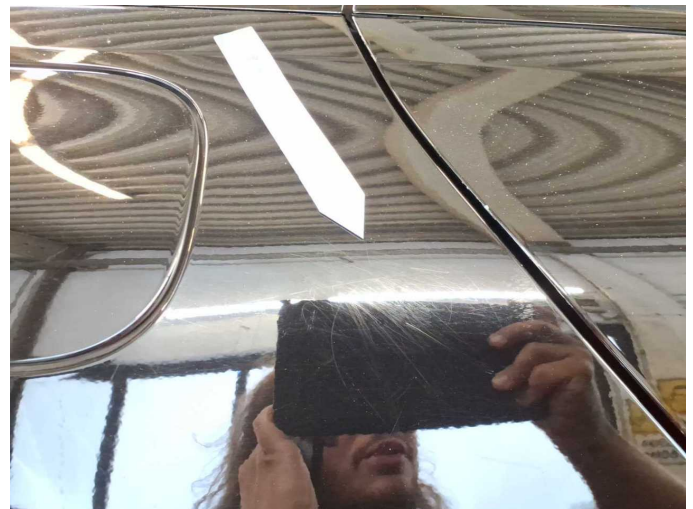

Damage 17: Side panel - rear right side: Side panel - Dent / paintcoat damage - Paint



Damage 17: Side panel - rear right side: Side panel - Dent / paintcoat damage - Paint

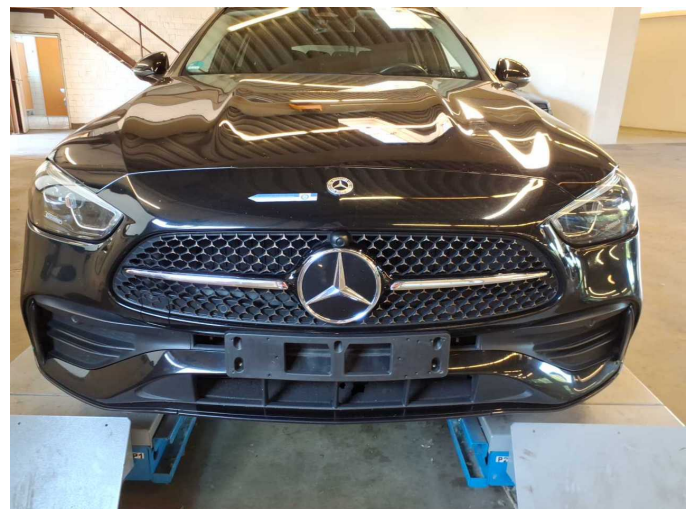


Damage 18: Front bumper: Front bumper - Scratched - Paint



Damage 18: Front bumper: Front bumper - Scratched - Paint




Damage 18: Front bumper: Front bumper - Scratched - Paint

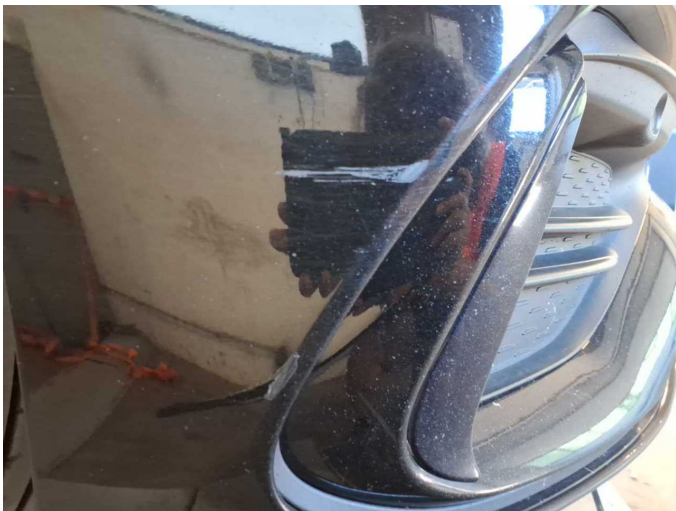

Damage 18: Front bumper: Front bumper - Scratched - Paint



Damage 18: Front bumper: Front bumper - Scratched - Paint

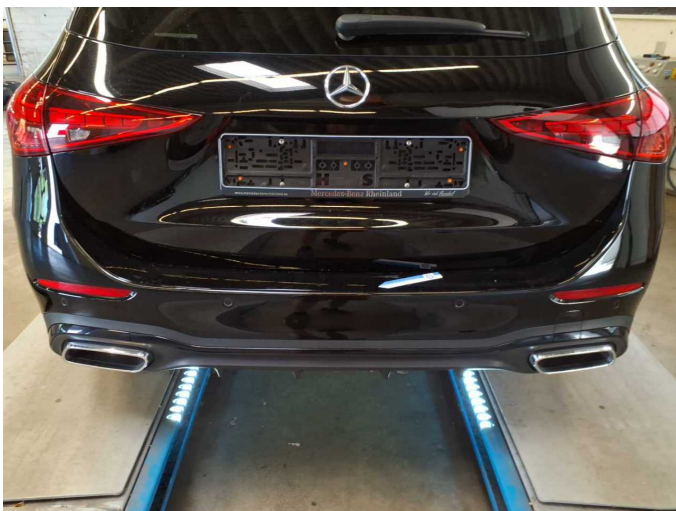


Wear and tear 1: Rear bumper: Rear bumper - Scratched - No deduction



Wear and tear 1: Rear bumper: Rear bumper - Scratched - No deduction



Wear and tear 2: Mudguard - left side: Mudguard - left side - Stone chips
- No deduction

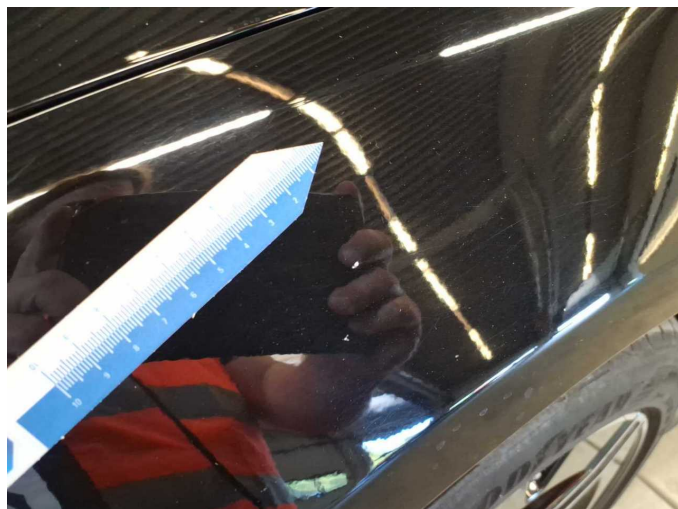


Wear and tear 2: Mudguard - left side: Mudguard - left side - Stone chips
- No deduction




Wear and tear 3: Wing mirror - right side: Cap - Scratch(es) - No deduction



Wear and tear 3: Wing mirror - right side: Cap - Scratch(es) - No deduction

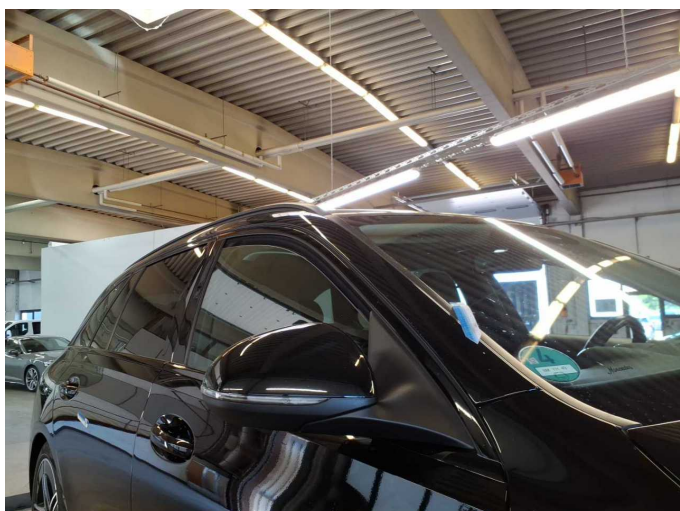

Wear and tear 4: Roof: Roof rail - right side - Stone chips - Smart repair

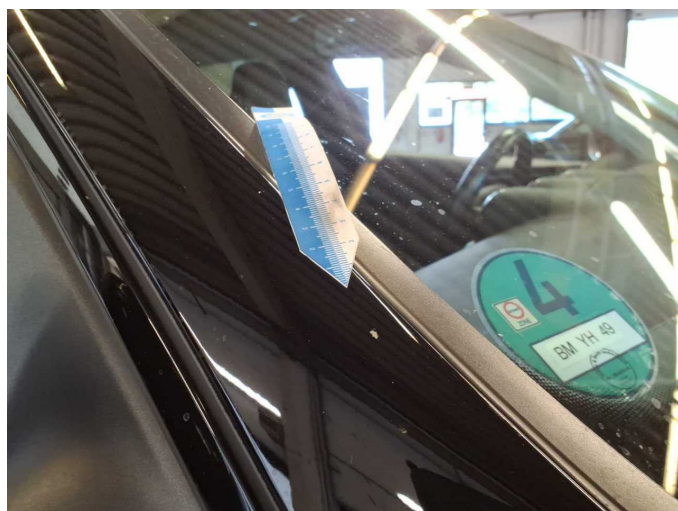

Wear and tear 4: Roof: Roof rail - right side - Stone chips - Smart repair



Wear and tear 4: Roof: Roof rail - right side - Stone chips - Smart repair



Missing part 1: 2nd wheel set: Wheel cover set - complete (Nabendeckel) - Missing - Replace



Missing part 1: 2nd wheel set: Wheel cover set - complete (Nabendeckel) - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K2062161F028508

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ C 220 T d 9G-TRONIC
AMG Line

Datum	KM-Stand	Beschreibung
13.01.2026	87.797	Regelwartungsdienst
19.12.2024	63.782	Bremsklötze vorne; HU + AU; Regelwartungsdienst
19.12.2023	42.798	Regelwartungsdienst
30.11.2022	18.535	Regelwartungsdienst