



Expertise

Protocol number: 46406680
Order No. / Reference: 26550242
Inspection date: 8 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLC-Coupe 300 de 4Matic 9G-TRONIC

VIN: W1N2533111G005224



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC-Coupe 300 de 4Matic 9G-TRONIC	
Vehicle Identification number	W1N2533111G005224
Mileage (Read)	129,027 km
First registration	12 Oct 2021
Number of holders	1
Next periodical technical inspection	11/2026
(Report on hand)	
Power / Engine displacement	143 kw / 1,950 ccm
Fuel type / Cylinder	Hybr.D/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	Coupe
Colour / colour code	SCHWARZ - UNILACK
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	34 Tag(e)
Last service on / at	08/2025 at 106,296 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF709708
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ASU 00037		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,660 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/60 R18 103V	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (illuminated storage compartment with 12V socket in center console, foldable armrest for driver and front passenger, illuminated and lockable glove compartment)
- Airbag: Windowbags
- Acoustic environmental protection (To ensure that your vehicle does not become a danger to pedestrians and cyclists even when driving purely electrically and almost silently, the acoustic environmental protection generates a Mercedes-Benz specific sound outside the vehicle up to a speed of 30 km/h.)
- Anti-lock braking system (ABS)
- Automatic passenger airbag deactivation
- Heated exterior mirrors on the left and right, electrically adjustable from the inside (with aspherically curved mirror glass and integrated turn signal light)
- Diesel particulate filter
- Tachometer
- Third brake light in LED technology
- EASY-Pack tailgate with electric operation for opening and closing
- Driving light assistant
- electric parking brake
- Velour floor mats in interior color
- Heated rear window (with timer)
- KEYLESS-GO start function
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display
- Communication module (LTE) for using Mercedes me connect services (The communication module (LTE) offers you a clear increase in comfort and safety. It constantly connects the vehicle to the internet – so that you can use helpful services such as the Live Traffic Information from Mercedes me connect. Two mobile antennas and an LTE-enabled SIM card ensure a fast connection.)
- Charging cable for household socket, 5m, smooth (This charging cable, also called Mode 2 cable, allows you to charge the vehicle battery at the household socket with up to 2.3 kW (230 V, 1-phase, 10 A) and fits sockets of type E/F CEE 7/7.)
- Steering column mechanically adjustable in height and length
- Navigation accessories: Extended MBUX functions (personalization (profiles) and prediction functions - LINGUATRONIC with natural language understanding - activation via "Hey Mercedes" - Wi-Fi hotspot - internet radio)
- Package: Interior lighting (More light, more atmosphere, better orientation: The interior lighting package provides more comprehensive direct and indirect lighting. The additional light elements create a pleasant atmosphere and make operation easier.)
- Upholstery: ARTICO man-made leather
- Radio accessories: Digital radio
- Airbag for driver and front passenger
- Airbag: Kneebag for driver
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Brake Assist (can help avoid rear-end collisions with vehicles ahead, whether moving or stationary, as well as collisions with moving pedestrians and cyclists. In addition to distance and collision warnings, it primarily offers brake boosting – up to and including autonomous emergency braking.)
- 4MATIC all-wheel drive
- ATTENTION ASSIST (can detect typical signs of fatigue through driver behavior and warn the driver of increasing fatigue or inattentiveness)
- On-board computer
- Brake system with larger brake discs on the front axle (drilled front brake discs and front brake calipers with Mercedes-Benz lettering).
- DYNAMIC SELECT
- EASY-Pack cargo cover (removable)
- Electronic Stability Program (ESP)
- Electric window regulator, 4-way (with comfort operation and anti-pinch protection)
- Transmission: 9G-TRONIC
- Black fabric headliner
- Climate: THERMATIC automatic climate control with 2 climate zones (The THERMATIC automatic climate control with 2 climate zones offers individual climate comfort in the front seats: driver and front passenger can set the temperature separately for their side. Thanks to the automatic climate control and the sensitive sensor system, this is kept constant without any manual adjustments.)
- Headrests adjustable in 5 ways (4-way for driver and front passenger, and 2-way in the rear)
- Paint finish: Solid
- Charging system: AC on-board charger 7.4 kW
- LED High Performance headlights (with integrated daytime running lights, LED taillights)
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black leather (with black decorative stitching and two-piece front trim in silver chrome)
- Mercedes-Benz emergency call system
- Package: Storage (map pockets on the back of the front seats - net on the load floor - folding box under the load floor - 12V socket in the load compartment on the left - two USB-C ports in the rear)
- Package: Chrome (radiator grille with integrated Mercedes star and 2 louvers in matte iridium silver with chrome inserts, optical underguard front and rear in chrome, beltline trim strip in polished aluminum, window surround in polished aluminum, exhaust system with 2 visible tailpipe trims in stainless steel, permanently integrated into the bumper)



- Radio accessories: Touchpad (integrated into the center console, including a hand rest - single and multi-finger gestures, swiping movements and zoom gestures by spreading and pinching the fingers - recognizes handwritten characters: letters, special characters and numbers - clear haptic feedback)
- Wheels: 45.7 cm (18") alloy wheels, 4-piece set in 10-spoke design (vanadium silver painted with 235/60 R18 tires, 8 J x 18 ET 38)
- Reversing camera (with dynamic guidelines on the display and dirt protection)
- Windscreen wipers with rain sensor
- Seats: Folding rear seat backrests (40/20/40 split including Easy Pack Quickfold and center armrest with double cupholder and storage compartment)
- Cruise control (Drive relaxed and fuel-efficiently, especially on longer journeys. Simply select your desired speed and your vehicle will regulate it. In addition to the cruising speed, the speed limiter helps you maintain a maximum speed. This increases road safety and protects you from expensive speeding tickets.)
- Decorative elements: Piano lacquer look in high-gloss black

Extra equipment

- Ambient lighting (Design the interior according to your personal preference or current mood. With a total of 64 colors, the ambient lighting offers almost unlimited possibilities for lighting design and has the right color for every situation. Illuminated door sills on the driver and passenger sides.)
- Package: Business (for plug-in hybrid vehicles) (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats; Public Charging Package)
- Package: High End Comfort (Seat heating for driver and front passenger, driver's seat electrically adjustable with memory function, front right seat electrically adjustable with memory function, multi-contour seat package: individually adjustable air chambers, massage effect in the lumbar region)
- Remote and Charging Services Plus
- Wheels: Complete summer wheel sets fitted at the factory
- Wheels: Winter complete wheels M+S 4-way 45.7 cm (18") light alloy wheels in 5-twin-spoke design (45.7 cm (18") light alloy wheels in 5-twin-spoke design, Himalayan grey matt painted and polished with 235/60 R 18 on 8.0 J x 18 ET 38)

- Radio accessories: Remote Online (Technical preparation for the use of Mercedes connect me services such as remote vehicle status query, vehicle tracking, etc. via smartphone)
- Tire pressure monitoring system (TPMS)
- Remote Services Plus (The Remote Services Plus package transforms mobility into a new experience, offering greater comfort and safety. Status queries provide information about the remaining range. You can remotely control certain functions and locate your vehicle. Services such as maintenance management coordinate service appointments, saving you valuable time.)
- Power steering
- Seats: i-Size child restraint system on the outer rear seats
- Seats: Front seats electrically adjustable (with electric adjustment for seat height and backrest angle, as well as mechanical adjustment for longitudinal adjustment and headrests)
- Pre-installation for roof rack systems
- High-visibility vest for drivers
- Immobiliser
- Central locking (with interior switch, automatic locking (can be deactivated) and crash sensor with emergency opening)

- Paint finish: Special paint finish, solid color
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: Advanced Park
- Package: High End Assistance (Mirror package: Electrically folding exterior mirrors, lowering right exterior mirror, automatic dimming function; Driving assistance package: Active Distance Assist DISTRONIC, Active Steering Assist, Active Brake Assist, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, PRE-SAFE PLUS)
- Package: High-end infotainment (Media display with touch controls, smartphone integration: Apple CarPlay and Android Auto, connectivity package, navigation, traffic sign assistant: thanks to intelligent linking of camera and map data, it can recognize not only speed limits, no-overtaking zones and their cancellation, but also fully digital instrument display, wireless charging system for mobile devices in the storage compartment)
- Wheels: 45.7 cm (18") alloy wheels, 4-spoke design, 5-twin-spoke design
- Heat-insulating dark tinted glass all around from the B-pillar back
- Decorative elements: black piano lacquer finish/light longitudinally brushed aluminum



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Front bumper	Spoiler - Scratch(es) - Loss in value
2	Trim / covers	Door trim - rear right side - dent(s) - Loss in value
3	Wheel / tyres	Alloy rim - rear right side - Scratched - Replace
4	Wheel / tyres	Alloy rim - front left side - Corrosion - Replace
5	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
6	Bonnet	Bonnet - Stone chips - Paint
7	Side panel - rear left side	Side panel - Scratch(es) - Paint
8	Rear bumper	Rear bumper - Scratched - Paint
9	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Door - rear right side	Door - Scratch(es) - No deduction
2	Door - front left side	Door edge - Scratch(es) - No deduction
3	Roof	Roof rail - right side - Stone chips - No deduction
4	Roof	Roof rail - left side - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
2	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side	177 µm	Door - rear left side	242 µm
-----------------------	--------	-----------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

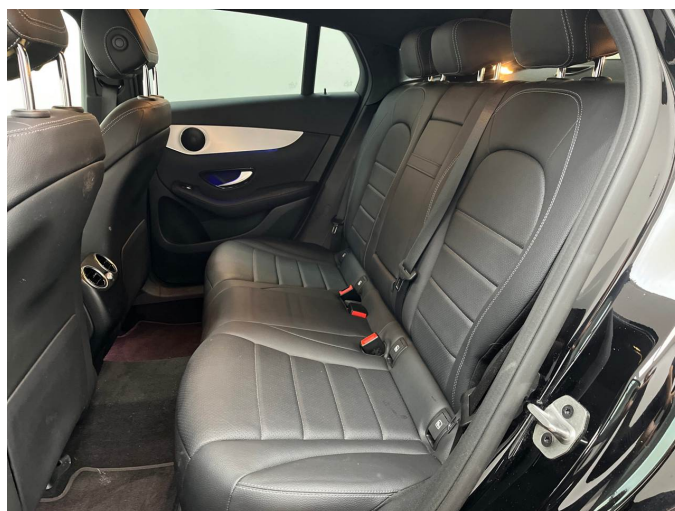


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

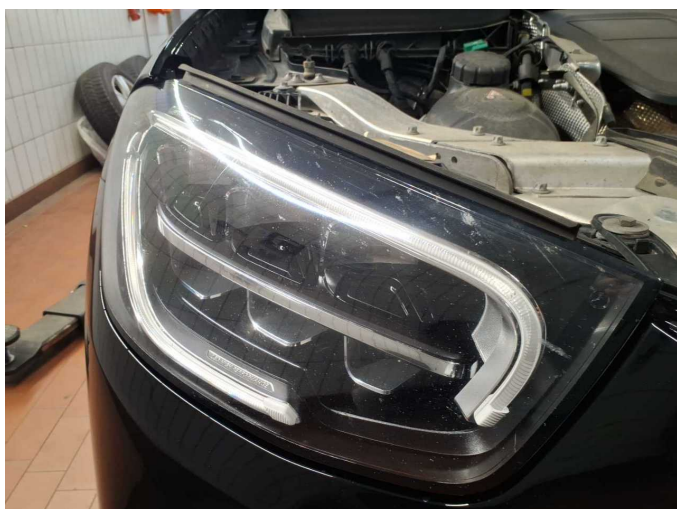


Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.




Damage 1: Front bumper: Spoiler - Scratch(es) - Loss in value

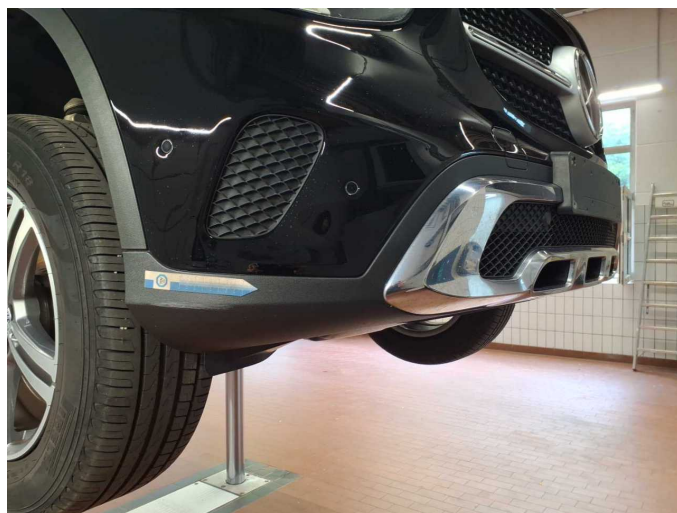

Damage 1: Front bumper: Spoiler - Scratch(es) - Loss in value



Damage 2: Trim / covers: Door trim - rear right side - dent(s) - Loss in value

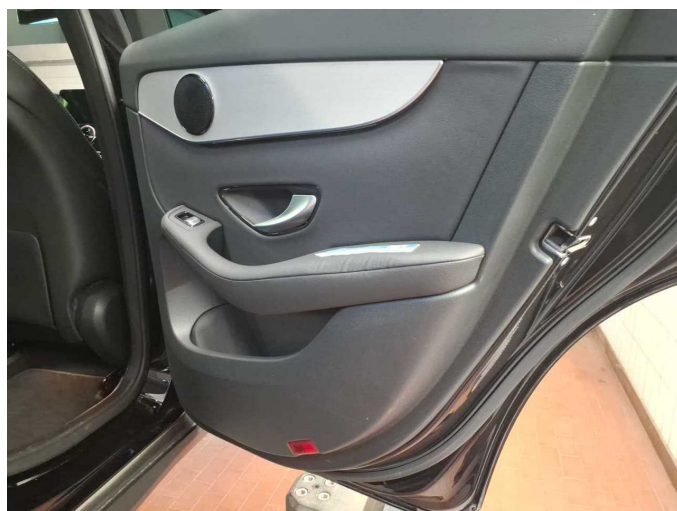


Damage 2: Trim / covers: Door trim - rear right side - dent(s) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace

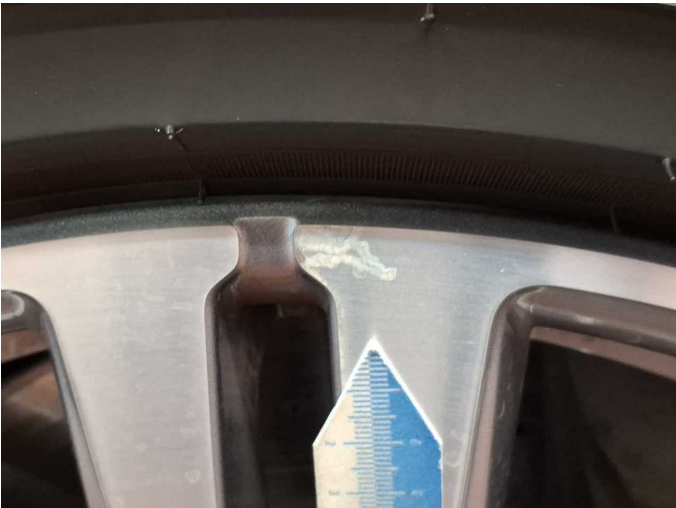


Damage 4: Wheel / tyres: Alloy rim - front left side - Corrosion - Replace



Damage 4: Wheel / tyres: Alloy rim - front left side - Corrosion - Replace



Damage 5: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

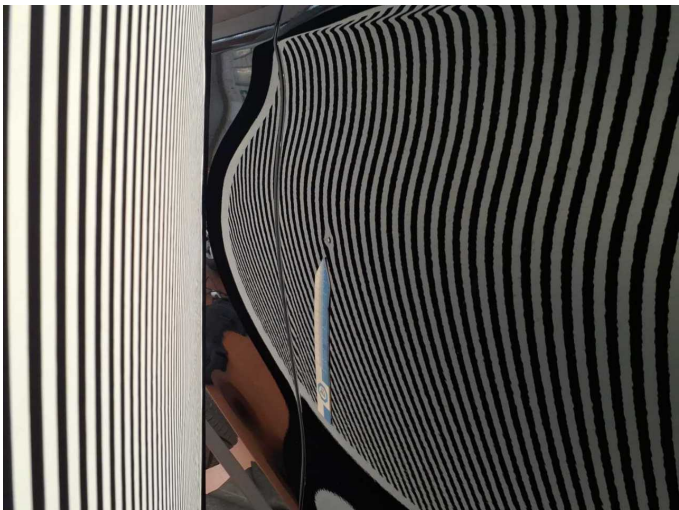


Damage 5: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 5: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 6: Bonnet: Bonnet - Stone chips - Paint

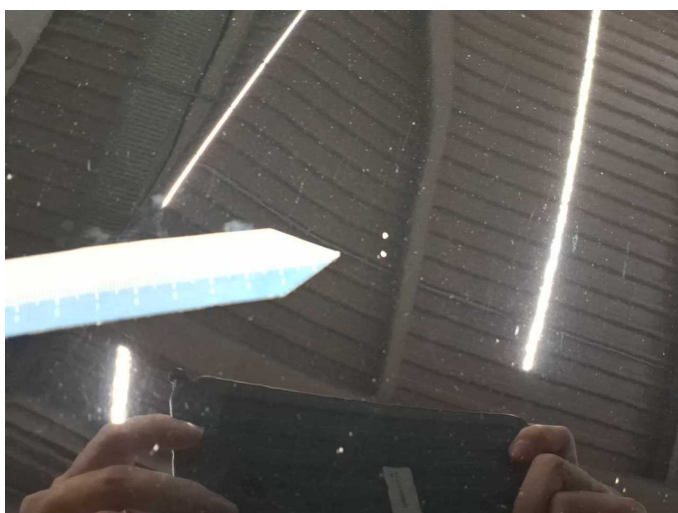


Damage 6: Bonnet: Bonnet - Stone chips - Paint

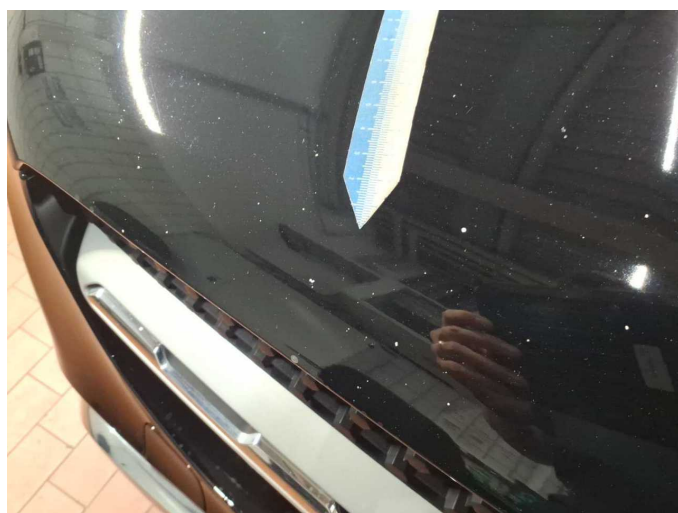

Damage 6: Bonnet: Bonnet - Stone chips - Paint



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint

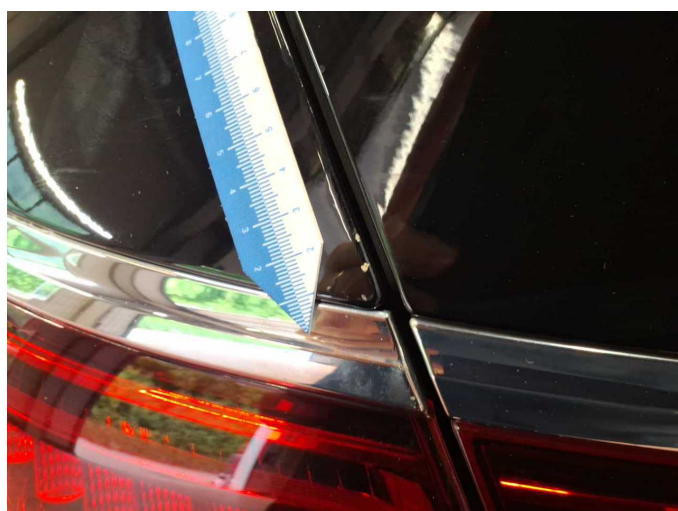

Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint




Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace

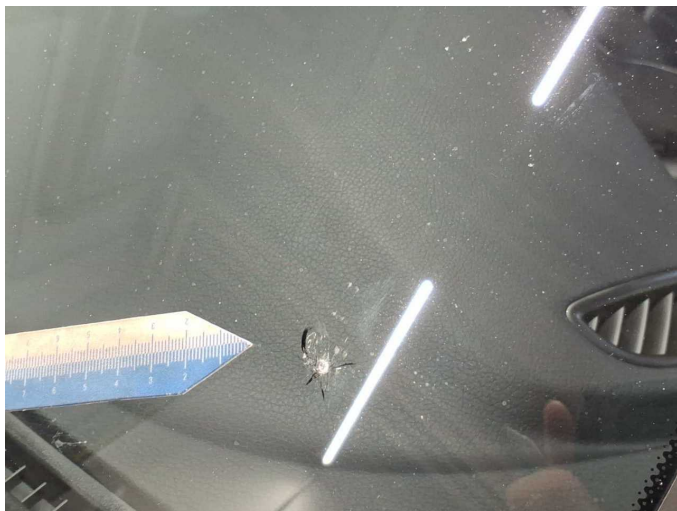

Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace



Repainting 1: Mudguard - right side



Repainting 2: Door - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2533111G005224

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLC-Coupe 300 de 4Matic
9G-TRONIC

Datum	KM-Stand	Beschreibung
11.08.2025	106.296	Regelwartungsdienst
11.07.2024	83.901	Regelwartungsdienst
09.08.2023	56.169	Regelwartungsdienst
13.09.2022	26.715	Regelwartungsdienst