



Expertise

Protocol number: 46523188
Order No. / Reference: 26656734
Inspection date: 15 Jul 2026

Manufacturer: Opel	Model: Astra 1.5 D Start/Stop Sports Tourer Automatik Elegance
VIN: W0VBE8EV7N8037882	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Astra 1.5 D Start/Stop Sports Tourer Automatik Elegance	
Vehicle Identification number	W0VBE8EV7N8037882
Mileage (Read)	160,753 km
First registration	4 Mar 2022
Number of holders	1
Next periodical technical inspection	04/2027
(Report on hand)	
Power / Engine displacement	90 kw / 1,496 ccm
Fuel type / Cylinder	Diesel / 3
Gearbox / Number of gears	Automatic / 9
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Argonsilber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	3 %
Last service on / at	01/2026 at 147,368 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ635170
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / ALM 00231		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,980 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Continental	4mm / 4mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	115/70 R16 92M	Summer tyres on Steel	Continental	2 mm
Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.				

Equipment

Standard equipment

- 2 ignition keys
- Airbag for driver and passenger side
- Airbag: Head airbags, 1st and 2nd row (outer seats)
- Ambient lighting, front doors
- Automatic activation of the hazard warning lights
- Hill Start Assist
- On-board computer
- Roof rails, silver
- Diesel particulate filter (DPF)
- Electronic Stability Program Plus (ESP Plus)
- Front camera
- Transmission: 9-speed automatic transmission
- rear window wiper
- Instruments, black, with high-gloss chrome rings, 3.5" driver information display
- Rear headrests (3)
- Cargo area cover
- LED daytime running lights
- Steering column, height and reach adjustable
- Sliding center armrest, front
- Parkpilot, rear parking aid
- Upholstery: Fabric/Premium leather look
- Radio: Digital radio reception DAB/DAB+/DMB-R
- Tire pressure monitoring system
- Power steering
- Luggage compartment safety net
- Seats: Ergonomic active seat
- 12V power outlet in the center console
- Pre-installation for child seat mounting system "ISOFIX"
- Heat-insulating glazing, green tinted, and windshield
- Storage compartments
- Airbag: Chest-pelvis side airbag for driver and front passenger side
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- third brake light
- Decorative trim strips in piano black
- Tachometer
- Electric windows front and rear
- Speed controller with limiter
- Back window, heater
- Interior lighting, front and rear
- Automatic climate control, two zones
- trunk light
- Front headrests
- LED headlights
- Light alloy wheels 7 J x 16 in a "10-spoke" design
- Lighting equipment
- Electric parking brake
- Pedals: Disengaging safety pedals
- Quickheat rapid heating system
- Radio: Multimedia radio with 7" touchscreen color display
- Rear seat backrest folds forward in a 60:40 split
- Seat belts: Three-point seat belts in all seats
- Visibility equipment
- Start/Stop System
- Traction Control (TC) Plus
- Immobiliser
- Central locking with remote control and interior switches



Extra equipment

- Fog light
- Heated windscreen, ThermoTec
- Interior equipment Sports Tourer (rear seat backrest foldable in 40:20:40 ratio - rear center armrest with pass-through from the luggage compartment - FlexFold rear seat backrest)
- Keyless locking and starting system (for driver and passenger doors as well as the luggage compartment)
- Paint finish: Metallic
- Park & Go Digital (Automatic parking assistant including parking pilot, front and rear parking aid - blind spot warning in both exterior mirrors - electrically folding exterior mirrors - digital reversing camera with steering guidelines)
- Phone: Wireless charging including 2 USB ports, rear
- Seats: Ergonomic active seat, driver and front passenger (certified by the Campaign for Healthy Backs (AGR) Driver and front passenger seat: - Length, height and tilt adjustable - Electropneumatic lumbar support adjustable in height and length - Extendable thigh support - Pocket on the back of the front seats, driver and front passenger)
- Wheels: Emergency spare wheel, steel 4Jx16
- Electric sliding/tilting sunroof (with pre-selection function and spoiler position, including anti-pinch protection, comfort closing function via remote control of the central locking system (only in conjunction with electric windows, front and rear), and manually operated sunshade)
- Package: Elegance Package (IntelliLux LED Matrix headlights - LED taillights - Multimedia Navi Pro voice control touchscreen color display multimedia radio Apple CarPlay/Android Auto Bluetooth - Solar Protect heat-insulating glazing, heavily tinted, in the rear)
- Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and front passenger (including rear footwell heating)
- Traffic sign assistant with pedestrian detection, front (detection of speed limits, no-overtaking zones and their cancellation, additional information signs (e.g., for wet conditions, slippery surfaces, left/right directions) on standard traffic signs, beginning and end of motorways, expressways and traffic-calmed areas, display of the detected sign in the driver information display (depending on traffic sign quality, visibility and weather conditions), automatic activation between 14 km/h and 200 km/h (during the day) or 150 km/h (at night))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Seat - front	Seat cover - right side - Soiled - Clean
2	Cab	Door rubber seal - left side - Damaged - Replace
3	Seat - front	armrests - Damaged - Replace
4	Trim / covers	Boot lid - interior trim - Scratched - Replace
5	Seat - front	Seat cover - left side - Damaged - Replace

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 29 Mar 2022	1.844,74 €
2	Front, Rear, Provided by user / customer, from 7 Oct 2024	5.586,97 €
3	Roof, Front, Rear, Provided by user / customer, from 21 Jun 2024	8.333,54 €

Repainting

No.	Repainting
1	Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof	196 µm	Mudguard - left side	180 µm
Bonnet	209 µm	Side panel - rear left side	198 µm
Side panel - rear right side	237 µm	Door - rear left side	193 µm
Door - rear right side	226 µm	Door - front left side	248 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

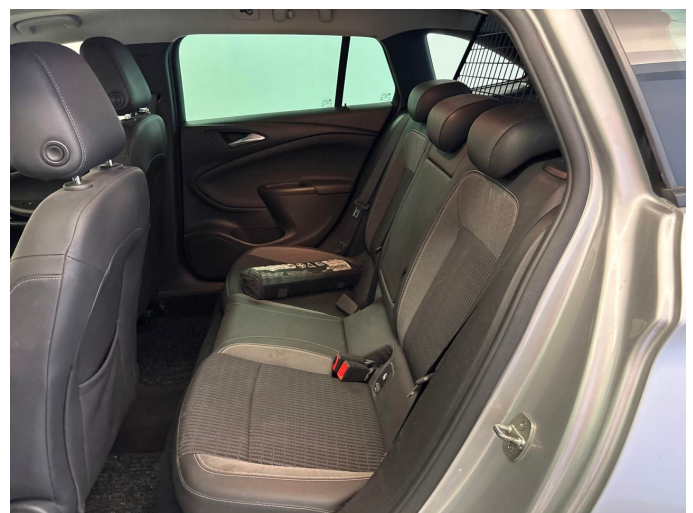


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

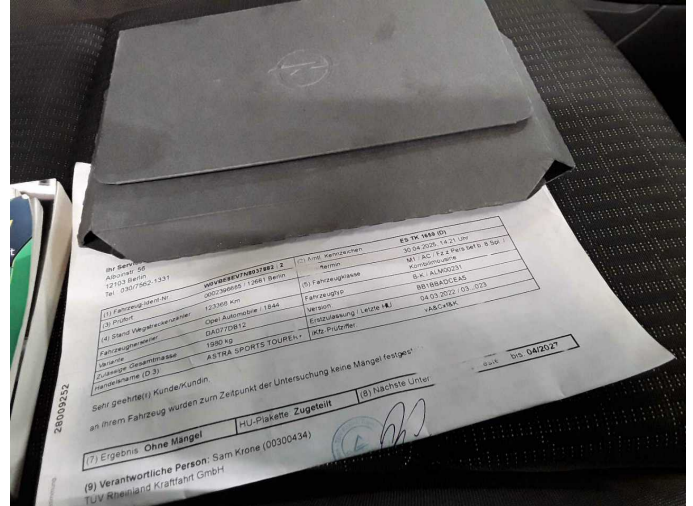


Figure 14: Documents

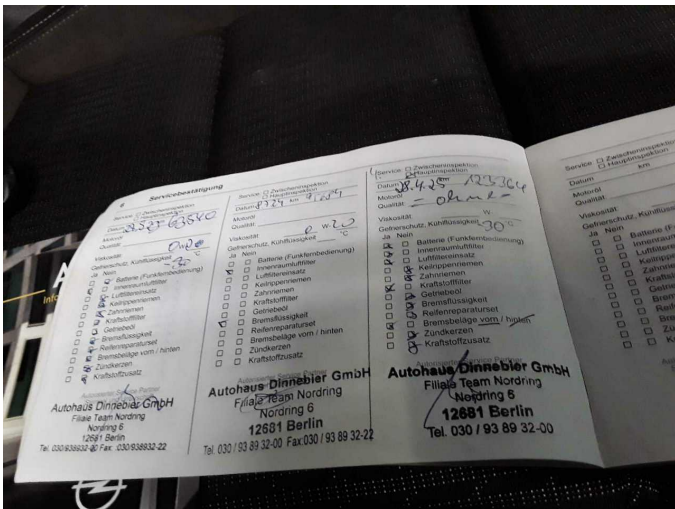


Figure 15: Documents

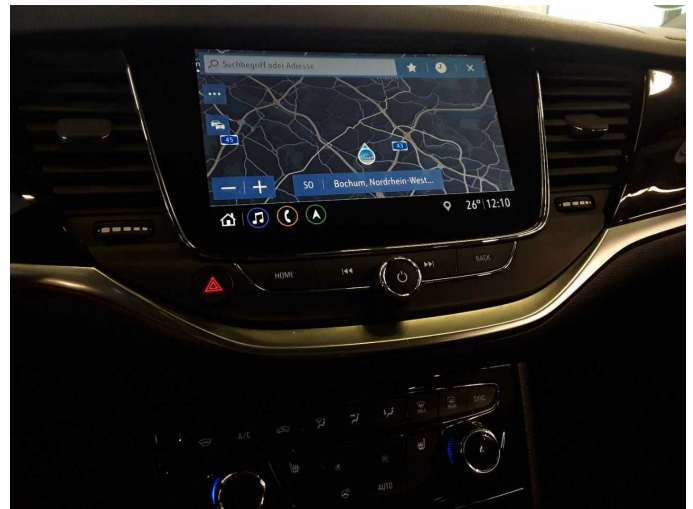


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.

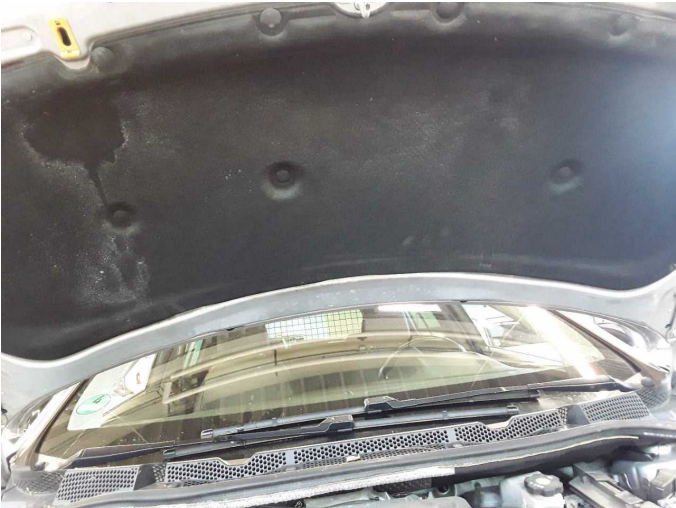


Figure 19: Misc.



Figure 20: Misc.




Figure 21: Misc.




Figure 22: Misc.



Figure 23: Misc.

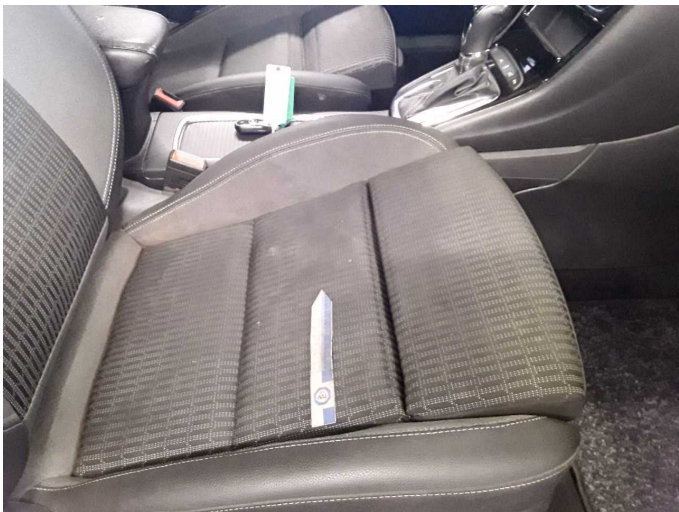


Damage 1: Seat - front: Seat cover - right side - Soiled - Clean

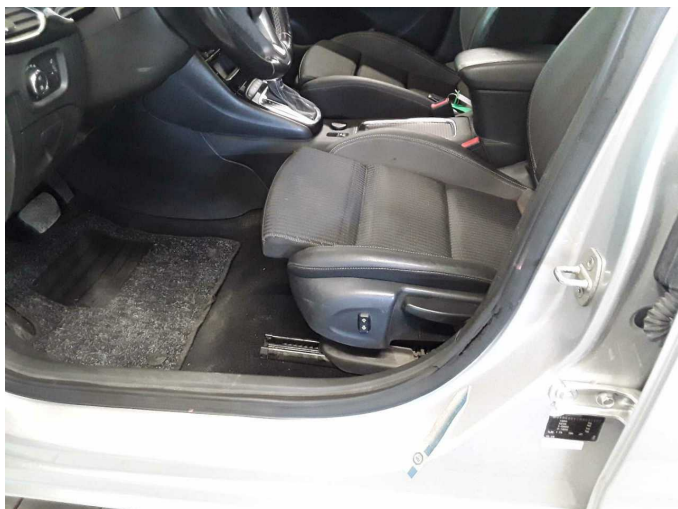


Damage 2: Cab: Door rubber seal - left side - Damaged - Replace



Damage 2: Cab: Door rubber seal - left side - Damaged - Replace

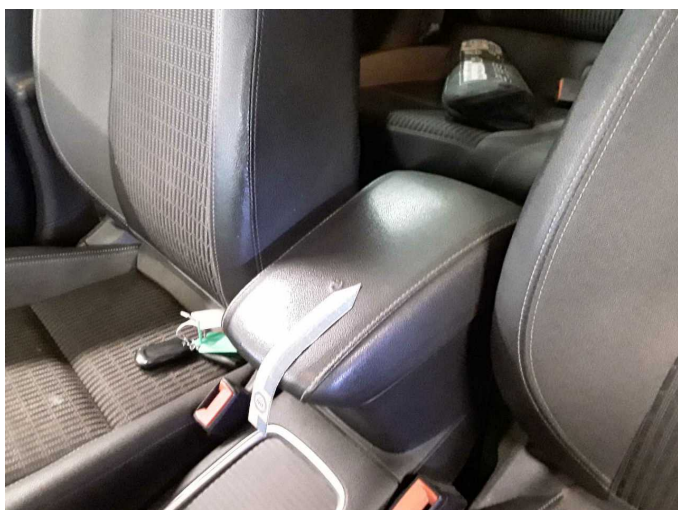

Damage 3: Seat - front: armrests - Damaged - Replace

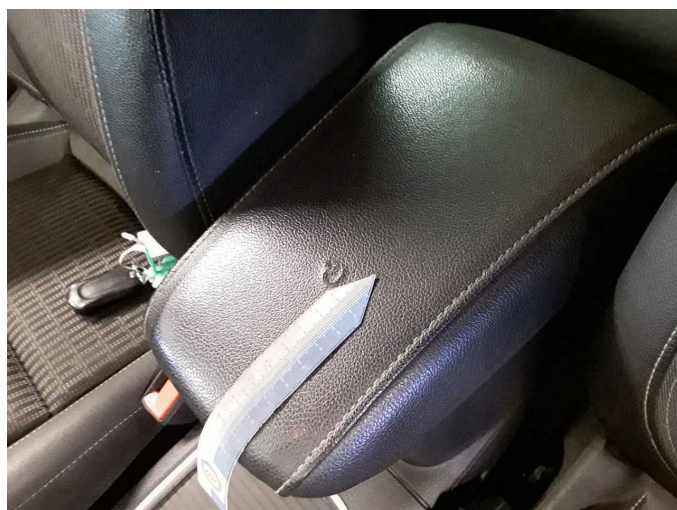

Damage 3: Seat - front: armrests - Damaged - Replace



Damage 4: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 4: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 5: Seat - front: Seat cover - left side - Damaged - Replace



Damage 5: Seat - front: Seat cover - left side - Damaged - Replace



Damage 5: Seat - front: Seat cover - left side - Damaged - Replace



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Repainting 1: Roof, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VBE8EV7N8037882

Hersteller / Modell: OPEL OPEL Astra 1.5 D Start/Stop Sports Tourer Automatik Elegance

Datum	KM-Stand	Beschreibung
29.04.2026	157.808	Reparatur Sonstiges; Systemtest/Eigendiagnose
27.01.2026	147.368	Keilrippenriemen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
27.08.2025	136.094	Klimaanlage inst.
02.08.2025	133.669	Bremsscheiben + Klötze h; Bremsscheiben hinten
16.07.2025	130.858	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
04.06.2025	124.485	Klimaanlage inst.; Kompressor Klima ern
30.04.2025	123.364	AU; Bremse Sonstiges; Bremsscheiben + Klötze v; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/Eigendiagnose
30.01.2025	113.819	Systemtest/Eigendiagnose; Wasserpumpe ern
21.01.2025	113.819	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
08.07.2024	95.684	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
31.05.2024	90.160	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben hinten; Bremsscheiben vorne; Ladeluftschlauch ern
13.02.2024	80.324	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
28.09.2023	63.540	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.05.2023	46.532	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
17.11.2022	28.551	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges