


2-CLV-208

2-CLV-208 · Style TSI 110cv 6v AS · 30 March 2026 · Zaventem (BE)

Specifications

License Plate Number	2-CLV-208	Fuel Type	Gasoline
Manufacturer	Volkswagen	VIN	WVGZZZC1ZPY008486
Model	T-Cross	Cylinder Capacity	999 ^{cm3}
Model Versions	Style TSI 110cv 6v AS	Transmission Type	Handmatig geschakelde transmissie
Body Type	5 door hatchback	First Admission	08-09-2022
Color	Grey	Odometer	105.759 ^{Km}
Paint Type	Metallic	Numer Of Keys	2
Production Year	2022	Interior	Black
KW	81	Number Headrests	5

Images

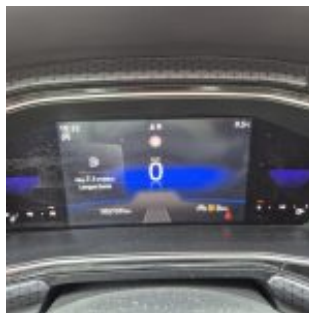



Accessories

ABS

Airbags

Alloy wheels

Audio System

Automatic air conditioning

Bluetooth car kit

Central door locking

Centre armrest

Cruise control

Electric rear windows

Electric windows front

Electrically adjustable exterior mirrors

Fog lights

Front & rear parking sensors

Leather steering wheel

Navigation system

Rear view camera

Roller cover / parcel shelf

Seat heating

Steering wheel multifunction

Condition

Condition exterior Adequate

Condition interior Adequate

Last Maintenance Unknown

Previous Repairs Unknown

Tire Specifications

Tire	Profile	Brand	Width	Aspect Ratio	Radial	Type
Front Left	4 ^{mm}	Hankook	205 ^{mm}	55 ^{mm}	17 ^{inch}	All Season
Rear Left	3 ^{mm}	Hankook	205 ^{mm}	55 ^{mm}	17 ^{inch}	All Season
Front Right	4 ^{mm}	Hankook	205 ^{mm}	55 ^{mm}	17 ^{inch}	All Season
Rear Right	3 ^{mm}	Hankook	205 ^{mm}	55 ^{mm}	17 ^{inch}	All Season
Spare Tire Type	Compressor					

Damages



Damage Part
Alloy – Left Rear

Damage Type
Damaged

Repair Type
Rim repair

Acceptable
No



Damage Part
Fender – Rear Left

Damage Type
Small dent(s)

Repair Type
Restyle

Acceptable
No



Damage Part
Reardoor – Left

Damage Type
small dents / small scratches

Repair Type
Panelbeating & Spray

Acceptable
No



Damage Part
Frontdoor - Left

Damage Type
Door-edge chipped

Repair Type
Acceptable

Acceptable
Yes



Damage Part
Mirror - leftside

Damage Type
Signallight broken

Repair Type
Replace

Acceptable
No



Damage Part
Hood

Damage Type
Stonechipping

Repair Type
Acceptable

Acceptable
Yes



Damage Part	Damage Type	Notes	Repair Type	Acceptable
Bumper - Front	Small scratch(es)	Middenstuk	Acceptable	Yes



Damage Part	Damage Type	Repair Type	Acceptable
Bumper - Front	Scratch(es)	Spotrepair	No



Damage Part	Damage Type	Repair Type	Acceptable
Bumper - Front	Scratch(es)	Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Alloy - Right Front	Damaged	Rim repair	No



Damage Part	Damage Type	Repair Type	Acceptable
Overfender	Small scratch(es)	Acceptable	Yes



Damage Part	Damage Type	Repair Type	Acceptable
Frontdoor – Right	Small dent(s)	Restyle	No



Damage Part	Damage Type	Repair Type	Acceptable
Reardoor – Right	Small dent(s)	Restyle	No



Damage Part	Damage Type	Repair Type	Acceptable
Bumper – Rear	Scratch(es)	Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Roof	Small scratch(es)	Polish	No



Damage Part	Damage Type	Repair Type	Acceptable
Interior	Stains & dirt	Cleaning	No

