



Expertise

Protocol number: 46535038  
Order No. / Reference: 26663141  
Inspection date: 15 Jul 2026

Manufacturer: Volkswagen

Model: Transporter T6.1 DSG Kurz

VIN: WV1ZZZ7HZMH017255



| Vehicle details                         |                    |
|-----------------------------------------|--------------------|
| Manufacturer / Type / Model / Equipment |                    |
| Volkswagen Transporter T6.1 DSG Kurz    |                    |
| Vehicle Identification number           | WV1ZZZ7HZMH017255  |
| Mileage (Read)                          | 141,440 km         |
| First registration                      | 20 Aug 2021        |
| Number of holders                       | 1                  |
| Power / Engine displacement             | 110 kw / 1,968 ccm |
| Fuel type / Cylinder                    | Diesel / 4         |
| Gearbox / Number of gears               | Automatic / 7      |
| Type of drive                           | Front drive        |
| Type of vehicle                         | Van                |
| Colour / colour code                    | Candy White (B9A)  |
| Doors / Seats                           | 4 / 3              |
| Upholstery type                         | Cloth              |
| Colour of upholstery                    | Black-Anthracite   |



## Vehicle details

|                                                      |                                |                                |                                                 |
|------------------------------------------------------|--------------------------------|--------------------------------|-------------------------------------------------|
| <b>Maintenance booklet / proof</b>                   | digital proof / complete       | <b>Next maintenance in</b>     | 3,200 km                                        |
| <b>Last service on / at</b>                          | 04/2025 at 116,546 km          |                                |                                                 |
| <b>Key is / should be</b>                            | 1 / 2                          | <b>FZG documents</b>           | Registration and title documents<br>unavailable |
|                                                      |                                | <b>Letter No.</b>              | FX262733                                        |
| <b>Previous damage / Accident</b>                    | None detectable                | <b>Repainting</b>              | Detectable                                      |
| <b>Inspection conditions</b>                         | sufficient                     | <b>Lifting equipment / pit</b> | yes                                             |
| <b>Test drive</b>                                    | Not performed                  | <b>Engine function test</b>    | Performed                                       |
| <b>Manufacturer key number/<br/>type code number</b> | 0603 / BXU 55196               |                                |                                                 |
| <b>Emission standard</b>                             | EURO6;WLTP;CI;PI/CI;N1 III, N2 | <b>fine dust sticker</b>       |                                                 |
| <b>Permitted total weight</b>                        | 3,200 kg                       | <b>Empty weight</b>            |                                                 |
| <b>Dimensions</b>                                    | 4904 x 1904 x -                |                                |                                                 |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre              | Manufacturer | Tread depth |
|----|-----------------|---------------------------|--------------|-------------|
| 1) | 205/65 R16 105T | All-season tyres on Steel | Dunlop       | 5mm / 5mm   |
| 2) | 205/65 R16 105T | All-season tyres on Steel | Dunlop       | 5mm / 5mm   |

### Additional tyres

| #  | Tyre size       | Type of tyre          | Manufacturer | Tread depth |
|----|-----------------|-----------------------|--------------|-------------|
| 1) | 205/65 R16 105T | Summer tyres on Steel | Hankook      | 4mm / 4mm   |
| 2) | 205/65 R16 105T | Summer tyres on Steel | Hankook      | 5mm / 5mm   |

### Replacement

| Typ | Tyre size       | Type of tyre          | Manufacturer | Tread depth |
|-----|-----------------|-----------------------|--------------|-------------|
| E   | 205/65 R16 107T | Summer tyres on Steel | Bridgestone  | 6 mm        |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment

### Standard equipment

- Storage and stowage boxes
- Exterior mirrors, left and right convex
- third brake light
- Electronic Stability Program
- Electric windows, front
- Transmission: DSG (dual-clutch transmission), 7-speed automatic
- Headrests (2)
- Paint finish: Solid
- Multi-collision brake
- Particulate filter: Soot particle filter for diesel engines
- "Composition Audio" radio with TFT display (monochrome)
- Radio accessories: 2 speakers (wideband)
- Wheels/Tires: Steel wheels 6.5 J x 16 in 20-hole design
- Wheels/Tire Accessories: Wheel covers for 16" wheels
- Keys for locking system: 2 remote control flip keys
- Crosswind assist
- Seat belts: Three-point automatic seat belts
- Daytime running light
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking with remote control and interior operation
- Airbag for driver and front passenger
- Hill Start Assist
- Tachometer
- Chassis: 16" chassis with 16" brake system
- Fresh air system with multi-stage fresh air blower
- Heating and ventilation system in the driver's cab
- Child safety lock, electrically operated
- Fuel tank with a 70-liter tank capacity
- Headlight range control
- Non-smoking version
- Upholstery: Seat covers in fabric, "Double Grid" design
- Radio: Digital radio reception (DAB+)
- Wheels/Tires: 205/65 R 16 C 107/105 T, optimized for low rolling resistance
- Sliding door in the passenger/cargo compartment: sliding door on the right
- electromechanical power steering
- Start-stop system
- Telephone: Mobile phone interface
- Lashing eyes for securing cargo
- Green thermal insulation glazing
- Registration as a truck



## Extra equipment

- Adaptive Cruise Control (ACC) "follow to stop" up to 210 km/h, with speed limiter (Front Assist system with City Emergency Braking function)
- Air parking heater, programmable
- Cargo area ventilation (Additional ventilation of the cargo area (baker's slots) on the D-pillar)
- Driver assistance systems: Rearview camera "Rear View" ((static lines))
- Electromechanical power steering for people with disabilities (significantly reduced steering effort required)
- Fleet management system interface (electrical terminal block and function control unit 1 with body manufacturer (ABH) programming)
- Fog lights including cornering lights
- Interior paneling: Side panels in the passenger/cargo area, made of hardboard (half-height in vehicles with window cutouts)
- Multifunction display "Plus" with fatigue detection (Multifunction display "Plus" with black and white display)
- Package: Comfort Package Plus (2 12-volt sockets, air conditioning in the driver's cab with manual control, fabric seat covers, "Bricks" design, 1 waste bin for the door pockets in the driver's cab, additional soundproofing measures in the driver's cab, height adjustment for the left single seat in the driver's cab, glove compartment lid with light, foldable grab handle on the roof frame on the passenger side, storage compartments on the driver's cab seats, reading light, sun visors with mirrors (front/rear), grab handle (front/rear), manual lumbar support for the left single seat in the 1st row of seats)
- Partition walls: High partition wall with fixed window and 8 lashing rings for securing cargo (partition wall, high, with window - without child safety lock in passenger compartment - lashing rings for securing cargo, reinforced (ISO 27956))
- Power outlets: 2 12-volt sockets in the dashboard
- Seat configuration - 5. Armrests: Armrests for the left seat in the driver's cab
- Steering wheel: Multifunction leather steering wheel (3 spokes)
- Exterior mirrors, electrically adjustable, heated and folding (including folding function via vehicle key)
- Floor coverings: Rubber floor in the passenger/cargo area (Rubber floor covering in the passenger/cargo area with loading edge protection, rear - Step lighting in the passenger/cargo area)
- Fuel tank with 80 l tank capacity
- Heated front windshield washer nozzles and washer fluid level indicator
- Lane Assist (cruise control system including speed limiter)
- LED headlights and LED taillights (LED headlights with LED daytime running lights - automatic headlight range control - red LED taillights)
- Light and visibility (interior safety mirror, automatically dimming - daytime running lights with automatic headlight control, "Leaving home" function and manual "Coming home" function - intermittent wiper control with rain sensor for the windshield wipers)
- ParkPilot in the front and rear areas
- Power outlet: 12V operating voltage and 230V socket on the driver's seat frame
- Radio navigation system "Discover Media" including "Streaming & Internet" (voice control - 2 USB interfaces (Type C) in the dashboard - "Discover Media" radio navigation system with 20.3 cm (8 inch) touchscreen including "Streaming and Internet" - navigation function/ preparation - 4 speakers: 2 tweeters, 2 woofers - Wired & Wireless App-Connect)
- Seat heating for driver's seat, left, adjustable
- Tailgate without window cutout with closing aid
- Tire pressure monitoring system
- Total weight: Permissible total weight 3.2 t with reinforced 16" steel wheels (4 steel wheels 6.5 J x 16 - Permissible total weight 3,200 kg - Suspension and damping, for vehicles with 3.2 t permissible total weight - On-board tools and jack, reinforced, for vehicles with 3.2 t GVW)
- Traffic sign recognition
- Wheels/Tires: Spare wheel (steel rim) with driving tires

## Brief expert findings

|                      |                                                                                                                                                                                |
|----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were not available. |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.      |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                       |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                          |
| Engine function test | An engine test run was performed.<br>This is due to the following reason.:<br>Geräusch Keilriemen und Zweimassenschwungrad                                                     |



## Value reducing factors

| No. | Component group        | Description                                                                            |
|-----|------------------------|----------------------------------------------------------------------------------------|
| 1   | Engine                 | Engine (Keilriemen) - Noise - Perform diagnosis                                        |
| 2   | Engine                 | Clutch (Zweimassenschwungrad macht Geräusche und Vibriert) - Noise - Perform diagnosis |
| 3   | Door - front left side | Door - Scratch(es) - Paint                                                             |

## Wear and tear

| No. | Component group | Description                             |
|-----|-----------------|-----------------------------------------|
| 1   | Interior        | Interior - Scratch(es) - No deduction   |
| 2   | Vehicle glazing | Windscreen - Stone chips - No deduction |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Repainting

| No. | Repainting            |
|-----|-----------------------|
| 1   | Mudguard - right side |

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



## Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

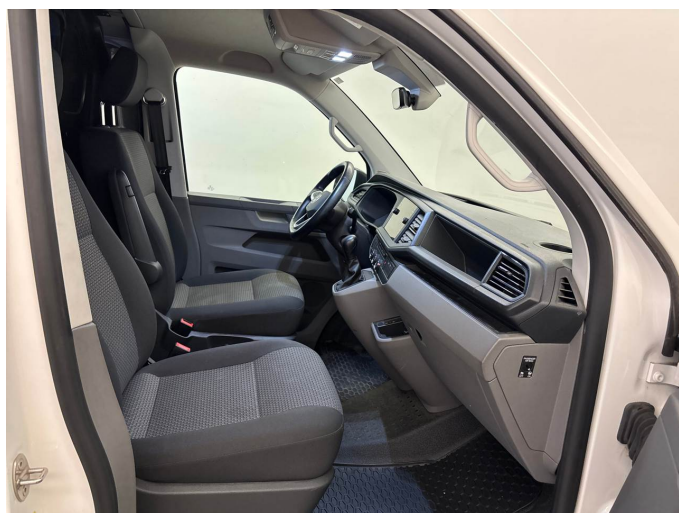


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

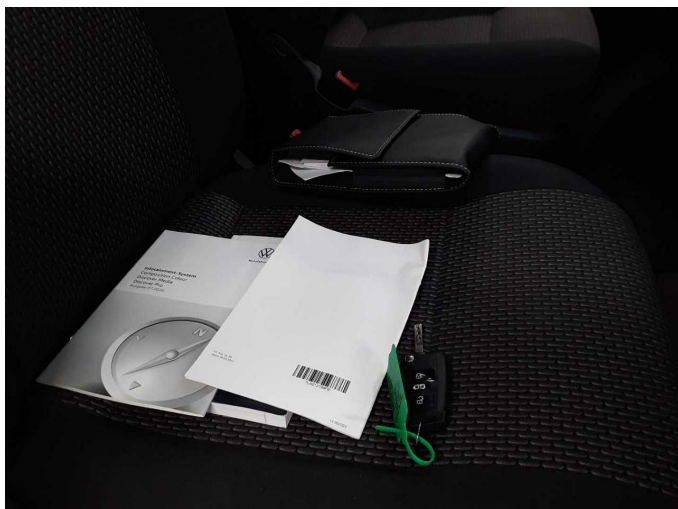


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

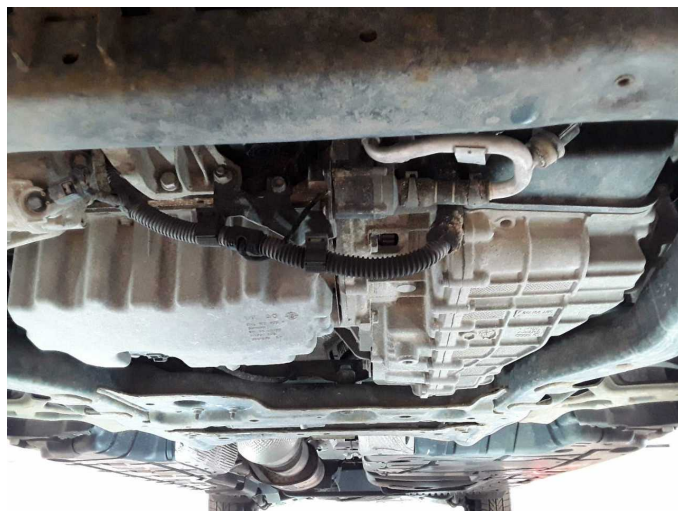


Figure 20: Misc.

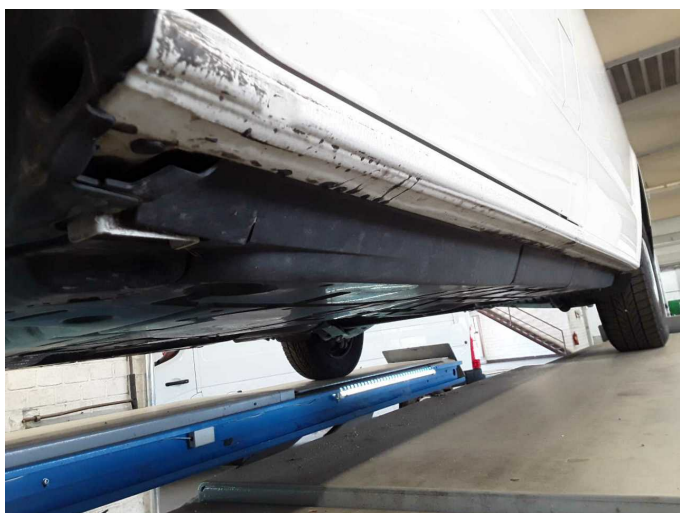


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.


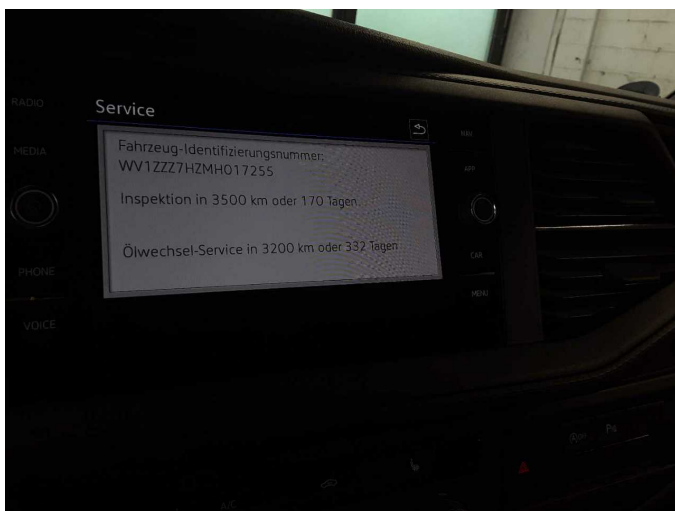


Figure 29: Misc.




Damage 3: Door - front left side: Door - Scratch(es) - Paint

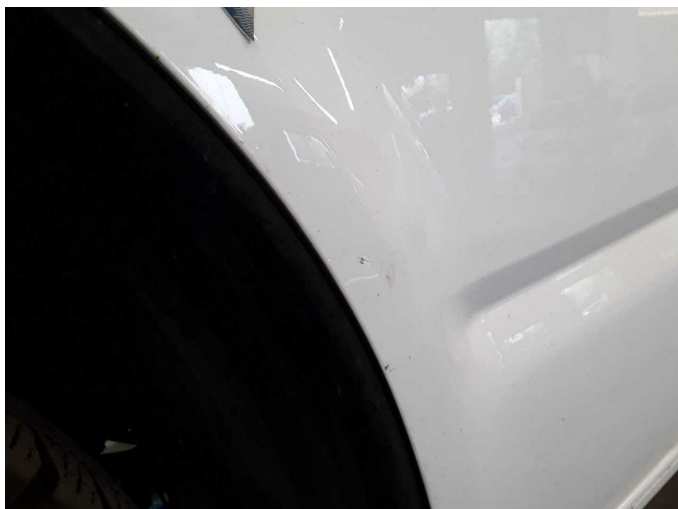

**Damage 3:** Door - front left side: Door - Scratch(es) - Paint



**Damage 3:** Door - front left side: Door - Scratch(es) - Paint

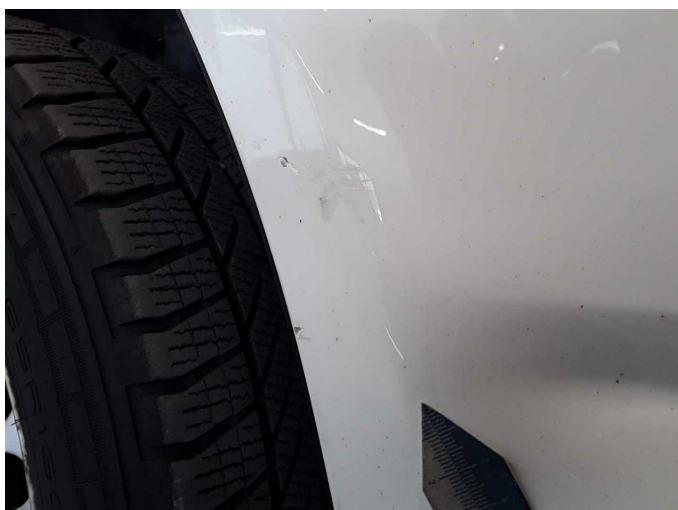

**Damage 3:** Door - front left side: Door - Scratch(es) - Paint



**Repainting 1:** Mudguard - right side



**Repainting 1:** Mudguard - right side



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV1ZZZ7HZMH017255

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Transporter T6.1 DSG Kurz

| Datum      | KM-Stand | Beschreibung                                                                                                                                |
|------------|----------|---------------------------------------------------------------------------------------------------------------------------------------------|
| 05.11.2025 | 126.291  | AU; Bremsklötze vorne                                                                                                                       |
| 25.04.2025 | 116.546  | Motoröl b. Wartung; Ölwechsel                                                                                                               |
| 20.03.2025 | 104.867  | Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                    |
| 31.10.2023 | 76.294   | Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne                                          |
| 04.08.2023 | 68.093   | AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges |
| 08.06.2022 | 28.049   | Motoröl b. Wartung; Ölwechsel                                                                                                               |