

INFORME DE INSPECCIÓN

VEHÍCULO

9339NHF / WBA31EG0X05479198 / 5479198

Datos vehículo:

Marca:	BMW	Combustible:	DIESEL
Modelo:	X1 SDRIVE20D U11	Transmisión:	NO DETERMINADO
Versión:	X1 sDrive20d U11	Color:	NO DETERMINADA
Tapicería:	NO DETERMINADA	Kilómetros:	30.434

Controles específicos:

Llaves principales:	1	Llaves secundarias:	0
Llaves especiales:	0	Tipo transmisión:	Automática
Revisión:	No controlado		

 CARPETA MANUALES

 DOCUMENTACION ORIGINAL

 MANUAL PROPIETARIO

 TUERCA ANTIRROBO

Información neumáticos

9339NHF Neumático	Marca	Medidas	Índice carga	Índice velocidad	Runflat
DD	PIRELLI	245/45/19	102	Y	-
DI	PIRELLI	245/45/19	102	Y	-
RP					-
TD	PIRELLI	245/45/19	102	Y	-
TI	PIRELLI	245/45/19	102	Y	-

Datos Inspección:

Tipo Inspección:	COMERCIAL	Ubicación Inspección:	BAL TARRAGONA
Fecha Inspección:	25/05/2026	RaC:	SIXT RENT A CAR
Comentarios:			

Daños no valorables:

9339NHF COMPONENTE	ACCIÓN	COMENTARIO
Llanta rueda tr iz	OBSERVACIÓN-	

9339NHF COMPONENTE	TIPO DAÑO	ACCIÓN	CARROC.	MONTAJE	PINTURA	MAT. PINTURA	RECAMBIO	%DTO	IMPORTE
1. Jgo pegado sensor lluvia	-	REEMPLAZAR				0,00	29,44	10,00	26,49 €
2. Emblema capó dl	-	REEMPLAZAR	0.08 h.			0,00	46,81	10,00	45,20 €
3. Luna parabrisas	-	REEMPLAZAR	2.25 h.			0,00	561,23	40,00	423,36 €
4. Jgo pegado lunas - PEGADO FRIO 300ML - Nueva	-	REEMPLAZAR				0,00	61,68	10,00	55,51 €
5. Juego fijación luna parabrisas	-	REEMPLAZAR				0,00	3,88	10,00	3,49 €
6. Neumático dl iz - HANKOOK S1 EVO3 - Nueva	-	REEMPLAZAR	0.50 h.			0,00	188,50	10,00	188,90 €
7. Moldura contorno aleta dl dr	Pintar Reparado Combinada no	-			0.42 h.	1,78	0,00		17,95 €
8. Moldura paragolpes tr	Pintar Reparado Pieza desmontada	-			0.46 h.	1,95	0,00		19,66 €
9. Paragolpes tr (zona inf)	Pintar Reparado Pieza desmontada	-			0.46 h.	1,95	0,00		19,66 €
10. Capó dl	Pintar Reparado Pieza montada	-			5.42 h.	22,95	0,00		231,62 €
11. Llanta rueda dl iz	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
12. Puerta tr iz	-	SR Carrocero				0,00	0,00		40,00 €
13. Llanta rueda tr dr	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
14. Llanta rueda dl dr	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
TOTAL INSPECCIÓN								(IVA no incluido)	1521,84 €

* Faltantes en color naranja

(IVA no incluido)

9339NHF RESUMEN PERITACIÓN	TIEMPO	EUROS
Total Mano de Obra Carrocero	2,83 h.	108,95 €
Total material pintura	-	28,63 €
Total Mano de Obra Pintura	6,76 h.	260,26 €
Total Recambios	-	634,02 €
Descuento recambios aplicado	-	257,52 €
Total Faltantes	-	0,00 €
Total Smart Repair	-	490,00 €













The digital instrument cluster displays the following information:

- Speedometer:** A needle-style gauge with a scale from 0 to 260 km/h. The current speed is 0 km/h.
- Fuel Gauge:** Located at the bottom left, showing 201 km of range.
- Time:** 12:38.
- Values since Individual:** 1.3 l/h.
- Power %:** 100.
- Navigation/Menu:** Options for CONTENT and LAYOUT.
- Temperature:** +23.5 °C.
- Alerts:** "Door open." and "OFF P" (Park Assist).
- Distance:** Total 30434 km, Trip 797.6 km.
- Icons:** Various warning and status icons including ABS, ESP, parking, and door open.

- ↶
- MEDIA
- TEL
- NAV



CHECK CONTROL

Bonnet open

To open bonnet pull the lever twice. Close bonnet before start of journey. See Owner's Handbook for further information.

Close message

Owner's Handbook

LOW





CLD-100 12:39


CHECK CONTROL
Bonnet open
To open bonnet, pull the lever twice. Close bonnet before start of journey. See Owner's Handbook for further information.

Close message
Owner's Handbook

LOW L LOW R





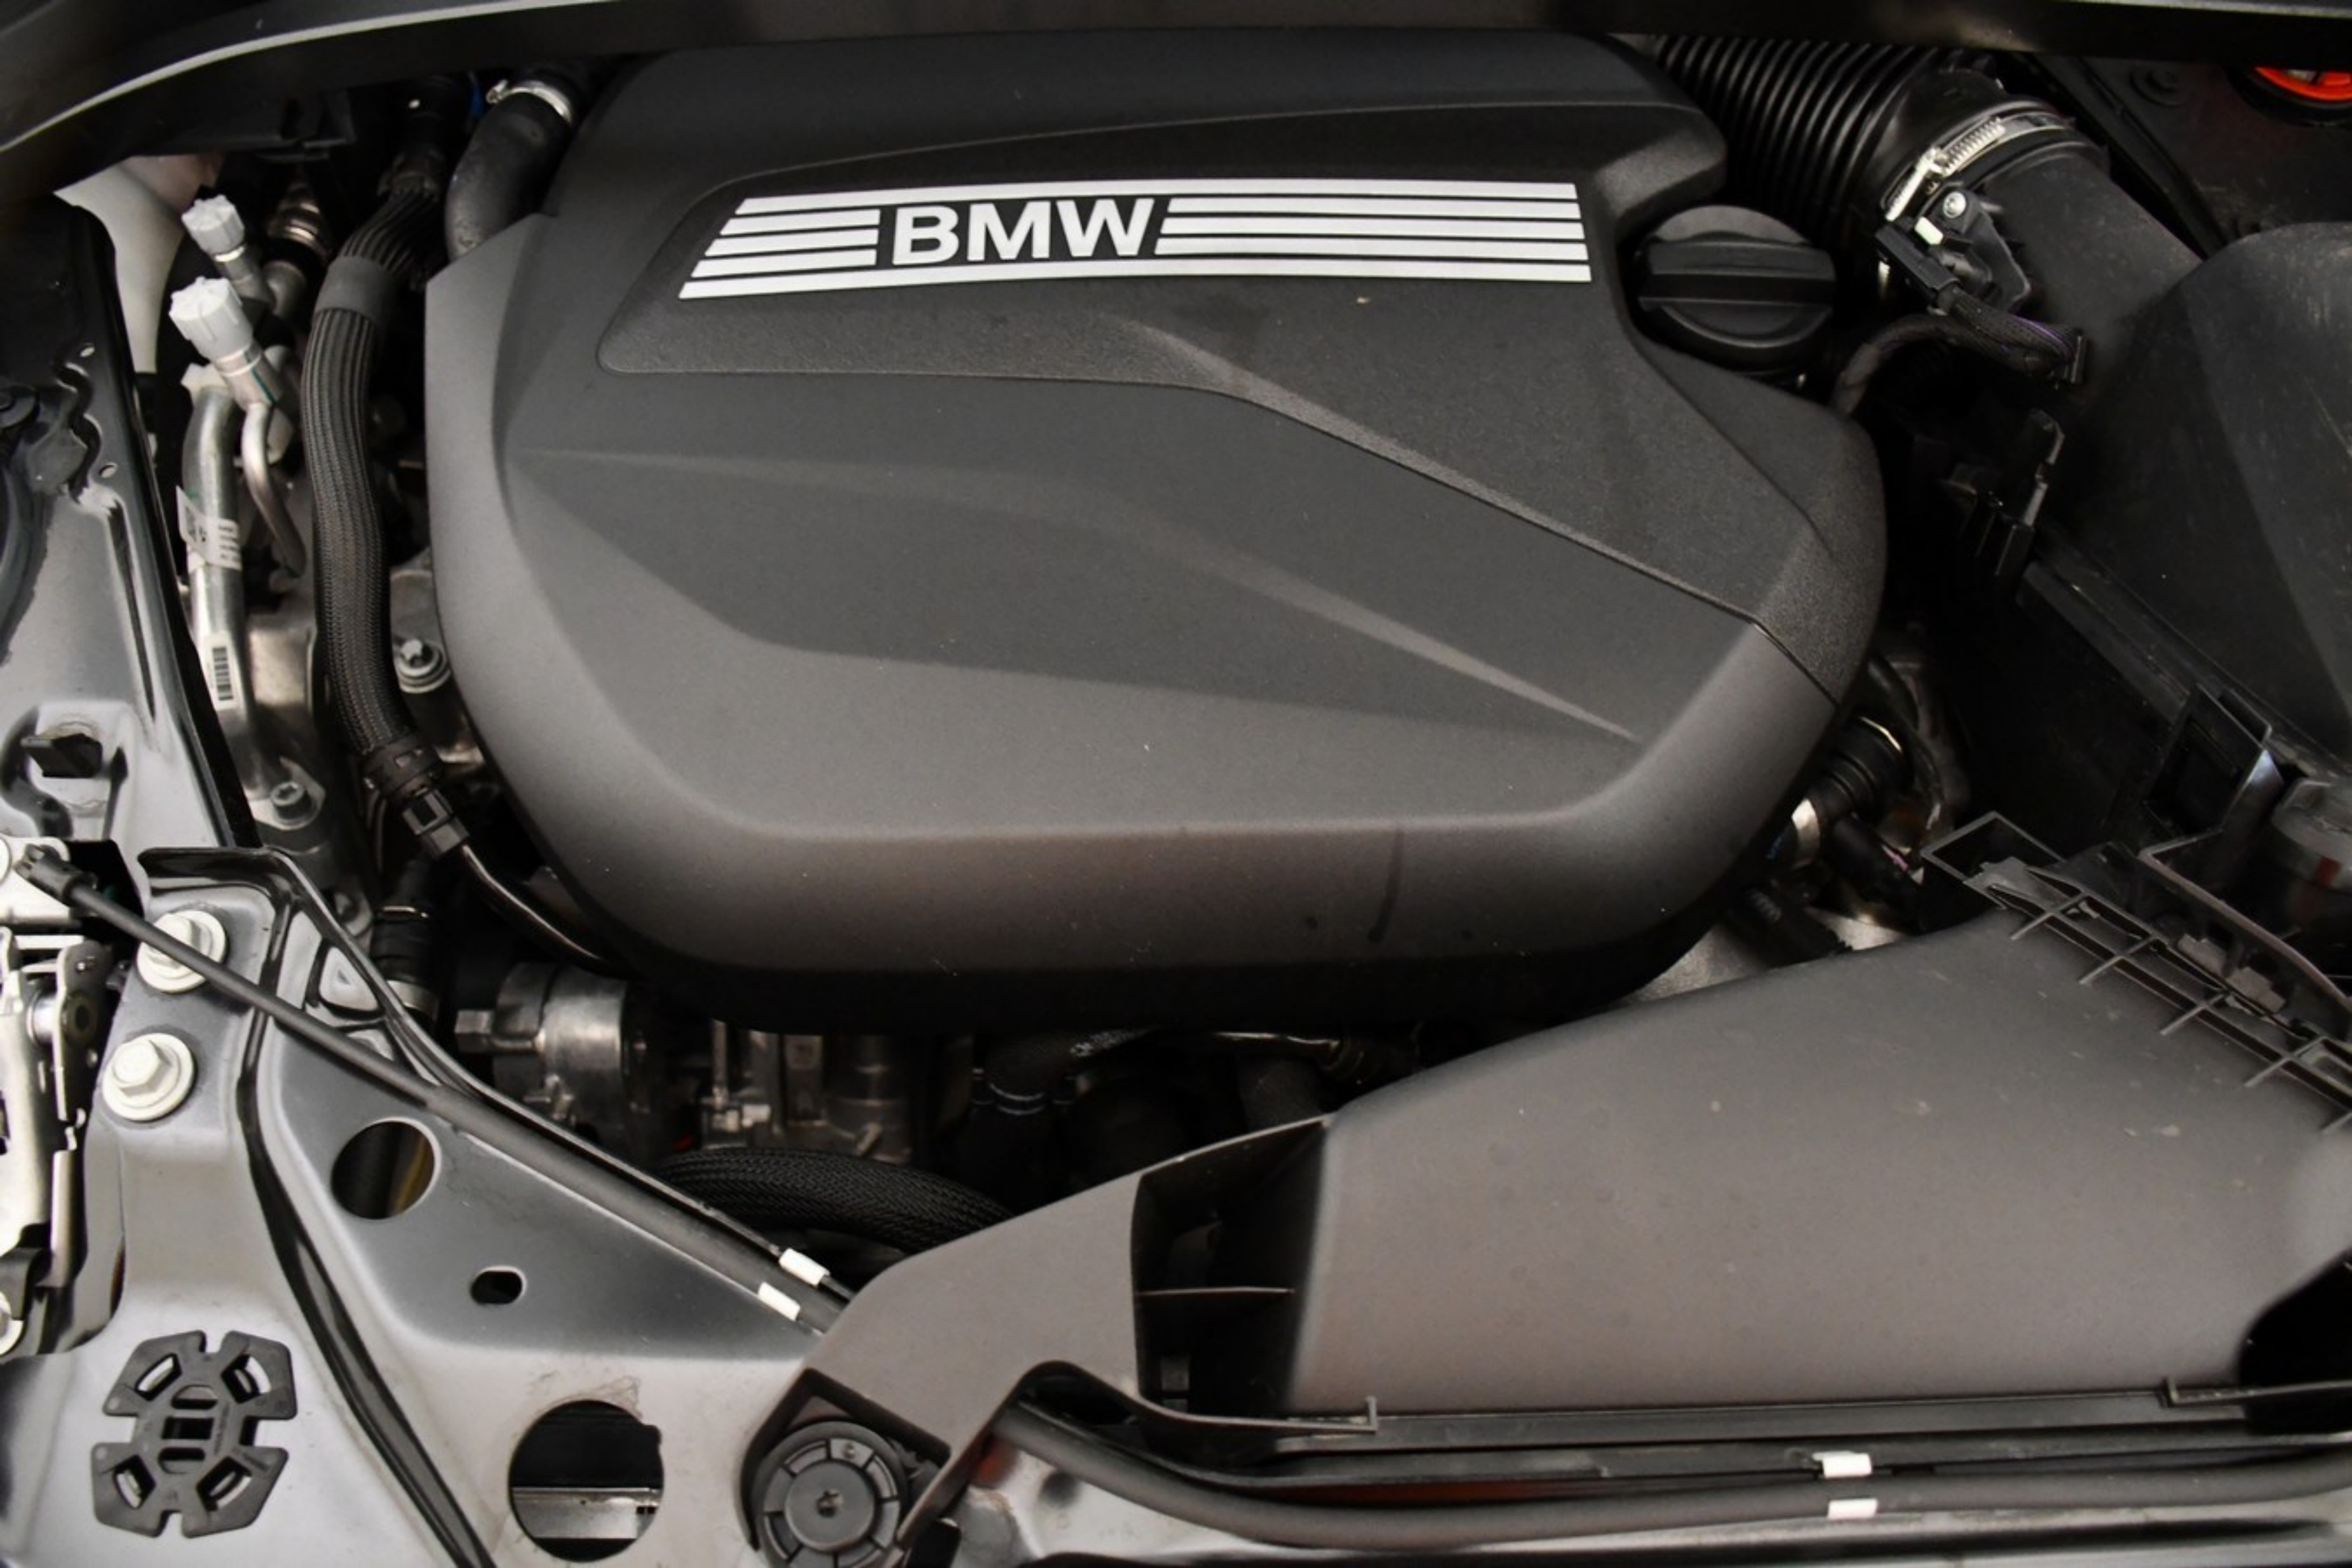









Instrument cluster display showing a large 'P' for Park, a gear shift indicator, and a small car icon. The display is illuminated with blue and white light.

Central infotainment screen displaying a navigation map with a blue background. The screen is divided into several sections:

- PERSONAL ASSISTANT** (top left): A menu with options for **BMW Maps** and **Live Vehicle**.
- Recommendation:** A notification that says "Remote Software Upgrade available. Tap for more info."
- Map:** A street map with a white location pin and a compass icon.
- Top Right:** Shows the destination **CAD-100**, a speaker icon, and the time **12:40**.
- Bottom:** A navigation bar with a home icon, a window icon, and a volume slider set to **LOW**.









4.89

27.125 INCHES AT TEMPERATURE A



























0 1 2 3 4 5 6 7 8 9 10
Manheim
COX ALTERNATIVE



0 1 2 3 4 5 6 7 8 9 10
Manheim
Car Automotive



Manheim
Car Automotive



0 1 2 3 4 5 6 7 8 9 10
cm
Manheim
Car Accessories





0 1 2 3 4 5 6 7 8 9 10
cm
Manheim
Car Automotive





0 1 2 3 4 5 6 7 8 9 10
cm
Manheim
CON. AUTOMOTIVE

BMW



Manheim
USA TRADE



Manheim
CAR ACCESSORIES

