



Expertise

Protocol number: 47166291
Order No. / Reference: 26759929
Inspection date: 20 Aug 2026

Manufacturer: Polestar

Model: 2 Single Motor 82kWh

VIN: YSMVSFEE3RL214049



Vehicle details	
Manufacturer / Type / Model / Equipment	
Polestar 2 Single Motor 82kWh	
Vehicle Identification number	YSMVSFEE3RL214049
Mileage (Read)	43,635 km
First registration	7 Aug 2023
Number of holders	1
Fuel type	Electric
Power	141 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Snow Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	18,466 km
Last service on / at	06/2025 at 32,101 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV801667
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2219 / AAC 00001		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,500 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102V	Summer tyres on Light alloy	Michelin	7mm / 7mm
2)	245/45 R19 102V	Summer tyres on Light alloy	Michelin	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102H	Winter tyres on Light alloy	Pirelli	7mm / 7mm
2)	245/45 R19 102H	Winter tyres on Light alloy	Pirelli	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 USB ports on the back
- 360° camera with side parking assist
- Airbags, driver and front passenger (passenger airbag, deactivatable)
- Alarm system (double locking - Alarm inclination sensor and motion sensor)
- Heated exterior mirrors
- Frameless, electrically adjustable exterior mirrors (automatically dimming exterior mirrors)
- Hill start assist
- third brake light
- Connected Safety (Connected Safety transmits information between your vehicle and other vehicles via the internet. This function can inform the driver if another vehicle on the current route has activated its hazard warning lights or has detected slippery road conditions. Connected Safety communication only works between vehicles equipped with this function and in which it is activated.)
- Front storage compartment 41 liters
- Transmission: Direct drive
- Back window, heater
- Infotainment powered by Android (incl. Google Assistant, Google Maps, Google Play Store -Google service connectivity -Over-the-air (OTA) updates for life)
- ISOFIX attachment for front passenger seat and outer rear seats
- Front and rear headrests
- Steering wheel: Multifunction steering wheel, height and reach adjustable
- Navigation system
- Electric parking brake (with auto-hold function)
- Polestar Connect (Thanks to Polestar Connect, the driver can communicate with the Polestar 2. For example, the Polestar Connect app allows the driver to switch on the climate control without entering the passenger compartment. The vehicle has buttons for making breakdown or emergency calls. In the event of an accident, the Polestar 2 even automatically makes an emergency call and a call if it is stolen.)
- Wheels: 19" alloy wheels with 5 double spokes, black, diamond cut (with tires 245/45 R19 on 8Jx19 ET50 front, 9Jx19 ET53 rear)
- Servotronic
- Seat belts (warning for unfastened seat belts, belt tensioners in the front and on the outer rear seats)
- Seats: Semi-electric seats, front (driver's seat memory - lumbar support, front - 4-way electrically adjustable)
- Smartphone integration: Apple Carplay
- Lane Keeping Assist (LKA) (The lane keeping assist steers the vehicle back into the lane and/or warns the driver with steering wheel vibrations.)
- Blind spot assist with steering intervention
- 2 USB ports on the front
- Acoustic Vehicle Alert System - AVAS
- Airbags: Head/shoulder airbags
- Airbags: SIPS side airbags (including inner side)
- Alcolock Preparation (Preparation for an alcohol immobilizer that can be installed in motor vehicles and ensures that the engine will not start if the driver's blood alcohol level exceeds a certain level.)
- Cup holders: 2 in the front, 2 in the rear
- Bluetooth
- CleanZone (cabin air filter)
- Driver Alert Control
- Front and rear parking assist
- Electric tailgate with soft closing
- First aid kit
- Driver display 12.3" (progressive digital display)
- electric window regulator
- Forward Collision Warning
- Speed limiter and cruise control
- Large, vertical display with touchscreen (11, 15")
- High Performance audio (8 speakers/250 W)
- Interior lighting Mid Level
- Interior rearview mirror with automatic dimming function
- Integrated eSIM (with constant internet connectivity)
- ECC 2-zone air conditioning
- Collision avoidance and mitigation (with braking and steering support - vehicle, cyclist and pedestrian detection)
- Automatic headlight range control
- Multi-collision brake
- One pedal drive (regenerative braking)
- Polestar App with vehicle functionalities (opening and closing the vehicle - pre-conditioning function - vehicle information status)
- Upholstery: embossed fabric with 3D etched decor
- Cross-traffic monitoring with emergency braking
- Radio accessories: Digital radio DAB+
- Rain sensor
- Indirect tire pressure monitoring
- Tire repair kit
- Rear lights, Full-LED (Full LED rear light with persistent light signature - automatically dimming)
- Whiplash protection system (In the event of a collision, the backrest and headrest of the front seat move as a unit with the occupant to support their neck.)
- Seats: Split and foldable rear bench seat (40/60)
- Seats: Front seats with seat heating
- Smartphone inductive charging 15W
- SmartZone (including 3D camera and radar technology)
- Electronic Stability Control (ESC) and traction control
- 12V socket in the trunk
- Textile floor mats



- Traffic Sign Information (RSI) (Using a camera or information from the Sensus navigation system, it provides information on speed limits, no-overtaking zones, one-way streets and various supplementary signs. The traffic sign is displayed on the speedometer or in the head-up display.)

- Vehicle Deceleration Control (ABS, Electronic Brake Distribution and Emergency Brake Assist)
- Immobiliser
- Hexagonal gear selector with illuminated Polestar symbol
- Central locking with remote control (incl. 1 standard key and 1 activity key)

Extra equipment

- Paint finish: Metallic
- Package: Pilot (Pixel LED headlights - LED front fog lights with cornering lights - Pilot Assist: keeps the vehicle in the center of the lane by intervening in the steering - Adaptive Cruise Control - Emergency Stop Assist - Rear Collision Warning & Mitigation)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
2	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Smart repair

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Fahrzeugmodellbezeichnung laut Rechnung: "Polestar Polestar 2 Single Motor 82kWh".

Winter - Radsatz ist kein Bestandteil des Lieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

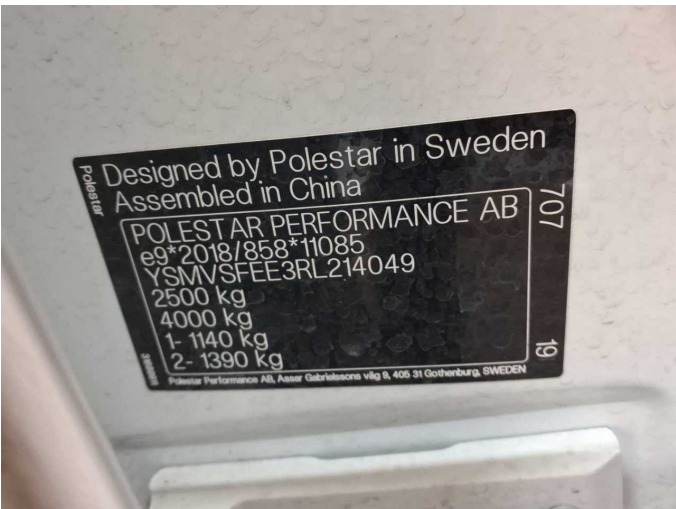


Figure 11: VIN



Figure 12: Mounted tyres

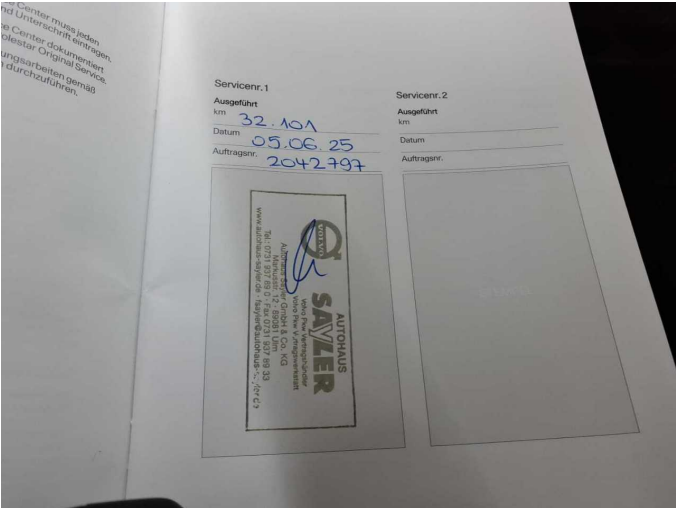


Figure 13: Documents



Figure 14: Documents

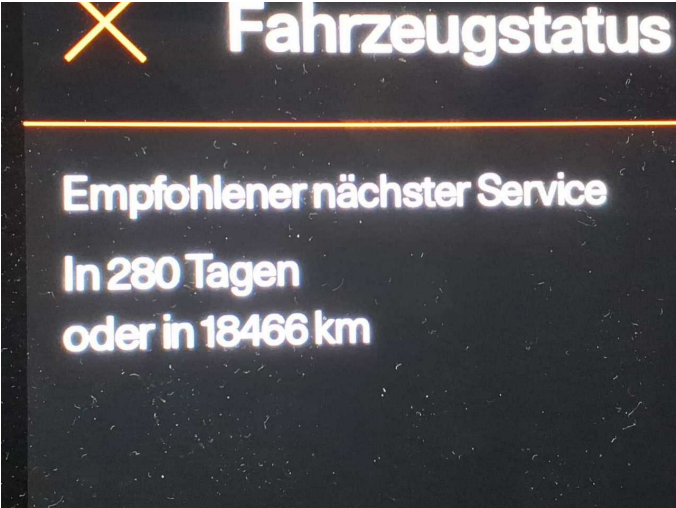


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Additional tyres

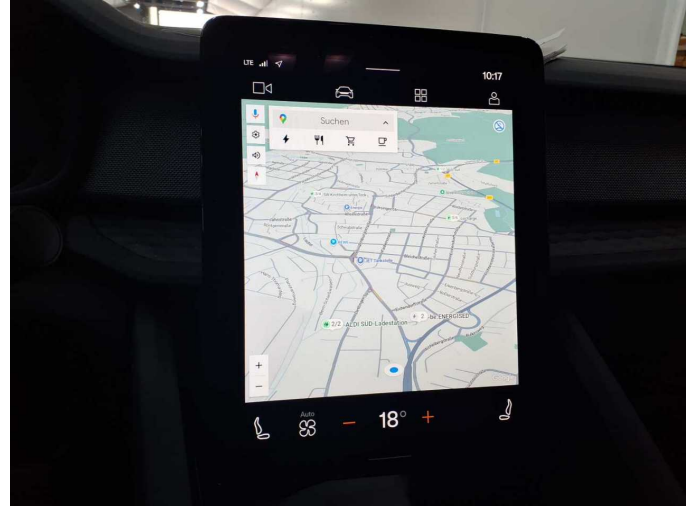


Figure 20: Navigation



Figure 21: Misc.

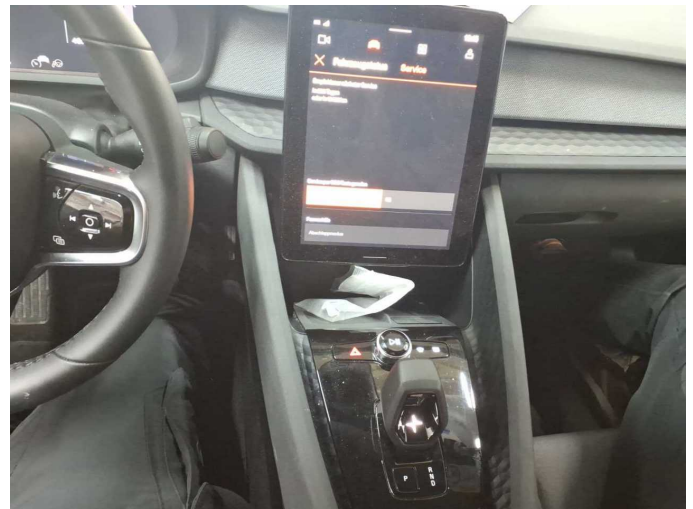


Figure 22: Misc.

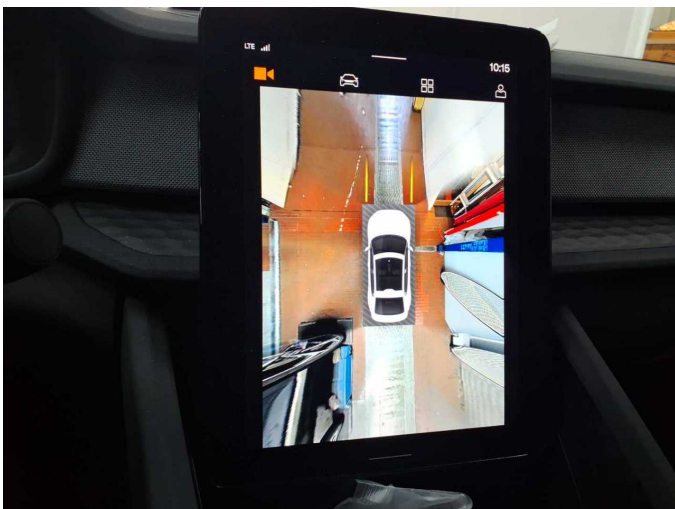


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.




Figure 36: Misc.



Damage 1: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 1: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value

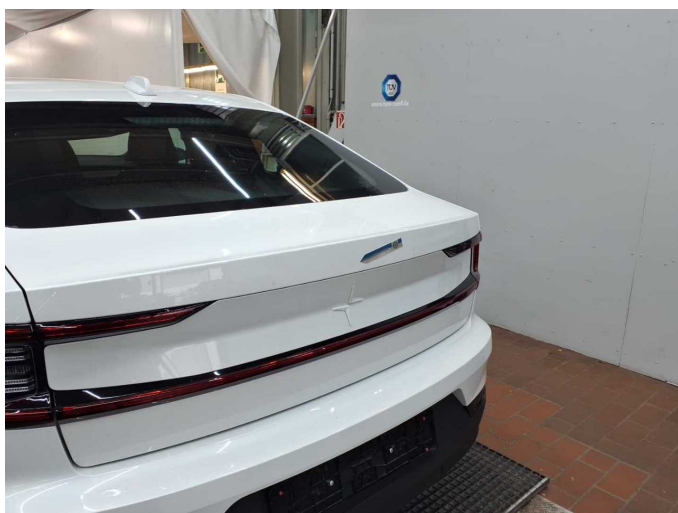

Damage 2: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair

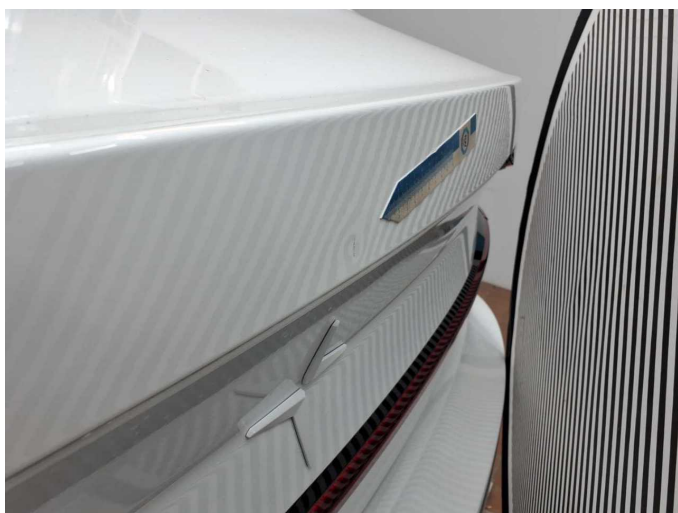

Damage 2: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair