



Expertise

Protocol number: 46657010
Order No. / Reference: 26649800
Inspection date: 22 Jul 2026

Manufacturer: Mercedes-Benz

Model: C 220 d 4Matic T 9G-TRONIC AMG Line

VIN: W1KAH0FB4PF117471



Vehicle details

Manufacturer / Type / Model / Equipment

Mercedes-Benz C 220 d 4Matic T 9G-TRONIC AMG Line

Vehicle Identification number	W1KAH0FB4PF117471
Mileage (Read)	85,699 km
First registration	13 Jul 2023
Number of holders	1
Next periodical technical inspection	07/2026
(Report not on hand)	

Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,993 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Selenitgrau metallic
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	298 Tag(e)
Last service on / at	04/2026 at 78,842 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV687151
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BBU 00205		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,410 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95Y	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	245/40 R18 97Y	Summer tyres on Light alloy	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/45 R18 95H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Center airbag
- Airbag: Windowbag for driver and front passenger
- Ambient lighting with 64 light colors
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Brake assist, active
- Diesel particulate filter
- DYNAMIC SELECT
- ECO start/stop function
- Chassis: Sport chassis with sport direct steering
- Speed Limit Assistant
- rear window wiper
- Interior headliner fabric crystal grey
- ISOFIX child seat attachment with top tether in the rear
- KEYLESS-GO start function
- Rear headrests (3)
- Cargo area cover including EASY-PACK safety net
- Mercedes-Benz emergency call system
- Package: Storage
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Radio: MBUX
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Remote Services Plus
- Seats: Rear seat backrests foldable
- Cruise control
- Electronic immobilizer
- Decorative elements, metal structure
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- 4MATIC all-wheel drive
- AMG floor mats
- Basic services
- Brake system with larger brake discs on the front axle
- black roof rails
- Double cup holder at the front
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Transmission: 9-speed automatic, 9G-TRONIC
- Heated rear window
- Instrument panel and door sills in ARTICO man-made leather in black nappa look
- Mechanical child safety lock for the rear doors
- Front headrests
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Package: Interior lighting package
- Radio: Extended MBUX functions
- Radio accessories: Digital radio (DAB)
- Radio accessories: Central display
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Lane Keeping Assist, active
- High-visibility vest for drivers
- Central locking with remote control

Extra equipment

- ENERGIZING AIR CONTROL (Air quality sensor and one fine dust sensor each for indoor and outdoor use - Fine dust filtration with 2 filters - Activated carbon-based indoor air filter with filter layers against fine dust (PM2.5) and nitrogen oxides (NOx) or sulfur dioxides (SO2) as well as pollen - Automatic recirculation or fresh air switching depending on the measured air quality, taking into account the overall climate comfort control system - Air quality menu in the MBUX multimedia system to illustrate the measured values)
- Fuel tank with larger capacity
- Paint finish: Metallic
- Center console metal structure
- Package: Advanced Parking Package (12 ultrasonic sensors - 360° camera - Active Parking Assist with PARKTRONIC: detects free parking spaces, assisted parking, visual and acoustic warning, display of camera and ultrasonic data in the media display - Cross traffic warning: can provide visual and acoustic warnings when reversing out of a parking space and, if necessary, automatically initiate emergency braking - Reverse maneuvering brake: can trigger a braking process - Drive-away assist)
- Package: High-End Infotainment Package (MBUX Navigation Premium (hard drive navigation, pre-installation for Live Traffic Information), Traffic Sign Assist, Smartphone Integration (connects the mobile phone wirelessly to the multimedia system via Apple CarPlay and Android Auto), Wireless charging system for mobile devices in the front, Driver display - 31.2 cm (12.3") color LCD display, Central display - 30.2 cm (11.9") touch display, MBUX Augmented Reality for navigation.)
- Package: High-end light package Multibeam D3L
- Package: Luggage compartment comfort (electrically folding rear seat backrests via switches on the right and left in the control panel in the load compartment - electric opening and closing of the load compartment roller blind - 12V socket on the left in the control panel in the load compartment - reversible mat, with a rubberized, non-slip side and a soft velour side)
- Package: Mirror package (both exterior mirrors electrically folding (button in the driver's door control panel) - interior mirror and exterior mirror on the driver's side automatically dimming continuously - ambient lighting of the exterior mirror to illuminate the entry area with projection of the Mercedes-Benz logo)
- Radio accessories: Advanced sound system (with 9 speakers and 225 watts system power)
- Wheels: 45.7 cm (18") AMG light-alloy wheels in 5-spoke design (aerodynamically optimized, painted black and high-sheen finish with front axle 225/45 R 18 on 7.5 J x 18 ET 40, rear axle 245/40 R 18 on 8.5 J x 18 ET 52)
- Seats: Heated rear seats
- Auxiliary heating
- Heat and noise insulating acoustic glass (for windshield and front doors)
- Black fabric headliner
- KEYLESS-GO (access and driving authorization system)
- THERMOTRONIC automatic climate control with 4 climate zones (controlled via the central display or the climate control unit in the center console, with Auto button for automatic control of temperature, air volume and air distribution - control unit on the back of the center console - automatic recirculation when a tunnel is detected via GPS, only in conjunction with navigation system - sensors for detecting e.g. inside/outside temperature - fine dust activated carbon filter - ventilation system - dew point sensors - residual heat function for efficient use of engine waste heat)
- Package: Air Balance (fragrance generator with filled fragrance bottle and function button in the glove compartment - ionizer in the side vent channel - improved filter system between the intake area and the air distribution system of the air conditioning unit)
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC, Active Speed Limit Assist, Extended Automatic Restart on Highways, Route-Based Speed Adaptation with Traffic Jam End Function, Active Traffic Jam Assist, Active Steering Assist, Active Lane Change Assist, Active Emergency Stop Assist, Emergency Lane Function, Active Brake Assist with Vehicle, Bicycle and Pedestrian Detection; Intersection Function, Turn Function, Traffic Jam End Emergency Braking Function, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, PRE-SAFE Impulse Side)
- Package: High-End Comfort Package (Seat heating for driver and front passenger - Memory Package: Driver and front passenger seats, steering column and exterior mirrors electrically adjustable and storable; Seat longitudinal position and headrest height additionally electrically adjustable; 3 memory settings each for driver and front passenger; 4-way lumbar support for driver and front passenger; Seat cushion depth adjustment with gapless cushion; PRE-SAFE positioning function for the front passenger seat)
- Package: Night (for T-Model with AMG Line exterior) (Radiator grille: diamond grille with silver pins and high-gloss black louvre (18") AMG light-alloy wheels in 5-spoke design, aerodynamically optimized, black-painted, high-sheen finish, with front axle 225/45 R18 on 7.5Jx18 ET40, rear axle 245/40 R18 on 8Jx18 ET52 AMG front apron with high-gloss black wing trim. Rear bumper with high-gloss black wing trim. Belt trim strip and window surrounds in high-gloss black. Exterior mirror housings in high-gloss black. Heat-insulating dark-tinted rear glass (from the B-pillar). Roof rails in black.)
- Heated windshield washer system
- Sunroof: Electric panoramic sunroof
- Seats: Sports seats
- Type designation removed from trunk lid
- Heat-insulating dark tinted glass



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Bonnet	Bonnet - dent(s) - Smooth repair work
2	Door - front left side	Door edge - Scratched - Smart repair
3	Wheel / tyres	Tyre - front right side (nicht fahrbereit) - Damaged - Replace
4	Wheel / tyres	Tyre - rear right side - Damaged - Replace
5	Door - rear right side	Door - Scratched - Smart repair
6	Front axle	Axles / undercarriage (wegen der beschädigten Felgen) - Specify findings - Measure
7	Door - rear left side	Door - Scratched - Paint
8	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
9	Wheel / tyres	Alloy rim - rear right side (Materialabtrag) - Scratched - Replace
10	Rear bumper	Rear bumper - Broken / torn - repair according to calculation
11	Front bumper	Front bumper (Materialabtrag) - Scratched - repair according to calculation

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	2nd wheel set	2 alloy rims - Deformed - No deduction
3	2nd wheel set	1 tyre (225,45,18,w) - Broken / torn - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Das Fahrzeug verfügt über eine allgemeine hohe Lackstärke.

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigtem, nicht demontiertem Zustand.
Schadenausweitung möglich, Zusatzkosten können entstehen.

Der beiliegende Radsatz gehört nicht zur Ausstattung.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung, Mehrkosten und somit Abweichung der für die Stoßstange ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

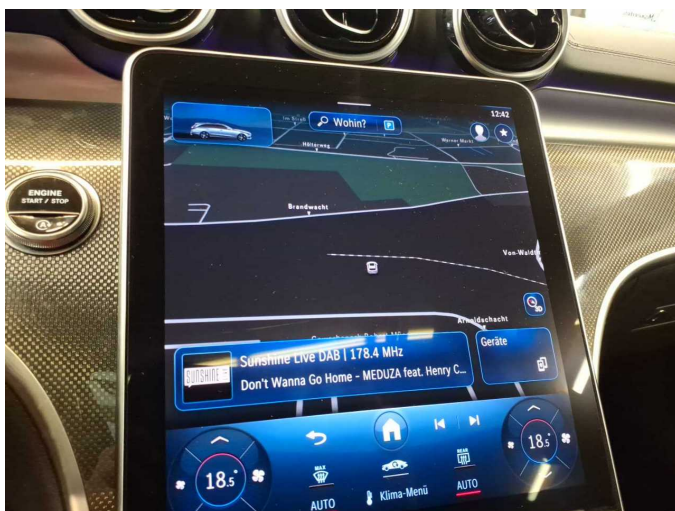


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

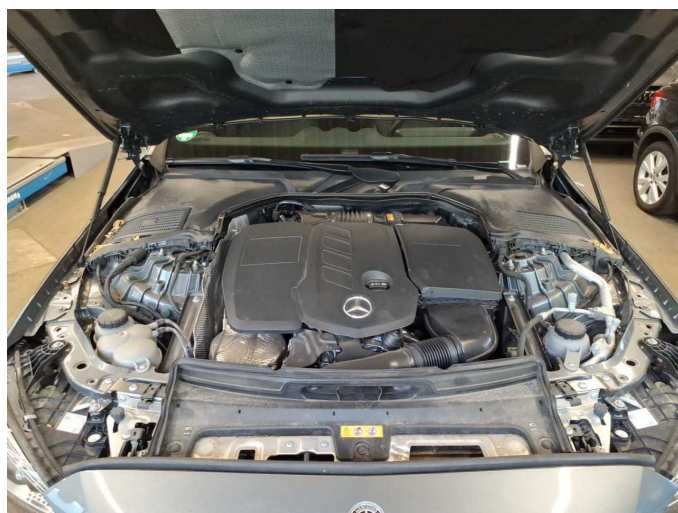


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

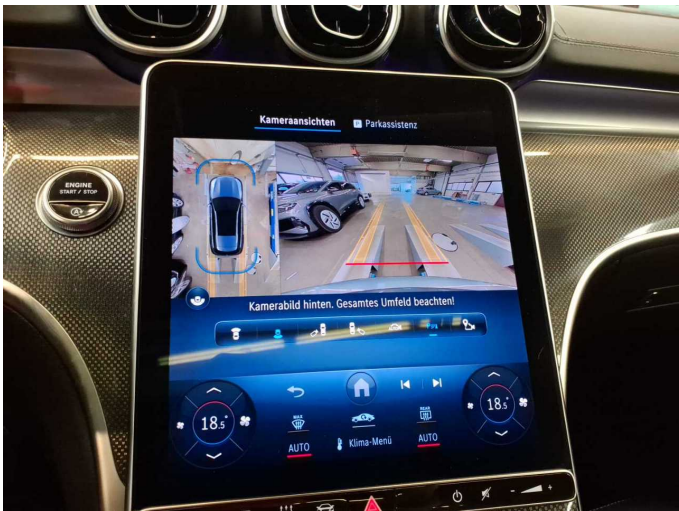


Figure 34: Misc.



Figure 35: Misc.




Damage 1: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 1: Bonnet: Bonnet - dent(s) - Smooth repair work




Damage 2: Door - front left side: Door edge - Scratched - Smart repair

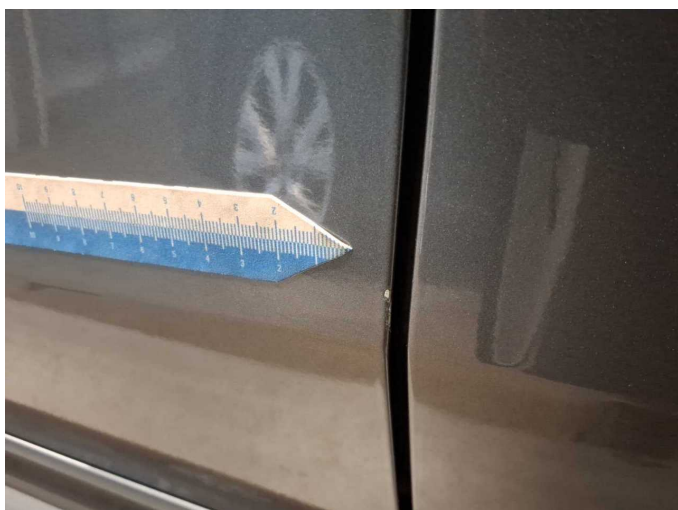

Damage 2: Door - front left side: Door edge - Scratched - Smart repair



Damage 3: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Damaged - Replace

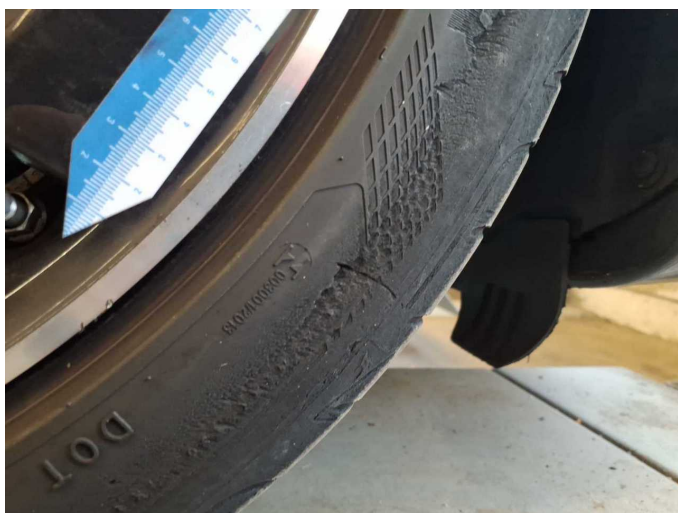


Damage 3: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Damaged - Replace



Damage 4: Wheel / tyres: Tyre - rear right side - Damaged - Replace




Damage 4: Wheel / tyres: Tyre - rear right side - Damaged - Replace

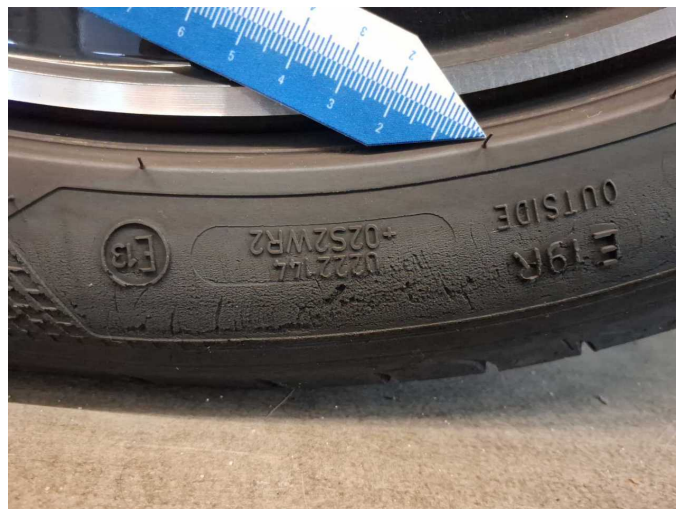

Damage 4: Wheel / tyres: Tyre - rear right side - Damaged - Replace



Damage 5: Door - rear right side: Door - Scratched - Smart repair

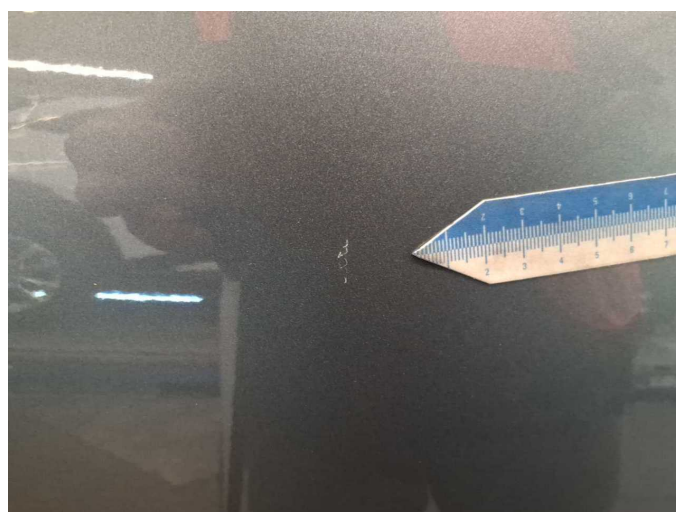


Damage 5: Door - rear right side: Door - Scratched - Smart repair



Damage 7: Door - rear left side: Door - Scratched - Paint



Damage 7: Door - rear left side: Door - Scratched - Paint

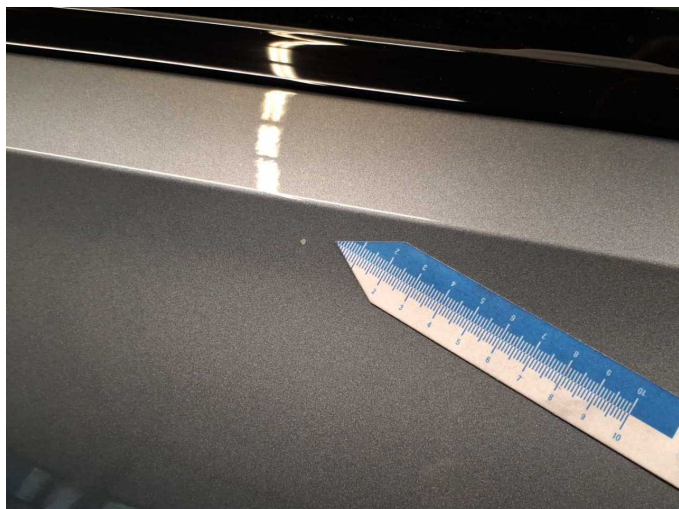


Damage 7: Door - rear left side: Door - Scratched - Paint




Damage 8: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value




Damage 8: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value

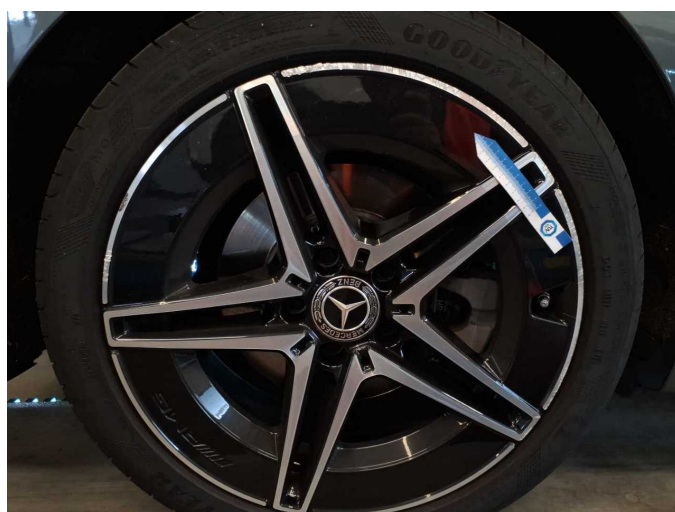

Damage 9: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace

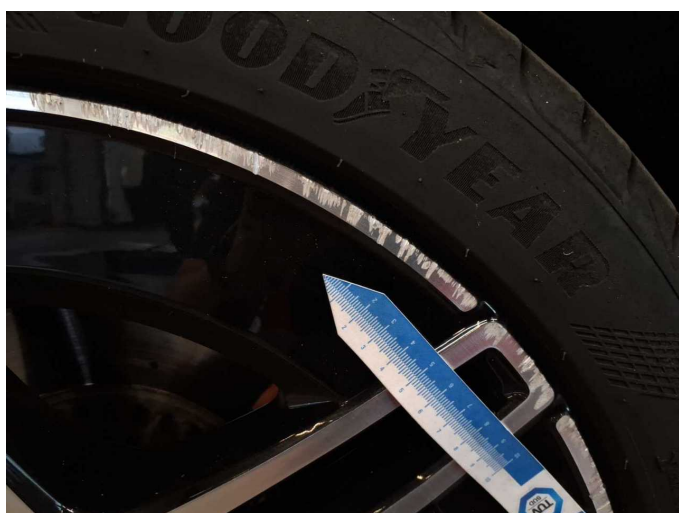

Damage 9: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace

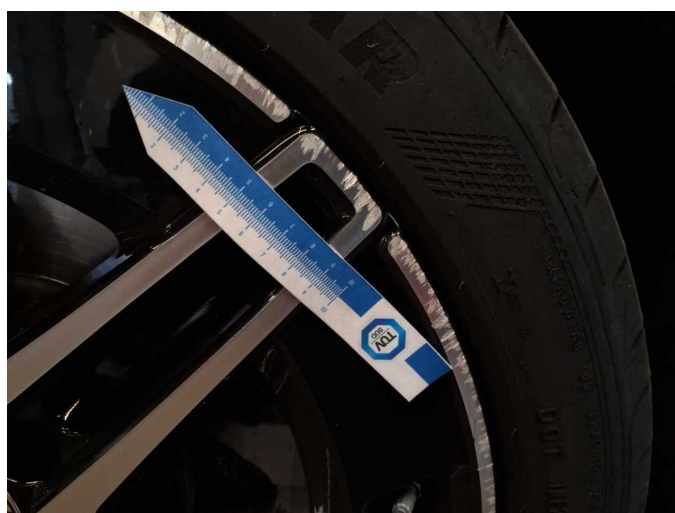

Damage 9: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Damage 9: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace




Damage 9: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Damage 10: Rear bumper: Rear bumper - Broken / torn - repair according to calculation



Damage 10: Rear bumper: Rear bumper - Broken / torn - repair according to calculation

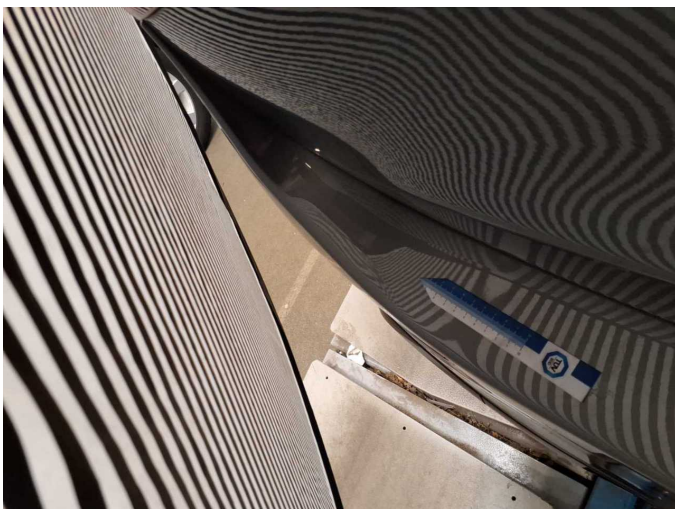

Damage 10: Rear bumper: Rear bumper - Broken / torn - repair according to calculation



Damage 10: Rear bumper: Rear bumper - Broken / torn - repair according to calculation



Damage 10: Rear bumper: Rear bumper - Broken / torn - repair according to calculation




Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation




Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation



Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation

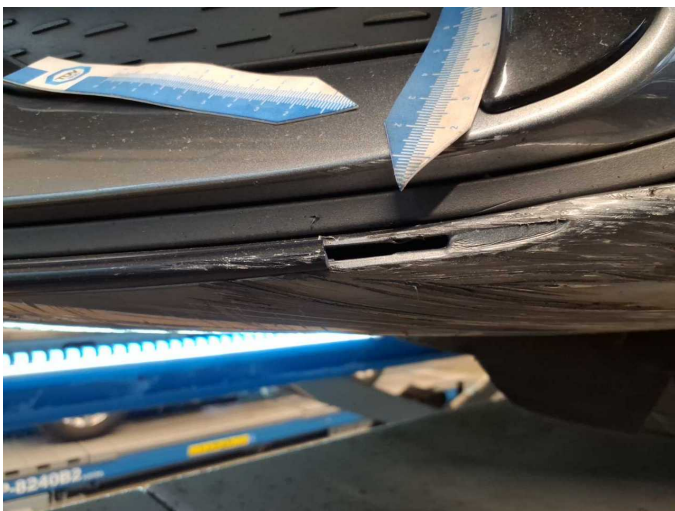


Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation

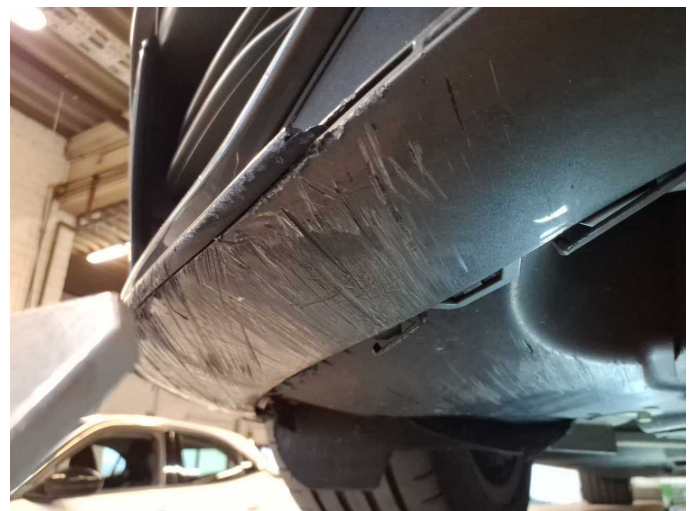

Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation



Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation

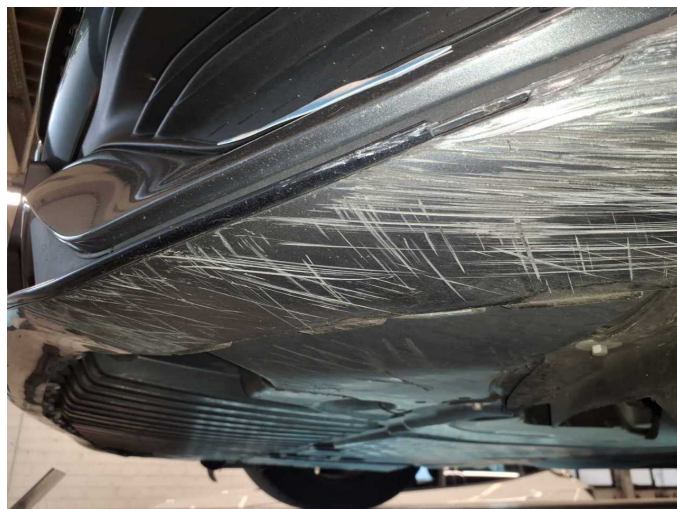

Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation



Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation



Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation



Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation



Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation



Damage 11: Front bumper: Front bumper (Materialabtrag) - Scratched - repair according to calculation



Wear and tear 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1KAH0FB4PF117471

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ C 220 d 4Matic T 9G-
TRONIC AMG Line

Datum	KM-Stand	Beschreibung
14.04.2026	78.842	Bremsscheiben vorne; Regelwartungsdienst
12.06.2025	51.499	Regelwartungsdienst
11.03.2024	24.802	Regelwartungsdienst