



Expertise

Protocol number: 46851103
Order No. / Reference: 26576812
Inspection date: 30 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1N4M1EB7PW335228

Model: GLB 220 d 8G-DCT AMG Line



ALPHABET



ALPHABET

Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLB 220 d 8G-DCT AMG Line	
Vehicle Identification number	W1N4M1EB7PW335228
Mileage (Read)	170,769 km
First registration	30 Nov 2023
Number of holders	1
Next periodical technical inspection	11/2026
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,950 ccm / 4
Power	140 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	MOUNTAINGRAU - METALLICLACK
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	164 Tag(e)
Last service on / at	01/2026 at 159,241 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GY536862
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ASE 00156		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,195 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R20 100W	Winter tyres on Light alloy	Bridgestone	4mm / 4mm
2)	235/45 R20 100W	Winter tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/40 R20 99W	Summer tyres (Without wheel rim)	Bridgestone	5mm / 5mm
2)	245/40 R20 99W	Summer tyres (Without wheel rim)	Bridgestone	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- AMG floor mats
- AMG Styling
- Rear armrest
- Automatic passenger airbag deactivation
- On-board computer
- Brake assist
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT
- Door sills with "Mercedes-Benz" lettering
- Chassis: Comfort chassis
- Luggage net on driver and passenger seatbacks
- Transmission: 8G-DCT dual-clutch automatic transmission, 8-speed
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control
- Headrests (2)
- Rear headrests (3)
- Paint finish: Solid
- Cargo area cover (roller blind)
- Steering column mechanically adjustable lengthwise and heightwise.
- Navigation accessories: Extended MBUX functions
- Package: Seating comfort
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Tire pressure monitoring system (TPMS)
- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4 in 5-twin-spoke design
- Seats: Rear seat backrests foldable
- 12V power outlet in center console
- High-visibility vest for drivers
- Decorative elements carbon structure
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- AMG sports pedal system
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Roof rails in polished aluminum
- Double cup holder
- Third brake light in LED technology
- ECO start/stop function
- Electronic Stability Program (ESP)
- Electric window regulators (4)
- Speed Limit Assistant
- Halogen headlights including integrated LED daytime running lights
- rear window wiper
- KEYLESS-GO start function
- Communication module (LTE) for the use of Mercedes me connect services
- Fuel tank with larger volume 60 l
- Loading floor height-adjustable and removable
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Package: Light and Visibility Package
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Radio accessories: Digital radio
- Rain and light sensor
- Remote Services Plus
- Windscreen wipers with rain sensor
- Power steering
- Seats: Sports seats
- Cruise control
- Immobiliser



Extra equipment

- Storage compartment in center console with roller blind (The roller blind for the storage compartment in the center console offers you an elegant privacy screen made of high-quality material. This looks good, the interior appears even tidier, and everything important is within easy reach. Typical everyday items such as a smartphone, wallet, or various keys fit into the practical storage compartment.)
- Towbar with ESP trailer stabilization
- Chassis: Adjustable damping (The chassis with adjustable damping offers this fascinating range. The DYNAMIC SELECT rocker switch in the center console selects the program and thus the characteristic. It's as if you had two chassis in one car – refined sportiness.)
- Paint finish: Metallic
- Steering: Direct steering
- MULTIBEAM LED (18 individually controllable high-performance LEDs per MULTIBEAM LED module for creating a column-shaped high beam with 16 controllable individual segments - Low beam and high beam in LED projection technology - Adaptive Highbeam Assist Plus (glare-free permanent high beam) - Cornering lights or cornering lights with roundabout and intersection function (only in conjunction with hard drive navigation) - Active curve illumination when high beam is activated - City light, country road light and motorway light - Adaptive full-LED rear lights)
- Package: KEYLESS-GO Comfort (vehicle key with KEYLESS-GO functionality - KEYLESS-GO access and drive authorization system - start/stop button - comfort opening and closing - door handles with chrome inlay - HANDS-FREE ACCESS - handle recess lighting - remote trunk lid closing - EASY-PACK trunk lid)
- Package: Night (AMG Line) (Door trim in black with inlay in running board design in high-gloss black - Exterior mirror housings in black - Belt edge trim and window line trim strip in high-gloss black - Roof rails in black - Heat-insulating dark tinted glass - 48.3 cm (19") AMG light alloy wheels in 5-twin-spoke design, aerodynamically optimized, high-gloss black and glossy, with 235/50 R 19 tires on 7.5 J x 19 ET 53 - Diamond grille with chrome pins, individual flames in black and chrome inlays, as well as AMG-specific front airbags with inlays in high-gloss black - AMG rear airbags with trim elements in high-gloss black)
- Package: Mirror package (Exterior mirrors electrically fold in and out via a button in the driver's door control panel - the menu allows you to set the exterior mirrors to fold in automatically when locking the vehicle and unfold again when unlocking - the exterior mirror on the driver's side and the interior mirror dim automatically and continuously depending on the incident glare and ambient light)
- Wheels: 50.8 cm (20") AMG multi-spoke light-alloy wheels, painted in high-gloss black (rim flange polished, 235/45 R 20 on 8 J x 20 ET 48)
- Seats: 4-way lumbar support for driver and front passenger
- Airbag: Side airbag in the rear
- Ambient lighting (in 64 colors, all colors are individually selectable - eight color worlds consisting of two colors each - the colors are statically set or slowly exchange each other in dynamic mode - the brightness of the LEDs can be adjusted in ten steps and three zones - the interior of the air vents is finished in silver chrome and illuminated - AMG Line and Progressive: additional lighting of the piping of the instrument panel above the trim element and in the doors)
- Black fabric headliner
- Climate control: THERMOTRONIC automatic climate control (two zones with individually adjustable temperature for driver and front passenger - automatic control of temperature, air volume and air distribution (Auto button) - sensors maintain the desired climate - fine dust activated carbon filter - dew point sensor prevents window fogging and enables energy-efficient climate control - rear center vents for improved climate comfort in the rear - residual heat button for heating/ventilation when the vehicle is switched off (country-dependent))
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Parking assistant with PARKTRONIC - Preparation for live traffic information)
- Package: MBUX High-End Package (Hard drive navigation - Smartphone integration - Wireless charging system for mobile devices - Preparation for digital key handover - Connectivity package navigation - Central Media Display 10.25" - Fully digital instrument display with high-resolution 10.25" display - MBUX Augmented Reality for navigation - Traffic sign assistant - Preparation for live traffic information)
- Package: Parking package with reversing camera (Active parking assistant with visual and acoustic warning of detected obstacles, notification of detected parking spaces in the instrument cluster via arrow display, assists with parking in and out of parallel and perpendicular parking spaces - reversing camera in the tailgate: display in the multimedia system screen with schematic representation and guidelines - ultrasonic sensors: located in the front and rear bumpers)
- Panoramic sunroof
- Radio accessories: Burmester surround sound system (with 12 speakers and 590 watts system power: - Premium midrange speaker as central speaker - one premium mid-bass speaker each in the front and rear doors - one premium tweeter each in the front doors (mirror triangles) and rear doors - two surround midrange speakers in the C-pillar - one subwoofer in the rear - external Class-D DSP amplifier, sophisticated sound optimization - visual enhancement through Burmester lettering and chrome trim)
- Sport brake system (drilled brake discs, brake calipers at the front and badges at the rear with Mercedes-Benz lettering)



- Seats: Electrically adjustable driver's seat with memory function in conjunction with the mirror package (the memory programming includes all seat adjustment options such as seat height and fore/aft position, seat cushion tilt, and backrest tilt – exterior mirrors and the optional head-up display are also integrated – dynamic seating while driving. Small movements of the seat cushion and backrest in three programs and two speeds).
- Telephone accessories: Wireless charging system for mobile devices (wireless charging according to Qi standard for compatible mobile phones - fast connection setup between multimedia system and mobile phone via Near Field Communication (NFC) for identification of the mobile device - storage compartment for wireless charging is located in the storage compartment at the front of the center console)
- Auxiliary heater (The auxiliary heater heats or ventilates the interior according to your preference even before you get in. A comfortable climate with clear windows at all times in winter, eliminating the stress and effort of defrosting. It's as if your car were parked in a garage instead of under a streetlamp – completely independent of a running engine.)
- Blind Spot Assist
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)
- Type designation removed from luggage compartment lid
- Decorative elements, black open-pore linden wood

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Sill - dent(s) - Smooth repair work
2	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
3	Mudguard - right side	Wheel well extension - Scratch(es) - Smart repair
4	Front bumper	Cover bumper - front - Scratched - Smart repair
5	Rear bumper	Rear bumper - Scratched - Smart repair
6	Mudguard - right side	Mudguard - right side - Scratched - Smart repair
7	Front bumper	Spoiler (Sandstrahleffekt) - Stone chips - Paint
8	Wheel / tyres	Tyre - front - Does not meet the leasing specifications - Replace
9	Wheel / tyres	Wheel rim - rear right side - Scratched - Loss in value
10	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
11	Body	A-pillar - left side (Sandstrahleffekt) - Stone chips - Paint
12	Bonnet	Bonnet (Sandstrahleffekt) - Stone chips - Paint
13	Front bumper	Front bumper (Sandstrahleffekt) - Stone chips - Paint
14	Vehicle glazing	Windscreen - Stone chips - repair according to calculation

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - No deduction
2	Door - rear left side	Door - dent(s) - Smooth repair work

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Sommerreifen gehören nicht zum fahrzeug, BMW x1 drauf notiert



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

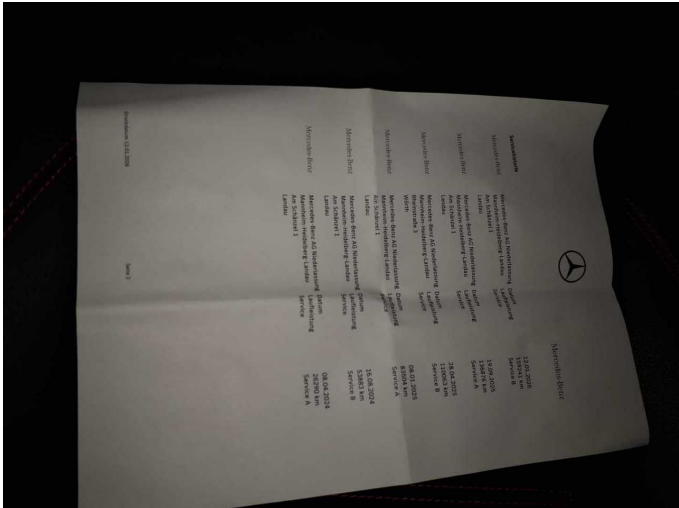


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

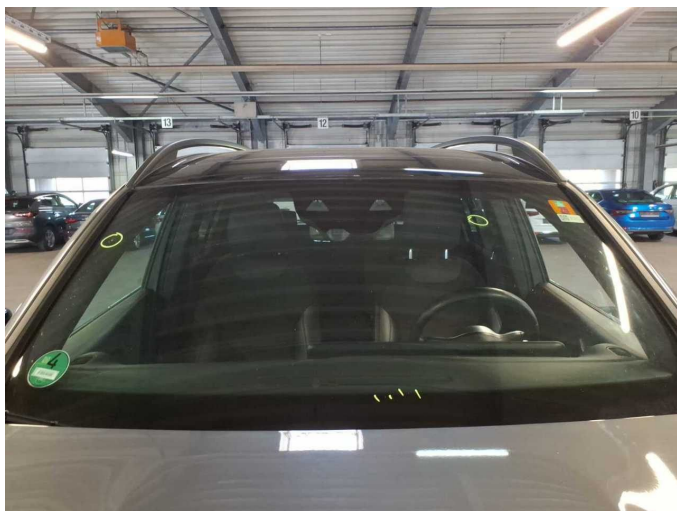


Figure 21: Misc.

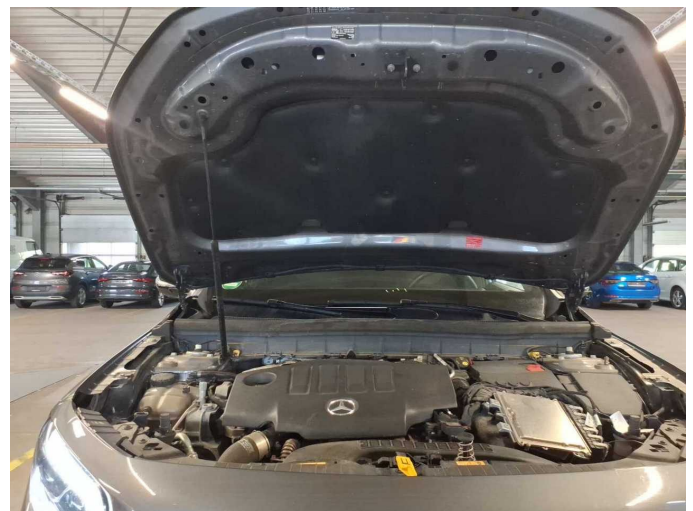


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

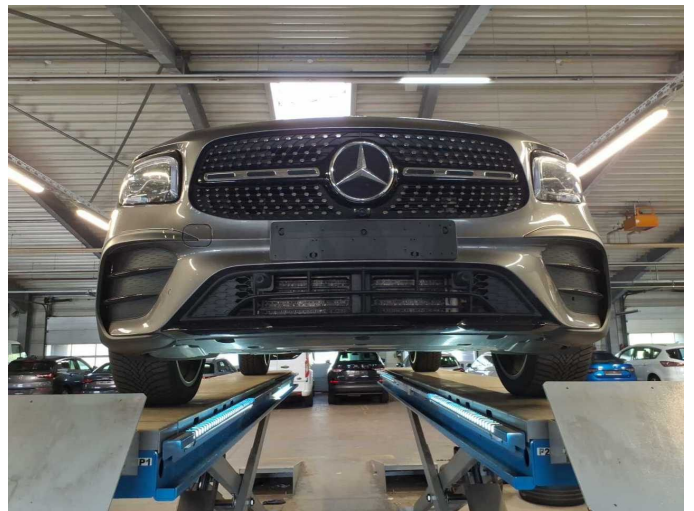


Figure 28: Misc.



Figure 29: Misc.

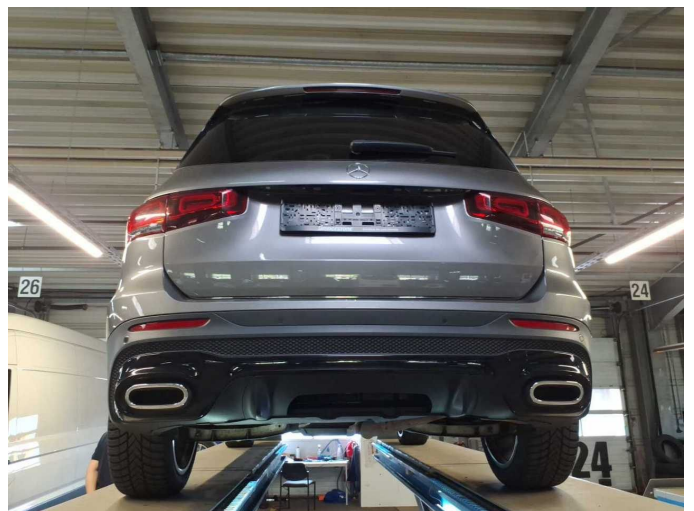


Figure 30: Misc.



Figure 31: Misc.



Damage 1: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 1: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 2: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 2: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 3: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair




Damage 3: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair

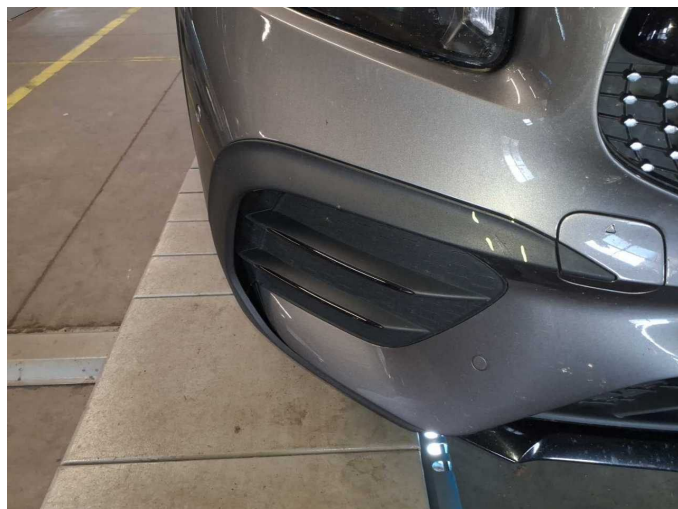

Damage 4: Front bumper: Cover bumper - front - Scratched - Smart repair

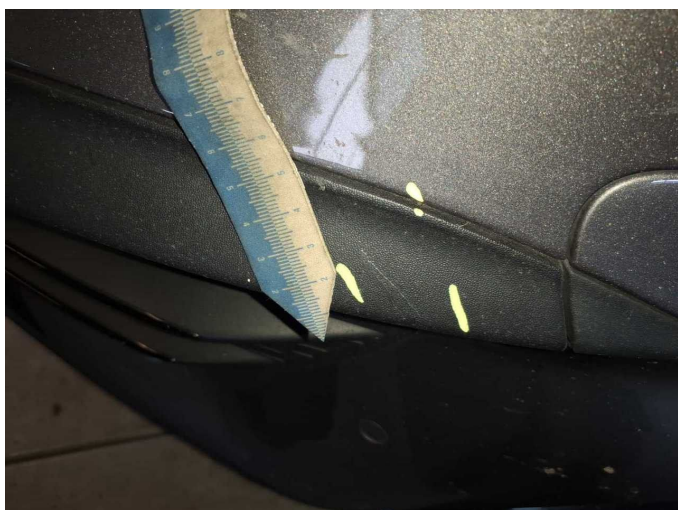

Damage 4: Front bumper: Cover bumper - front - Scratched - Smart repair

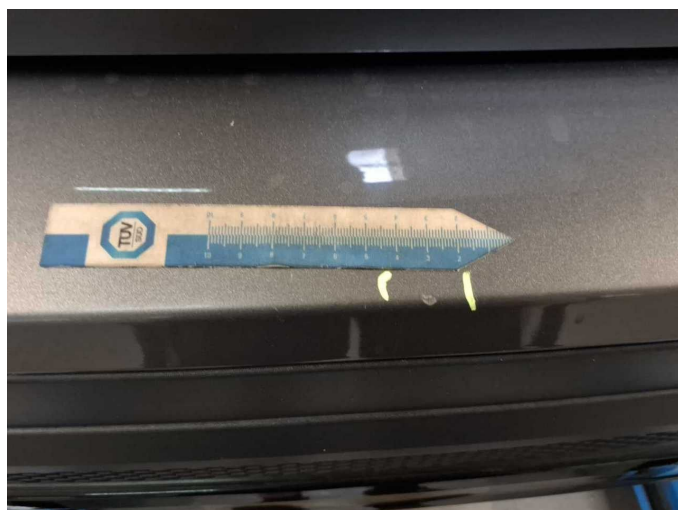

Damage 5: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 5: Rear bumper: Rear bumper - Scratched - Smart repair




Damage 6: Mudguard - right side: Mudguard - right side - Scratched - Smart repair



Damage 6: Mudguard - right side: Mudguard - right side - Scratched - Smart repair



Damage 7: Front bumper: Spoiler (Sandstrahleffekt) - Stone chips - Paint

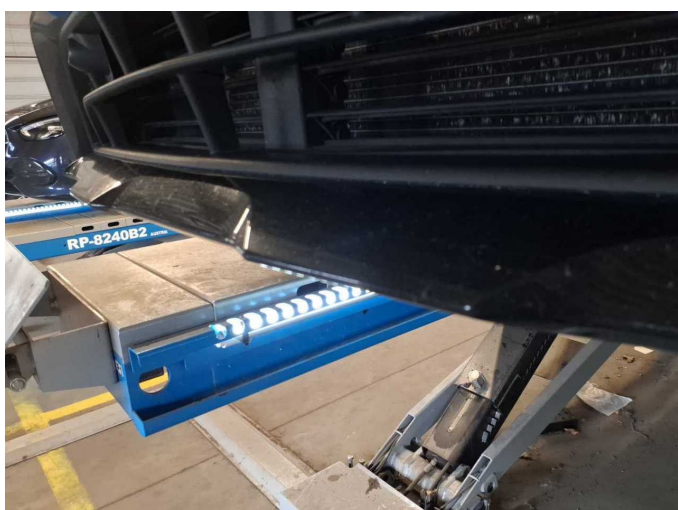

Damage 7: Front bumper: Spoiler (Sandstrahleffekt) - Stone chips - Paint



Damage 7: Front bumper: Spoiler (Sandstrahleffekt) - Stone chips - Paint



Damage 8: Wheel / tyres: Tyre - front - Does not meet the leasing specifications - Replace



Damage 8: Wheel / tyres: Tyre - front - Does not meet the leasing specifications - Replace



Damage 8: Wheel / tyres: Tyre - front - Does not meet the leasing specifications - Replace



Damage 9: Wheel / tyres: Wheel rim - rear right side - Scratched - Loss in value



Damage 9: Wheel / tyres: Wheel rim - rear right side - Scratched - Loss in value



Damage 9: Wheel / tyres: Wheel rim - rear right side - Scratched - Loss in value




Damage 9: Wheel / tyres: Wheel rim - rear right side - Scratched - Loss in value




Damage 10: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 10: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value

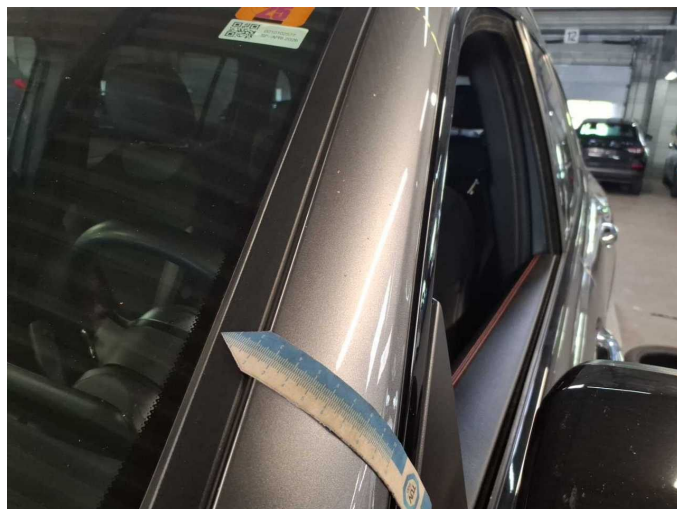


Damage 11: Body: A-pillar - left side (Sandstrahleffekt) - Stone chips - Paint

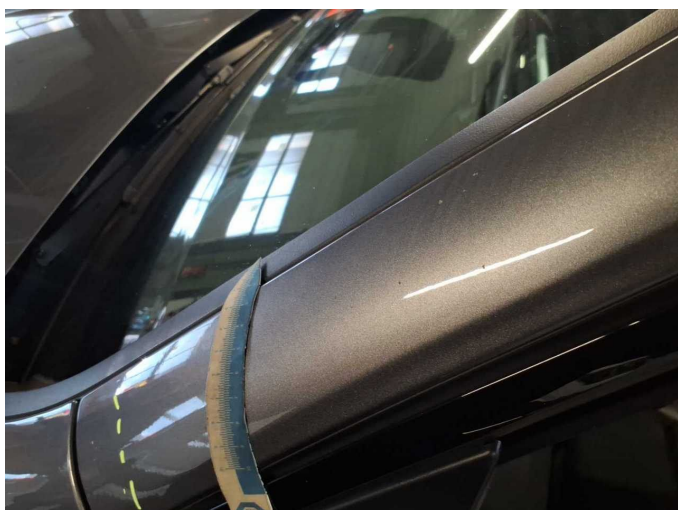

Damage 11: Body: A-pillar - left side (Sandstrahleffekt) - Stone chips - Paint



Damage 12: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

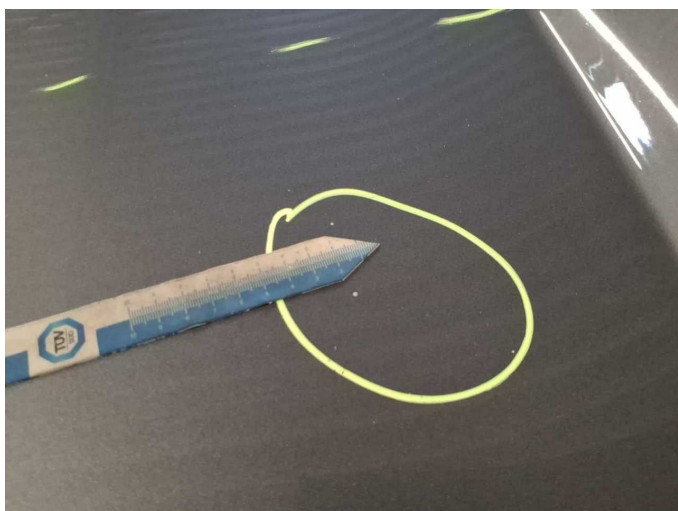

Damage 12: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint




Damage 12: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint



Damage 12: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint



Damage 12: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

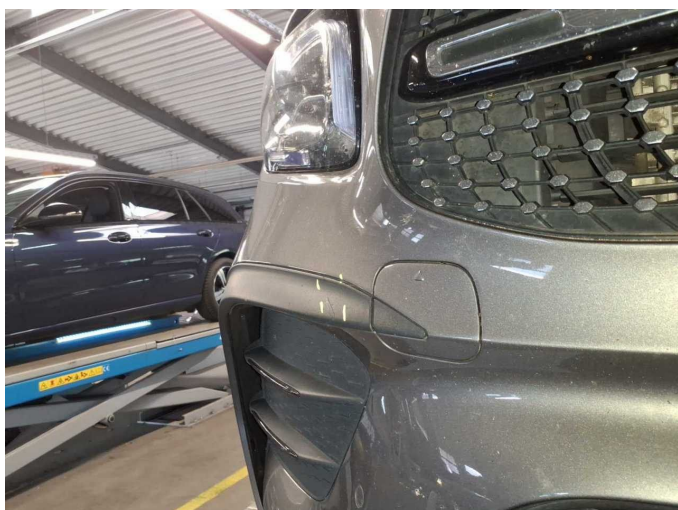

Damage 13: Front bumper: Front bumper (Sandstrahleffekt) - Stone chips - Paint



Damage 13: Front bumper: Front bumper (Sandstrahleffekt) - Stone chips - Paint



Damage 13: Front bumper: Front bumper (Sandstrahleffekt) - Stone chips - Paint



Damage 13: Front bumper: Front bumper (Sandstrahleffekt) - Stone chips - Paint




Damage 13: Front bumper: Front bumper (Sandstrahleffekt) - Stone chips - Paint




Damage 14: Vehicle glazing: Windscreen - Stone chips - repair according to calculation



Damage 14: Vehicle glazing: Windscreen - Stone chips - repair according to calculation

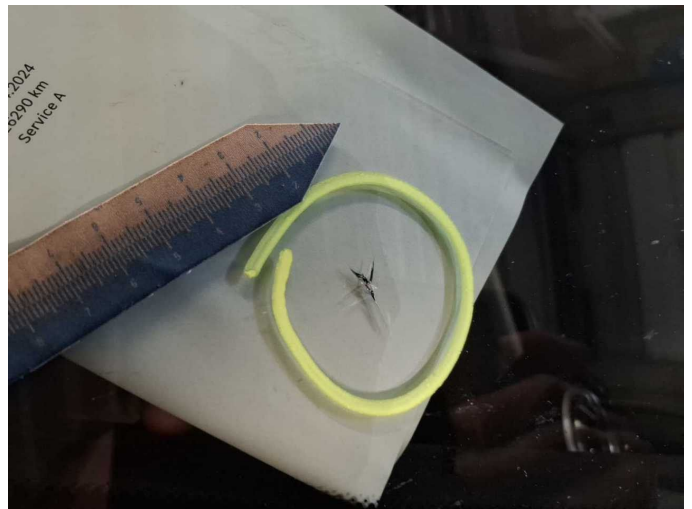

Damage 14: Vehicle glazing: Windscreen - Stone chips - repair according to calculation

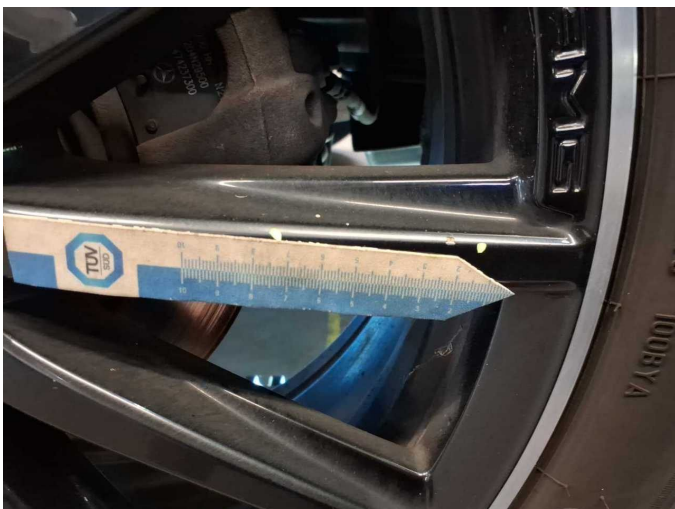

Wear and tear 1: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - No deduction



Wear and tear 1: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - No deduction



Wear and tear 2: Door - rear left side: Door - dent(s) - Smooth repair work



Wear and tear 2: Door - rear left side: Door - dent(s) - Smooth repair work



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N4M1EB7PW335228

Hersteller / Modell: MERCEDES-BENZ MB GLB 220 d 8G-DCT AMG Line

Datum	KM-Stand	Beschreibung
07.01.2026	159.241	Bremsinspektion vo + hi; Regelwartungsdienst
19.08.2025	136.876	Regelwartungsdienst
28.03.2025	110.063	Bremsscheiben+Beläge v+h; Regelwartungsdienst
19.11.2024	83.504	Regelwartungsdienst
16.07.2024	53.883	Bremsklötze vorne; Regelwartungsdienst
13.03.2024	26.290	Regelwartungsdienst