



Expertise

Protocol number: 46375850
Order No. / Reference: 26663212
Inspection date: 6 Jul 2026

Manufacturer: Opel

Model: Insignia Sports Tourer 2.0 Diesel Business

VIN: W0VZT8EP7N1029229



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Business	
Vehicle Identification number	W0VZT8EP7N1029229
Mileage (Read)	202,690 km
First registration	6 Oct 2022
Number of holders	1
Power / Engine displacement	128 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Argonsilber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Anthracite-Black
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	51 %
Last service on / at	01/2026 at 187,987 km		
Key is / should be	2 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GN188130
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1844 / AMC 00313		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,205 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97W	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	225/55 R17 97W	Summer tyres on Light alloy	Pirelli	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 06/2030		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments (storage compartment in the center console, pockets in the front doors suitable for 1.5-liter beverage bottles, pockets in the rear doors suitable for 1-liter beverage bottles, cup holder in the center console, illuminated glove compartment)
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Hill Start Assist
- Glasses compartment in the headliner
- Decorative strip hexagon
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Luggage compartment cover (extendable with comfort operation)
- Transmission: 6-speed manual transmission
- rear window wiper
- Automatic climate control, two zones
- Rear headrests (3 pieces) (height adjustable)
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Winter 1 (Heated seats, multi-stage, driver and front passenger - Heated leather steering wheel - Heated ThermoTec windshield)
- Radio: Digital radio reception DAB+
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Tire pressure display (with tire pressure warning - direct system with automatic calibration after wheel change)
- Wheels: Alloy wheels 7.5 J x 17 in 5 twin-spoke design (tires 225/55 R 17)
- Rear seat backrest folds forward in a 60:40 split
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)
- Lane Keeping Assist (warning in case of unintentional lane departure (between 60 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.)
- Bumpers painted in body color
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Pre-installation for child seat mounting system "ISOFIX" (rear)
- Immobiliser
- Thermal insulation glazing, green tinted
- Central locking with remote control (and interior switches)
- Adaptive brake light
- Airbag: Front and side airbags, driver and front passenger (front and side airbag, passenger, deactivatable)
- Airbag: Front and rear outer head airbags
- Ambient lighting (dashboard and doors (front))
- Electrically adjustable and heated exterior mirrors for driver and passenger side (manually foldable)
- third brake light
- Roof rails, silver anodized
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Pedestrian protection including active hood
- Noise-reducing, laminated front side windows
- Speed controller
- Back window, heater
- Child safety lock in the rear doors, manual
- Front headrests (height adjustable)
- LED headlights (automatic headlight range control)
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Electric parking brake (including 12-volt socket)
- Parkpilot, front and rear parking aid
- Quickheat rapid heating system
- Radio: Multimedia Navi Pro with 8" color touchscreen display (voice control for audio, telephone and navigation, USB port, Bluetooth audio streaming, navigation system with SD card storage, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, steering wheel controls, Apple CarPlay and Android Auto)
- Power steering (speed-dependent)
- Safety net (for installation behind the 1st or 2nd row of seats)
- Visibility equipment (rain sensor, front)
- Seats: Ergonomic active seat (AGR) driver (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electropneumatically adjustable in height and length - extendable thigh support, manually adjustable - headrest, height and tilt adjustable)
- Start/Stop system (reinforced starter, high-performance battery, brake energy recuperation, switch to deactivate the start/stop function)
- Traffic sign assistant (recognition of speed limits, no-overtaking zones and their cancellation, additional information signs (e.g., for wet conditions, slippery surfaces, left/right directions) on standard traffic signs, beginning and end of motorways, expressways and traffic-calmed areas, display of the recognized sign in the driver information display (depending on traffic sign quality, visibility and weather conditions).)



Extra equipment

- 3. Key
- Package: Business Premium (Easy Access Package: Keyless locking and starting system, sensor-controlled tailgate, electric loading sill protection, stainless steel - Charging Package: Wireless charging, 2 USB ports, rear center console - Park & Go: Digital reversing camera, reversing assistant, lane change assistant, blind spot warning in both exterior mirrors - Innovation Package 1: IntelliLux LED Pixel headlights, traffic sign assistant - Solar Protect heat-insulating glass, heavily tinted, in the rear)
- Package: Sound (Bose sound system)
- Paint finish: Metallic
- GS Line interior equipment (GS Line sport leather steering wheel, heated - aluminum - sport pedals - black headliner)
- Upholstery: Monita fabric/Premium leather look including Winter Package 2 (Ergonomic active seat, certified by the Campaign for Healthy Backs (AGR), front/front seat heating, multi-stage, front/front heated leather steering wheel, heated ThermoTec windshield, Seat Comfort Equipment 1: 8-way electrically adjustable driver's seat, electro-pneumatically adjustable lumbar support, memory function - driver and exterior mirrors, massage function, front exterior mirrors, electrically adjustable, heated, folding rear seat backrest with FlexFold function, 40:20:40 split, Charging Package: Wireless charging, 2 USB ports)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (2.,3. und 5. Wartung überzogen)
2	Body	Body - Glued / labelled - De-glue / neutralise
3	Roof	Roof rail - right side - Scratch(es) - Smart repair
4	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
5	Bonnet	Bonnet - Stone chips - Paint
6	Vehicle glazing	Windscreen - Stone chips - Replace
7	Front bumper	Front bumper - Scratch(es) - Paint
8	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Roof	Roof - dent(s) - No deduction
2	Side panel - rear right side	Side panel - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key (3 Schlüssel lt. Ausst.)



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

-Der montierte Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

- Keine Besichtigung des Unterbodens, Begutachtung Fahrwerk/Achsen/Aggregate nur bedingt möglich, Zusatzkosten können entstehen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

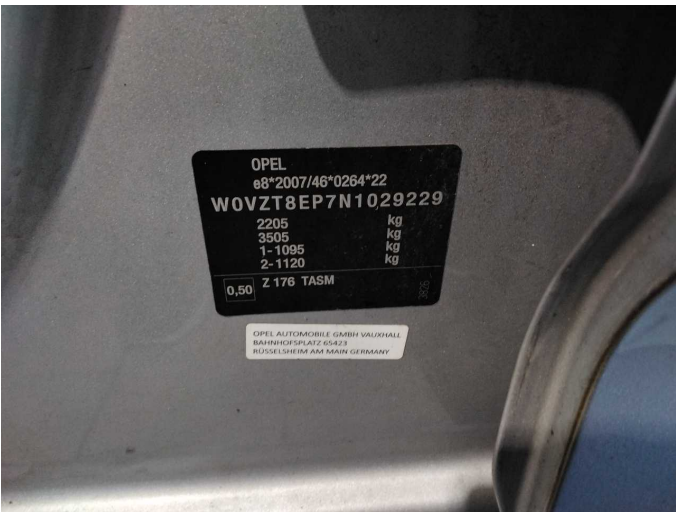


Figure 11: VIN



Figure 12: Mounted tyres

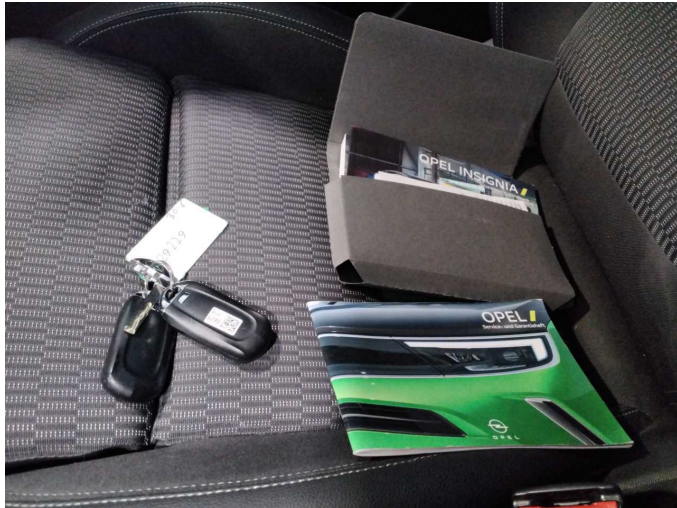


Figure 13: Documents

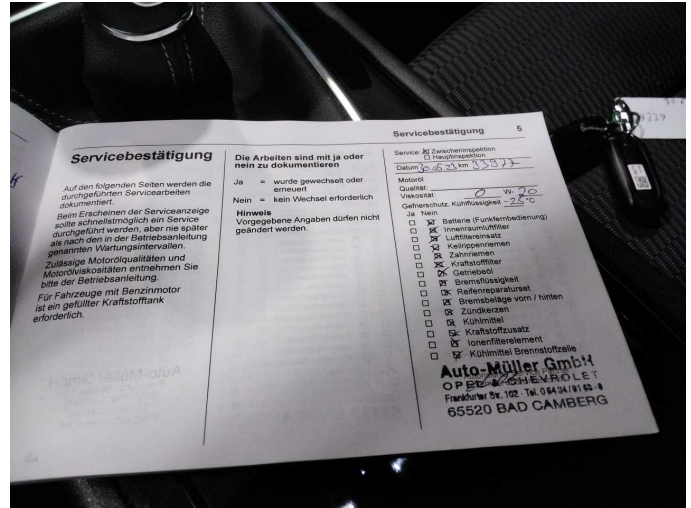


Figure 14: Documents

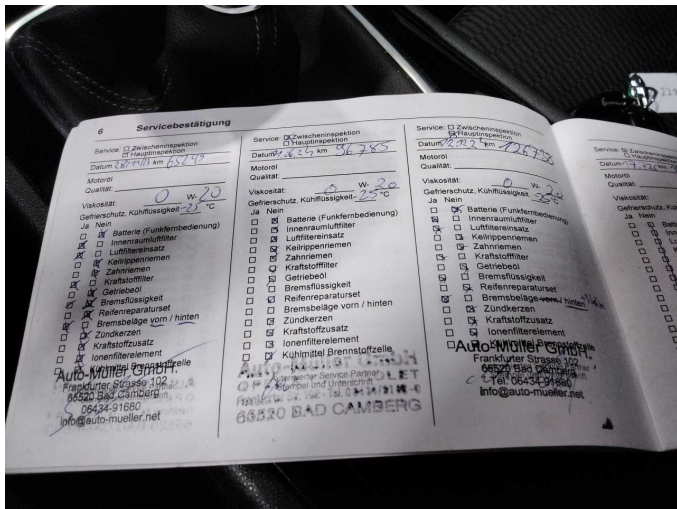


Figure 15: Documents

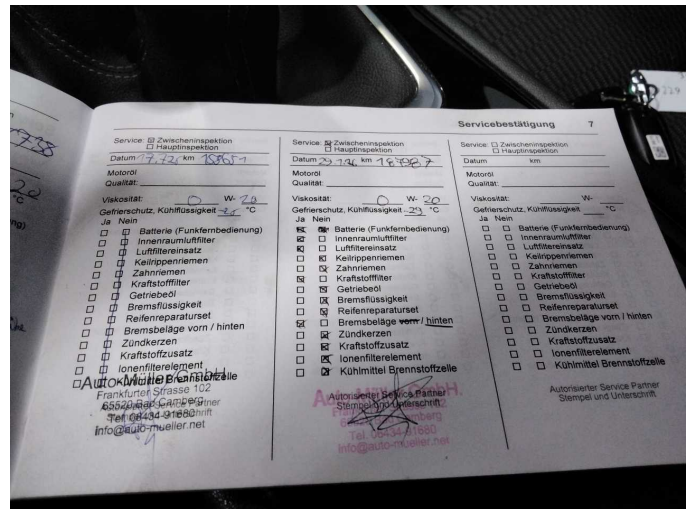


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

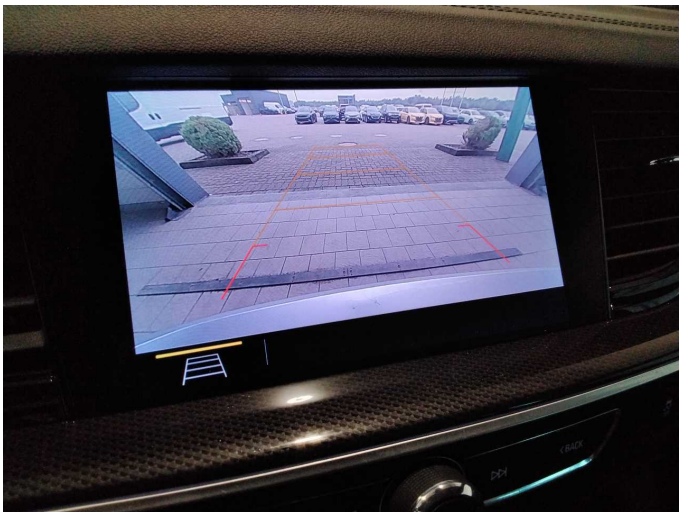


Figure 24: Misc.



Figure 25: Misc.

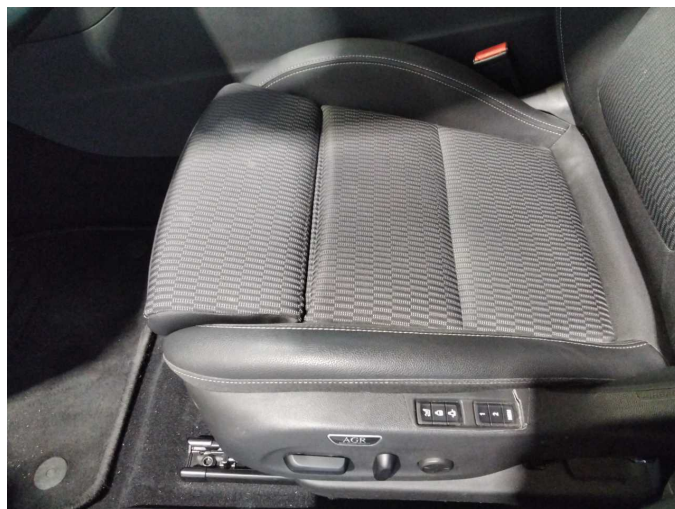


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



Damage 2: Body: Body - Glued / labelled - De-glue / neutralise

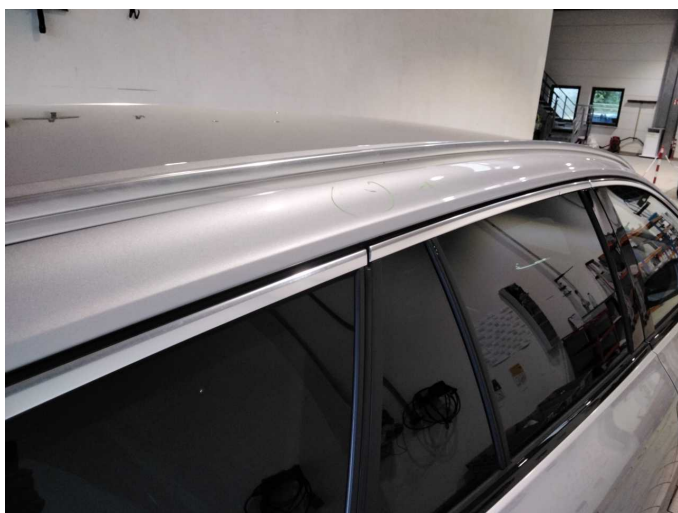


Damage 3: Roof: Roof rail - right side - Scratch(es) - Smart repair



Damage 3: Roof: Roof rail - right side - Scratch(es) - Smart repair



Damage 4: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value

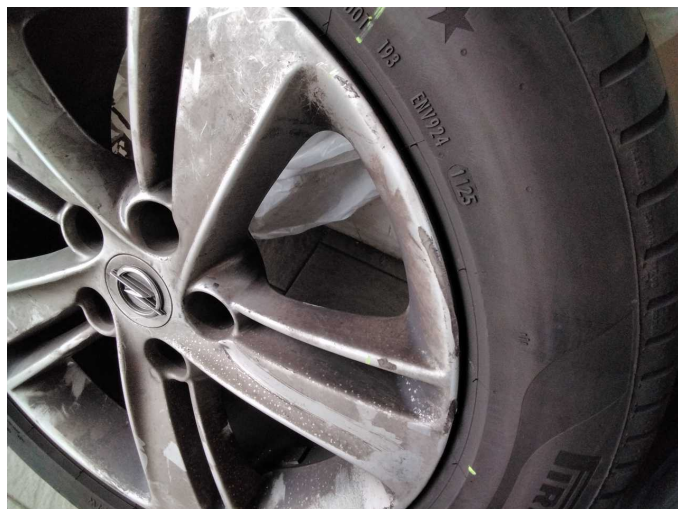


Damage 4: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 5: Bonnet: Bonnet - Stone chips - Paint



Damage 5: Bonnet: Bonnet - Stone chips - Paint

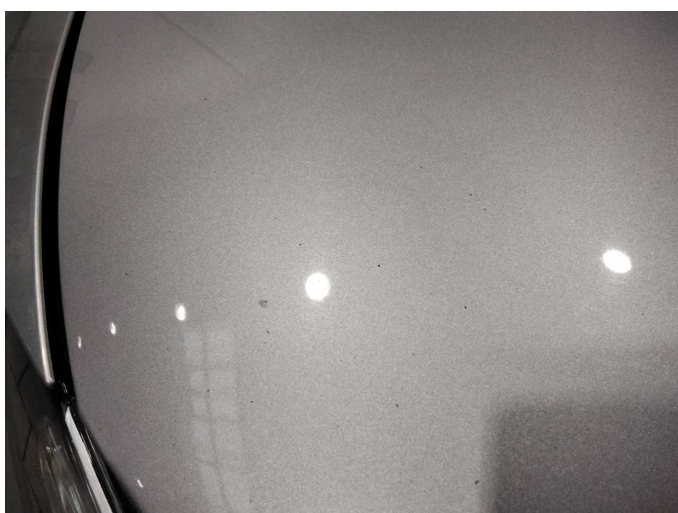

Damage 5: Bonnet: Bonnet - Stone chips - Paint



Damage 5: Bonnet: Bonnet - Stone chips - Paint



Damage 5: Bonnet: Bonnet - Stone chips - Paint



Damage 5: Bonnet: Bonnet - Stone chips - Paint




Damage 5: Bonnet: Bonnet - Stone chips - Paint



Damage 5: Bonnet: Bonnet - Stone chips - Paint




Damage 6: Vehicle glazing: Windscreen - Stone chips - Replace

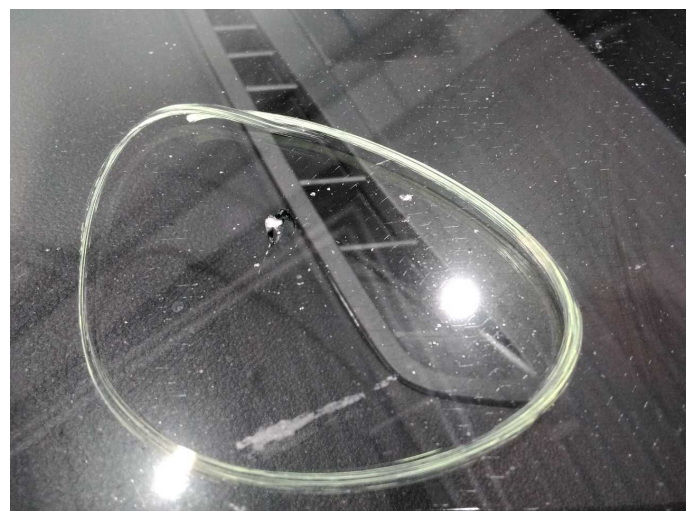


Damage 6: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 6: Vehicle glazing: Windscreen - Stone chips - Replace

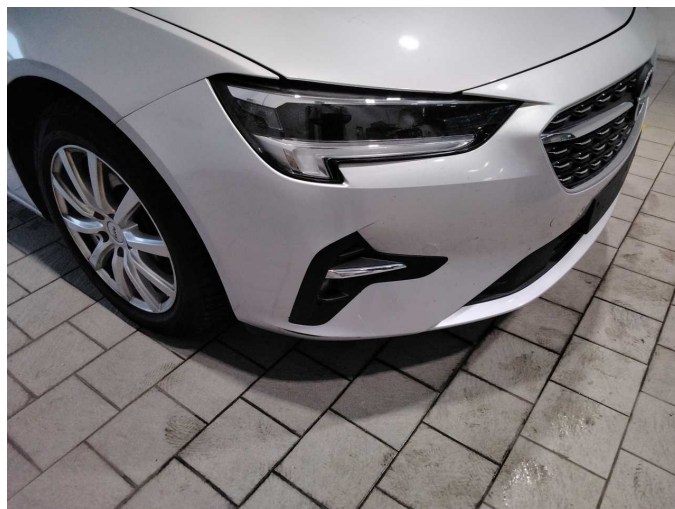

Damage 7: Front bumper: Front bumper - Scratch(es) - Paint

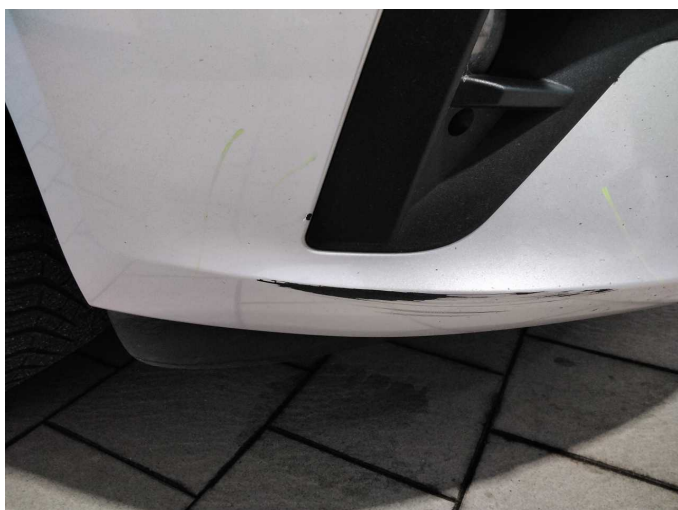

Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 8: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

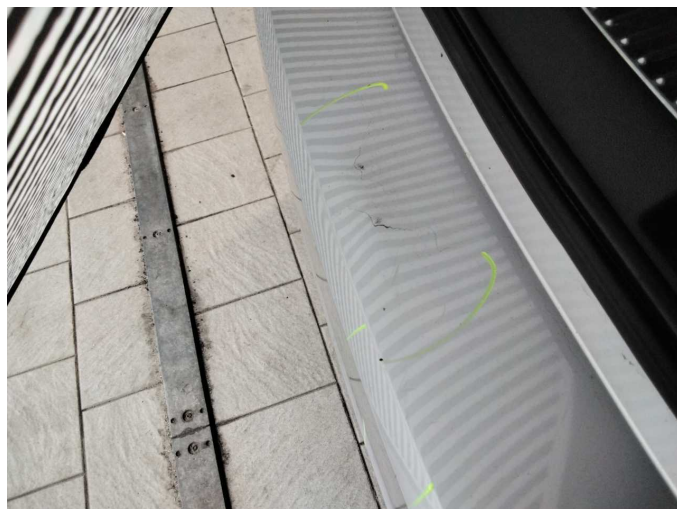


Damage 8: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Wear and tear 1: Roof: Roof - dent(s) - No deduction



Wear and tear 1: Roof: Roof - dent(s) - No deduction

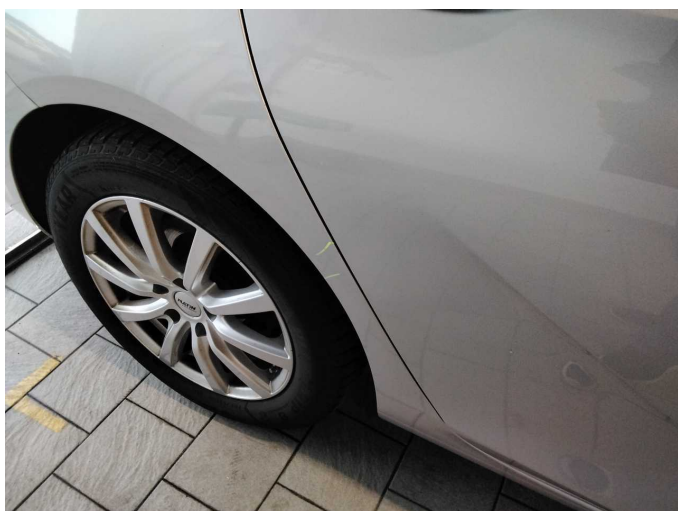

Wear and tear 2: Side panel - rear right side: Side panel - Scratch(es) - No deduction



Wear and tear 2: Side panel - rear right side: Side panel - Scratch(es) - No deduction