



Expertise

Protocol number: 46613904
Order No. / Reference: 26631899
Inspection date: 21 Jul 2026

Manufacturer: Volvo

Model: XC60 B4 D Core

VIN: YV1UZZK5V7R1751282



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC60 B4 D Core	
Vehicle Identification number	YV1UZZK5V7R1751282
Mileage (Read)	65,422 km
First registration	21 Jul 2023
Number of holders	2
Next periodical technical inspection	07/2027
(Report not on hand)	
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,969 ccm / 4
Power	145 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Vapour Grey
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Grey
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	17,780 km
Last service on / at	09/2025 at 53,202 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV801892
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	9101 / BTJ 00014		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,460 kg	Empty weight	
Dimensions	4708 x - x -		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107H	Winter tyres on Light alloy	Nokian	5mm / 5mm
2)	235/60 R18 107H	Winter tyres on Light alloy	Nokian	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105H	All-season tyres on Light alloy	Michelin	6mm / 6mm
2)	235/55 R19 105H	All-season tyres on Light alloy	Michelin	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Active safety belts with belt tensioners
- Airbag, driver's knee airbag
- Android infotainment system
- Automatic climate control with separate temperature control for driver and front passenger (and additional air vents for the 2nd row of seats (integrated in the B-pillar))
- Automatic tailgate (electric)
- Black roof rails (integrated)
- Cargo area roller blind
- Central locking with two remote controls and integrated emergency keys (automatic locking of doors while driving (can be deactivated) - comfort opening/closing of side windows and, if applicable, sunroof via remote control - panic function integrated into the remote control)
- Child safety lock for the rear doors (electric)
- Digital Services including Google Maps navigation system (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data) - Volvo On Call (includes, among other things, contacting the Volvo On Call service center at the touch of a button and additional convenience services via the Volvo CarsApp) - Usage is time-limited and will be subject to charges thereafter. Further information on renewal is available from a Volvo dealer partner.)
- Electric parking brake
- Electric windows front and rear (with auto-down and auto-up function)
- Electrically adjustable exterior mirrors
- First aid kit and warning triangle
- Front center armrest with integrated storage compartment and cup holders
- Front grille in waterfall design in high-gloss black
- Glazing: Colored glazing
- Hill Start Assist (HSA)
- Illuminated makeup mirror for driver and front passenger
- Immobiliser
- Interior lighting (headliner, front reading lights, front ambient lighting, front footwell, storage compartment behind center console, glove compartment and luggage compartment)
- Keyless Start (electronic engine start system)
- LED turn signals integrated into the exterior mirrors
- Luggage compartment partition net
- Outdoor temperature display
- Package: Parking Assistance (front and rear parking aid with automatic braking intervention (rear))
- Paint finish: Solid
- Power outlet (12-volt connection in the luggage compartment)
- Preparation for Trailer Stability Assist (TSA)
- Radio accessories: Digital radio reception (DAB+)
- Radio accessories: Two USB-C ports on the back of the center console
- ABS - Anti-lock Braking System
- Air quality system with activated carbon filter (automatic recirculation and pre-ventilation of the interior when the vehicle is unlocked)
- Airbag, side airbags for driver and front passenger and head/shoulder airbags for all occupants
- Aluminum door sill plates with Volvo lettering at the front
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Chrome window surround
- Diesel particulate filter
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver and passenger side airbags with two-stage deployment system
- Electrically folding exterior mirrors
- Electronic differential lock
- Electronic Stability Control (ESC)
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated below 10 km/h)
- Enhanced air quality system with fine dust filtration according to air quality standard PM2.5
- Fog sensor for automatic activation of the defroster function
- Front seat belt height adjustment
- Headrests (5) front and rear
- Headrests of the 2nd row of seats can be folded down (electrically)
- Heated exterior mirrors and rear window (automatic)
- Heated rear window
- Hill Descent Control (HDC)
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- Interior and exterior mirrors automatically dimming
- ISOFIX mounting for the outer rear seats
- Keyless Drive (electronic access system) (with sensor-controlled tailgate, illuminated door handles and floor lights)
- Lashing eyes in the luggage compartment (foldable)
- LED headlights "Thor's Hammer" (with high beam assist and integrated LED daytime running lights)
- On-board computer (with vehicle control functions)
- Parking ticket holder
- Passenger side airbag can be deactivated
- Phone: Inductive smartphone charging system (Wirelessly charges smartphones that support the Qi standard on a charging pad)
- Plastic loading sill protector in the luggage compartment
- Radio accessories: Smartphone integration Apple CarPlay
- Radio: Audio system High Performance Sound (220 watts of power - 10 speakers)
- Rain sensor



- Rear seats in a 40/60 split or completely foldable with pass-through function
- rear window wiper
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers including emergency call via Volvo On Call and door unlocking)
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Seats: Driver and front passenger seats height adjustable (electrically) (including manual tilt adjustment)
- Speed-sensitive power steering
- Start/Stop technology
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- third brake light
- Transmission: 8-speed automatic transmission
- Upholstery: Premium textile comfort seats (Insert: Iron Ore - Headliner: Light Beige)
- Whiplash protection system WHIPS (including immersion protection on all seats and energy-absorbing front seat cushions)

- Rear view camera
- Roof edge spoiler
- Safety Assistance (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection braking assistant and emergency braking assistant for oncoming traffic - Connected Safety - Driver Alert - Attention warning - Distance warning - Variable speed limiter - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assistant - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition)
- Seats: Lumbar support (2-way adjustable) for driver and front passenger seats
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)

Extra equipment

- Package: Winter Package (front seat heating - rear seat heating - steering wheel heating)
- Seats: Heated rear seats (outer seats of the 2nd row)
- Wheels: 19" 5-V-spoke alloy wheels, sport design, diamond cut/high-gloss black (all-season tires 235/55 R19 with rims 7.5 x 19")

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Engine	Engine cover (Dichtung L + R) - Damage caused by marten / rodent - Replace
2	Front bumper	Front bumper - Scratch(es) - Paint



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

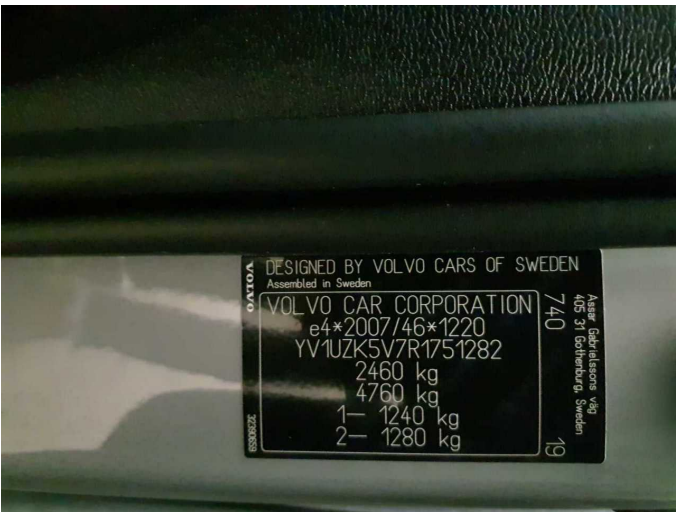


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

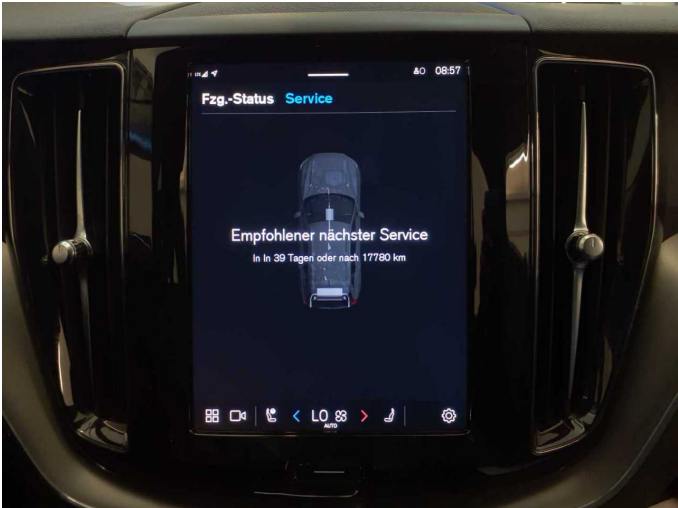


Figure 14: Documents

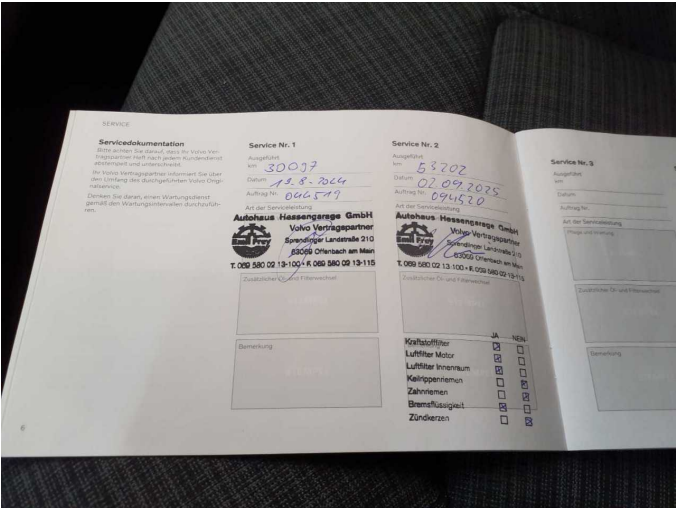


Figure 15: Documents



Figure 16: Additional tyres

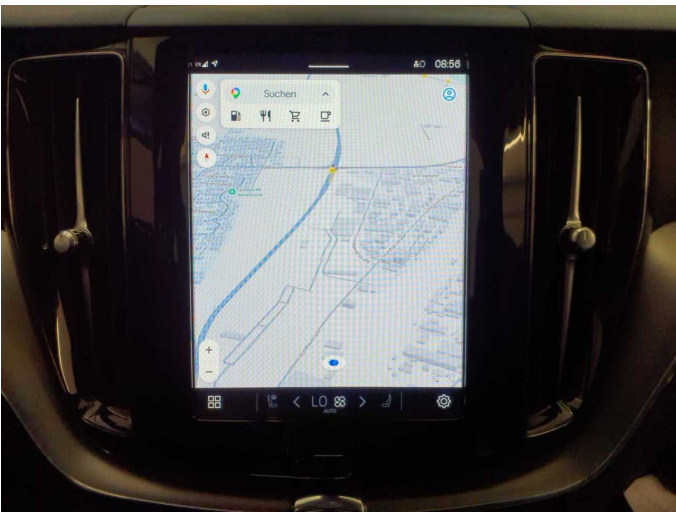


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

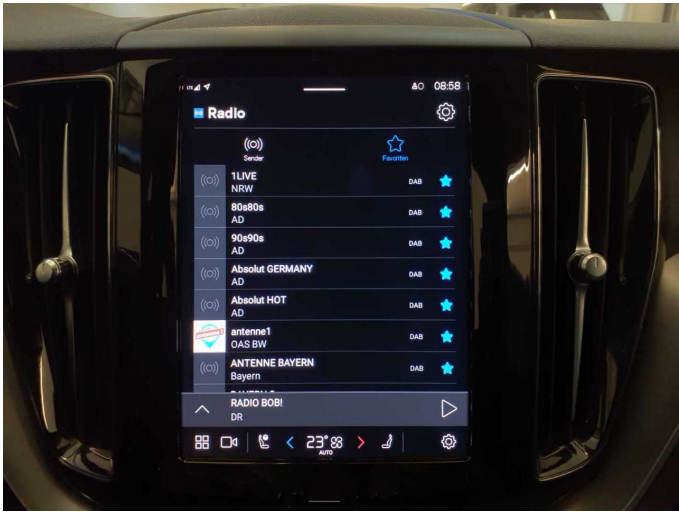


Figure 24: Misc.



Figure 25: Misc.

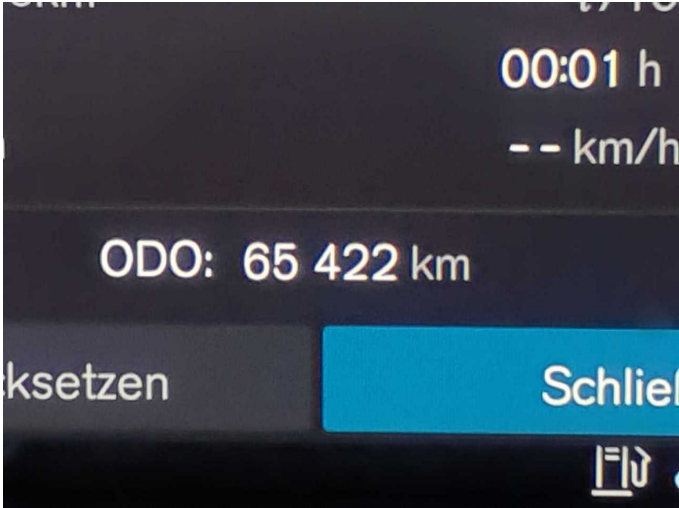


Figure 26: Misc.

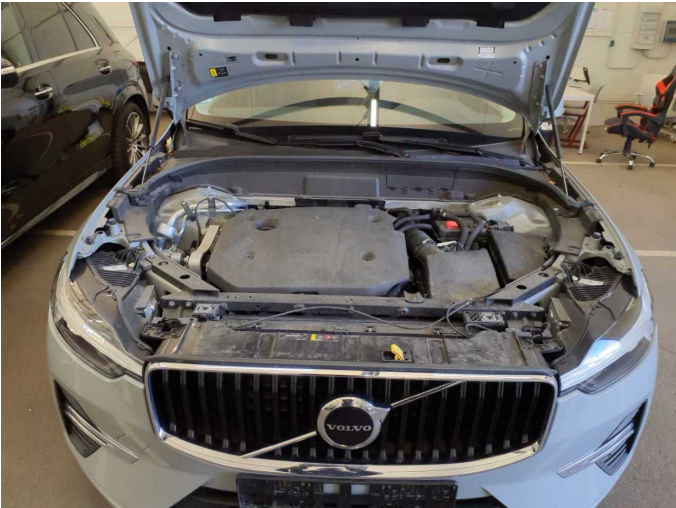


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.


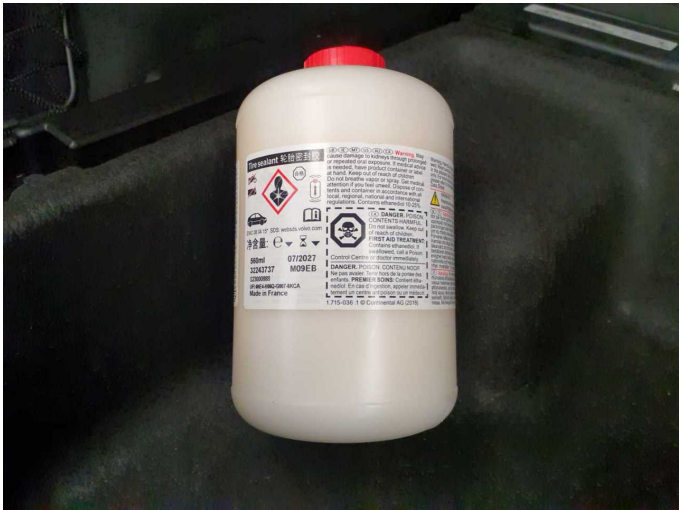



Figure 30: Misc.



Damage 1: Engine: Engine cover (Dichtung L + R) - Damage caused by marten / rodent - Replace

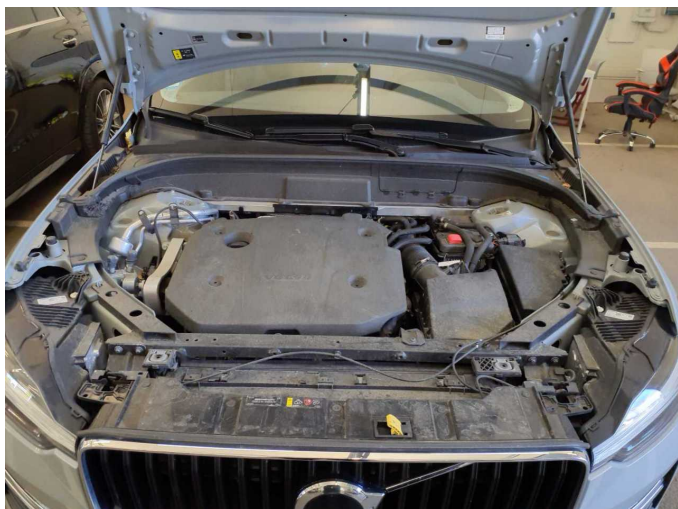

Damage 1: Engine: Engine cover (Dichtung L + R) - Damage caused by marten / rodent - Replace

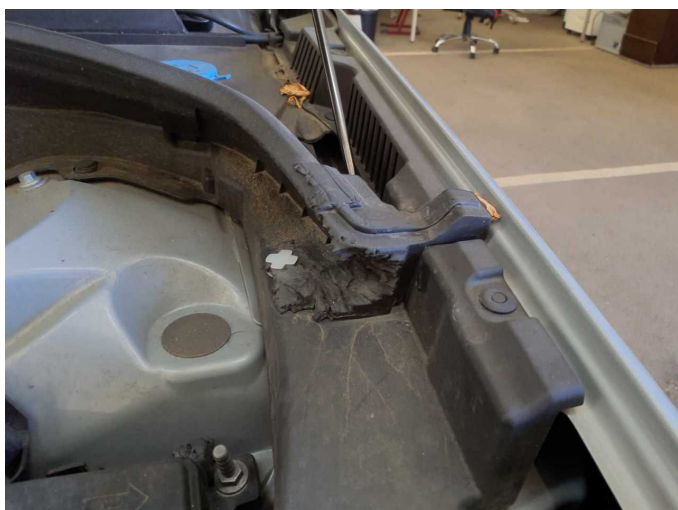

Damage 1: Engine: Engine cover (Dichtung L + R) - Damage caused by marten / rodent - Replace



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint

Wartungshistorie

(gemäß Auftraggeber Informationen)



Fahrgestellnummer: YV1UZZK5V7R1751282
Hersteller / Modell: VOLVO VOLVO XC60 B4 D Core

Datum	KM-Stand	Beschreibung
02.09.2025	53.202	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
20.08.2024	30.097	Motoröl b. Wartung; Motoröl b. Wartung; Motoröl b. Wartung; Ölfilter ern; Ölfilter ern; Ölfilter ern; Regelwartungsdienst; Regelwartungsdienst; Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges; Wartung Sonstiges