



Expertise

Protocol number: 46706265
Order No. / Reference: 26495895-1
Inspection date: 23 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1NKM0KB0TF536081

Model: GLC 300 de 4Matic 9G-TRONIC AMG Line Advanced



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 300 de 4Matic 9G-TRONIC AMG Line Advanced	
Vehicle Identification number	W1NKM0KB0TF536081
Mileage (Read)	5,096 km
First registration	17 Dec 2025
Number of holders	1
Next periodical technical inspection	12/2028
(Report not on hand)	
Fuel type	Hybr.D/E ext.aufl
Engine displacement / Cylinder	1,993 ccm / 4
Power	145 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Graphitgrau Metallic
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Grey-Anthracite
Re-import	no
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	151 Tag(e)
Key is / should be	2 / 2	FZG documents	Registration and title documents unavailable
		Letter No.	HQ461407
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BLB 00797		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,920 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	255/55 R18 109H	Winter tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/35 R19 105W	Summer tyres on Light alloy	Continental	7 mm
	235/55 R19 105W	Summer tyres on Light alloy	Continental	7 mm
2)	255/50 R19 107W	Summer tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2031		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaautomatik

|



Standard equipment

- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- 4MATIC all-wheel drive
- AMG front apron with sporty air intakes and chrome trim element
- AMG Line interior
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Automatic passenger airbag deactivation
- Roof rails made of glossy anodized aluminum
- Double cup holder
- Tachometer
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Driver display
- Fingerprint scanner
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control
- Communication module (5G) for the use of Mercedes me connect services
- Charging cable for household socket, 5m, smooth
- Charging system: Alternating current charging system (AC charging) up to 11 kW
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Center console in high-gloss black
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation accessories: Pre-installation for remote and navigation services
- Package: Storage compartment with cargo handle
- Package: Chrome Interior Package
- Package: Boot Comfort Package
- Package: Seating comfort
- Package: USB package
- Radio accessories: Digital radio
- Tire pressure monitoring system
- Wheels: 48.3 cm (19") AMG light-alloy wheels in a 5-spoke design
- Windscreen wipers with rain sensor
- Heated seats for driver and front passenger
- Phone accessories: Apple CarPlay
- Phone accessories: Smartphone integration
- Cruise control
- Immobiliser
- Central display
- Decorative elements: metal structure
- Airbag for driver and front passenger
- Airbag: Center airbag
- Airbag: Windowbag
- Active Lane Keeping Assist
- Ambient lighting
- AMG floor mats
- AMG Line Exterior
- AMG sports pedal assembly made of brushed stainless steel with black rubber studs
- ATTENTION ASSIST
- Basic services
- Diesel particulate filter
- Downhill Speed Regulation (DSR)
- Third brake light in LED technology
- EASY-Pack: Cargo area cover
- Driver observation camera
- Chassis: Comfort chassis
- Transmission: 9G-TRONIC
- Rear window wiper/washer system
- Instrument panel and door sills in ARTICO man-made leather in black nappa look
- Radiator grille with Mercedes-Benz pattern and integrated Mercedes star
- Charging cable for wallbox and public charging station, 5m, smooth
- LED High Performance Headlights
- Steering: Sport direct steering
- Mercedes-Benz emergency call system
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for navigation services
- Navigation: Hard disk navigation
- Navigation: MBUX Navigation Premium
- Package: AMG Line Advanced (for hybrid models)
- Package: Interior light
- Package: Parking package with reversing camera
- Package: Mirror Package
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Radio accessories: MBUX multimedia system
- Remote and Charging Services Plus
- Wheels: Summer tires
- Wheel accessories: TIREFIT with tire inflator compressor
- Seats: 4-way lumbar support for driver and front passenger
- Phone accessory: Android Auto
- Phone accessories: Wireless charging system for mobile devices at the front
- High-visibility vest for drivers
- Heat-insulating dark tinted glass
- Central locking with remote control

Extra equipment

- Center console diamond pattern silver grey
- Charging system: DC on-board charger (60 kW) (For your optimal charging speed with up to 60 kW)
- Heat and sound insulating acoustic glass (The heat and sound insulating acoustic glass for the windshield and front side windows offers you outstanding noise comfort. The glass effectively reduces background noise, allowing you to enjoy a particularly quiet travel environment. Acoustic glass: The glass features a special acoustic film and is specifically optimized to dampen high-frequency wind noise and primarily low-frequency engine noise.)
- Illuminated running boards in aluminum look with rubber studs
- Navigation accessories: MBUX Augmented Reality for Navigation (To help you find your way in complex traffic situations, MBUX Augmented Reality for Navigation connects the virtual world with the real one. The technology overlays graphical navigation and traffic information onto live images. You reach your destination quickly, safely and stress-free.)
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC, Active Speed Limit Assist, Extended Automatic Restart, Route-Based Speed Adaptation with Traffic Jam Definition, Active Steering Assist, Active Lane Change Assist, Active Emergency Stop Assist with SOS Radio, Emergency Lane Radio, Active Brake Assist, Turn and Intersection Radio, Traffic Jam Emergency Brake Radio, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, Exit Warning Radio, PRE-SAFE PLUS Pedestrian Warning Function, Traffic Sign Assist, Active Traffic Jam Assist, PRE-SAFE Impulse Side)
- Package: Parking package with 360° camera (12 ultrasonic sensors: 6 each in the front and rear bumpers - 360° camera: four networked cameras, display on the media display, trailer mode - Active Parking Assist PARKTRONIC: detects parking spaces, assisted parking, assisted exiting, visual and acoustic warning of detected obstacles, display of camera and ultrasonic data on the central display, button for Active Parking Assist with PARKTRONIC - cross traffic warning - maneuvering brake - drive-away assist)
- Paint finish: Metallic
- Sunroof: Panoramic sunroof (large glass module made of heat-insulating safety glass - mesh wind deflector in the front area - electric sunshade with one-touch operation - comprehensive protection concept: anti-pinch protection, automatic rain closing, automatic closing when the recirculation function is activated, PRE-SAFE closing function (only in conjunction with PRE-SAFE system))
- Traffic Sign Assistant (Camera and navigation data always keep an eye on the current speed limit – so you stay oriented even in a maze of signs. Because the system constantly informs you, the risk of violations decreases. This is not only convenient, but also increases safety in everyday road traffic.)
- Upholstery: ARTICO man-made leather
- Wheel arch trims in body color
- Wheels: Complete winter wheel sets fitted at the factory
- Black fabric headliner
- Climate control: THERMOTRONIC automatic climate control (4-zone automatic climate control: individually adjustable climate, with "Auto" button, control unit for rear passengers - automatic recirculation when a navigation system is selected - sensor system - interior air vents: center vents, side vents, footwell vents for driver/front passenger/rear, rear auxiliary blower, vents on the back of the center console - fine dust activated carbon filter - defrosting system - residual heat function)
- Decorative elements in diamond pattern, silver-grey
- Package: AMG Premium Plus (Memory Package - Blind Spot Assist - Illuminated door sills with "Mercedes-Benz" lettering and interchangeable covers - Traffic Sign Assist - Acoustic glass - KEYLESS-GO Comfort Package - DIGITAL LIGHT with projection function - Parking Package with 360° camera - Panoramic sliding sunroof - Head-up display - THERMOTRONIC automatic climate control - Burmester 3D surround sound system - MBUX Augmented Reality for navigation - Ambient lighting Plus)
- Package: Night for plug-in hybrid (radiator grille with Mercedes-Benz pattern and louvre in high-gloss black - attractive 48.3 cm (19") AMG light-alloy wheels in 5-spoke design, front axle 235/55 R19 on 8.0 J x 19 ET 32.5 and rear axle 255/50 R19 on 9.0 J x 19 ET 30 - AMG front apron with visual underguard in high-gloss black - beltline trim strip and window surrounds in high-gloss black - exterior mirror housings painted in high-gloss black - roof rails in matte black, rear apron and diffuser in black)
- Package: Winter Package Plus with 18" winter complete wheels (Winter Package: heated seats for driver and front passenger, heated steering wheel, heated windscreen washer system - M+S winter complete wheels, 4-way aerodynamically optimized, painted black and diamond-turned with front axle 235/60 R18 on 8.0 J x 18 ET 32.5 and rear axle 255/55 R18 on 9.0 J x 18 ET 30)
- Pre-installation for MBUX Entertainment Plus (integration of music streaming services (user account required): Spotify, Amazon Music, Apple Music, TIDAL, TuneIn (no user account required), ZYNC video streaming (user account may be required), extended radio information (free for 1 year from activation), extended radio station tracking (free for 1 year from activation), third-party convenience data volume (free for 1 year from activation)
- Radio accessories: Sound personalization (A tailor-made listening experience: Personalizing the sound system makes it easy to achieve your perfect sound setup. A setup assistant with an innovative algorithm works with you to determine your music preferences and adjusts the Burmester® sound system to your wishes. The result is saved in a personal profile.)
- Seats: Seat climate control for driver and front passenger seats (3-stage seat ventilation (blue lights) - does not switch off or revert after a defined period - 3-stage seat heating (red lights) - switches off automatically - both comfort features can be activated separately or in combination)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were not available.
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Front bumper	Front bumper - Scratch(es) - Smart repair
2	Boot lid / rear door	Boot lid (Verkleidung links Leiste befestigung beschädigt) - Damaged - Replace
3	Vehicle glazing	Windscreen (Rissbildung im Sichtbereich) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Door - rear left side	Door - Stone chips - No deduction
2	Side panel - rear right side	Wheel well extension - Scratch(es) - No deduction
3	Misc.	Inspection / maintenance - No evidence - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Service book (digitaler Nachweis)

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

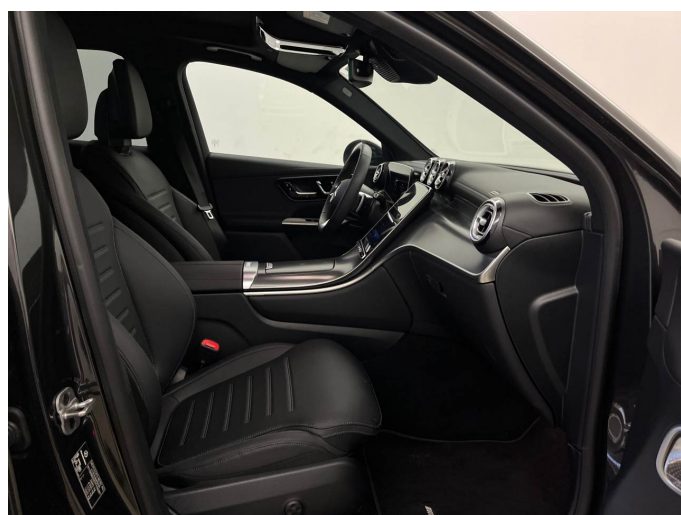


Figure 5: Interior - front

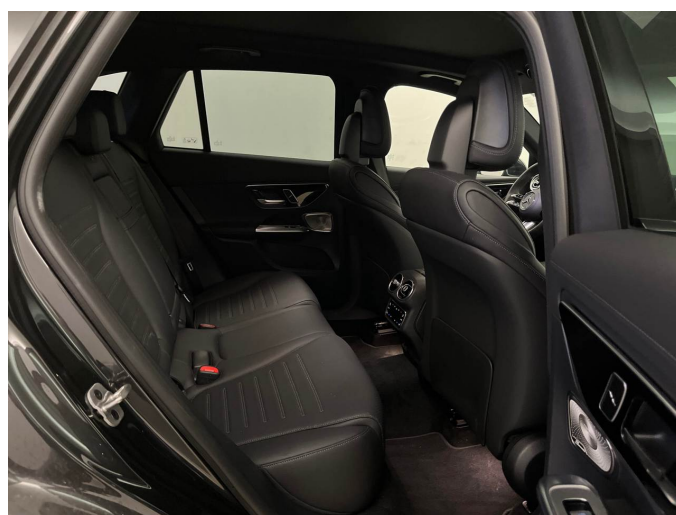


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

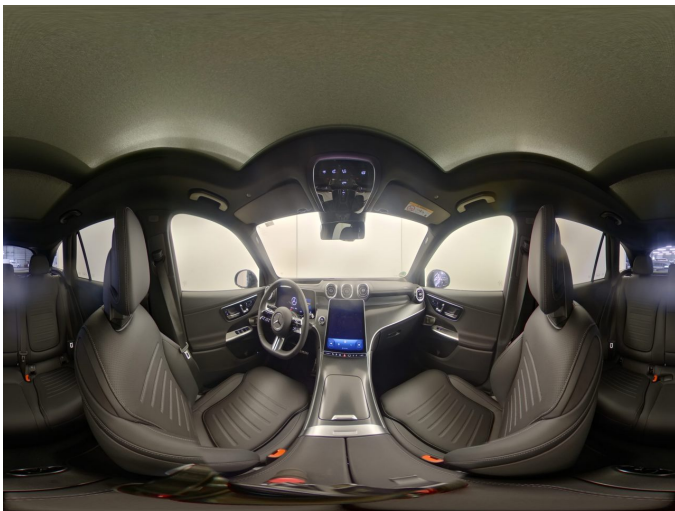


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: Mounted tyres



Figure 12: Additional tyres



Figure 13: Additional tyres



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.




Figure 23: Misc.



Damage 1: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 1: Front bumper: Front bumper - Scratch(es) - Smart repair

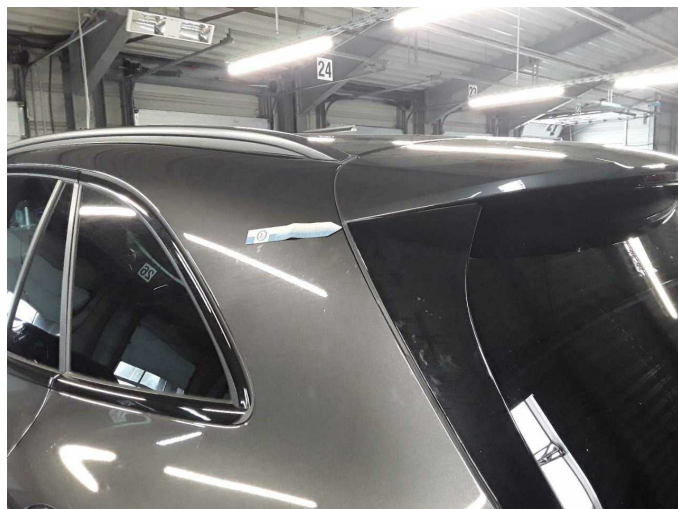

Damage 2: Boot lid / rear door: Boot lid (Verkleidung links Leiste befestigung beschädigt) - Damaged - Replace



Damage 2: Boot lid / rear door: Boot lid (Verkleidung links Leiste befestigung beschädigt) - Damaged - Replace



Damage 2: Boot lid / rear door: Boot lid (Verkleidung links Leiste befestigung beschädigt) - Damaged - Replace