



Expertise

Protocol number: 46507132
Order No. / Reference: 26576653
Inspection date: 9 Jul 2026

Manufacturer: Seat

Model: Leon Sportstourer 2.0 TDI Style

VIN: VSSZZZKL1RR002842



Vehicle details

Manufacturer / Type / Model / Equipment

Seat Leon Sportstourer 2.0 TDI Style

Vehicle Identification number VSSZZZKL1RR002842

Mileage (Read) 73,741 km

First registration 2 Aug 2023

Number of holders 1

Power / Engine displacement 110 kw / 1,968 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle Station wagon

Colour / colour code Midnight Schwarz Metallic

Doors / Seats 5 / 5

Upholstery type Cloth

Colour of upholstery Grey-Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	16,400 km
Last service on / at	01/2026 at 66,047 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HN656433
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	7593 / ASL 00427		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,030 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Goodyear	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Goodyear	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment in the front doors
- Driver and passenger airbags
- Airbag: Head airbag system, front and rear
- Electrically adjustable and heated exterior mirrors
- LED turn signals integrated into the exterior mirrors
- On-board computer
- Roof rails, black
- Electronic differential lock XDS
- Electronic parking brake
- Electric window regulator with anti-pinch protection and one-touch function
- Luggage compartment lighting
- Speed limiter
- Transmission: 6-speed manual
- Heated rear window
- ISOFIX child seat restraint system, triple in the 2nd row of seats
- Front headrests (2)
- LED technology for headlights, daytime running lights and taillights
- Reading light front/rear
- Rear center armrest with pass-through option
- Fog lights with cornering light function in LED technology
- Upholstery: Cloth
- Radio accessories: Bluetooth interface with integrated hands-free system and audio streaming
- Wheels: Alloy wheels (4) 7 J x 16" "Design I"
- Leather gear knob
- Power steering
- Seats, passenger seat height adjustable
- Seats: Remote release for folding down the rear seat backrest into the boot
- Seats: Rear seat backrest asymmetrically split and foldable
- Start-stop system and recuperation
- Power outlet: 12V socket at the front
- Front Assist area monitoring system with City Emergency Braking function
- Electronic immobilizer
- Central locking with remote control

Extra equipment

- Deletion of the model designation on the rear
- Paint finish: Metallic
- Package: Winter Package (heated steering wheel - heated front seats)
- Rear view camera
- Virtual Cockpit (Fully digital instrument cluster with 10.25" TFT display)

- Storage pockets on the backs of the front seats
- Airbag: Passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Exterior mirror housings, bumpers and door handles in body color
- third brake light
- Diesel particulate filter
- Tachometer
- Electronic Stability Control (ESC) including Anti-lock Braking System (ABS)
- Gear recommendation display
- luggage compartment roller blind
- Cruise control system
- Illuminated glove compartment
- rear window wiper
- Keyless Go (engine start/stop button)
- "Climatronic" air conditioning system
- Rear headrests (3)
- Steering wheel: Three-spoke leather steering wheel with multifunction controls
- Lights: Full LED taillights
- Fatigue detection
- Emergency call service
- Radio accessories: 6 speakers
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Wheels: Tyre fit
- SEAT CONNECT
- Seat belts: Three-point automatic front and rear
- Seats: Driver's seat with height adjustment
- Seats: Lumbar support for front passenger
- Seats: Lumbar support for driver
- Sun visor on driver and passenger side
- Lane departure warning system
- Power outlet: 12V socket in the trunk
- Ultrasonic rear parking aid
- Variable luggage compartment floor
- Lashing eyes in the luggage compartment
- thermal insulation glazing

- Luggage partition net
- Navigation system (prepared for activation of the SEAT CONNECT online infotainment service package - navigation system with 10" display - 3D navigation - voice control - MAPCARE with integrated map for Europe, Wireless Full Link Connectivity incl. Android Auto and Apple CarPlay)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Verspätet Durchgeführt) - No deduction
2	Tail light	Auxiliary brake light (Bremsleuchte/Lichtband Heckklappe) - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

-Der montierte Winterradsatz ist kein Bestandteil des
Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

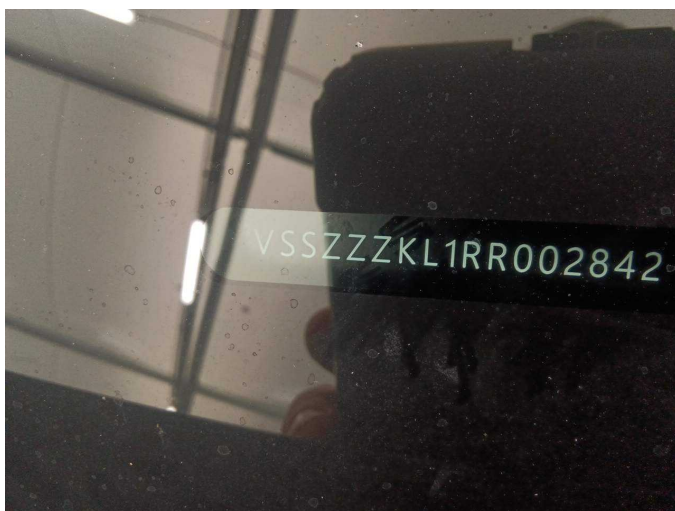


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 2: Tail light: Auxiliary brake light (Bremsleuchte/Lichtband Heckklappe) - Broken / torn - Replace



Damage 2: Tail light: Auxiliary brake light (Bremsleuchte/Lichtband Heckklappe) - Broken / torn - Replace



Damage 2: Tail light: Auxiliary brake light (Bremsleuchte/Lichtband Heckklappe) - Broken / torn - Replace



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VSSZZZKL1RR002842

Hersteller / Modell: SEAT SEAT Leon Sportstourer 2.0 TDI Style

Datum	KM-Stand	Beschreibung
20.01.2026	66.047	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.09.2024	29.052	Regelwartungsdienst
11.06.2024	19.702	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
27.01.2024	37.665	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges