



Expertise

Protocol number: 47188278
Order No. / Reference: 26831294
Inspection date: 20 Aug 2026

Manufacturer: Ford

Model: Grand Tourneo Connect 2.0 EcoBlue Aut. TITANIUM

VIN: WF0EXXSK3PX011923



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Grand Tourneo Connect 2.0 EcoBlue Aut. TITANIUM	
Vehicle Identification number	WF0EXXSK3PX011923
Mileage (Read)	57,264 km
First registration	21 Jul 2023
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	90 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Graphite Grey Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4,300 km
Last service on / at	02/2025 at 31,569 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT907678
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BVY 00100		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,300 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Light alloy	Hankook	5mm / 5mm
2)	205/60 R16 96H	Summer tyres on Light alloy	Hankook	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Hankook	3mm / 3mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Hankook	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Anti-lock braking system (ABS) with ESP, HLA and TCS
- Tires: 6.5 J x 16 alloy wheels (4) with 205/60 R16
- third brake light
- Roof rails, silver-colored
- Tachometer
- Electric front windows
- Curved luggage compartment cover
- Transmission: 7-speed automatic transmission
- Glove compartment with lid, additionally illuminated
- Rear interior light
- Interior mirror automatically dimming
- Intelligent Protection System (IPS)
- Front air conditioning, manual
- Front headrests, height adjustable
- Steering wheel: Leather multifunction steering wheel, 4 spokes
- Fatigue warning
- Package: Seat Package 18
- Front parking pilot system
- Upholstery: Cloth
- Tire repair kit, weight-saving
- Windscreen wipers with rain sensor
- Seats: Bench seat (in the 2nd row, 3 seats)
- Start-stop system
- Front bumper with chrome trim
- Carpeted floor in the luggage compartment
- Child safety lock on sliding doors
- USB port for the 2nd row of seats
- Heat-insulating glazing, tinted (from the B-pillar)
- Electrically adjustable, heated, and additionally electrically folding exterior mirrors
- Front overhead storage compartment
- Diesel particulate filter (DPF)
- Lane keeping assist including lane keeping assist
- Ford Power Start function (keyless start)
- Cruise control system with adjustable speed limiter
- Halogen headlights with daytime running lights
- Rear swing door with heated rear window
- Front interior lighting with delay function and two reading lamps
- Isofix bracket
- Rear headrests, height adjustable
- Leather gear knob
- Steering column, adjustable in height and reach
- Center console "Premium"
- Fog light
- Rear parking pilot system
- Pollen and dust filter
- Radio equipment: Audio system 4
- Tire Pressure Monitoring System (TPMS)
- Headlight assistant with day/night sensor
- Sun visor for driver and front passenger
- Rear bumper, painted in body color
- Carpet (1st and 2nd row)
- Carpet floor mats for the front (2-piece set)
- Doors: Sliding door, right and left
- Electronic immobilizer
- Central locking: Second remote control key (instead of conventional key)

Extra equipment

- Trailer hitch preparation kit (ESP trailer stabilization with continuous power supply (includes trailer module and connection preparation for 13-pin socket))
- Paint finish: Metallic
- Package: Comfort (air conditioning with automatic temperature control1), separately adjustable for driver and front passenger side (2-zone automatic climate control) - reversing camera - LED headlights)
- Audio system 4: Ford navigation system, 10" touchscreen
- Awning windows, 2nd row, right and left
- Driver Assistance Package 2
- LED taillights
- Package: Winter (Heated windshield - Large windshield washer fluid reservoir)
- Panoramic roof with heat-insulating glazing
- Phone accessories: Inductive charging station for mobile devices (according to Qi standard, compatibility depends on the device)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Vehicle key with remote control (Batterie) - Empty - Replace
2	Roof	Roof rail - right side - dent(s) - Smooth repair work
3	Door - front right side	Door edge - Scratch(es) - Smart repair
4	Sliding door, right	Sliding door with glass panel (Türkante) - Scratch(es) - Smart repair
5	Trim / covers	Boot lid - interior trim - Scratched - Replace
6	Bonnet	Insulation lining - Damage caused by marten / rodent - Replace
7	Interior	Interior - Soiled - Clean
8	Rear bumper	Rear bumper - Scratched - Paint
9	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	Tyres - complete set (Nicht Bestandteil der Ausstattung) - Does not meet the leasing specifications - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Trim / covers - Floor mats (Hinten beide)

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Der angegebene Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.
- Ein Nachweis über die Zulässigkeit des beiliegenden Radsatzes wurde nicht erbracht.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

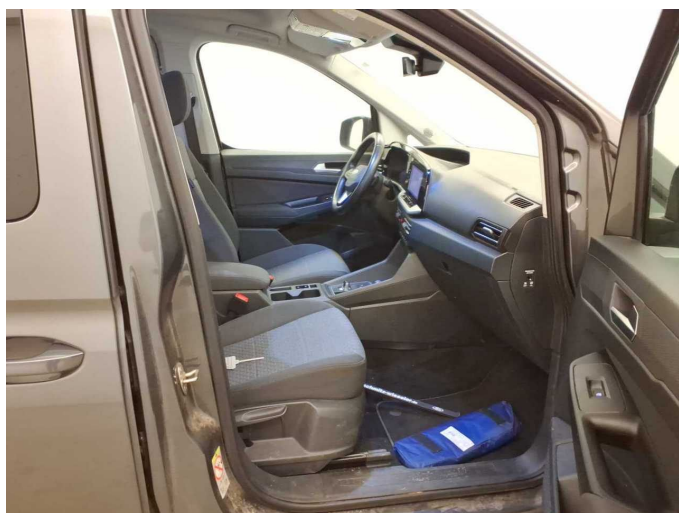


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

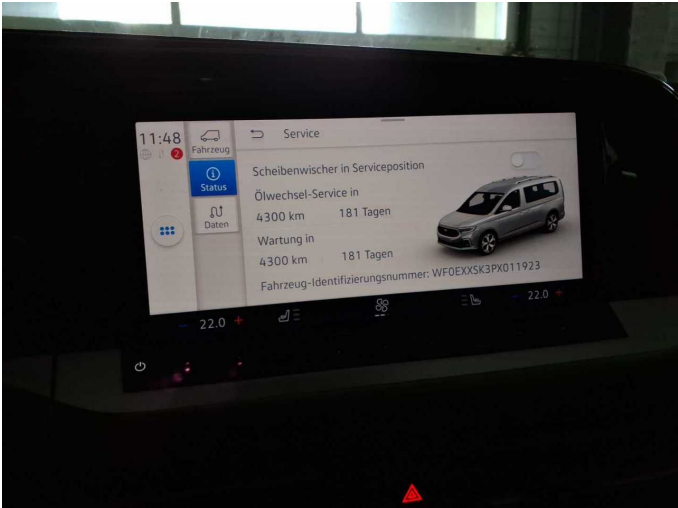


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

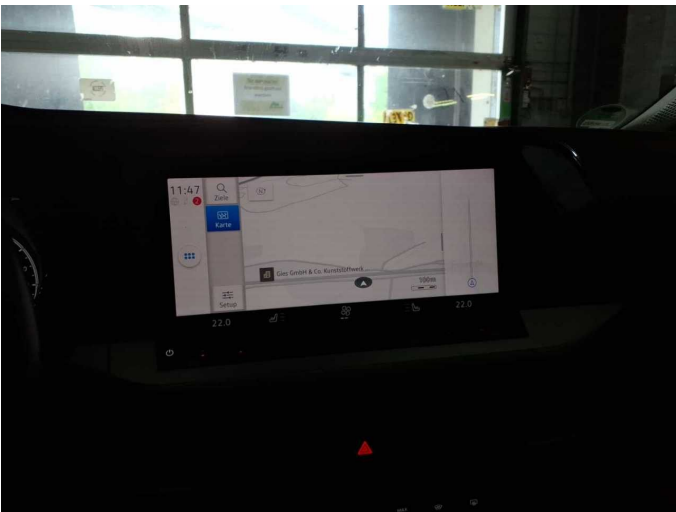


Figure 17: Navigation



Figure 18: Misc.

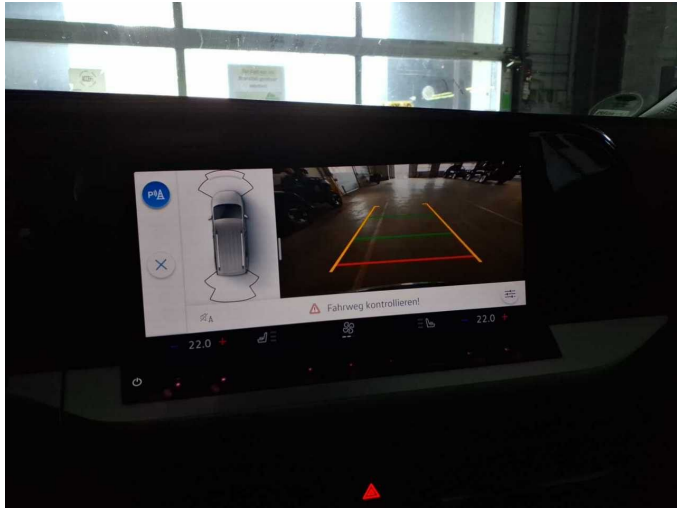


Figure 19: Misc.

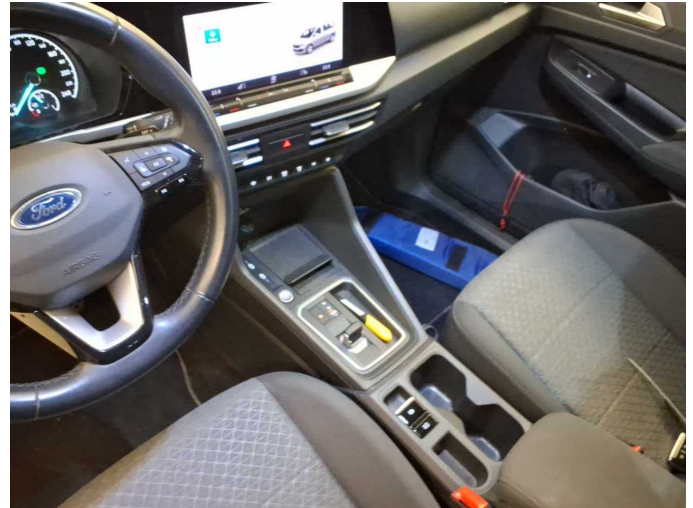


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

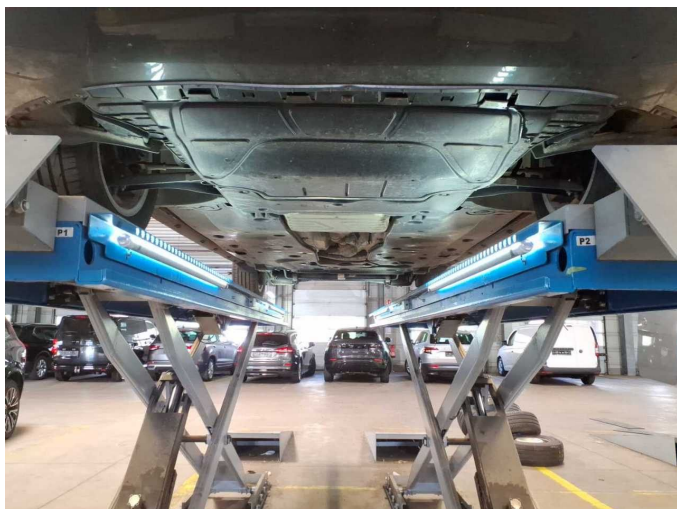


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 2: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 2: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 3: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 4: Sliding door, right: Sliding door with glass panel (Türkante) - Scratch(es) - Smart repair




Damage 4: Sliding door, right: Sliding door with glass panel (Türkante) - Scratch(es) - Smart repair



Damage 5: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 5: Trim / covers: Boot lid - interior trim - Scratched - Replace

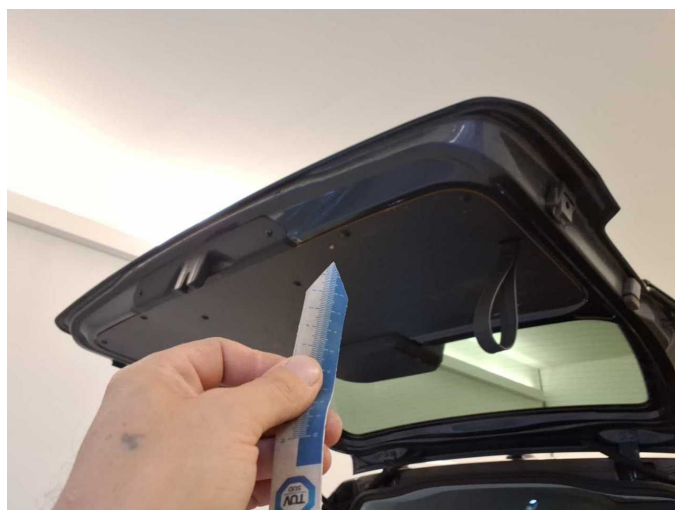

Damage 5: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 5: Trim / covers: Boot lid - interior trim - Scratched - Replace




Damage 6: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace



Damage 6: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace



Damage 7: Interior: Interior - Soiled - Clean

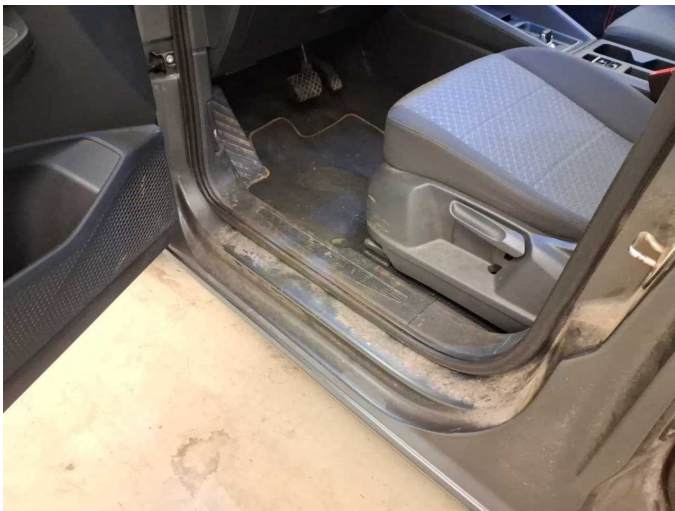

Damage 7: Interior: Interior - Soiled - Clean



Damage 7: Interior: Interior - Soiled - Clean



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint




Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint

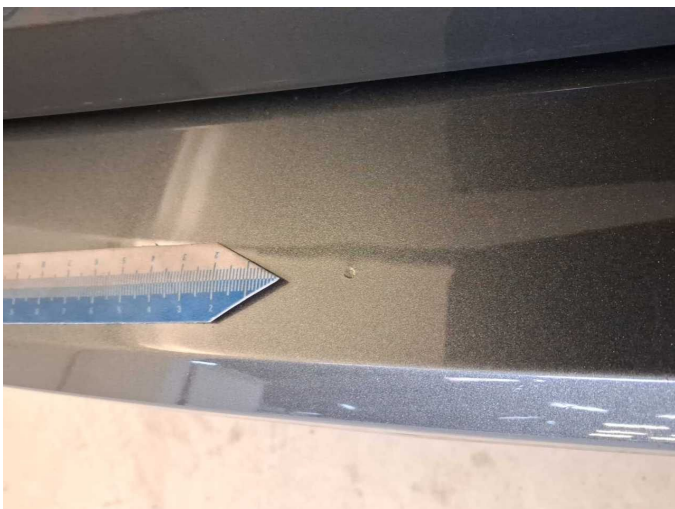

Damage 8: Rear bumper: Rear bumper - Scratched - Paint




Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint




Damage 9: Front bumper: Front bumper - Scratched - Paint

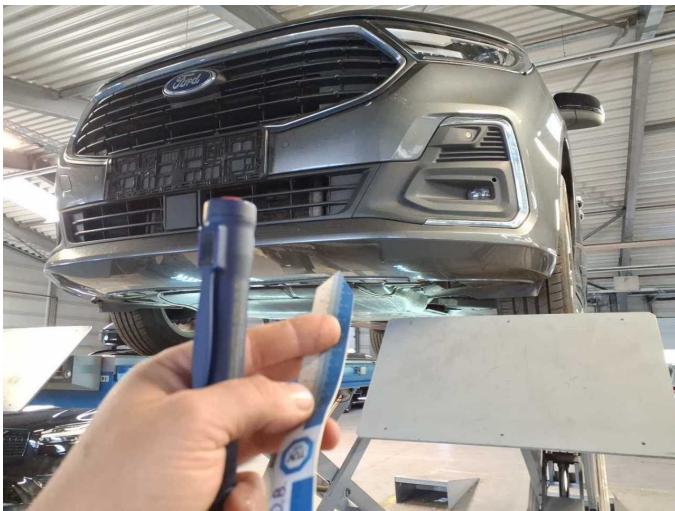


Damage 9: Front bumper: Front bumper - Scratched - Paint




Damage 9: Front bumper: Front bumper - Scratched - Paint

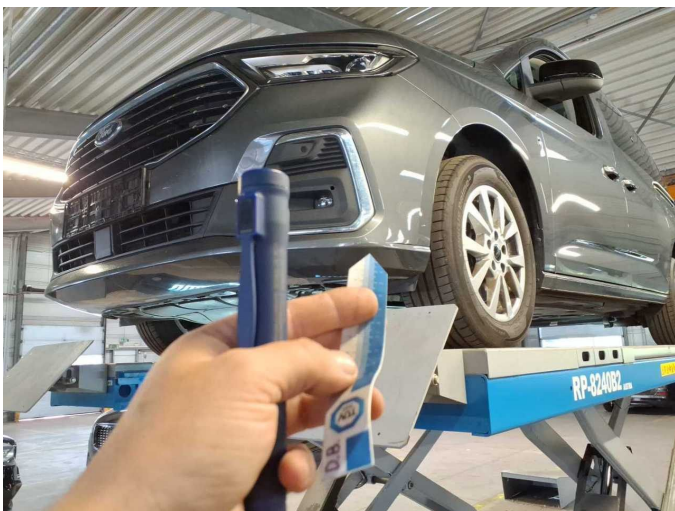


Damage 9: Front bumper: Front bumper - Scratched - Paint

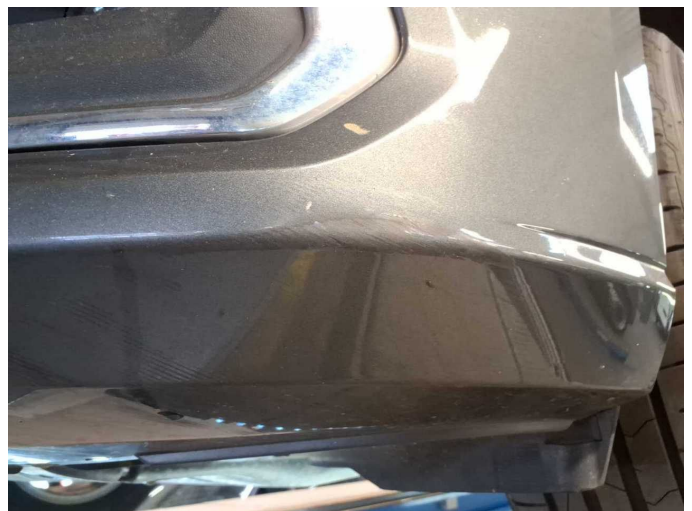


Damage 9: Front bumper: Front bumper - Scratched - Paint

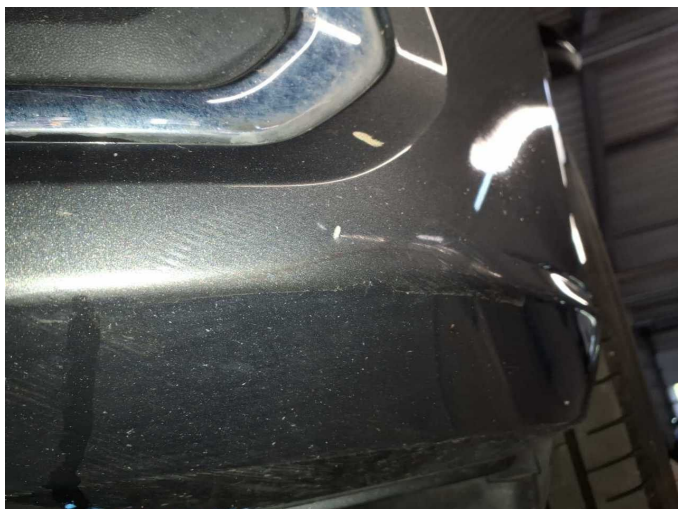

Damage 9: Front bumper: Front bumper - Scratched - Paint

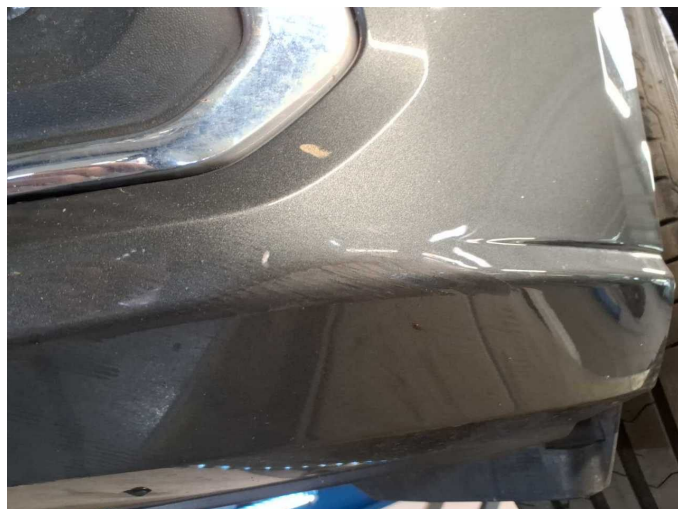

Damage 9: Front bumper: Front bumper - Scratched - Paint

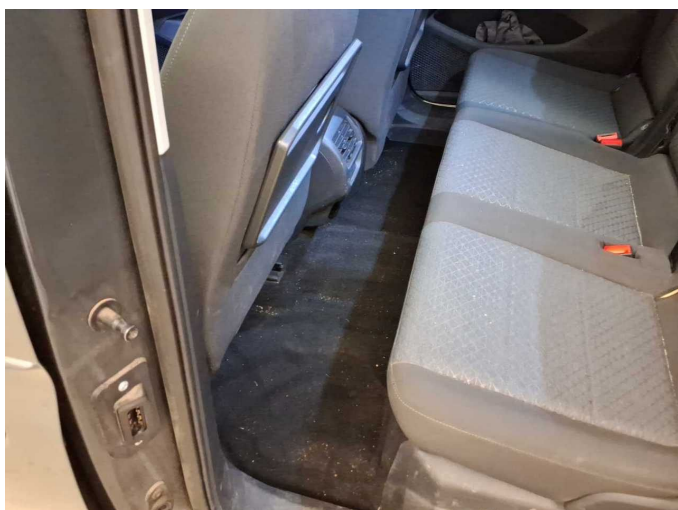

Missing part 1: Trim / covers: Floor mats (Hinten beide) - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0EXXSK3PX011923

Hersteller / Modell: FORD FORD Grand Tourneo Connect 2.0 EcoBlue Aut. TITANIUM

Datum	KM-Stand	Beschreibung
17.02.2025	31.569	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges