



Expertise

Protocol number: 46156914
Order No. / Reference: 26381379
Inspection date: 25 Jun 2026

Manufacturer: Volvo

Model: V60 B4 D Geartronic Momentum Pro

VIN: YV1ZWK5VDM2444566



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo V60 B4 D Geartronic Momentum Pro	
Vehicle Identification number	YV1ZWK5VDM2444566
Mileage (Read)	93,691 km
First registration	18 May 2021
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Power / Engine displacement	145 kw / 1,969 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black Stone
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	1 Tag(e)
Last service on / at	07/2025 at 74,768 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA552037
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BTH 00004		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,280 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	225/50 R17 98H	Winter tyres on Light alloy	Continental	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	225/50 R17 98V	Summer tyres on Light alloy	Michelin	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS - Anti-lock Braking System
- Driver and passenger side airbags with two-stage deployment system
- Outdoor temperature display
- fog sensor
- On-board computer with vehicle control functions
- Chrome trim on the side windows
- CleanZone air quality system
- Connected Safety
- Aluminum roof rails (integrated)
- Drive Mode
- Driver Alert
- Rear parking assist
- Electronic differential lock Corner Traction Control (CTC)
- Electric windows front and rear
- Front grille in waterfall design in black
- Cruise control system with variable speed limiter
- Automatic tailgate (electric)
- rear window wiper
- Interior and exterior mirrors with automatic dimming function
- Keyless Start
- Child safety lock (manual, rear doors)
- Automatic air conditioning
- Rear headrests foldable, electrically
- Charging box under the cargo floor
- Cargo area roller blind
- Lane Keeping Aid (LKA) - Active lane keeping assistant
- LED headlights "Thor's Hammer"
- Steering wheel: Leather steering wheel in 3-spoke design, anthracite
- Illuminated makeup mirror for driver and front passenger
- Front center armrest with integrated storage compartment and cup holders
- Oncoming Lane Mitigation
- Particulate filter: Soot particle filter for diesel engines
- Radio: Sensus Connect infotainment system with high-performance sound
- Radio accessories: Two USB-C ports on the back of the center console
- Road Sign Information (RSI)
- Wheels: Tire pressure monitoring system (passive)
- Gearshift lever in leather
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Driver and front passenger seats are height-adjustable (electrically)
- Seats: Rear seats in a 40/60 split or fully foldable with pass-through function
- Fuel filler neck with misfuelling protection
- Volvo On Call with WiFi hotspot
- Immobiliser
- Front passenger airbag can be deactivated
- Electrically folding exterior mirrors
- Electrically adjustable and heated exterior mirrors
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- third brake light
- City Safety
- Colored glazing
- Roof edge spoiler
- Digital instrumentation with a 12.3" full-graphic display (31.2 cm diagonal, high resolution)
- Insoles: Iron Ore
- Aluminum door sill plates with Volvo lettering at the front
- ESC - Vehicle Dynamics Control
- Automatic emergency braking
- Luggage compartment partition net
- Transmission: 8-speed Geartronic
- Heated rear window
- IDIS (Intelligent Driver Information System)
- Interior lighting
- Keyless Drive (electronic access system) (with sensor-controlled tailgate, waterproof micro key and illuminated door handles and puddle lights)
- Headrests (5) front and rear,
- Paint finish: Solid
- Stainless steel loading sill protector in the luggage compartment
- LED fog lights
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel in black
- Rear center armrest (foldable) with cup holders
- Sensus navigation system
- Emergency brake lights
- Electric parking brake
- Upholstery: Textile comfort seats
- Radio accessories: Apple CarPlay and Android Auto
- Radio accessories: Digital radio reception (DAB+)
- Rain sensor
- Road Edge Detection
- Run-off Road Protection
- Wheel accessories: Tire sealant
- Speed-sensitive power steering
- Seat belts
- Safety steering column (adaptive)
- Seats: Lumbar support (2-way electrically adjustable) for driver and front passenger seats
- Start/Stop technology
- Power socket
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- WHIPS whiplash protection system



- Central locking system with two remote controls and integrated emergency keys

Extra equipment

- Alarm system (with motion/tilt sensor, security locking and private locking (separate trunk locking))
- Package: IntelliSafe Package Pro (Interior and exterior mirrors with automatic dimming - Pilot Assist: Adaptive cruise control with distance warning and lane keeping assist up to speeds of 130 km/h - IntelliSafe Surround with: Blind Spot Information System (BLIS) - Blind Spot Assist and Lane Change Warning including steering intervention; Cross Traffic Alert (CTA) - Cross traffic warning with braking intervention - warning including braking to a standstill; Rear Impact Mitigation - preventive protection in case of impending rear-end collisions)
- Front and rear parking sensors
- Suspension: Sport suspension (lowered by 15 mm)
- Package: Parking Assistance Package (front and rear parking aid - reversing camera)
- Package: Winter Package
- Wheels: 17" 5-spoke alloy wheels, diamond cut/graphite look (7 J x 17 with 225/50 R 17 V tires)
- Rear view camera
- Side and rear windows tinted (from the B-pillar back)
- Phone: Inductive smartphone charging system (Qi standard) (Wirelessly charges smartphones on a charging pad (compatibility required))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (in 1 Tag fällig) - No deduction
2	Equipment	Tirefit filler - Expired - Replace
3	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
4	Body	Body - Damage by hail - Smooth repair work
5	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Interior	Interior - Scratch(es) - No deduction
4	Sill - left side	Sill - Scratch(es) - No deduction
5	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

2nd wheel set - Wheel cover set - complete



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig und eingeschränkt möglich.
- Mehrkosten möglich .
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

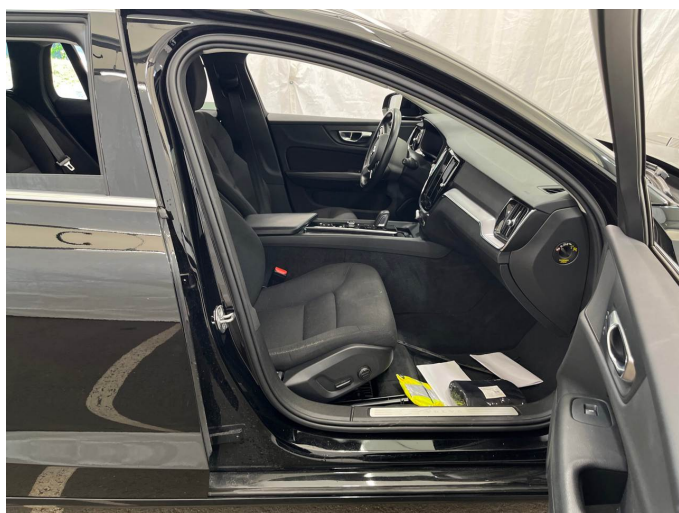


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

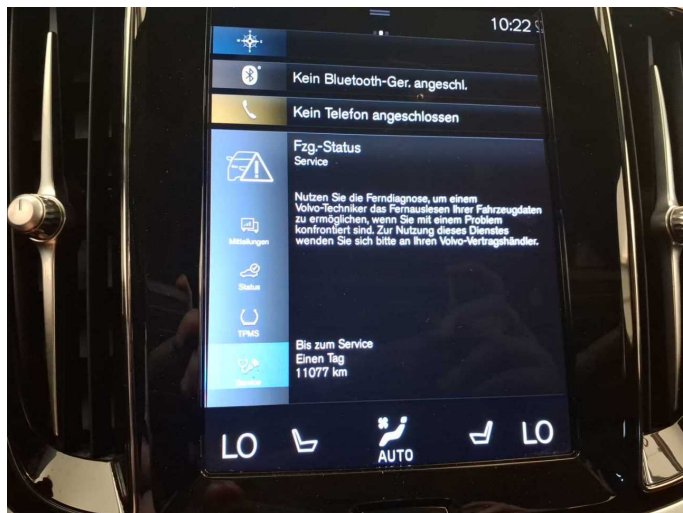


Figure 14: Documents



Figure 15: Documents



Figure 16: Documents

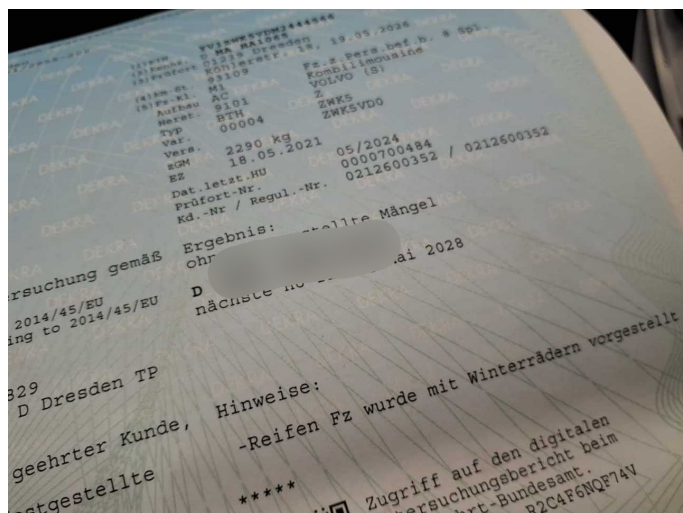


Figure 17: Documents



Figure 18: Additional tyres

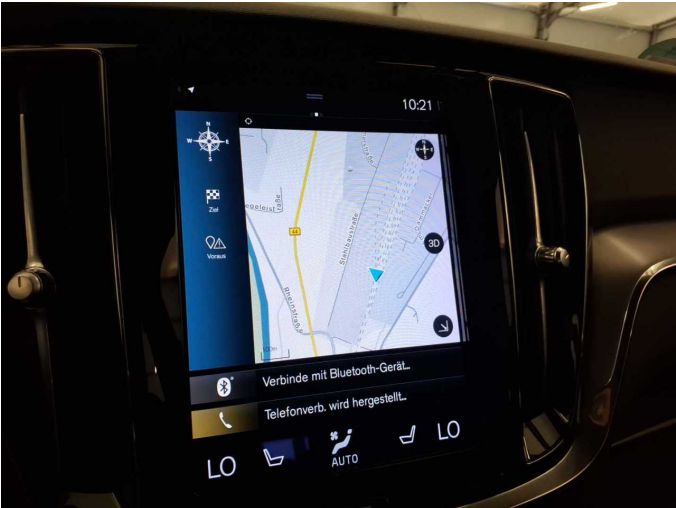


Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

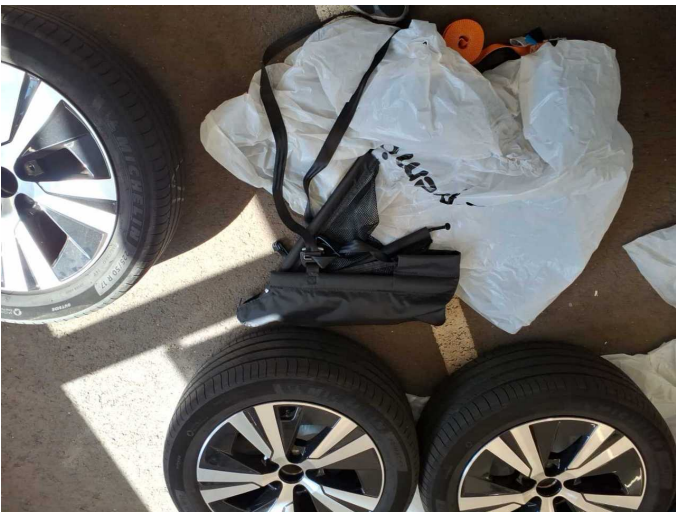


Figure 23: Misc.

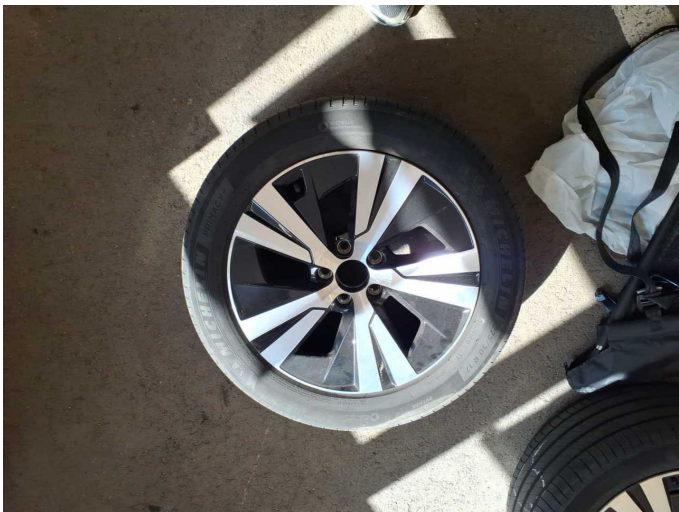


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

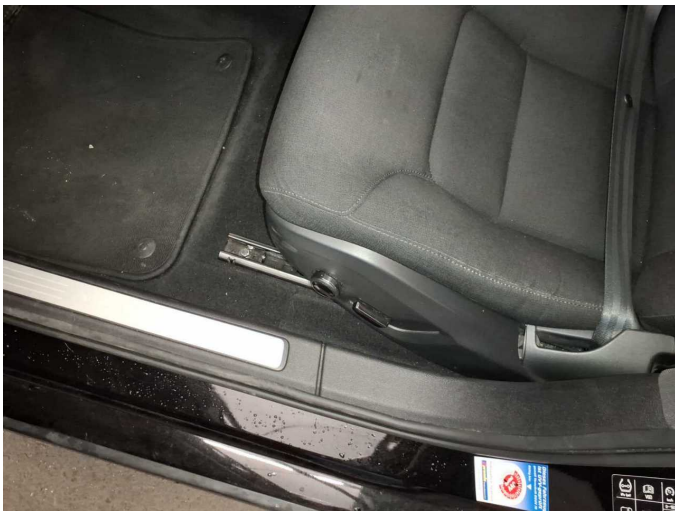


Figure 27: Misc.



Figure 28: Misc.

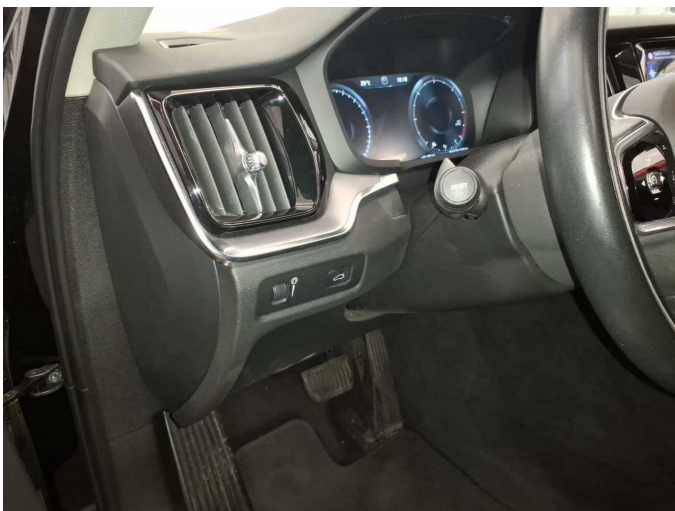


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.




Figure 33: Misc.



Figure 34: Misc.

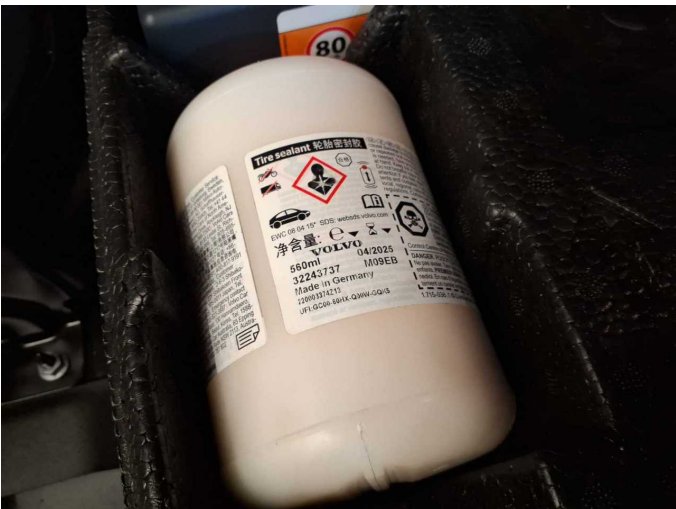


Damage 2: Equipment: Tirefit filler - Expired - Replace

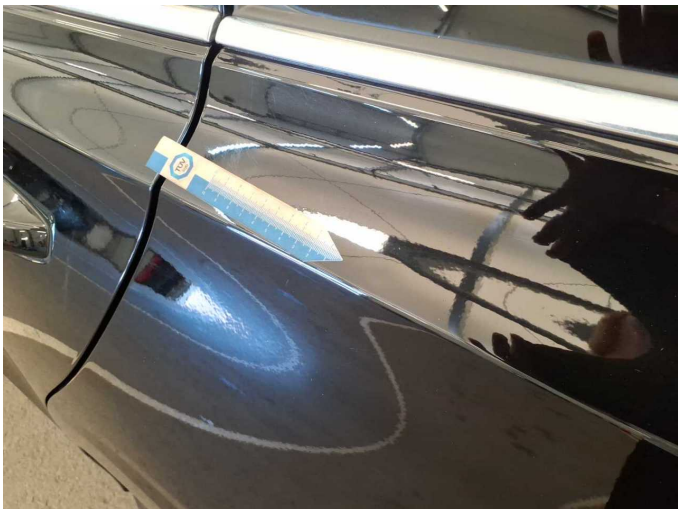

Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work




Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

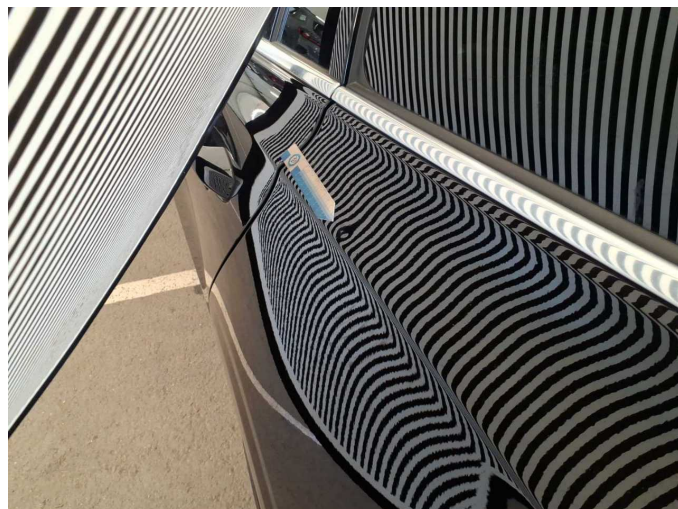

Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 4: Body: Body - Damage by hail - Smooth repair work

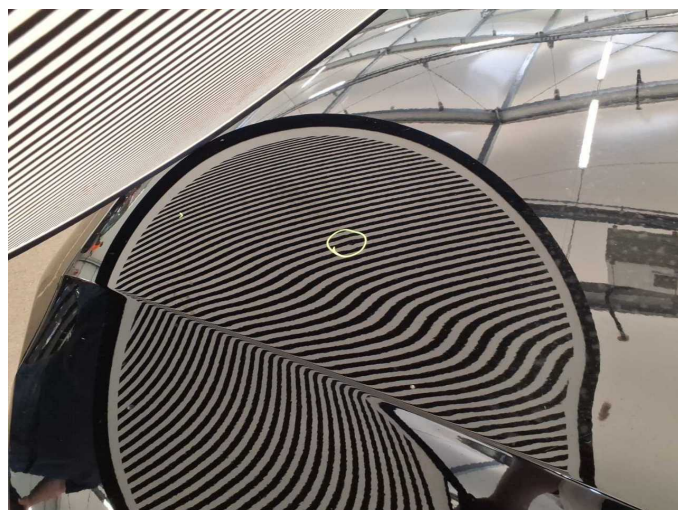

Damage 4: Body: Body - Damage by hail - Smooth repair work



Damage 4: Body: Body - Damage by hail - Smooth repair work



Damage 4: Body: Body - Damage by hail - Smooth repair work




Damage 4: Body: Body - Damage by hail - Smooth repair work



Damage 4: Body: Body - Damage by hail - Smooth repair work



Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

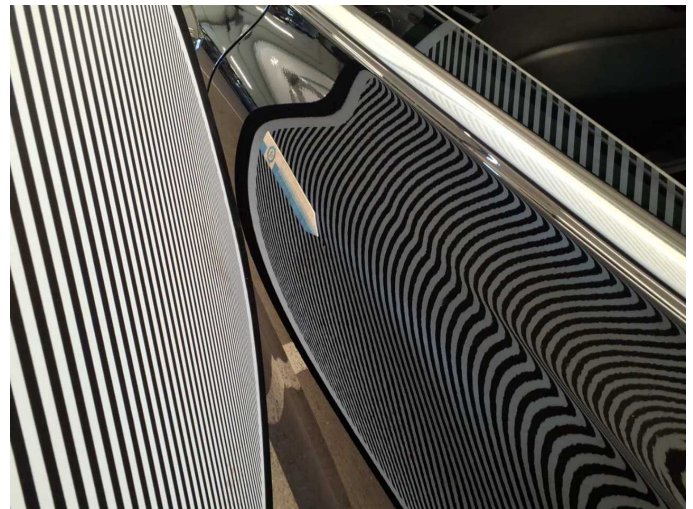

Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

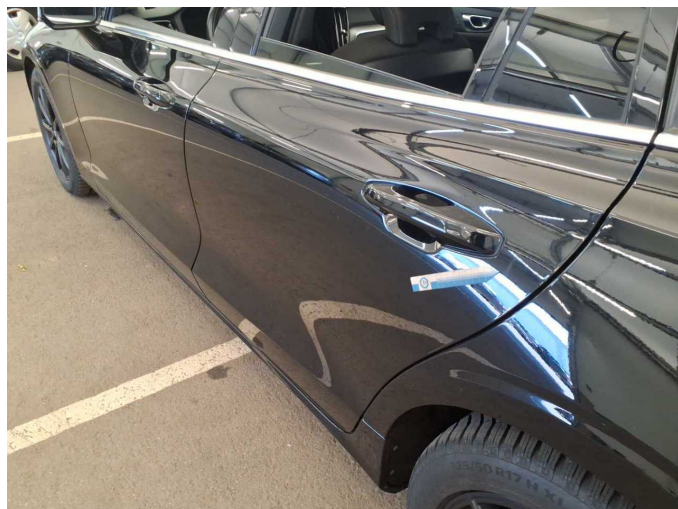


Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

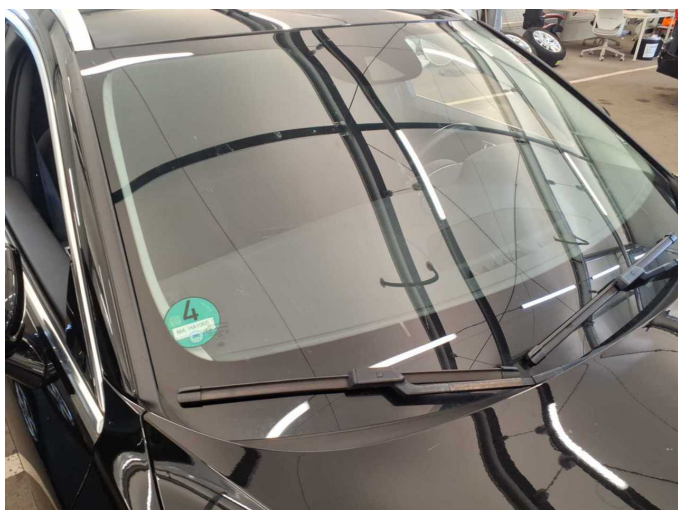


Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction

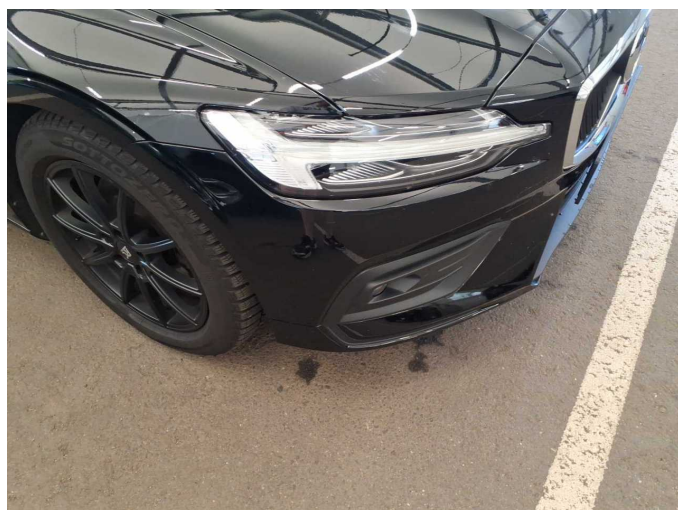

Wear and tear 2: Front bumper: Front bumper - Stone chips - No deduction

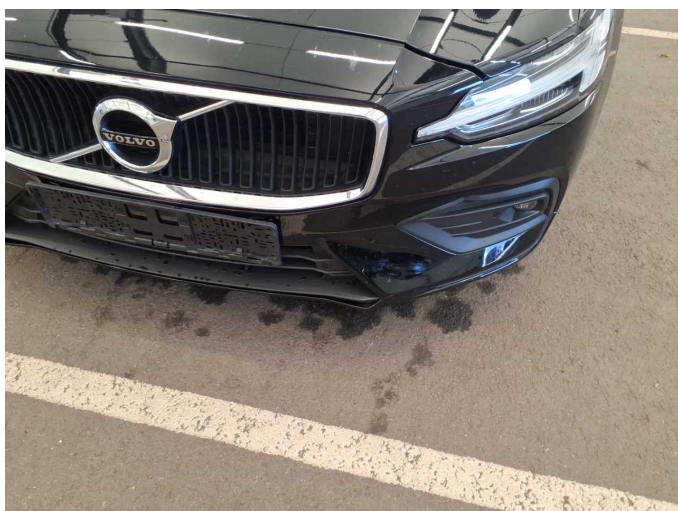

Wear and tear 2: Front bumper: Front bumper - Stone chips - No deduction

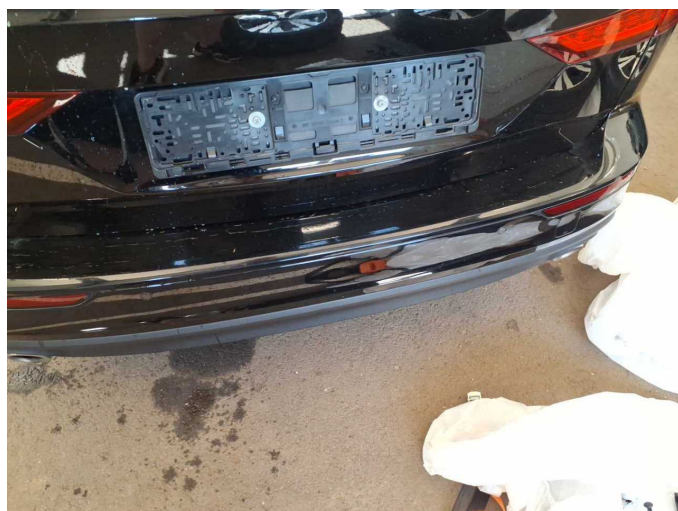

Wear and tear 5: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wear and tear 5: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1ZWK5VDM2444566

Hersteller / Modell: VOLVO VOLVO V60 B4 D Geartronic Momentum Pro

Datum	KM-Stand	Beschreibung
01.07.2025	74.768	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
07.05.2024	54.216	AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
24.05.2023	37.111	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
19.05.2022	9.672	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges