



Expertise

Protocol number: 46644227
Order No. / Reference: 26450097
Inspection date: 22 Jul 2026

Manufacturer: Volvo	Model: XC90 T8 AWD Plug-in Hybrid Ultra Dark
VIN: YV1LFH7V0S1342356	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC90 T8 AWD Plug-in Hybrid Ultra Dark	
Vehicle Identification number	YV1LFH7V0S1342356
Mileage (Read)	31,994 km
First registration	28 Jan 2025
Number of holders	1
Next periodical technical inspection	01/2028
(Report not on hand)	
Fuel type	Hybr.B/E ext.aufl
Engine displacement / Cylinder	1,969 ccm / 4
Power	228 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	VAPOUR GREY
Doors / Seats	5 / 7
Upholstery type	Leather
Colour of upholstery	Anthracite-Black
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	184 Tag(e)
Last service on / at	01/2026 at 22,485 km		
Key is / should be	2 / 2	FZG documents	Registration and title documents unavailable
		Letter No.	HG394770
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	9101 / BUL 00016		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,950 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/35 R22 104Y	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	275/35 R22 104Y	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105T	Winter tyres on Light alloy	Continental	4mm / 4mm
2)	235/55 R19 105T	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- ABS - Anti-lock Braking System
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Airbags (airbags for driver and front passenger with two-stage deployment system - knee airbag for driver - side airbags for driver and front passenger - head/shoulder airbags for all occupants)
- All-wheel drive (AWD) (depending on the driving mode)
- Aluminum door sill plates with Volvo lettering at the front and rear
- Applications in the front bumper in high-gloss black
- Armrests with integrated storage compartment and cup holders for the 3rd row of seats (left and right)
- Automatic climate control with 4-zone temperature control (Individual climate control for driver, front passenger and rear passengers left and right (2nd row of seats) including climate display for the 2nd row of seats)
- Automatic tailgate (electric)
- Auxiliary heater with timer (electrically operated)
- Bottle holder in the luggage compartment
- Brake energy recuperation
- Charging cable Schuko/Type 2 (Mode 2) (7 m length, 1-phase, 10A (for connection to a standard 230-volt household socket))
- Child safety lock for the rear doors (electric)
- Dashboard in leather look with contrasting stitching
- Digital Services (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data) - Volvo On Call (includes, among other things, alerting the Volvo On Call service center at the touch of a button as well as additional convenience services via the Volvo CarsApp, such as locking and unlocking the vehicle, displaying the vehicle position and digital manual))
- Door sill area in car color
- Driver Assistance (Emergency Stop Assist (automatic emergency stopping system in case of failure to heed warnings due to lack of steering, braking and acceleration activity by the driver, including activation of the hazard warning lights and automatic braking to a standstill) - Pilot Assist (lane guidance assistant with adaptive cruise control up to speeds of 130 km/h) - Adaptive cruise control)
- Electrically adjustable exterior mirrors
- Electrically folding exterior mirrors
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h)
- Front and rear parking sensors with automatic braking intervention (rear)
- Front center armrest with integrated storage compartment and cup holders
- Front passenger airbag can be deactivated
- Glazing: Colored glazing
- Head-up display
- Acoustic Vehicle Alerting System (AVAS) (Acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Active safety belts with belt tensioners (pre-activation of the belt tensioners in dangerous situations and belt force limiter)
- Air conditioning for the 3rd row of seats
- Android infotainment system (9" touchscreen (22.9 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - 2 USB-C ports (compatible with Apple iPod/iPhone/iPad))
- Attachment system for carrier bags in the luggage compartment
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Cargo area roller blind (semi-automatic)
- Central locking with two remote controls and integrated emergency key (including automatic locking of the doors while driving (can be deactivated) - panic function (integrated in the remote control) - comfort opening/closing of the side windows and, if applicable, sunroof via remote control - luggage compartment lid release via remote control or from the driver's seat)
- Charging box under the cargo floor
- Deactivation of the high-voltage battery (in case of a collision)
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Drive Mode (driving mode settings for engine, transmission, steering and brakes)
- Driver Awareness (Blind Spot Information System (BLIS) - Blind Spot Assist including Lane Change Warning for rapidly approaching vehicles - Cross Traffic Alert (CTA) - Cross Traffic Warning with braking intervention - Warning of vehicles, cyclists and pedestrians approaching from the side when reversing out of a parking space, including braking to a standstill if warning signals are ignored - Rear Impact Mitigation - Preventive protection in case of impending rear-end collisions)
- Electric parking brake
- Electric windows front and rear (with auto-down and auto-up function)
- Electronic differential lock
- Electronic stability control
- Engine emblem on the rear of the vehicle
- First aid kit and warning triangle
- Fog sensor for automatic activation of the defroster function
- Headrests (7)
- Headrests of the 2nd row of seats can be folded down (electrically)
- Heated rear window
- Illuminated makeup mirror for driver and front passenger
- Immobiliser



- Headliner and door pillars in nubuck fabric (in anthracite or light beige (corresponding to the standard headliner or the optional anthracite headliner))
- Heated exterior mirrors and rear window (automatic)
- High-gloss black applications on the rear of the vehicle
- Hill Descent Control (HDC)
- Hill Start Assist (HSA)
- Intelligent Speed Assist (Intelligent speed assistant - warning when exceeding the maximum permitted speed)
- ISOFIX mounting for the outer rear seats
- Keyless Start (electronic engine start system)
- LED turn signals integrated into the exterior mirrors
- Luggage compartment partition net
- Otto particulate filter
- Outdoor temperature display
- Package: Lighting Package (Headlight cleaning system - Full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assist with adaptive headlight range control and integrated LED daytime running lights - Ambient lighting Extended: Ambient lighting front/rear Exit lights front/rear Illuminated door pockets - openers front/rear Footwell lighting rear Reading lights rear Work light on the tailgate)
- Paint finish: Solid
- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)
- Phone: Inductive smartphone charging system (Qi standard) (Wirelessly charges smartphones on a charging pad (compatibility required))
- Radio accessories: Smartphone integration Apple CarPlay
- Rain sensor
- rear window wiper
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Seats: Rear bench seat of the 2nd row in a 40/20/40 ratio or completely foldable (incl. individual backrest angle adjustment)
- Seats: Third row of seats (7-seater) (manually adjustable and retractable with longitudinal adjustment (120 mm) for the 2nd row of seats and easy-entry function)
- Speed-sensitive power steering
- Sport front and rear apron
- Start/Stop technology
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Sun blinds for the rear side windows (integrated)
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Transmission: 8-speed automatic transmission
- Upholstery: Leather/leatherette comfort seats (incl. rear center armrest (2nd row of seats) - Aluminum inlay: Metal Mesh - Headliner: Light Beige)
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- Interior and exterior mirrors automatically dimming
- Keyless Drive (electronic access system) (with sensor-controlled tailgate, illuminated door handles and floor lights)
- Lashing eyes in the luggage compartment (foldable)
- Model emblem on the rear of the vehicle
- On-board computer (with vehicle control functions)
- One Pedal Drive (acceleration and deceleration to a standstill via the accelerator pedal - activation/deactivation via the menu - recuperation (brake energy recovery) as soon as the foot is taken off the accelerator pedal, to optimize the range)
- Package: Seat Comfort Package (Electrically adjustable front passenger seat (8-way) - Electrically adjustable driver's seat (8-way) with memory function for driver's seat and exterior mirror settings (stored in the remote control) - Lumbar support (4-way electrically adjustable) for driver and front passenger seats - Memory function for front passenger seat - Adjustable leg support for driver and front passenger seats)
- Parking ticket holder
- Pollen filter
- Power outlet (12-volt connection in the luggage compartment)
- Premium textile floor mats, front and rear
- Preparation for Trailer Stability Assist (TSA)
- Radio accessories: Two USB-C ports on the back of the center console
- Radio: Premium Sound audio system by Harman/Kardon (600 watts of power - 14 speakers - Fresh Air - Subwoofer - Dirac Unison - Sound optimization)
- Rear view camera
- Roof edge spoiler
- Roof rails in high-gloss black (integrated)
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers including emergency call via Volvo On Call and door unlocking)
- Safety Assistance (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection braking assistant and emergency braking assistant for oncoming traffic - Connected Safety - Driver Alert - Attention warning - Distance warning - Variable speed limiter - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assistant - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition)
- Seat belt height adjustment front and rear (2nd row of seats)
- Seats: Child seat integrated in the middle rear seat (2nd row).
- Seats: Heated front seats
- Seats: Heated rear seats (outer seats of the 2nd row)
- Sport exterior mirrors in high-gloss black
- Sport front grille with horizontal struts and surround in high-gloss black
- Stainless steel loading sill protector in the luggage compartment
- Steering wheel: Steering wheel heating



- Volvo On Call (Alerting the Volvo On Call service center at the touch of a button, as well as additional convenience services via the Volvo Cars App, such as locking and unlocking the vehicle, displaying the vehicle position and digital manual.)
- Wheels: 20" 5-spoke alloy wheels, diamond cut/high-gloss black (tires 275/45 R20; rims 9 x 20")
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)
- Whiplash Protection System (WHIPS) (including immersion protection on all seats and energy-absorbing front seat cushions)
- Window surround in high-gloss black

- Textile floor mats for the 3rd row of seats
- third brake light
- Warning tone/indicator when seat belts are not fastened (for all seats)

Extra equipment

- Chassis: Adaptive air suspension with Four-C technology (Continuously Controlled Chassis Concept) including automatic leveling and entry/rear lowering (-2cm/+4cm)
- Upholstery: Nappa leather/imitation leather sports seats (perforated side bolsters of the front seats - incl. rear center armrest (2nd row of seats) - sports steering wheel and gearshift lever made of Swedish crystal glass by Orrefors - aluminum inlay: Metal Mesh - headliner: anthracite)
- Wheels: 22" 5-twin-spoke sport design alloy wheels, diamond cut/high-gloss black (tires 275/35 R22; rims 9 x 22")
- Glazing: Side and rear windows tinted (from the B-pillar back)

- Type 2 charging cable
- Parking camera with 360° surround view (including front, side and rear parking aid with automatic braking intervention (rear))
- Radio: Premium Sound audio system by Bowers & Wilkins (1,410 watts power - 19 speakers - 15 channels - Double-layer (aluminum) Nautilus tweeter - Continuum midrange driver - Carbon/cellulose diaphragm woofer - Fresh Air mica subwoofer - Dirac Unison sound optimization - Room Modes (Studio, Individual Stage, Jazz Club, Gothenburg Concert Hall))
- Glazing: Acoustic glazing for the side windows (UV and burglar-resistant laminated glass panes)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were not available.
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door - Dent / paintcoat damage - Smart repair
2	Wheel / tyres	Alloy rim - front right side - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Side panel - rear left side	Wheel well extension - Scratch(es) - No deduction
4	2nd wheel set	2 tyres (Über 4mm Profiltiefe) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

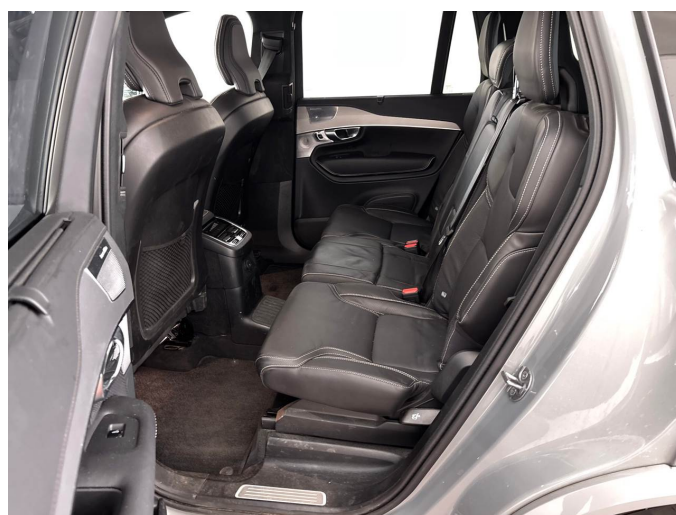


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: Cargo area



Figure 12: VIN

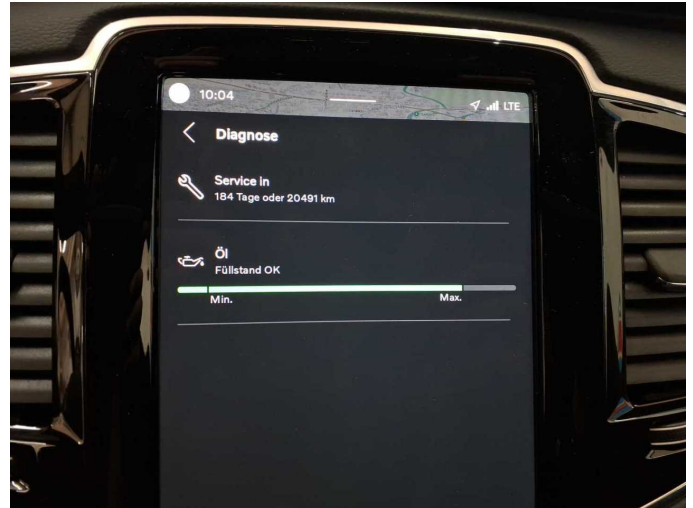


Figure 14: Documents

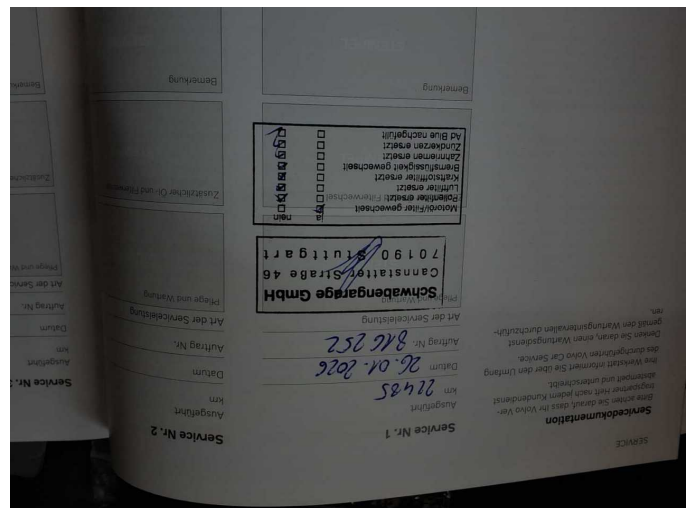


Figure 16: Documents



Figure 18: Additional tyres

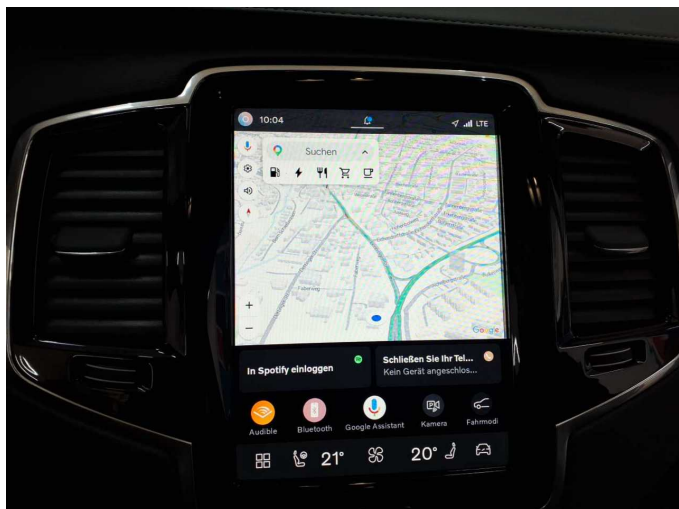


Figure 19: Navigation

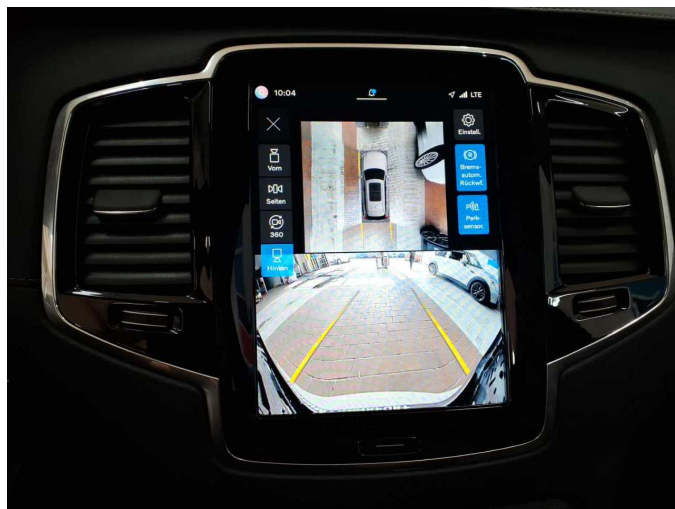


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

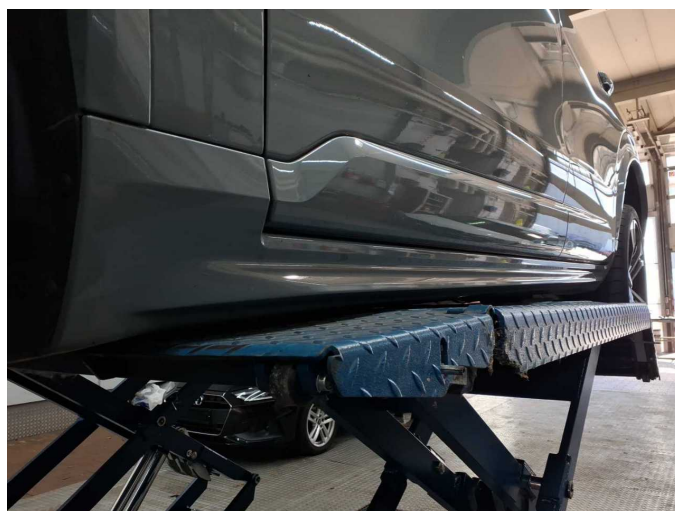


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

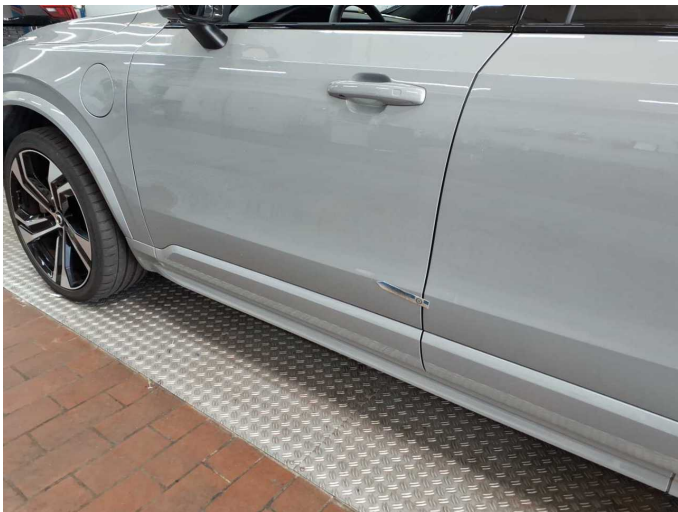


Damage 1: Door - front left side: Door - Dent / paintcoat damage - Smart repair




Damage 1: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 1: Door - front left side: Door - Dent / paintcoat damage - Smart repair

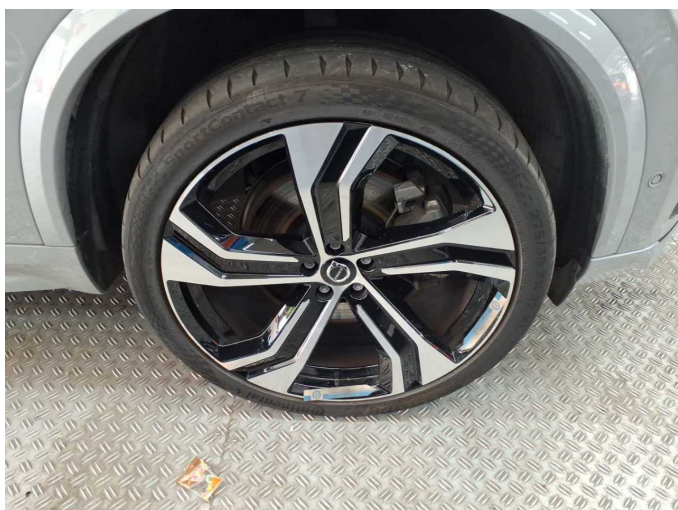

Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Replace

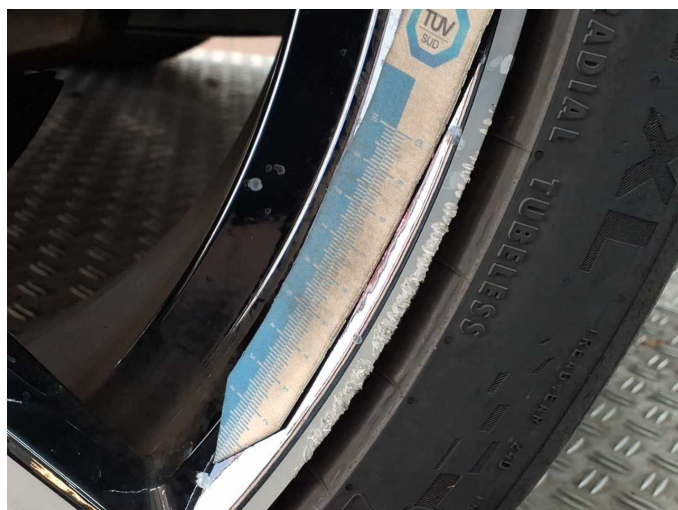

Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Wear and tear 3: Side panel - rear left side: Wheel well extension - Scratch(es) - No deduction



Wear and tear 3: Side panel - rear left side: Wheel well extension -
Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1LFH7V0S1342356

Hersteller / Modell: VOLVO VOLVO XC90 T8 AWD Plug-in Hybrid Ultra Dark

Datum	KM-Stand	Beschreibung
27.01.2026	22.485	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges