



Expertise

Protocol number: 46490204
Order No. / Reference: 26605646
Inspection date: 14 Jul 2026

Manufacturer: Peugeot

Model: 508 SW BlueHDi 130 EAT8 GT

VIN: VR3FCYHZTNY657840



Vehicle details	
Manufacturer / Type / Model / Equipment	
Peugeot 508 SW BlueHDi 130 EAT8 GT	
Vehicle Identification number	VR3FCYHZTNY657840
Mileage (Read)	112,829 km
First registration	3 May 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report not on hand)	
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Platinum Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	12 Monat(e)
Last service on / at	06/2026 at 105,178 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG058117
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1889 / AEA 00045		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,043 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 98W	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	235/45 R18 98W	Summer tyres on Light alloy	Michelin	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Dunlop	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS (Anti-lock Braking System)
- Airbag for driver and front passenger
- Airbag: Curtain airbags front and rear
- Adaptive Cruise Control (ACC) with Stop & Go function
- Exterior mirrors in Perla Nera Black
- Hill start assist
- On-board computer
- Black headliner
- Decorative inlays in carbon look
- EBV (Electronic Brakeforce Distribution)
- Rear parking aid, acoustic and visual
- Electronic Stability Program (ESP)
- Misfueling protection
- High beam assist
- Follow-me-home function (automatic)
- Full LED headlights with headlight range control
- luggage compartment roller blind
- Cup holder in the center console
- Seat belts: 3-point safety belts in all seats
- Rear window and side windows in the second row are more heavily tinted.
- Interior mirror automatically dimming
- Map pockets on the front seatbacks
- Manual child lock
- Height-adjustable headrests
- LED ambient lighting in the front footwell
- Blue LED ambient lighting on the front door panels
- LED daytime running lights
- Steering wheel: Small multifunction leather steering wheel, flattened at the top and bottom.
- Rear center armrest with pass-through flap
- Multifunctional touchscreen
- Multimedia: Mirror Screen
- Navigation system: 3D navigation system NAC
- Particulate filter: FAP diesel particulate filter
- Aluminum pedals and stainless steel door sills
- Upholstery: Decorative copper stitching on the dashboard
- Radio accessories: 2 USB ports (Type A) in row 2
- Rain sensor
- Wheels: Anti-theft wheel bolts
- Reversing camera with 180° surround view
- Electric power steering
- Seats: Ergonomic comfort seats with AGR seal of approval
- Seats: Rear bench seat and backrest 40/60 split folding
- Lane keeping assist with steering intervention
- Chrome-plated decorative exhaust tailpipes
- Traffic sign recognition
- Central locking can be activated from inside using a remote control.
- Active Safety Brake Plus
- Airbag: Side airbag
- Active Blind Spot Assist
- Electrically adjustable, heated and folding exterior mirrors
- Illuminated glove compartment
- Turn signals with lane change indicator function
- third brake light
- Roof rails in high-gloss black
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- Front parking aid, acoustic and visual
- Driving mode selector (Sport - Normal - Eco)
- Electric windows front and rear
- electric parking brake
- Front collision warning
- front and rear floor mats
- Transmission: 8-speed automatic transmission EAT8
- GT logo on the fenders and the trunk lid
- Heated rear window
- rear window wiper
- Rear apron with diffuser look in black
- Frameless interior mirror
- Keyless system
- Automatic climate control (2-zone)
- Radiator grille in checkered flag pattern in "Dark Chrome"
- Blue LED ambient lighting on the dashboard
- LED ceiling lighting at the front
- "Sperone" 18" two-tone alloy wheels
- light sensor
- makeup mirror
- Front center armrests with illuminated storage compartment
- Fatigue warning
- Emergency brake assist
- Break warning
- Upholstery: Fabric/faux leather
- Radio: Audio
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Wheels: Tire repair kit (compressor + tire sealant spray)
- paddle shifters on the steering wheel
- Seats: Passenger seat height adjustable
- Seats: Driver's seat height adjustable
- Sport mode
- Stop&Start system
- Glazing: Laminated glass windshield, noise-reducing
- Immobiliser
- Decorative trim in high-gloss black on the side windows



Extra equipment

- Mechanically swiveling towbar with ball head
- Paint finish: Special metallic paint
- Radio accessories: FOCAL sound system (total output 515 watts - 10 speakers including center speaker and subwoofer - HiFi woofer and midrange speaker as well as TNF tweeter - 12-channel amplifier)
- tailgate sensor-controlled
- Panoramic tilt/slide sunroof with manual blind
- Reversing camera with 360° surround view
- Seats: Ergonomic Comfort Seats Plus with AGR seal of approval (GT) (Ergonomic comfort seats in front, electrically adjustable, driver's seat with memory function - massage function for driver and front passenger seat - front seat heating)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door - dent(s) - Smooth repair work
2	Front bumper	Front bumper - Scratch(es) - Smart repair
3	Engine	Engine - Leaking - Diagnosed and repair if necessary
4	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
5	Wheel / tyres	Alloy rim - front right side - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Wartungshistorie gemäß Auftraggeber Informationen.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

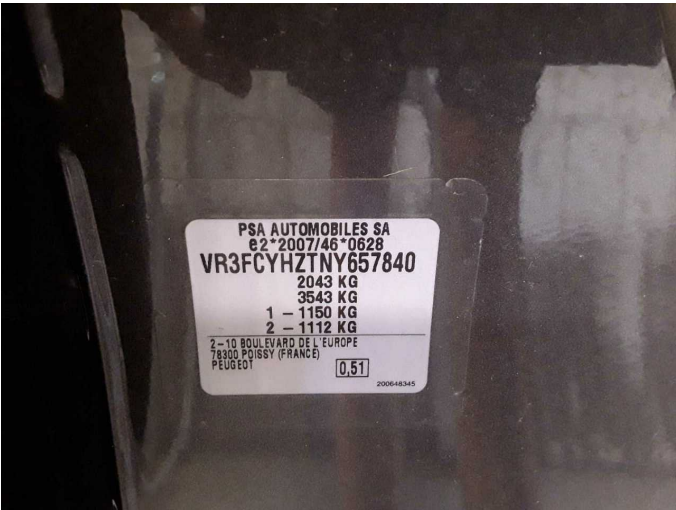


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

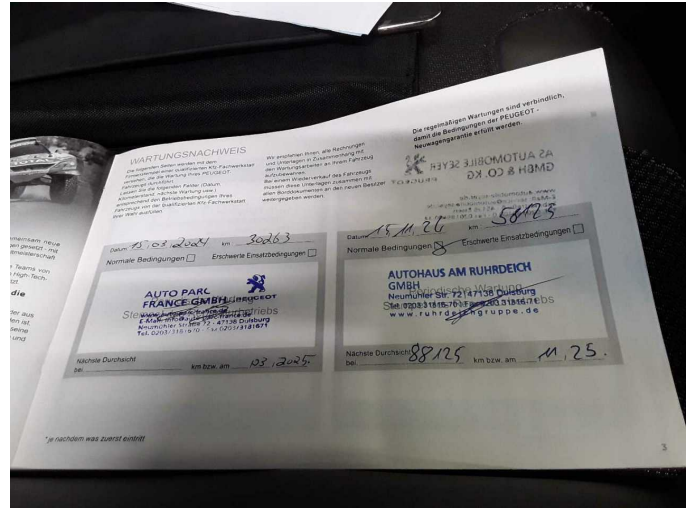


Figure 14: Documents

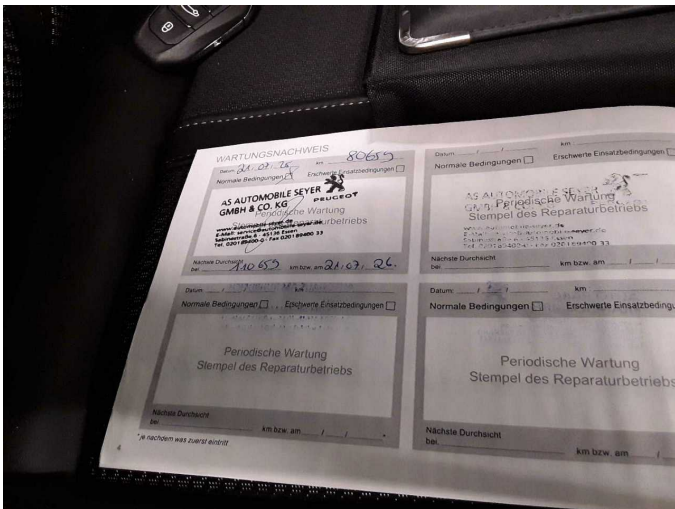


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

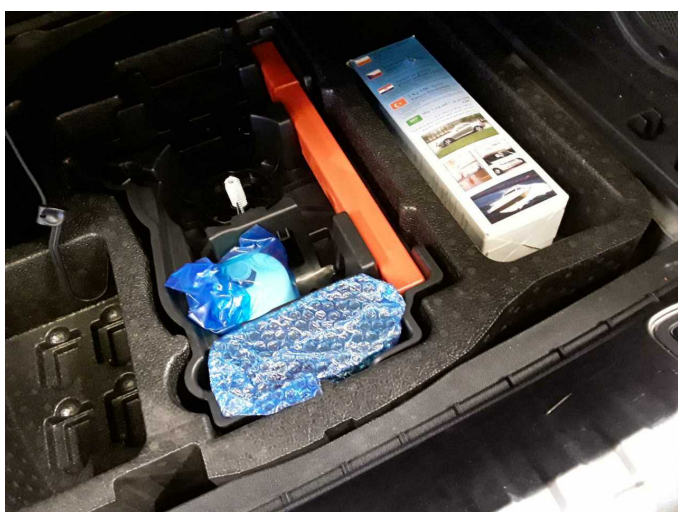


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

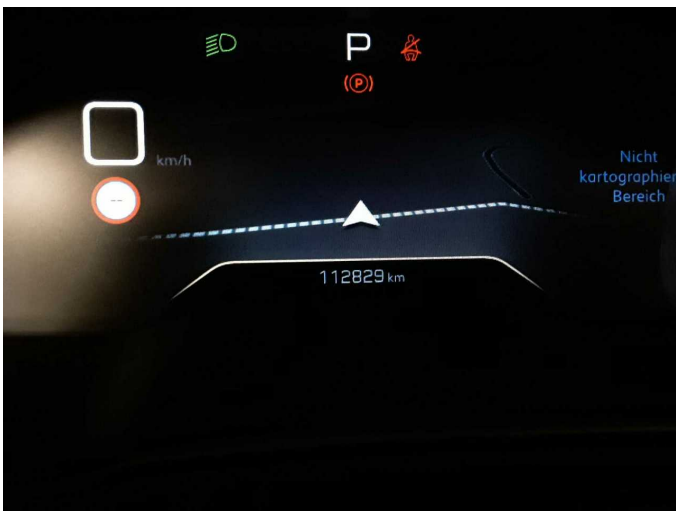


Figure 29: Misc.



Figure 30: Misc.



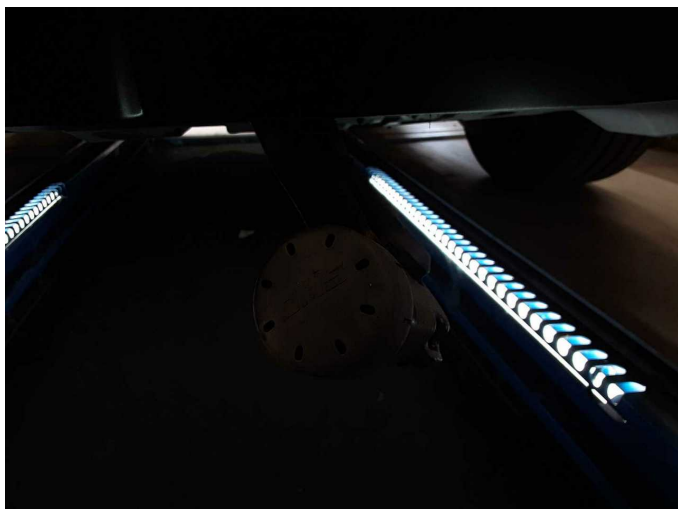



Figure 31: Misc.

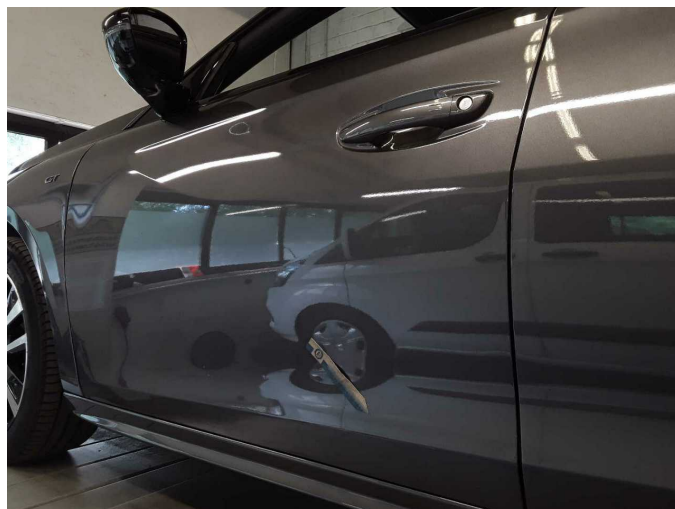

Damage 1: Door - front left side: Door - dent(s) - Smooth repair work

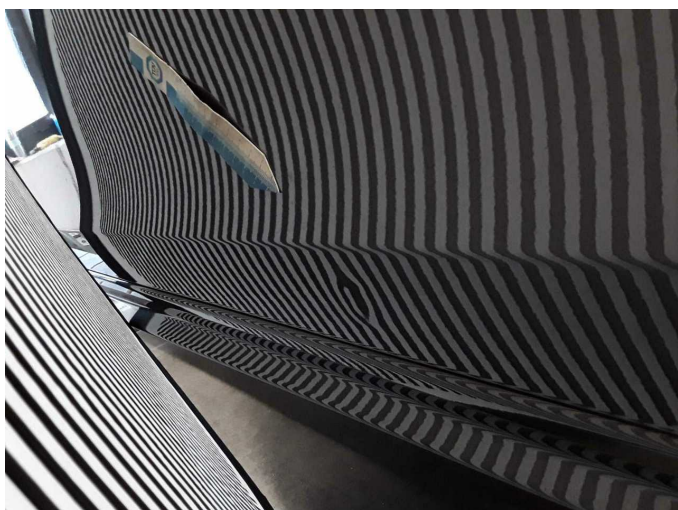

Damage 1: Door - front left side: Door - dent(s) - Smooth repair work

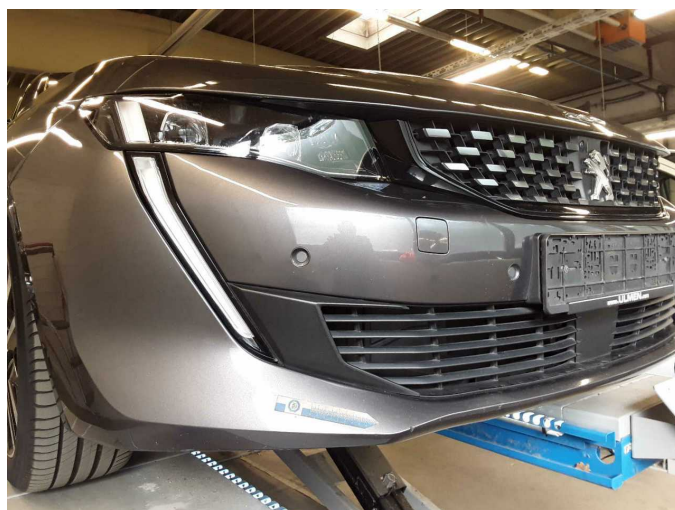

Damage 2: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 2: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 3: Engine: Engine - Leaking - Diagnosed and repair if necessary



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VR3FCYHZTNY657840

Hersteller / Modell: PEUGEOT PEUGEOT 508 SW BlueHDi 130 EAT8 GT

Datum	KM-Stand	Beschreibung
22.06.2026	105.178	Motoröl b. Wartung; Ölfilter ern; Reparatur Sonstiges; Systemtest/ Eigendiagnose; Turbolader ern; Wartung Sonstiges
12.05.2026	105.178	HU + AU
02.03.2026	105.178	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten
24.11.2025	92.009	Regelwartungsdienst
06.11.2025	93.264	Bremsklötze vorne; Bremsscheiben vorne
30.10.2025	92.516	Batterie ern
21.07.2025	68.178	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
22.03.2025	68.178	Bremsklötze hinten; Bremsscheiben hinten
15.11.2024	58.125	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges