



Expertise

Protocol number: 46713493
Order No. / Reference: 26640214
Inspection date: 21 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLE 350 de 4Matic 9G-TRONIC

VIN: W1N1671171A419349



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLE 350 de 4Matic 9G-TRONIC	
Vehicle Identification number	W1N1671171A419349
Mileage (Read)	188,180 km
First registration	14 May 2021
Number of holders	2
Fuel type	Hybr.D/E ext.auf
Engine displacement / Cylinder	1,950 ccm / 4
Power	143 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Obsidianschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	296 Tag(e)
Last service on / at	05/2026 at 182,069 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC563734
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AFH 00057		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,260 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/45 R21 107Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	315/40 R21 111Y	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/50 R20 113V	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	275/50 R20 113V	Winter tyres on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Exhaust system with 2 chrome-plated tailpipe trims
- Adaptive Highbeam Assist
- Airbag: Driver and passenger side
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- 4MATIC permanent all-wheel drive
- Anti-lock braking system
- Foldable armrest for driver and front passenger
- ATTENTION ASSIST
- Electrically adjustable and heated exterior mirrors
- Roof rails in aluminum look
- Downhill Speed Regulation (DSR)
- Third brake light
- EASY-Pack cargo cover (removable)
- ECO start/stop function
- Electronic Stability Program
- Electronic traction system for all-wheel drive (4ETS)
- Electric windows, front and rear
- Velour floor mats
- Transmission: 9G-TRONIC
- Rear window heated
- Rear window wiper with intermittent function
- KEYLESS-GO start function
- Climate: THERMATIC automatic climate control
- Headrests 5-way
- Radiator grille with 2 chrome-plated louvers in SUV design
- Charging system: AC on-board charger 7.4 kW
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Steering column mechanically adjustable lengthwise and heightwise.
- Navigation accessories: Extended MBUX functions
- Navigation: Hard disk navigation
- Package: Chrome
- Package: Mirror Package
- Radio accessories: Digital radio (DAB)
- Tire pressure monitoring system (TPMS)
- Rear view camera
- Power steering
- Seats: Comfort seats
- Seats: Rear seat backrests foldable
- Phone accessories: Smartphone integration
- High-visibility vest for drivers
- Widescreen Cockpit
- Central locking with interior switch
- ADAPTIVE BRAKE
- Adaptive brake light
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist
- Acoustic environmental protection
- Ambient lighting
- Traction control (ASR)
- Rear armrest
- Automatic passenger airbag deactivation
- Brake Assist BAS
- Diesel particulate filter
- Tachometer
- EASY-Pack tailgate with electric operation for opening and closing
- Front door sills with "Mercedes-Benz" lettering illuminated in white
- Chassis with steel springs and lowered suspension
- electric parking brake
- Speed Limit Assistant
- Lockable, air-conditioned and illuminated glove compartment
- Interior headliner fabric crystal grey
- Mechanical child safety lock in the rear doors
- Communication module (LTE) for the use of Mercedes me connect services
- Charging cable for household socket, 5m, smooth (This charging cable, also called Mode 2 cable, allows you to charge the vehicle battery at the household socket with up to 2.3 kW (230 V, 1-phase, 10 A) and fits sockets of type E/F CEE 7/7.)
- Mercedes-Benz emergency call system
- Navigation accessories: Pre-installation for navigation services
- Package: Parking package with reversing camera
- PRE-SAFE system
- Radio accessories: Additional USB ports
- Remote Services Plus
- Windscreen wipers with rain sensor
- 3-point seat belts
- Seats: Heated seats for driver and front passenger seats
- Seats: Front seats electrically adjustable
- Cruise control with variable speed limiter
- Immobiliser
- Heat-insulating glass, all around
- Decorative elements: Brushed aluminum with light longitudinal grain

Extra equipment

- Airbag: Sidebags in the rear, left and right
- Black fabric headliner
- Paint finish: Metallic
- Charging cable for wallbox and public charging stations Type 2 (Mode 3) 8 m, smooth
- MULTIBEAM LED (84 individually controllable high-performance LEDs per headlight - low beam and high beam in LED projection technology - Adaptive Highbeam Assist Plus - ULTRA RANGE high beam with a range of 650 m (maximum legally permissible beam range) - cornering light or cornering light with roundabout and intersection function - active curve illumination - extended fog light, city light, country road light, motorway light and bad weather light - off-road light - adaptive full-LED taillights)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Steering Assist - Active Brake Assist - Evasive Steering Assist - Active Lane Keeping Assist - Active Blind Spot Assist - PRE-SAFE PLUS)
- Package: MBUX Innovation Package (MBUX Interior Assistant - Head-up Display - MBUX Augmented Reality for Navigation - Full-screen navigation in the instrument cluster). Enjoy touchless operating convenience with the MBUX Interior Assistant: the innovative system detects and interprets your hand and arm movements. Selected functions can thus be activated literally in the blink of an eye. The system can distinguish between driver and front passenger – so that you access precisely the menus you want to use.)
- Radio accessories: Burmester surround sound system (with 13 speakers and 590 watts system power. Experience enhanced performance and exclusivity with legendary Burmester sound. The high-performance speakers create a first-class surround sound experience. This can be specifically optimized for the front and rear seats, intensifying the listening experience. A quality that is also visible thanks to the high-quality Burmester logos.)
- Seats: Multicontour seats for driver and front passenger (driver and front passenger seats fully electrically adjustable via the switches in the door control panel: - Seat cushion depth adjustment - Seat cushion tilt adjustment - Seat longitudinal adjustment - Seat height adjustment - Seat backrest tilt adjustment - Headrest adjustment (horizontal and vertical) - 4-way lumbar support - Comfort headrests - Active cushions with inflatable air chambers in the lower seat back and side bolsters - Hot stone massage effect in the lumbar region - Seat heating plus - Front seat ventilation)
- Towbar with ESP trailer stabilization
- Instrument panel and door sills in ARTICO leatherette (Instrument panel in ARTICO leatherette - Door sills in ARTICO leatherette)
- Chrome-look loading sill protector
- Package: AIR-BALANCE (fragrance generator with filled fragrance bottle and function button in the glove compartment - ionizer in the side nozzle channel - improved filter system between the intake area and the air distribution system of the air conditioning unit)
- Package: AMG Line Exterior (diamond grille with chrome pins, integrated Mercedes star and 1 louvre painted in matte iridium silver with chrome inserts - AMG Styling: AMG front apron with chrome trim strip, sporty and distinctive air intakes in the wheel arch trims, fender flares front and rear in body paint, AMG side sill trims, AMG rear apron with diffuser-look insert in black and chrome trim strip)
- Package: KEYLESS-GO Comfort Package (vehicle key with KEYLESS-GO functionality - KEYLESS-GO access and drive authorization system - start/stop button - comfort opening and closing - door handles with chrome inlay - HANDS-FREE ACCESS - handle recess lighting - remote trunk lid closing - EASY-PACK tailgate)
- Package: Public Charging (Includes charging cable for wallbox and public charging stations, 5m, smooth and Remote and Charging Services Plus)
- Upholstery: Leather (including 4-way lumbar support for driver, electrically adjustable seat cushion depth and front headrests)
- Wheels: 53.3 cm (21") AMG multi-spoke light-alloy wheels (painted Himalayan grey and polished with front axle 275/45 R 21 on 10 J x 21 ET 54, rear axle 315/40 R 21 on 11 J x 21 ET 49)
- Sunroof: Panoramic sunroof (large glass module made of heat-insulating, tinted safety glass - mesh wind deflector in the front area - electric sunshade with one-touch operation - comprehensive protection concept: - anti-pinch protection - automatic rain closing - PRE-SAFE closing function (only in conjunction with PRE-SAFE system))
- Telephone: Multifunctional telephony (wireless connection of mobile phone with external antenna - wireless charging for compatible mobile phones - Bluetooth and WLAN pairing wirelessly via NFC (Near Field Communication) technology)
- Partition net for luggage compartment separation and occupant protection
- Heat-insulating dark tinted glass



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Rear of vehicle	Trailer hitch (Anhängerkupplung fährt nicht aus, ohne Funktion) - Specify findings - Perform diagnosis
2	Door - front left side	Door - Scratch(es) - Smart repair
3	Front bumper	Spoiler (Zierleiste rechts) - Damaged - Replace
4	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
5	Door - rear left side	Door - Scratch(es) - Paint
6	Rear bumper	Rear bumper - Scratched - Paint
7	Side panel - rear left side	Side panel - Scratch(es) - Paint
8	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint
9	Wheel / tyres	Alloy rim - front left side (Mit Materialabtrag) - Scratch(es) - Replace
10	Bonnet	Bonnet - Deformed - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Interior	Interior - Soiled - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 28 Aug 2021	5.043,34 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

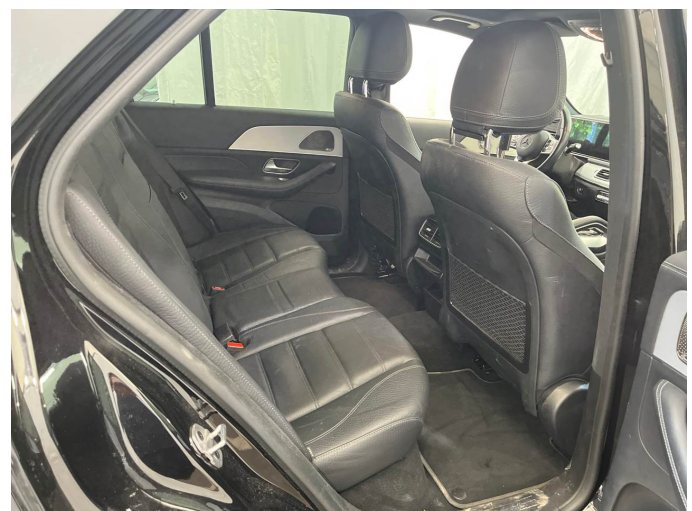


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

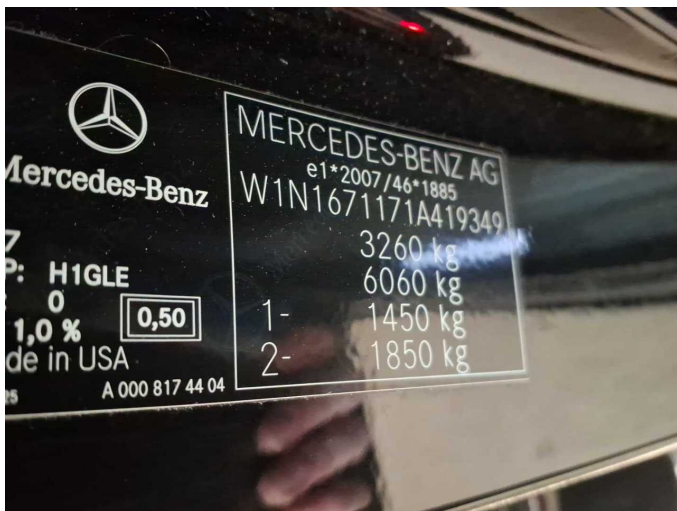


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

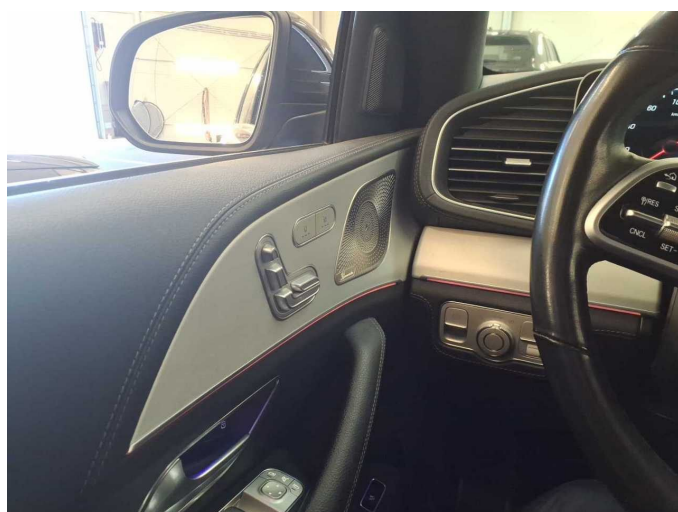


Figure 22: Misc.

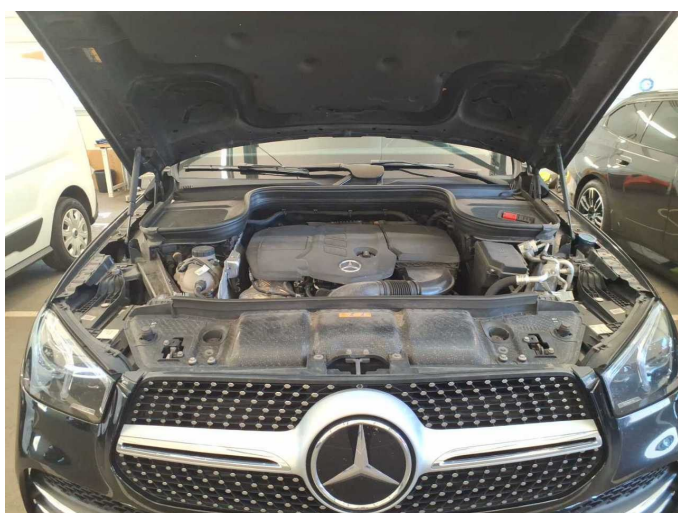


Figure 23: Misc.

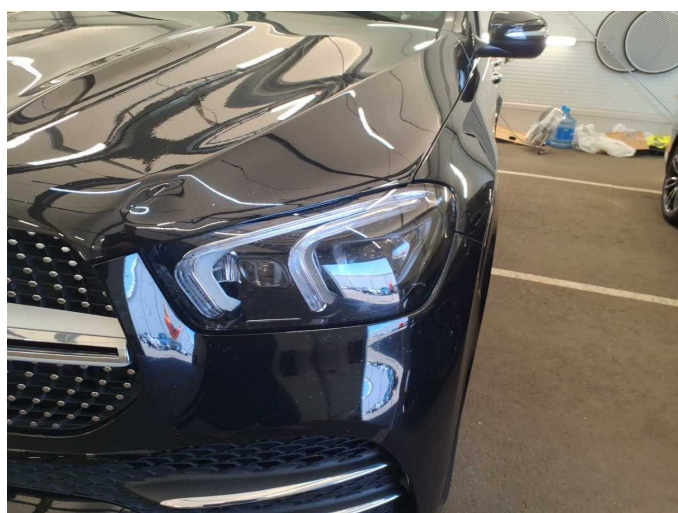


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

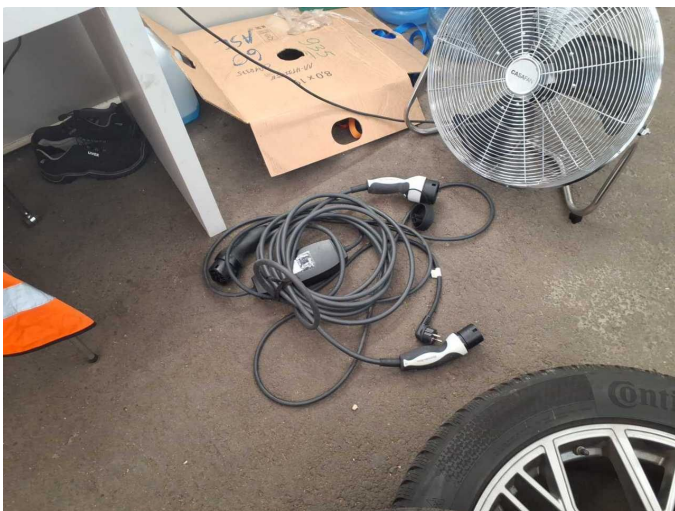


Figure 29: Misc.



Figure 30: Misc.



Damage 1: Rear of vehicle: Trailer hitch (Anhängerkupplung fährt nicht aus, ohne Funktion) - Specify findings - Perform diagnosis




Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 3: Front bumper: Spoiler (Zierleiste rechts) - Damaged - Replace

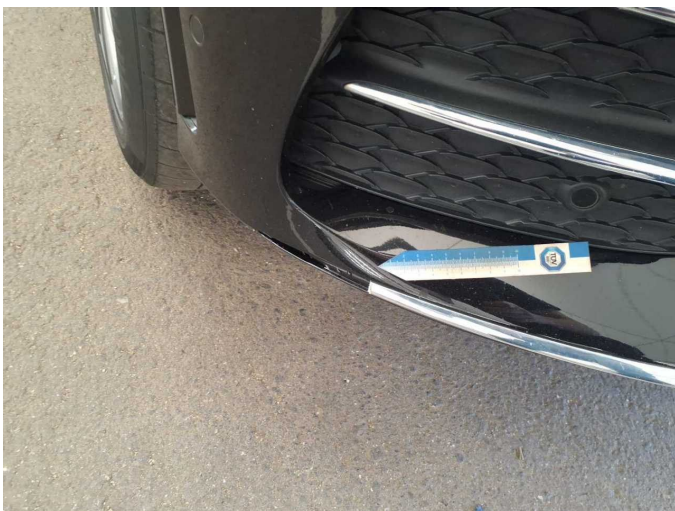

Damage 3: Front bumper: Spoiler (Zierleiste rechts) - Damaged - Replace



Damage 3: Front bumper: Spoiler (Zierleiste rechts) - Damaged - Replace




Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value




Damage 5: Door - rear left side: Door - Scratch(es) - Paint

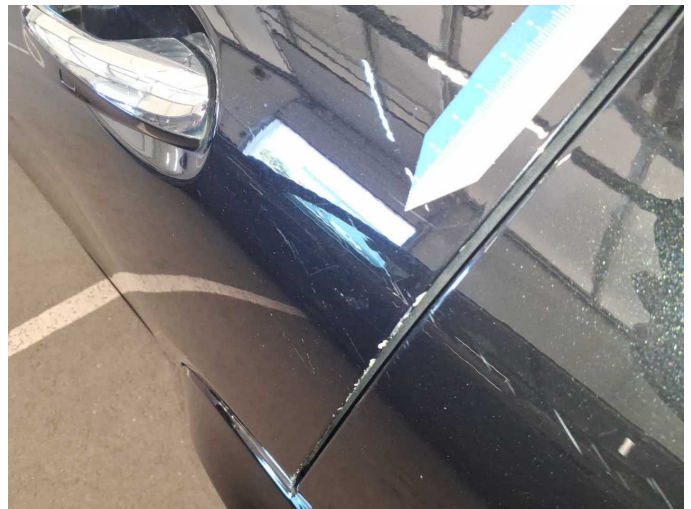

Damage 5: Door - rear left side: Door - Scratch(es) - Paint




Damage 5: Door - rear left side: Door - Scratch(es) - Paint

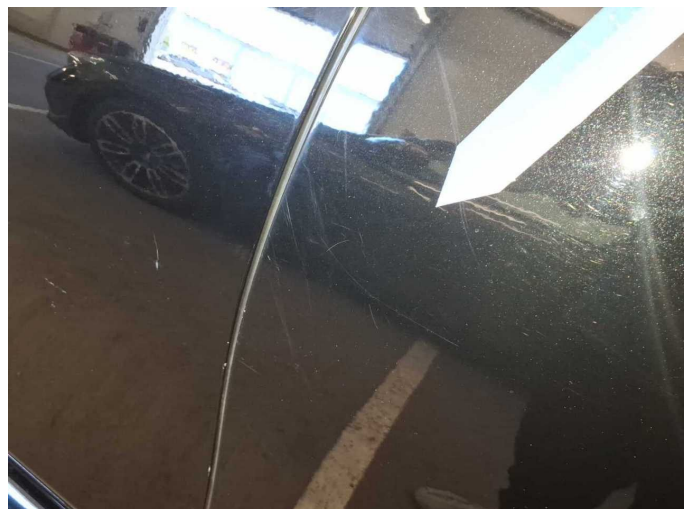

Damage 5: Door - rear left side: Door - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint

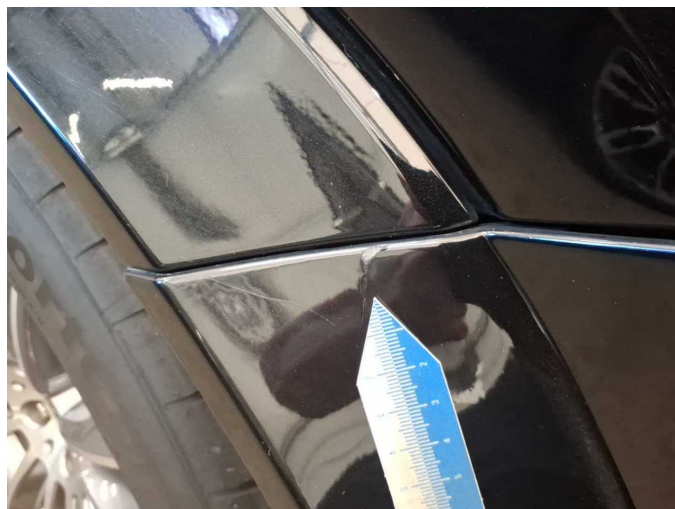

Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 8: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 8: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 8: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 9: Wheel / tyres: Alloy rim - front left side (Mit Materialabtrag) - Scratch(es) - Replace




Damage 9: Wheel / tyres: Alloy rim - front left side (Mit Materialabtrag) - Scratch(es) - Replace




Damage 9: Wheel / tyres: Alloy rim - front left side (Mit Materialabtrag) - Scratch(es) - Replace

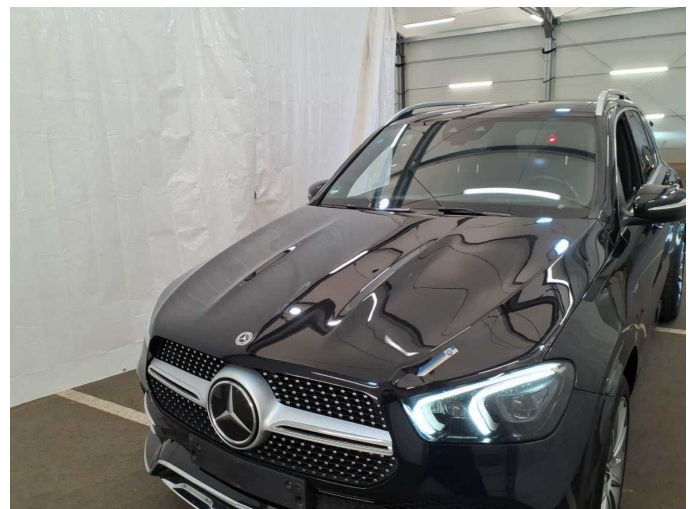

Damage 10: Bonnet: Bonnet - Deformed - Repair and paint

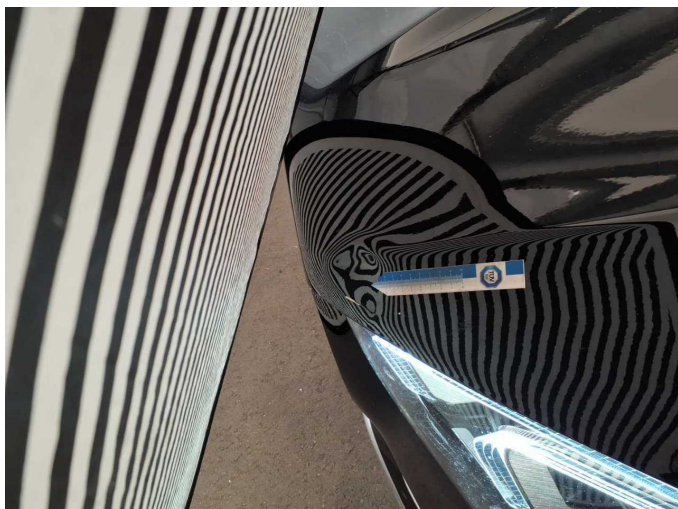

Damage 10: Bonnet: Bonnet - Deformed - Repair and paint

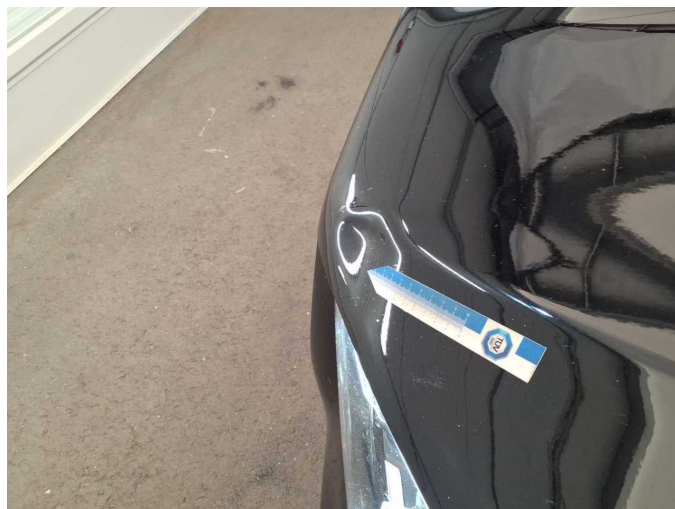

Damage 10: Bonnet: Bonnet - Deformed - Repair and paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N1671171A419349

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLE 350 de 4Matic 9G-TRONIC

Datum	KM-Stand	Beschreibung
16.06.2026	186.625	Reparatur Sonstiges; Systemtest/Eigendiagnose
01.05.2026	182.069	AU; Regelwartungsdienst
21.10.2025	158.643	Bremsscheiben vorne
15.10.2025	158.145	Regelwartungsdienst
16.07.2025	148.749	Ladeluftschlauch ern; Systemtest/Eigendiagnose
23.05.2025	140.650	Reparatur Sonstiges; Systemtest/Eigendiagnose
03.02.2025	132.040	Regelwartungsdienst
09.08.2024	114.884	Reparatur Sonstiges; Reparatur Sonstiges; Systemtest/Eigendiagnose
13.05.2024	105.341	AU; Regelwartungsdienst
06.11.2023	84.876	Bremse Sonstiges; Reparatur Sonstiges; Systemtest/Eigendiagnose
22.09.2023	80.398	Reparatur Sonstiges; Systemtest/Eigendiagnose; Turbolader ern; Wartung Sonstiges
20.09.2023	80.398	Regelwartungsdienst
26.07.2023	74.126	Systemtest/Eigendiagnose
20.07.2023	73.718	Systemtest/Eigendiagnose
12.12.2022	53.358	Regelwartungsdienst
28.03.2022	26.193	Regelwartungsdienst