



Expertise

Protocol number: 46428374
Order No. / Reference: 26605940
Inspection date: 9 Jul 2026

Manufacturer: Audi

Model: A4 Avant 30 TDI S tronic advanced

VIN: WAUZZZF47PA022347



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Avant 30 TDI S tronic advanced	
Vehicle Identification number	WAUZZZF47PA022347
Mileage (Read)	167,361 km
First registration	15 Nov 2022
Number of holders	1
Next periodical technical inspection	12/2027
(Report on hand)	
Power / Engine displacement	100 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Ibisweiss (Y9C)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	2 Monat(e)
Last service on / at	12/2025 at 145,552 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP781451
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BPI 00835		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,160 kg	Empty weight	
Dimensions	4766 x 1847 x 1446		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94H	Summer tyres on Light alloy	Pirelli	7mm / 7mm
2)	225/50 R17 94H	Summer tyres on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Dunlop	8mm / 8mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Dunlop	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- AdBlue tank (12 liters) (tank for AdBlue solution for reducing nitrogen oxides in the exhaust gas using an SCR system)
- Accent surfaces in matte black (for dashboard, trim panels in door sills and center console insert)
- Traction control (ASR)
- Audi pre sense city (can detect vehicles and pedestrians within system limits at speeds up to approximately 85 km/h. If an impending collision is detected, the system warns the driver visually, audibly, and, if necessary, with a braking jolt, and can initiate full deceleration if required to reduce speed or, if necessary, avoid the collision.)
- Electrically adjustable and heated exterior mirrors (with integrated LED turn signals, including heated windshield washer nozzles)
- Headliner in fabric (depending on the chosen interior color, either titanium grey or atlas beige)
- Decorative inlays diamond lacquer silver grey
- Tachometer
- Electromechanical parking brake (includes parking brake function when stationary, starting aid by automatic release when starting and full deceleration while driving via all 4 wheels)
- Chassis: Standard chassis (for good driving dynamics with very good ride comfort; shock absorbers and coil springs on front and rear axles)
- Electric windows (front and rear)
- Window channel strips in black (rubber)
- Remote key, without SafeLock (locks and unlocks doors, luggage compartment and fuel filler flap - including Keyless-Go - including comfort closing/opening of windows)
- Transmission: S tronic 7-speed
- rear window wiper
- Top speed limited to 210 km/h
- Interior lighting (front and rear roof module including reading lights - capacitively operated at the front, ambient light on center console, glove box light, passive door warning lights, trunk light on the left, additionally on the right for the A4 Avant/S4 Avant, and tailgate lighting)
- ISOFIX and Top Tether child seat attachment for the outer rear seats (holding device for the practical attachment of ISOFIX child seats with an additional upper attachment point (Top Tether) on the outer rear seats)
- boot floor mat
- Headrests (5) (height adjustable front and rear)
- Loading floor (one side in high-quality velour, the other as a waterproof, durable dirt tray)
- Manual cargo cover
- LED taillights (taillights using LED technology impress with faster activation of the taillights and brake lights, thus enabling earlier detection by following traffic. The light signature is a visible recognition signal to the rear.)
- Steering column, manually adjustable in height and axis
- Airbag for driver and front passenger (with front passenger airbag deactivation)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS) (with electronic brake force distribution (EBD) and brake assist)
- Audi connect Emergency Call & Service with Audi connect Remote & Control (Audi connect Emergency Call: - Online breakdown call - Audi damage service - Audi service appointment online - Online Car Care Audi connect Remote & Control: - Parking position - Vehicle status - Remote locking and unlocking - Remote control of auxiliary heating - Anti-theft alarm notification)
- Exterior mirror housings in body color
- On-board tools (in the luggage compartment)
- third brake light, raised
- Black roof rails (for transport, stable and aerodynamically shaped, in aluminum)
- Diesel particulate filter (DPF)
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Electronic Stability Control (ESC)
- Driver Information System (with high-resolution 5" monochrome display - display content: speed, time, mileage, outside temperature, fuel warning with remaining range, gear shift indicator, current radio station or music track, radio and media lists, telephone menu (in conjunction with multifunction steering wheel), navigation information (if equipped). On-board computer with short- and long-term memory - including break recommendation)
- Front and rear floor mats (made of velour in black)
- Cruise control with speed limiter (assists in maintaining a speed of approximately 20 km/h or higher, provided engine and braking power allow. The speed limiter helps to prevent exceeding a speed of approximately 30 km/h. The system limits the speed even when the accelerator pedal is depressed. It is operated via a separate steering column stalk. The set speed is displayed in the driver information system.)
- Interior mirror dimming
- Child lock
- Automatic climate control (single-zone automatic climate control - electronically regulates air temperature, volume and distribution, sun position-dependent control - air distribution can be set using 5 main positions - the 3 LEDs integrated into the seat heating and seat ventilation buttons provide feedback on the selected setting (optional) - buttons for defrosting the front and rear windows - manual recirculation control and particle filter - with key recognition and humidity sensor)
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction controls (height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 6 multifunction buttons.)



- Light/rain sensor (for controlling the automatic headlight switching, the coming home/leaving home function and the automatic windshield wiper function)
- front center armrest
- Non-smoking version (one 12-volt socket each in the front in front of the cup holders and in the rear for the 2nd row of seats - no cigarette lighter)
- Wheel: Alloy wheels, 5-arm (size 7 J x 16 with tires 205/60 R 16)
- Wheel: Low rolling resistance tires, speed-limited (maximum permissible speed 210 km/h)
- Radio accessories: 8 speakers (passive) front and rear
- Radio accessories: Digital radio reception (DAB) (in addition to the analog station offerings, reception of digitally broadcast radio stations according to the DAB standard. Display of program-related information (e.g., artist and title) as well as additional information in the form of a slideshow (e.g., album art and weather). A second DAB tuner with a second DAB antenna continuously searches for alternative reception frequencies of the selected station. The station list is updated simultaneously.)
- Headlights in LED technology (low beam, high beam, daytime running light and position light in LED, turn signal in incandescent bulb technology, with all-weather light - create a daylight-like illumination of the road and impress with low energy consumption, long service life and good visibility to others)
- Seats: Standard front seats (with manual adjustment of seat height, seat longitudinal position, backrest angle, headrest height and seat belt height)
- Seats: Front seats manually adjustable
- Start-stop system (helps reduce fuel consumption and CO2 emissions by switching off the engine during stationary phases, e.g. at traffic lights. For restarting, the starting process is initiated as soon as the foot brake is released. Can be deactivated at any time via a button.)
- First aid kit with warning triangle (warning triangle in the trunk - first aid kit in the trunk - 2 high-visibility vests in the door pockets)
- Electronic immobilizer
- Central locking "Keyless-Go" without safe locking (keyless engine start)
- Mild hybrid (Mild hybrid features an enhanced start-stop function, extended energy recuperation during braking to charge the starter battery, and additional lithium-ion storage. This allows the system to recover more energy and switch off the engine more frequently. A supplementary belt-driven starter generator (BSG) is conceptually included for mild hybrid systems. Purely electric driving is not possible.)
- Radio: MMI Radio plus (10.1" color display (1,540 × 720) including MMI touch operation - driver information system with 5" mono display - Bluetooth interface (hands-free calling and audio streaming) - Audi music interface with 1 USB-A and 1 USB-C port, each with data and charging function - passive speakers - AM/FM phase diversity - speed-dependent volume adjustment - voice control system with natural language for controlling infotainment and vehicle functions - WLAN hardware)
- Tire pressure monitoring system (visual and audible warning in case of pressure loss in one or more wheels, display in the driver information system)
- Tire repair kit (compressor and tire sealant, maximum permissible speed 80 km/h)
- Electromechanical power steering (maintenance-free rack and pinion steering with speed-dependent steering assistance; precise steering feel at high speeds, excellent support when parking.)
- Seat covers in Index fabric (seat center panels in Index fabric black or rock grey - seat side bolsters, headrests, center armrest in solid black or rock grey fabric)
- Seats: Folding rear seat backrest (split in a 40:20:40 ratio or fully foldable - center armrest - including lashing eyes, 4 in the luggage compartment, for securing luggage and objects - attachment points for the luggage compartment net, with removable partition net; to be attached to the body or to the folded rear seat backrest; helpful whether the rear seat backrest is upright, folded down on one side, or folded down on both sides)
- Glazing: Windscreen in heat-insulating and acoustic glazing (windscreen in heat-insulating glazing, green tinted - improved external noise insulation)



Extra equipment

- Decorative inlays in matt brushed aluminum (for dashboard, door panels and center console)
- Deletion of model designation and performance/technology lettering
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and S sport seats also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
- Fuel tank with increased filling volume (54 l)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- High-beam assist (within the system's limitations, it automatically detects oncoming headlights, taillights of other road users, and light sources in built-up areas. Depending on the traffic situation, the high beams are automatically switched on or off. The system thus improves the driver's visibility and increases comfort.)
- Paint finish: Solid
- Power outlet: USB charging port for rear passengers (2 USB charging ports for rear passengers in the rear center console - instead of 12-volt socket in the rear (from non-smoking version))
- S line interior package (sports seats in front - black fabric/leather combination with S embossing in the backrests of the front seats - 3-spoke leather steering wheel with multifunction plus including steering wheel grips in perforated leather and S emblem - brushed matt aluminum inlays - glossy black accent surfaces - illuminated front door sill trims with aluminum inlays and S lettering - stainless steel pedals and footrest - black fabric headliner - velour floor mats in the front)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)
- Front sports seats (with manual adjustment of seat height, seat longitudinal position, seat tilt, backrest tilt, headrest and belt height; with pronounced seat side bolsters for better lateral support in curves, extendable thigh support)
- Rear parking aid (supports reversing and maneuvering within the system limits by acoustically indicating the distance to a detected object behind the vehicle. The measurement is carried out by ultrasonic sensors discreetly integrated into the bumper, which are activated when reverse gear is engaged.)
- Seat covers in fabric Sequenz/leather combination (for front sports seats: - Seat center section of the front seats and the two outer rear seats in fabric Sequenz black - Seat side bolsters, headrest center section front in leather black with contrast stitching - S embossing in the backrests of the front seats - Headrests in the rear as well as center armrest front and rear in synthetic leather)
- Steering wheel: Sport contour leather steering wheel in 3-spoke design, flattened at the bottom with multifunction plus (with more contoured steering wheel rim; adjustable in height and distance; with 12 multifunction buttons for convenient operation of the available infotainment features with shift paddles for manual gear changes in automatic transmissions)
- Telephone: Audi Smartphone Interface (The Audi smartphone interface (Android Auto and Apple CarPlay) connects your smartphone to your Audi and seamlessly displays your smartphone content directly on the MMI display. Navigation, telephony, music, and selected third-party apps can be conveniently controlled via the MMI touchscreen and voice control. The connection can be established either using a suitable USB cable or wirelessly.)
- Wheel: Alloy wheels, 5 parallel spokes (7.5 JX 17 with tires 225/50 R 17)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Door - front right side	Door (Mehrkosten möglich) - Scratch(es) - Conditioning
2	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
3	Door - rear left side	Door - dent(s) - Smart repair
4	Rear bumper	Spoiler - Scratched - Loss in value
5	Side panel - rear left side	Elbow - Scratch(es) - Paint
6	Sill - right side	Sill (Zierleiste) - Scratched - Paint
7	Mudguard - right side	Mudguard - right side - Scratch(es) - Paint
8	Rear bumper	Rear bumper - Scratched - Paint
9	Door - rear right side	Door - Scratched - Paint
10	Door - front left side	Door - Dent / paintcoat damage - Paint
11	Front bumper	Front bumper - Scratched - Paint
12	Bonnet	Bonnet - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Misc.	Inspection / maintenance (30, 60, 90, 120 000er) - Missing - No deduction
2	2nd wheel set	1 alloy rim - Scratched - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description
Equipment - Tirefit filler
Interior - Rear shelf

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 23 May 2023	970,00 €
2	Front, Side right, Provided by user / customer, from 12 Feb 2024	4.458,40 €

Repainting

No.	Repainting
1	Bonnet, Door - front right side, Professionally carried out

Paint coat thickness measurement

Bonnet	85 µm	Door - front right side	175 µm
--------	-------	-------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

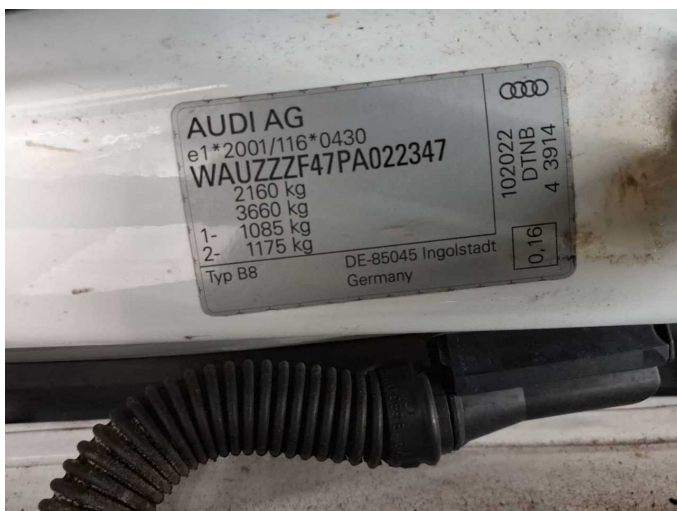


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

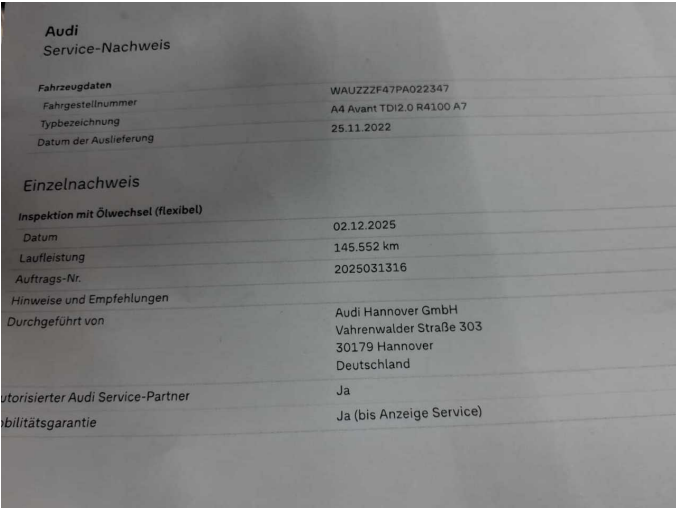


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres

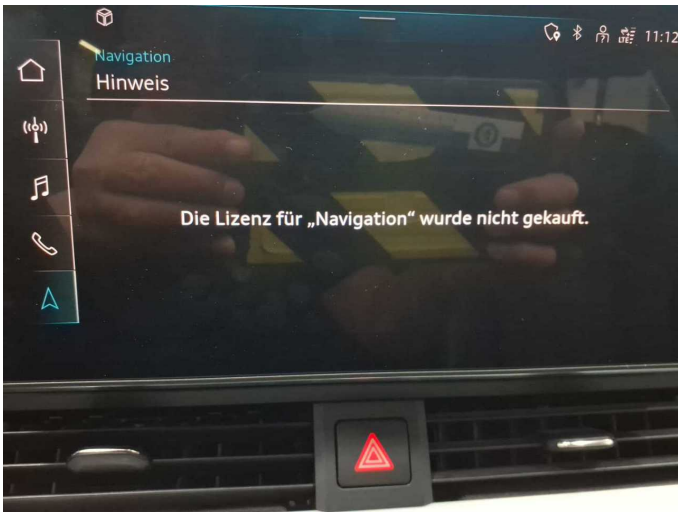


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

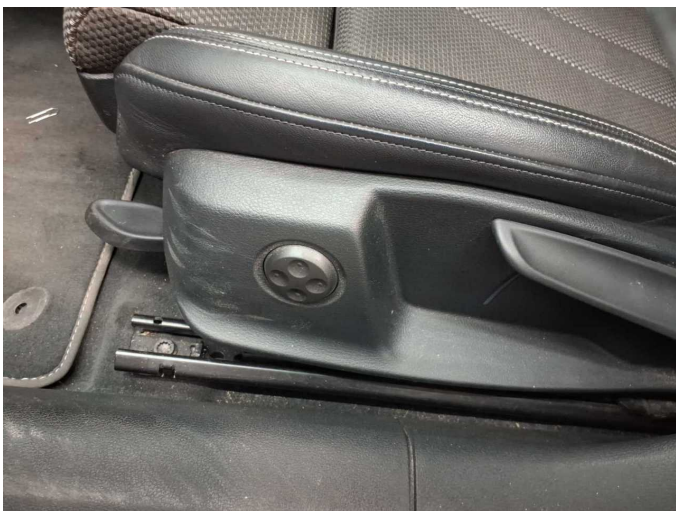


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

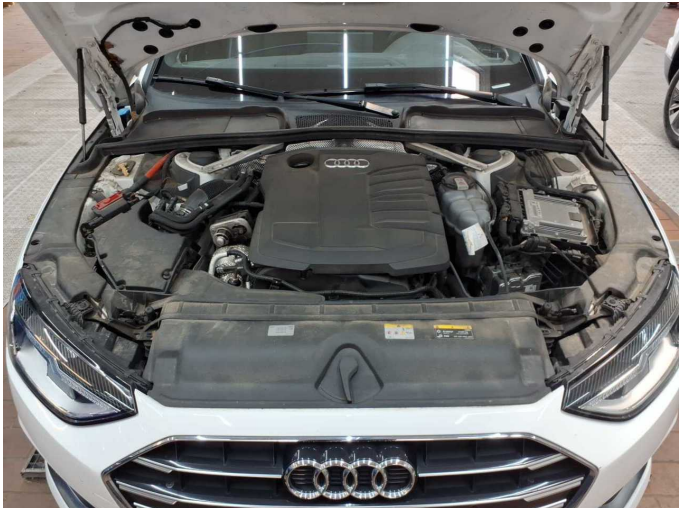


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 1: Door - front right side: Door (Mehrkosten möglich) - Scratch(es) - Conditioning



Damage 1: Door - front right side: Door (Mehrkosten möglich) - Scratch(es) - Conditioning



Damage 2: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 2: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 3: Door - rear left side: Door - dent(s) - Smart repair



Damage 3: Door - rear left side: Door - dent(s) - Smart repair



Damage 4: Rear bumper: Spoiler - Scratched - Loss in value




Damage 4: Rear bumper: Spoiler - Scratched - Loss in value



Damage 4: Rear bumper: Spoiler - Scratched - Loss in value



Damage 4: Rear bumper: Spoiler - Scratched - Loss in value

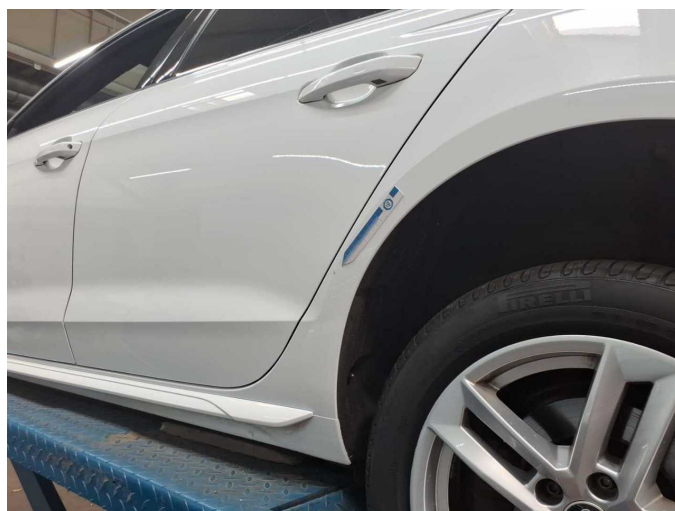

Damage 5: Side panel - rear left side: Elbow - Scratch(es) - Paint



Damage 5: Side panel - rear left side: Elbow - Scratch(es) - Paint



Damage 6: Sill - right side: Sill (Zierleiste) - Scratched - Paint



Damage 6: Sill - right side: Sill (Zierleiste) - Scratched - Paint



Damage 6: Sill - right side: Sill (Zierleiste) - Scratched - Paint



Damage 6: Sill - right side: Sill (Zierleiste) - Scratched - Paint



Damage 7: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 7: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Door - rear right side: Door - Scratched - Paint



Damage 9: Door - rear right side: Door - Scratched - Paint



Damage 10: Door - front left side: Door - Dent / paintcoat damage - Paint




Damage 10: Door - front left side: Door - Dent / paintcoat damage - Paint



Damage 10: Door - front left side: Door - Dent / paintcoat damage - Paint



Damage 10: Door - front left side: Door - Dent / paintcoat damage - Paint

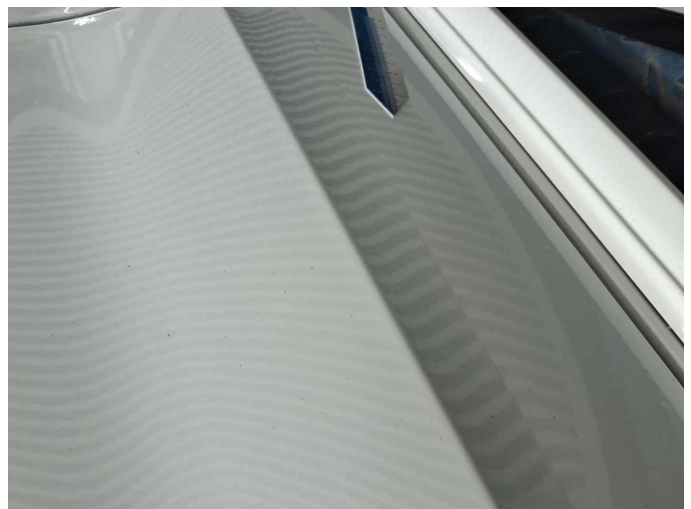

Damage 10: Door - front left side: Door - Dent / paintcoat damage - Paint



Damage 11: Front bumper: Front bumper - Scratched - Paint



Damage 11: Front bumper: Front bumper - Scratched - Paint



Damage 11: Front bumper: Front bumper - Scratched - Paint



Damage 11: Front bumper: Front bumper - Scratched - Paint



Damage 11: Front bumper: Front bumper - Scratched - Paint



Damage 11: Front bumper: Front bumper - Scratched - Paint



Damage 11: Front bumper: Front bumper - Scratched - Paint



Damage 11: Front bumper: Front bumper - Scratched - Paint



Damage 11: Front bumper: Front bumper - Scratched - Paint



Damage 11: Front bumper: Front bumper - Scratched - Paint



Damage 12: Bonnet: Bonnet - Stone chips - Paint



Damage 12: Bonnet: Bonnet - Stone chips - Paint



Damage 12: Bonnet: Bonnet - Stone chips - Paint



Damage 12: Bonnet: Bonnet - Stone chips - Paint



Repainting 1: Bonnet, Door - front right side



Repainting 1: Bonnet, Door - front right side



Repainting 1: Bonnet, Door - front right side



Repainting 1: Bonnet, Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF47PA022347
Hersteller / Modell: AUDI AUDI A4 Avant 30 TDI S tronic advanced

Datum	KM-Stand	Beschreibung
04.12.2025	145.552	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; HU + AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.04.2025	118.191	Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
17.09.2024	87.465	Bremsflüssigkeit; Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
09.02.2024	57.541	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
30.06.2023	31.098	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges