



Expertise

Protocol number: 46423848
Order No. / Reference: 26578289
Inspection date: 9 Jul 2026

Manufacturer: Volkswagen

Model: ID.4 Performance Upgrade Pro

VIN: WVGZZZE2ZPE001048



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID.4 Performance Upgrade Pro	
Vehicle Identification number	WVGZZZE2ZPE001048
Mileage (Read)	67,073 km
First registration	22 Nov 2022
Number of holders	1
Next periodical technical inspection	11/2027
(Report on hand)	
Power / Engine displacement	70 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Grenadilschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	141 Tag(e)
Last service on / at	11/2024 at 35,712 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM751821
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLQ 00106		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,540 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105H	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	225/50 R19 107H	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101T	Winter tires (with run-flat tires) on Light alloy	Pirelli	7mm / 7mm
2)	255/50 R19 103T	Winter tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 USB-C ports on the front
- Airbag for driver and front passenger, with front passenger airbag deactivation
- Ambient lighting, 10 colors
- Electrically adjustable, folding and heated exterior mirrors
- Car2X
- e-Sound
- ESP Electronic Stability Program
- Speed limiter
- Back window, heater
- Interior mirror automatically dimming
- Front and rear headrests (5)
- Charging: 11 kW AC charging power (alternating current)
- LED headlights with automatic headlight control
- Makeup mirrors in the sun visors
- Fatigue detection
- Emergency call service
- Upholstery: Seat center panels of the front seats and the outer rear seats in "Matrix" fabric
- LED taillights
- electromechanical power steering
- Seats: Armrest for front seats
- Seats: Driver's seat height adjustable
- Voice control
- Lane keeping assistant "Lane Assist"
- Ambient lighting with logo projection
- Traffic sign recognition
- Green thermal insulation glazing, sides and rear
- Turning brake function and evasive steering support
- Airbags: Front and rear head airbags, front side airbags, center airbag
- App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- black roof rails
- Parking assistance
- Driving profile selection
- Transmission: 1-speed automatic
- rear window wiper
- ISOFIX mounting points for child car seats
- Mode 3 Type 2 charging cable, 16 A
- Charging: 125 kW DC charging power (direct current)
- Steering wheel: Multifunction steering wheel with touch controls
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Radio accessories: 6 + 1 speakers
- Tire pressure monitoring system
- Keyless Start system
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Rear bench seat undivided, backrest asymmetrically split and foldable
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking including remote control



Extra equipment

- Adaptive Cruise Control (ACC) "stop & go" including speed limiter
- Interior Top Sport "Plus" Platinum Grey with black steering wheel (30-color ambient lighting, electrically adjustable, folding, and heated exterior mirrors, passenger-side mirror dipping function, ergoActive front seats with electrical adjustment, memory function, sliding thigh support, pneumatically adjustable lumbar support in front, massage function, leather multifunction steering wheel, heated, with touch controls, pedals in "Play/Pause" design, asymmetrically split folding rear seat backrest, through-loading facility and center armrest, 2 cup holders, ArtVelours microfleece seats, ambient lighting, heated front seats)
- Package: Infotainment Package "Plus" (Head-up display - Navigation system "Discover Pro": 23.4 cm touchscreen, map with 2D display, traffic sign recognition, points of interest, App-Connect Wireless, voice control - Radio "Ready 2 Discover Max": DAB+ digital radio reception, diversity antenna for FM reception - Telephone interface "Comfort" with inductive charging function including hands-free system, Bluetooth audio, external antenna connection with LTE support - Sound system, 6 loudspeakers, digital channel amplifier, subwoofer, 450 W)
- Package: Sport package "Plus" (Adaptive chassis control DCC incl. driving profile selection - progressive steering)
- Wheels: Alloy wheels (4) "Hamar" 8 J x 19 in Dark Graphite, polished finish (Airstop all-season tires 235/55 R 19 front, Airstop all-season tires 255/50 R 19 rear - wheel locks with enhanced theft protection)
- Heat pump for range optimization
- Reversible luggage compartment mat, variable loading floor
- Paint finish: Metallic
- Retrofitting an electric tailgate
- Package: Assistance package (Anti-theft alarm system with interior monitoring, backup horn and tow-away protection - Parking assistant "Park Assist Plus" incl. parking aid - Proactive occupant protection system in conjunction with "Front Assist" - Rear view camera - Keyless locking and starting system "Keyless Access", with safe locking - Illuminated door handle recesses)
- Package: Design Package "Plus" (3D LED taillights with dynamic turn signals - Dynamic Light Assist high beam control for LED matrix headlights - IQ.LIGHT - LED matrix headlights with automatic headlight control, bad weather light, welcome function - Illuminated strip between the headlights - Panoramic roof - Laminated safety glass for front side windows; tinted rear window and rear side windows)
- Package: Comfort Package "Plus" in conjunction with Interior Top Sport "Plus" or Style (2 USB-C interfaces in the front, 2 USB-C charging ports on the rear center console - Windscreen in laminated safety glass, wirelessly heated and infrared-reflecting, noise-reducing - Luggage net - Luggage compartment floor - "Air Care Climatronic" air conditioning with active combination filter, stationary climate control and 3-zone temperature control - Variable center console with interchangeable inserts for cup holders and storage compartments - Cargo net partition - Rain sensor - Automatically heated front windscreen washers - Heated front seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - Smart repair
2	Side panel - rear right side	Side panel - dent(s) - Smart repair
3	Mudguard - right side	Wheel well extension - Scratch(es) - Replace
4	Front bumper	Spoiler - Scratch(es) - Replace



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 7 Aug 2025	1.167,17 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

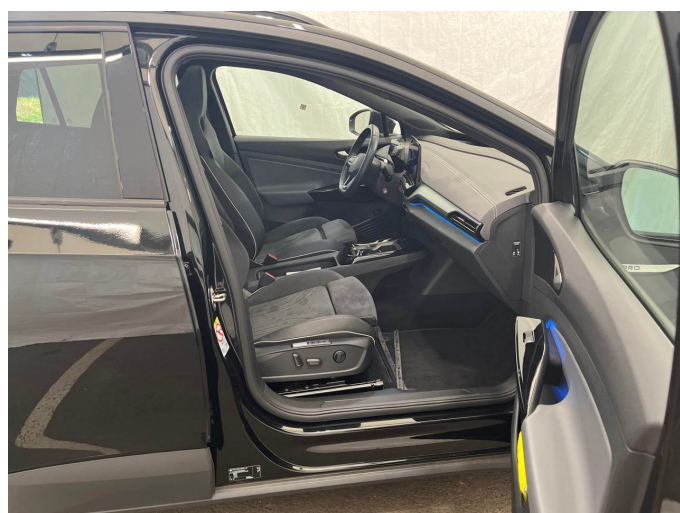


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

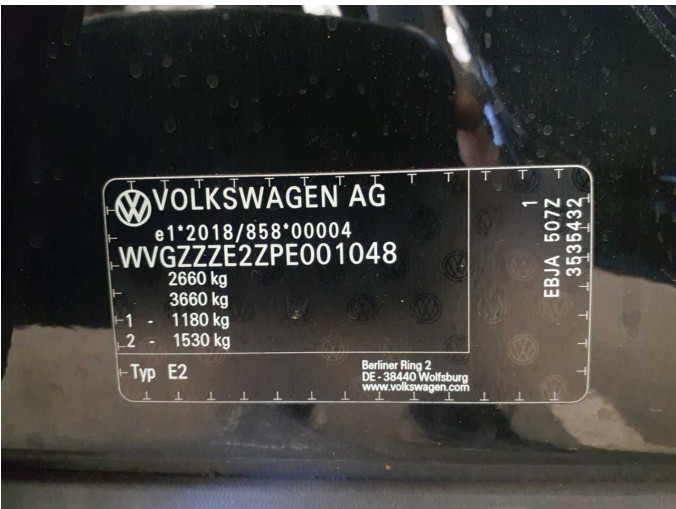


Figure 11: VIN



Figure 12: Mounted tyres

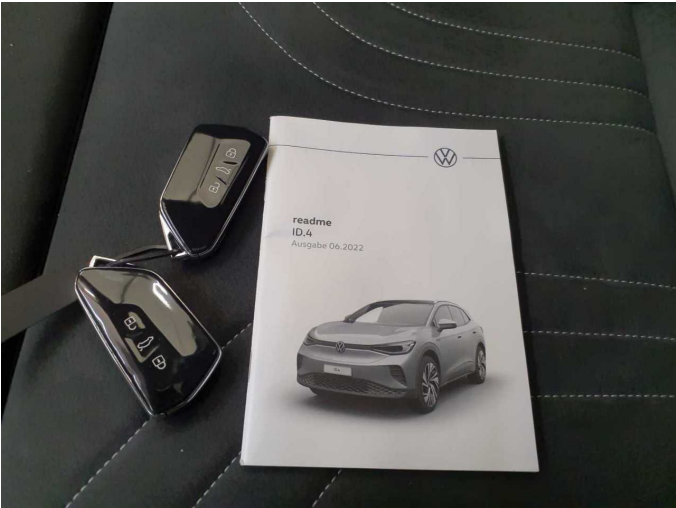


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

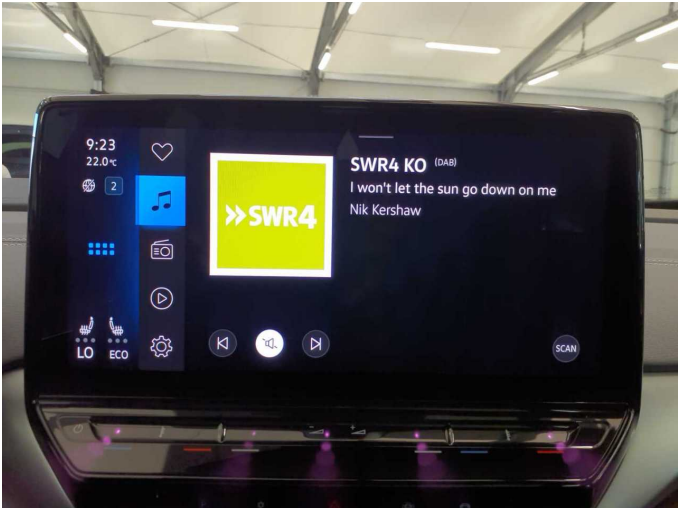


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

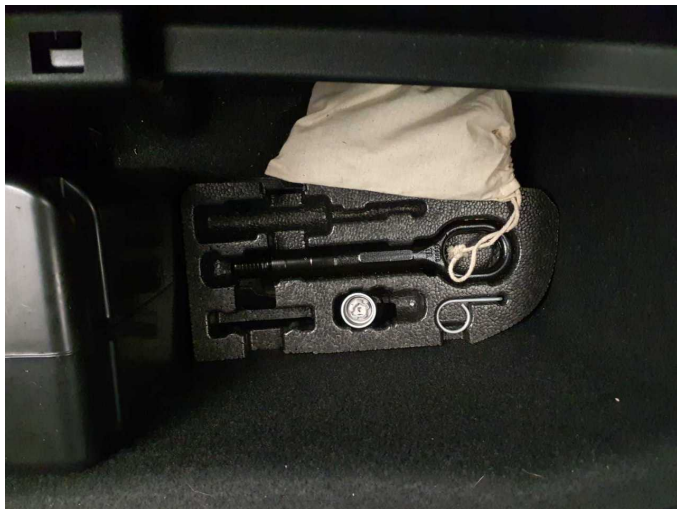


Figure 33: Misc.

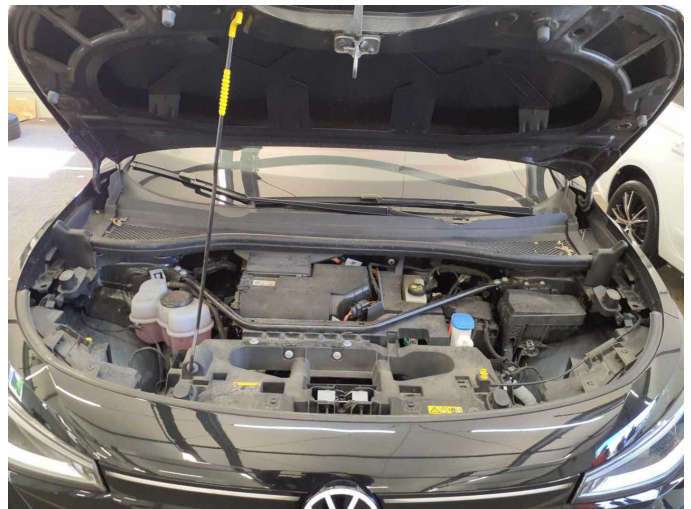


Figure 34: Misc.



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Side panel - rear right side: Side panel - dent(s) - Smart repair



Damage 3: Mudguard - right side: Wheel well extension - Scratch(es) - Replace



Damage 3: Mudguard - right side: Wheel well extension - Scratch(es) - Replace



Damage 4: Front bumper: Spoiler - Scratch(es) - Replace



Damage 4: Front bumper: Spoiler - Scratch(es) - Replace

Wartungshistorie

(gemäß Auftraggeber Informationen)



Fahrgestellnummer: WVGZZZE2ZPE001048
Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN ID.4 Performance Upgrade Pro

Datum	KM-Stand	Beschreibung
10.11.2025	53.313	Reparatur Sonstiges
29.11.2024	35.712	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst