



Expertise

Protocol number: 46328207
Order No. / Reference: 26644375
Inspection date: 2 Jul 2026

Manufacturer: Opel

Model: Insignia Sports Tourer 2.0 Diesel Aut. Business Edition

VIN: W0VZM8EG8L1017200



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Aut. Business Edition	
Vehicle Identification number	W0VZM8EG8L1017200
Mileage (Read)	133,366 km
First registration	23 Apr 2020
Number of holders	1
Power / Engine displacement	125 kw / 1,956 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Lava Rot
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	75 %
Last service on / at	03/2026 at 133,183 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FN794974
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AAK 00395		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97W	Summer tyres on Light alloy	Kleber	6mm / 6mm
2)	225/55 R17 97W	Summer tyres on Light alloy	Bridgestone	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97H	Winter tyres on Light alloy	Kleber	6mm / 6mm
2)	225/55 R17 97H	Winter tyres on Light alloy	Kleber	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2030		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments (storage compartment in the center console, pockets in the front doors suitable for 1.5-liter beverage bottles, pockets in the rear doors suitable for 1-liter beverage bottles, cup holder in the center console, illuminated glove compartment)
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Hill Start Assist
- Roof design line, chrome-plated
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Pedestrian protection including active hood
- Luggage compartment cover (extendable with comfort operation)
- Speed controller
- Transmission: 8-speed automatic transmission
- rear window wiper
- Interior and reading lights, front and rear
- Child safety lock in the rear doors, manual
- Automatic climate control, two zones (with separate temperature control for driver and front passenger, including: - recirculation mode, manual - particle/activated carbon filter - automatic air distribution - sun position sensor - humidity sensor)
- Leather steering wheel, heated
- Steering column adjustable for height and reach
- Illuminated make-up mirrors (driver and passenger side)
- Fog light
- Parkpilot, front and rear parking aid (with acoustic warning signal when parking forwards and backwards)
- Quickheat rapid heating system
- Radio accessories: 2 USB ports (rear center console)
- Tire pressure display (with tire pressure warning - direct system with automatic calibration after wheel change)
- Wheels: Alloy wheels 7.5 J x 17 in 5 twin-spoke design (tires 225/55 R 17)
- Wheels: Tire repair kit (tire sealant - 12 volt compressor)
- Service interval indicator
- Seat belts: Three-point seat belts in all seats (belt force limiter, front and rear - warning tone and light for unfastened belts, front)
- Seats: Ergonomic seat with AGR seal of approval (Campaign for Healthy Backs e. V.). Driver's seat 8-way adjustable (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electropneumatically adjustable in height and length - extendable thigh support, manually adjustable - headrest, height and tilt adjustable - pocket on front seat back - front passenger seat 4-way adjustable, length and backrest angle manually adjustable)
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Immobiliser
- Adaptive brake light
- Airbag: Front airbags (multi-stage) and side airbags, driver and front passenger (front and side airbags, front passenger, deactivatable)
- Airbag: Front and rear outer head airbags
- Electrically adjustable and heated exterior mirrors for driver and passenger side (manually foldable - exterior mirror housing in body color)
- black roof rails
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front camera (Gen. 3) (Forward collision warning with pedestrian detection and automatic emergency braking: active from 8 km/h, range 100 m. - Lane departure warning and lane keeping assist: warning in case of unintentional lane departure (between 60 km/h and 180 km/h) via an indicator light in the driver information display. The lane keeping assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle. - Distance indicator: displays the distance to the vehicle ahead)
- Front headrests (height adjustable)
- Rear headrests (3 pieces) (height adjustable)
- Paint finish: Solid
- LED taillights
- LED daytime running lights
- Steering wheel: Leather steering wheel (steering wheel remote control)
- Center armrest, front
- Electric parking brake (including 12-volt socket)
- Upholstery: Milano fabric in conjunction with AGR seat, driver
- Radio: Multimedia navigation system with 7" touchscreen color display (Multimedia radio, voice control for audio, telephone and navigation, navigation system with integrated memory, road map for over 30 European countries, map display in 2D and 3D, dynamic route guidance via map and/or arrow display and voice prompts)
- Keyless Start system
- Power steering (speed-dependent)
- Safety net (for mounting behind the 1st or 2nd row of seats - pre-installation for safety net attachment for 1st and 2nd row of seats)
- Heated seats for driver and front passenger (multi-stage adjustable)
- Start/Stop system (reinforced starter, high-performance battery, brake energy recuperation, switch to deactivate the start/stop function)
- 12V power outlet in the luggage compartment
- Bumpers painted in body color
- Phone: Wireless Charging (Wireless charging of smartphones in the center console)
- Exterior door handles, in body color with chrome inlay
- Pre-installation for child seat mounting system "ISOFIX" (rear)
- Central locking with remote control (and interior switches)



- Thermal insulation glazing, green tinted
- Second folding ignition key

Extra equipment

- FlexOrganizer equipment (FlexOrganizer rails, 4 mounting adapters with mounting hooks in the luggage compartment floor, movable)
- Wheels: Additional set of 17" alloy winter wheels SFP
- Visibility equipment (rain sensor, front interior mirror, automatically dimming, automatic dimming headlights with tunnel detection, high beam assist)
- Seats: Driver's seat 6-way adjustable and front passenger seat 4-way adjustable (Driver's seat 6-way adjustable: (length, backrest angle and height adjustment, manually adjustable) Front passenger seat 4-way adjustable: (length and backrest angle, manually adjustable) Rear seat backrest foldable in a 60:40 ratio Headrests, front, height adjustable)
- Paint finish: Two-coat brilliant Lava Red
- Upholstery: Milano fabric
- Radio: Multimedia Navi Pro with 8" color touchscreen display (Multimedia Radio, voice control for audio, telephone and navigation, digital radio reception DAB/DAB+/DMB-R, navigation system with SD card storage, road map for over 30 European countries, map display in 2D and 3D, dynamic route guidance via map and/or arrow display and voice prompts, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, 2 USB interfaces, steering wheel remote control, Apple CarPlay and Android Auto)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
2	Roof	Roof - Holes - Loss in value
3	Interior	Cargo area floor (Griff) - Broken / torn - Replace
4	Side panel - rear right side	Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint
5	Front bumper	Front bumper - Scratch(es) - Paint
6	Door - rear left side	Door - Scratch(es) - Paint
7	Rear bumper	Rear bumper - Scratch(es) - Paint
8	Door - rear right side	Door (Schleifspuren und Spachtel eingefallen) - Unprofessionally repaired - Repair and paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Roof	Roof - dent(s) - No deduction
4	Door - front left side	Door edge - Scratch(es) - No deduction
5	Vehicle glazing	Windscreen - Stone chips - No deduction
6	Door - front left side	Door - dent(s) - No deduction
7	Mudguard - left side	Mudguard - left side - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 18 Nov 2020	1.954,37 €

Repainting

No.	Repainting
1	Side panel - rear right side, Door - rear right side, Unprofessionally carried out

Paint coat thickness measurement

Side panel - rear right side	2,520 µm	Door - rear right side	218 µm
------------------------------	-------------	------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres

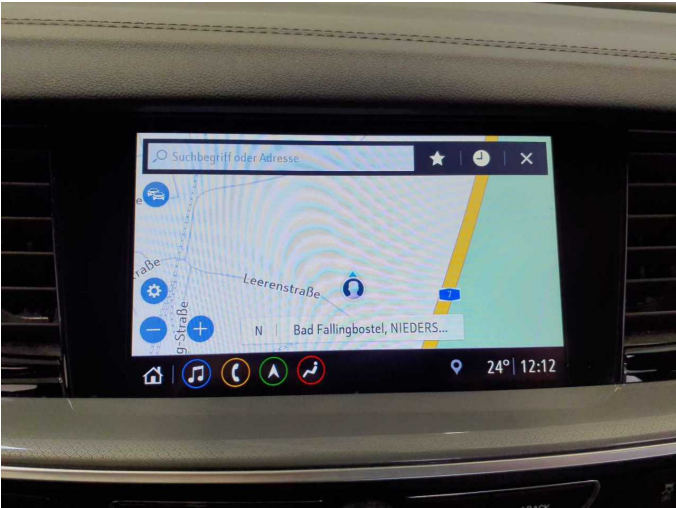


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

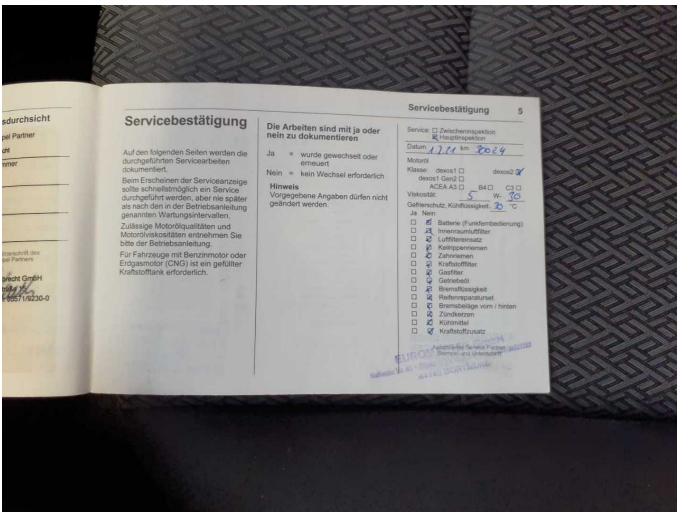


Figure 18: Misc.

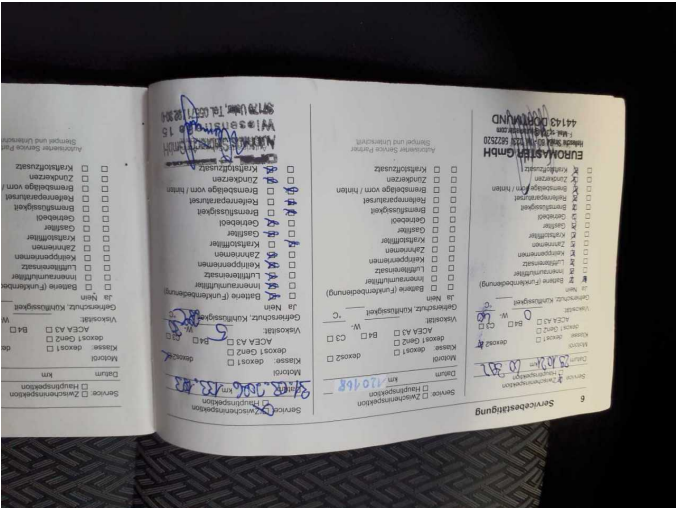


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

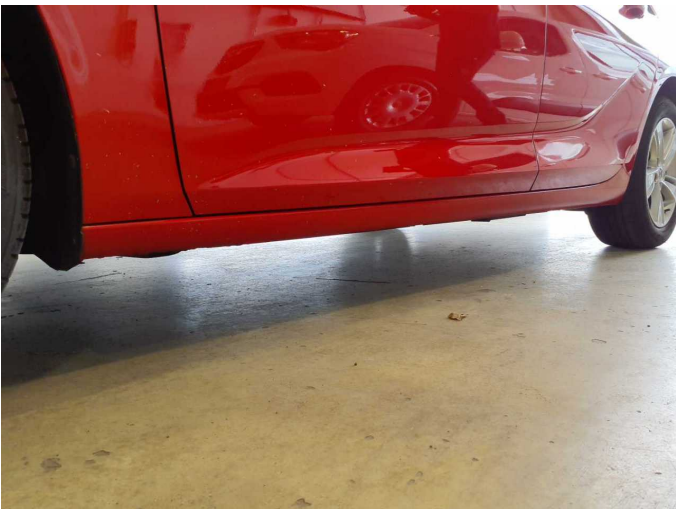


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 1: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 2: Roof: Roof - Holes - Loss in value



Damage 2: Roof: Roof - Holes - Loss in value



Damage 3: Interior: Cargo area floor (Griff) - Broken / torn - Replace



Damage 3: Interior: Cargo area floor (Griff) - Broken / torn - Replace



Damage 3: Interior: Cargo area floor (Griff) - Broken / torn - Replace



Damage 4: Side panel - rear right side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint



Damage 4: Side panel - rear right side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint



Damage 4: Side panel - rear right side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint



Damage 4: Side panel - rear right side: Side panel (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint



Damage 5: Front bumper: Front bumper - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratch(es) - Paint




Damage 6: Door - rear left side: Door - Scratch(es) - Paint



Damage 6: Door - rear left side: Door - Scratch(es) - Paint




Damage 6: Door - rear left side: Door - Scratch(es) - Paint

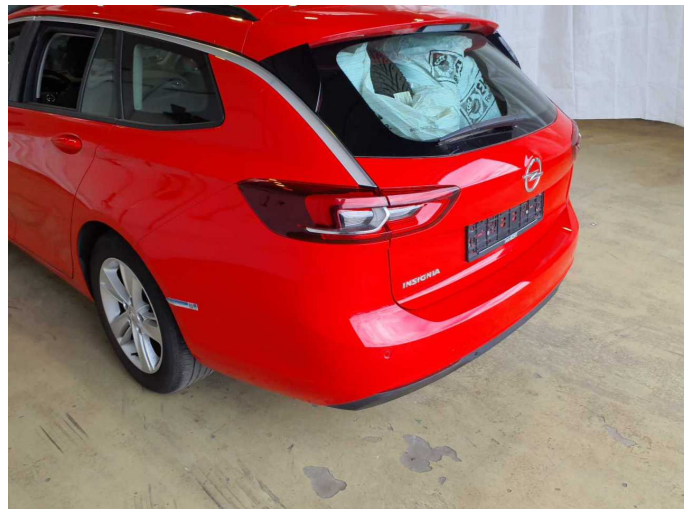

Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint

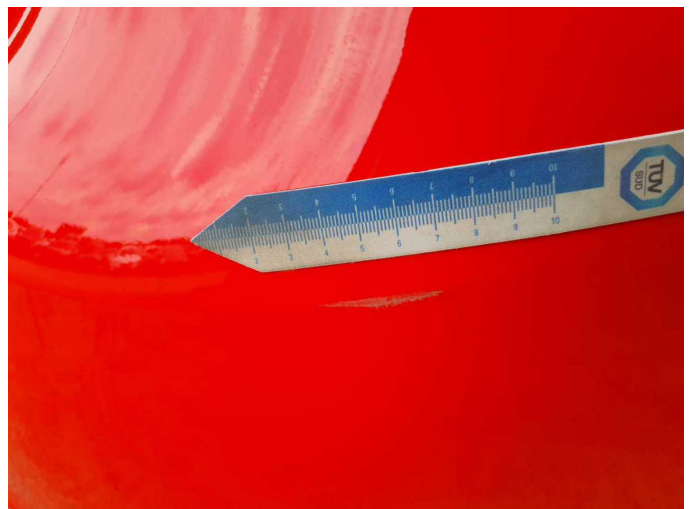

Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Door - rear right side: Door (Schleifspuren und Spachtel eingefallen) - Unprofessionally repaired - Repair and paint



Damage 8: Door - rear right side: Door (Schleifspuren und Spachtel eingefallen) - Unprofessionally repaired - Repair and paint



Damage 8: Door - rear right side: Door (Schleifspuren und Spachtel eingefallen) - Unprofessionally repaired - Repair and paint



Damage 8: Door - rear right side: Door (Schleifspuren und Spachtel eingefallen) - Unprofessionally repaired - Repair and paint



Damage 8: Door - rear right side: Door (Schleifspuren und Spachtel eingefallen) - Unprofessionally repaired - Repair and paint



Wear and tear 6: Door - front left side: Door - dent(s) - No deduction



Wear and tear 6: Door - front left side: Door - dent(s) - No deduction




Wear and tear 7: Mudguard - left side: Mudguard - left side - dent(s) - No deduction



Wear and tear 7: Mudguard - left side: Mudguard - left side - dent(s) - No deduction




Wear and tear 7: Mudguard - left side: Mudguard - left side - dent(s) - No deduction

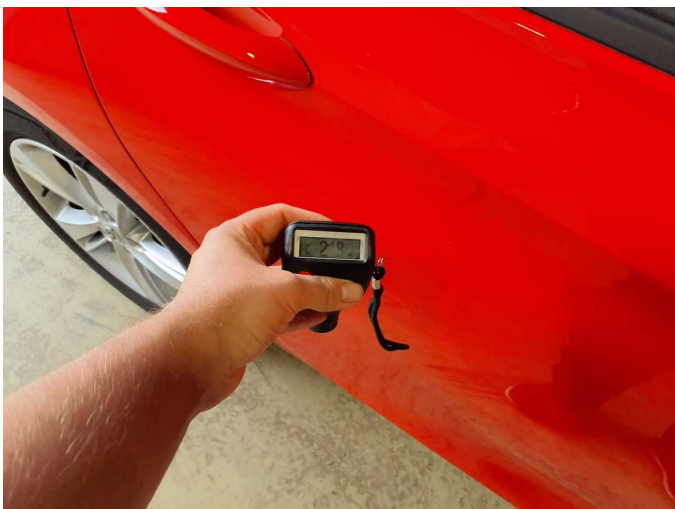

Repainting 1: Side panel - rear right side, Door - rear right side



Repainting 1: Side panel - rear right side, Door - rear right side

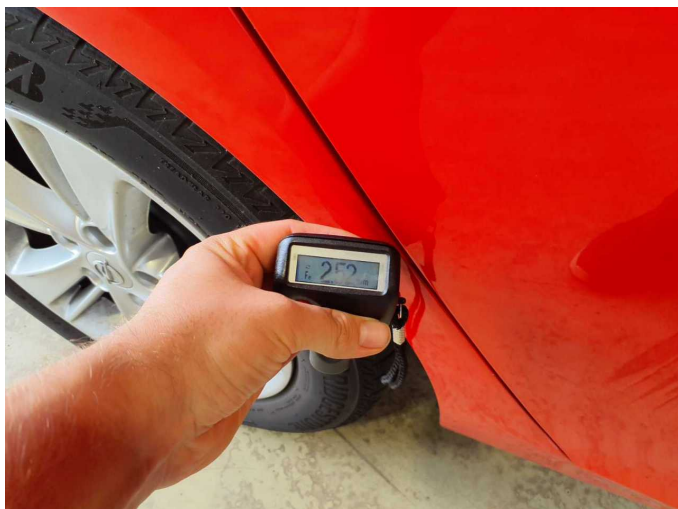

Repainting 1: Side panel - rear right side, Door - rear right side



Repainting 1: Side panel - rear right side, Door - rear right side