



RENAULT EXPRESS: 7693-MDB

Vinnumber:	VF1RJK00470135846	Versionname:	Confort 1.5 Blue dCi 55 kW (75 cv) furgón derivado de turismo 55kW 4P manual
First Registrationdate:	28/12/2022	Fiscalpower:	
Expertise Mileage:	133017	Power Kw:	
Bodytype:	Transporter	Body colour:	Black
Gearbox:	MAN 6 VIT	Type of rims (mounted):	Steel
Transmission:			
Fueltype:	Diesel		
Engine functioning:	Yes		
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of seats:	2		
Number head rests:	2		
Type of rims (mounted):	Steel		
Certificate of Conformity:	Yes		
Category:	Light Commercial Vehicle		
Registration Certificate Car (BE):	Yes		

Options

Number of keys total	2	Radio
Number keys remote	2	
Windows electric F		
Cruise Control		
Steering wheel multifunctional		
Type of climate control	Manual climate control	

Tyres

	185/65/15/88 T			
Summer tyres:	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 6 mm
	Re.L.	Goodyear: 6 mm	Re.R.	Goodyear: 3 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				6.0
Tyre profile depth RL				6.0
Tyre profile depth RR				3.0
Tyre size FL				185/65 R 15 88 T
Tyre size FR				185/65 R 15 88 T
Tyre size RL				185/65 R 15 88 T
Tyre size RR				185/65 R 15 88 T
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Spare wheel	No	Jack	No
-------------	-----------	------	-----------

Service book, Missing, Repair/replace (lump sum)



User's manual, Missing, Repair/replace (lump sum)



Interior, Dirty, Cleaning



Wing FL, Dent(s), Repair and paint (complete)



Outside rear-view mirror base L, Broken, Replace



Side wall RL, Scratch(es), Paint



Rear light L, Scratch(es), Acceptable



Bumper F, Scratch(es), Paint



Wing FR, Dent(s), Repair and paint (complete)




Door FR, Dent(s), Paintless dent repair



Sliding door R, Dent(s), Repair and paint (complete)



Wing RR, Dent(s), Repair and paint (complete)

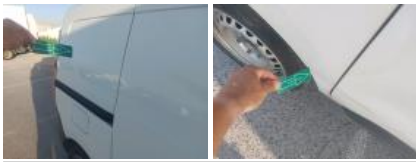

Wheel bolt cover RR, Missing, Replace



Jack, Missing, Replace



Tailgate / Boot, Dent(s), Repair and paint (complete)



Bumper R, Dent(s) and scratch(es), Repair and paint (complete)



Rear panel, Scratch(es), Repair and paint (complete)



Spare rim, Missing, Replace



Tyres, No damage, Check

