

## Expertise

Protocol number: 45975606  
Order No. / Reference: 26372781  
Inspection date: 16 Jun 2026

Manufacturer: Volvo

Model: EX30 Single M. Extended Range RWD Ultra

VIN: YV12ZEL93RS051932



### Vehicle details

#### Manufacturer / Type / Model / Equipment

Volvo EX30 Single M. Extended Range RWD Ultra

**Vehicle Identification number** YV12ZEL93RS051932

**Mileage (Read)** 9,901 km

**First registration** 23 Jul 2024

**Number of holders** 1

**Power / Engine displacement** 75 kw /

**Fuel type / Cylinder** Electric / 0

**Gearbox / Number of gears** Direct drive / 1

**Type of drive** Rear drive

**Type of vehicle** Misc.

**Colour / colour code** Blue University

**Doors / Seats** 5 / 5

**Upholstery type** Cloth / leather combination

**Colour of upholstery** Anthracite-Blue

**Vehicle with smoke odor** no



**Vehicle details**

<b>Maintenance booklet / proof</b>	Available / complete	<b>Next maintenance in</b>	2 Tag(e)
<b>Key is / should be</b>	3 / 3	<b>FZG documents</b>	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		<b>Letter No.</b>	HD846185
<b>Previous damage / Accident</b>	None detectable	<b>Repainting</b>	None detectable
<b>Inspection conditions</b>	Conditional: Light/moisture/dirt	<b>Lifting equipment / pit</b>	No
<b>Test drive</b>	short drive on the company premises	<b>Engine function test</b>	Performed
<b>Manufacturer key number/ type code number</b>	9101 / BZO 00003		
<b>Emission standard</b>	2017/1151;WLTP;reine Elektrofz	<b>fine dust sticker</b>	
<b>Permitted total weight</b>	2,240 kg	<b>Empty weight</b>	

**Tyres**

**Mounted tyres**

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Winter tyres on Light alloy	Continental	9mm / 9mm
2)	225/55 R18 102V	Winter tyres on Light alloy	Continental	8mm / 8mm

**Additional tyres**

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102V	Summer tyres on Light alloy	Goodyear	6mm / 6mm
2)	245/45 R19 102V	Summer tyres on Light alloy	Goodyear	6mm / 6mm

**Replacement**

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 01/2029		

**Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.**

TÜV SÜD Auto Partner GmbH  
Wiesenring 2  
04159 Leipzig

Inspection location  
Hartmann Fleet Professionals GmbH  
Leerenstraße 25  
29683 Bad Fallingbommel



## Equipment



## Standard equipment

- ABS - Anti-lock Braking System
- Driver and passenger side airbags with two-stage deployment system
- Passenger side airbag can be deactivated
- Airbag, side airbags for driver and front passenger and head/shoulder airbags for all occupants
- Android infotainment system (12.3" touchscreen (31.2 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - 2 USB-C ports in the first row of seats - 5G internet connection)
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- Charger, 22 kW Onboard (22kW Onboard Charger for faster charging at the wallbox (Wallbox must be 22kW capable))
- Deactivation of the high-voltage battery (in case of a collision)
- Driver Awareness (Blind Spot Information System (BLIS), Blind Spot Assist including Lane Change Warning: vehicle approaching rapidly; Cross Traffic Alert (CTA): cross traffic warning with braking intervention; warning of vehicles approaching from the side, cyclists, and pedestrians when reversing out of parking spaces, including braking to a standstill if warning signals are ignored; Rear Impact Mitigation: preventive protection against impending rear-end collisions; Safe Exit: Door Opening warns of other road users when exiting the vehicle.)
- Floor mats: Premium textile floor mats
- Transmission: 1-speed direct drive
- Front seat belt height adjustment
- Heated rear window
- Rear spoiler in matte black
- Interior lighting, extended (selection of 6 different lighting themes including optional acoustic accompaniment. (Archipelago, Mid-Summer, Northern Lights, Forest Bath, Nordic Twilight, white) - lighting themes for decorative panels and front door trim)
- Automatic climate control with 2-zone temperature control (including separate temperature control for driver and front passenger, automatic blower control and air distribution including air quality system with activated carbon filter)
- Charging control display (set current limit (from 6 A) and charge level in 10% Ssteps)
- LED taillights - new category: Safety & Driver Assistance Systems
- Steering wheel: Sports steering wheel (steering column adjustable in height and length)
- rear fog light
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h)
- Panoramic glass roof, fixed
- Acoustic Vehicle Alerting System (AVAS) (Acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Airbag, driver's knee airbag
- Active safety belts with belt tensioners
- Alarm system with motion/tilt sensor and security lock
- Towbar: Preparation
- Exterior mirrors: Frameless exterior mirrors with memory function
- Electrically adjustable, foldable and heated exterior mirrors
- Hill Descent Control (HDC)
- Fog sensor for automatic activation of the defroster function
- third brake light
- Convenient Entry and Start (vehicle start by pressing the brake pedal and engaging the forward (D) or reverse (R) gear)
- Digital Services including Google Maps navigation system (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data volume) - Volvo On Call (includes, among other things, alerting the Volvo On Call service center at the touch of a button as well as additional convenience services via the Volvo Cars App))
- Electronic Stability Control (ESC)
- Electronic differential lock
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Automatic emergency braking (locking the vehicle after the airbags or seatbelt pretensioners have been deployed to prevent secondary accidents.)
- Automatic tailgate (electric)
- rear window wiper
- Interior and exterior mirrors automatically dimming
- Cabin air pollen filter
- Intelligent Speed Assist (Intelligent speed assistant - warning when exceeding the maximum permitted speed)
- ISOFIX (mounts for the outer rear seats)
- Child safety lock for the rear doors (electric)
- Contrasting roof in Onyx Black
- Headrests (5) front and rear
- Paint finish: Solid - Cloud Blue
- Charging cable Type 2/Type 2 (Mode 3) (5 m length, 3-phase, 32A (for connection to a charging station with Type 2 connector))
- LED headlights "Thor's Hammer" (high beam assist - integrated LED daytime running lights - welcome sequence)
- Front center armrest with integrated storage compartment and cup holders
- One Pedal Drive (acceleration and deceleration to a standstill via the accelerator pedal - activation/deactivation via the menu - recuperation (brake energy recovery) as soon as the foot is taken off the accelerator pedal, to optimize the range)
- Electric parking brake



- Park Pilot Assist (The vehicle detects available parking spaces and displays suggested parking spaces on the center display. After selecting the preferred parking space, the car parks automatically by taking over steering, acceleration, braking, and gear shifting. Park Pilot Assist works in all common parking situations and can also assist when exiting a tight parallel parking space.)
- Upholstery: Textile & Nordico (Upholstery: Anthracite / Dark Blue - Interior Design: Anthracite - Carpet: Anthracite - Headliner: Anthracite - Denim Decor - Interior Design: Indigo)
- Radio: Premium Sound audio system by Harman Kardon (1040 watts of power - 9 speakers - 9 channels - equalizer - subwoofer - Dirac Unison sound optimization - Quantum Logic surround sound - vehicle noise compensation)
- Rain and light sensor with automatic light function
- Roadside Assistance (free mobility promise, 3 years and almost throughout Europe. Covers, for example, mechanical or electrical defects, tire problems, traffic accidents in which the vehicle is so badly damaged that it is unroadworthy, etc. Also applies in the event of premature change of ownership.)
- Safety Assistance (adaptive cruise control (distance control, curve assist, overtaking assist, stop and go assist, intelligent speed assist) - Lane Keeping Aid (LKA) - Active lane keeping assist - Speed limiter - Run-off road mitigation - Road Sign Information (RSI) - Traffic sign recognition - Connected Safety - Emergency Stop Assist - Driver monitoring system - Attention warning including driver alert - Pedestrian, cyclist, and scooter detection including steering intervention)
- Auxiliary heater including timer
- Phone: Inductive smartphone charging system (Qi standard) (Wirelessly charges smartphones on a charging pad (compatibility required))
- Volvo Safe Space Technology (360° all-round view of the safety systems: - Front camera - 5 radars - 4 (ultrasonic) sensors - Rearview camera)

- Parking camera with 360° surround view (including front, side and rear parking aid with automatic braking intervention (rear))
- Pilot Assist (Adaptive cruise control including steering assistance when lane markings are clear. - Lane Change Assist: On multi-lane highways, the vehicle automatically changes lanes when the driver activates the turn signal and there is sufficient space and time for the lane change. Valid at speeds between 65-130 km/h - Extended distance when overtaking trucks and oncoming vehicles. Valid at speeds between 50-130 km/h - Automatic speed limiter according to traffic signs)
- Radio accessories: 2 USB ports on the back
- Tire pressure monitoring system (TPMS)
- Wheels: 19" 5-spoke Aero Design alloy wheels (19" 5-spoke Aero Design - diamond cut/high-gloss black with 245/45 R19 tires - 8 x 19" (front), 8 x 19" (rear) - Volvo tire category A)
- Wheels: Tire sealant (with 12-volt compressor (maximum speed 80 km/h))
- Headlight cleaning system
- Speed-sensitive power steering
- Safety steering column (adaptive)
- Seats: Driver and front passenger seats electrically adjustable (memory function for driver's seat - electrically adjustable lumbar support for driver's seat)
- Seats: Lumbar support for driver's seat
- Seats: Rear seats in a 40/60 split or fully foldable
- Smartphone integration Apple CarPlay (wireless)
- Power outlet (12-volt connection in the luggage compartment)
- First aid kit and warning triangle
- Lashing eyes (four) in the luggage compartment
- Immobiliser
- Central locking key card (central locking with two NFC cards including automatic locking of the doors while driving (can be deactivated) - including emergency key)

### Extra equipment

- Paint finish: Solid
- Glazing: Side and rear windows tinted (from the B-pillar back)

- Package: Winter (front seat heating - steering wheel heating)

### Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/dampness or dirt. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.



## Value reducing factors

No.	Component group	Description
1	Rear bumper	Spoiler - Scratch(es) - Loss in value
2	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - Replace

## Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

## Missing parts

### Description

Equipment - Code card (2x NFC Card)

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
*(Functional testing of driver assistance systems is not included in the scope of services!)*
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear

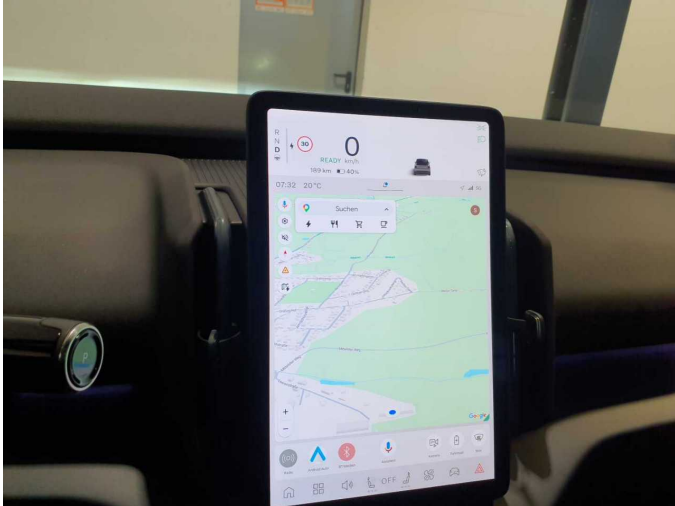


Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres

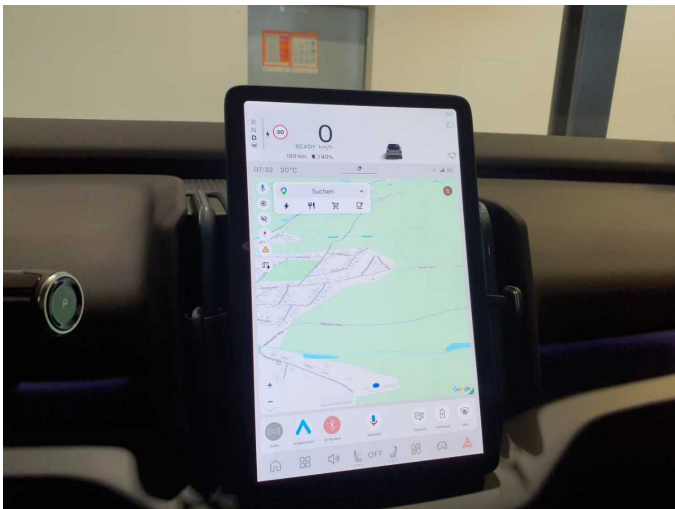


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

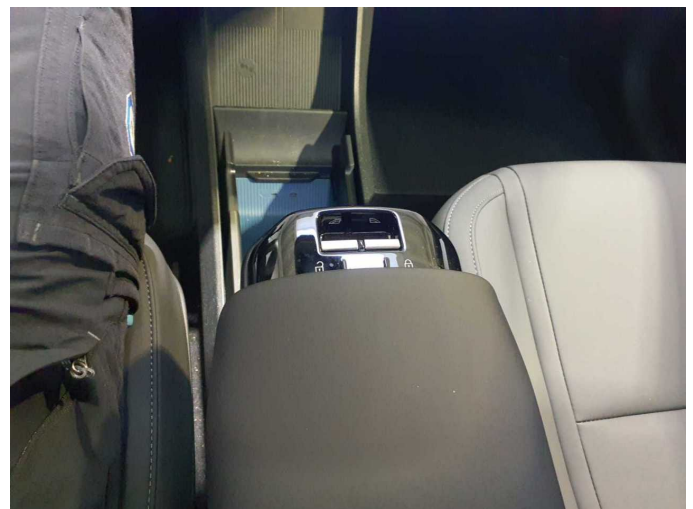


Figure 18: Misc.



Figure 19: Misc.

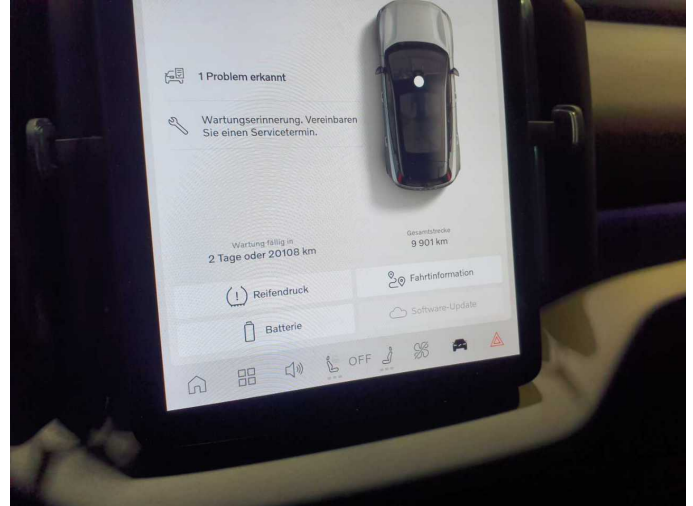


Figure 20: Misc.

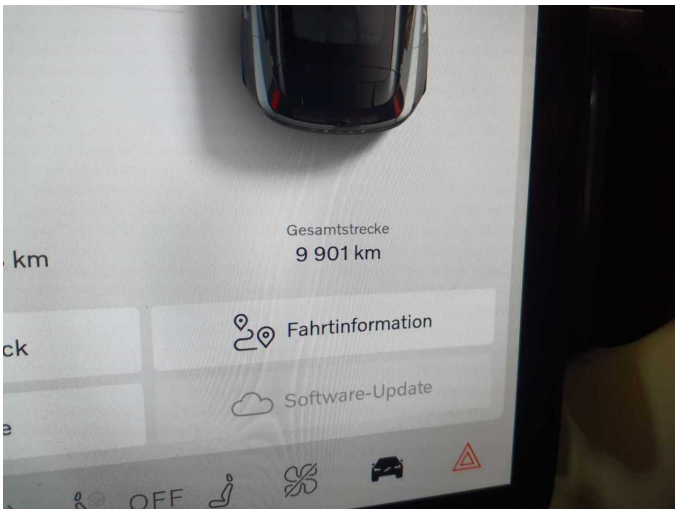


Figure 21: Misc.

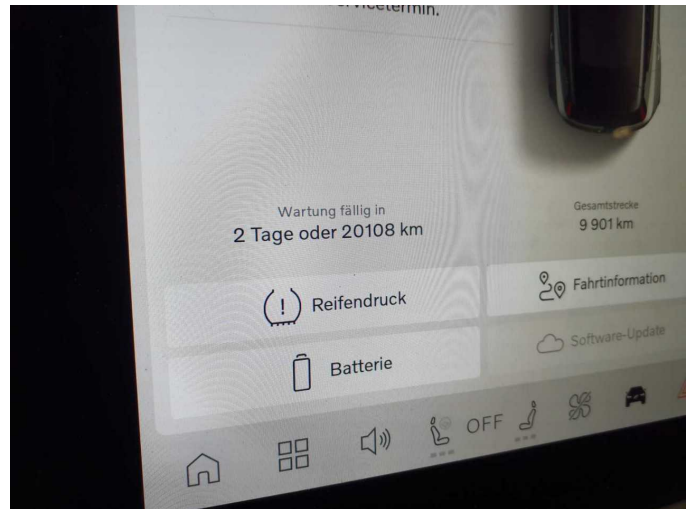


Figure 22: Misc.



Figure 23: Misc.

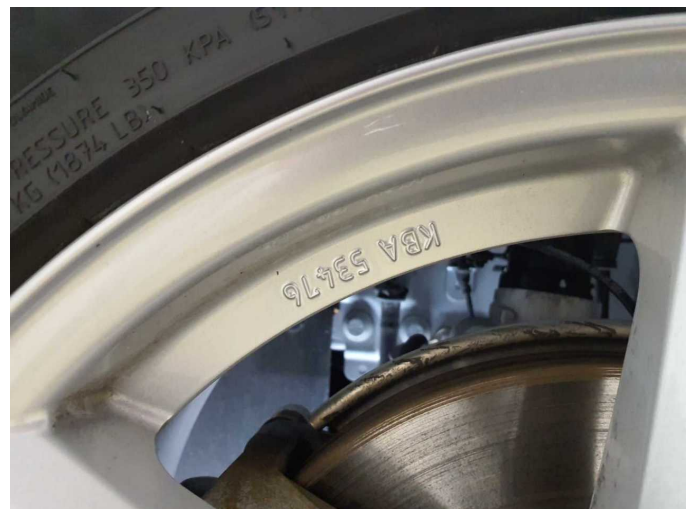


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



**Figure 31:** Misc.



**Damage 1:** Rear bumper: Spoiler - Scratch(es) - Loss in value



**Damage 1:** Rear bumper: Spoiler - Scratch(es) - Loss in value



**Damage 2:** Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace



**Damage 2:** Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace