



Expertise

Protocol number: 46566928  
Order No. / Reference: 26652502  
Inspection date: 17 Jul 2026

Manufacturer: Volvo

Model: XC90 B5 D AWD Geartronic Inscription

VIN: YV1LCK2VCM1760848



Vehicle details

Manufacturer / Type / Model / Equipment

Volvo XC90 B5 D AWD Geartronic Inscription

|                                      |                   |
|--------------------------------------|-------------------|
| Vehicle Identification number        | YV1LCK2VCM1760848 |
| Mileage (Read)                       | 166,797 km        |
| First registration                   | 18 Jun 2021       |
| Number of holders                    | 1                 |
| Next periodical technical inspection | 06/2028           |
| (Report on hand)                     |                   |

|                             |                       |
|-----------------------------|-----------------------|
| Power / Engine displacement | 173 kw / 1,969 ccm    |
| Fuel type / Cylinder        | Hybrid Diesel / E / 4 |
| Gearbox / Number of gears   | Automatic / 8         |
| Type of drive               | All-wheel drive       |
| Type of vehicle             | Station wagon         |

|                      |               |
|----------------------|---------------|
| Colour / colour code | Blue Metallic |
| Doors / Seats        | 5 / 5         |
| Upholstery type      | Leather       |
| Colour of upholstery | Brown         |



## Vehicle details

|                                                  |                              |                                |                                                            |
|--------------------------------------------------|------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | Available / complete         | <b>Next maintenance in</b>     | 12,955 km                                                  |
| <b>Last service on / at</b>                      | 01/2026 at 149,752 km        |                                |                                                            |
| <b>Key is / should be</b>                        | 2 / 2                        | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                              | <b>Letter No.</b>              | GA559072                                                   |
| <b>Previous damage / Accident</b>                | None detectable              | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                     | sufficient                   | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                | Not performed                | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/ type code number</b> | 9101 / BPR 00067             |                                |                                                            |
| <b>Emission standard</b>                         | EURO6;WLTP;AP;PI/CI; M, N1 I | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 2,670 kg                     | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 275/45 R20 110Y | Summer tyres on Light alloy | Pirelli      | 6mm / 6mm   |
| 2) | 275/45 R20 110Y | Summer tyres on Light alloy | Pirelli      | 6mm / 6mm   |

### Additional tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 235/55 R19 105V | Winter tyres on Light alloy | Michelin     | 6mm / 6mm   |
| 2) | 235/55 R19 105V | Winter tyres on Light alloy | Michelin     | 6mm / 6mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 06/2025 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment



## Standard equipment

- ABS - Anti-lock Braking System
- Passenger side airbag can be deactivated
- Airbag, driver's knee airbag
- Active safety belts with belt tensioners (for all occupants)
- All-wheel drive (AWD)
- Dashboard and door trim in leather look with contrasting stitching
- Electrically adjustable, foldable and heated exterior mirrors
- Attachment system for carrier bags in the luggage compartment
- Fog sensor for automatic activation of the defroster function
- On-board computer
- third brake light
- Chrome applications
- Chrome trim strip in the door sill area
- CleanZone air quality system with activated carbon filter (automatic recirculation and pre-ventilation of the interior when the vehicle is unlocked)
- Diesel particulate filter
- Tachometer
- Rear parking assist
- Aluminum door sill plates with Volvo lettering at the front (illuminated) and rear
- Electric windows front and rear
- Front grille in waterfall design, satin finish
- Cruise control
- Seat belt height adjustment front and rear (2nd row of seats)
- Rear window wiper with intermittent function
- Interior lighting
- IntelliSafe Assistant
- ISOFIX mounting for the outer rear seats
- Keyless Drive
- Child lock
- Headrests of the 2nd row of seats can be folded down (electrically)
- Paint finish: Solid
- LED headlights "Thor's Hammer" with high beam assist and integrated LED daytime running lights
- Illuminated makeup mirror for driver and front passenger
- Model and engine emblem on the rear
- Oncoming Lane Mitigation
- Electric parking brake
- Pollen filter
- Radio: Sensus Connect infotainment system with high-performance sound
- Radio accessories: Two USB-C ports on the back of the center console
- Road Edge Detection
- Run-off Road Protection
- Wheels: Tire sealant
- Rear bench seat of the 2nd row in a 40/20/40 ratio or completely foldable
- Speed-sensitive power steering
- Driver and passenger side airbags with two-stage deployment system
- Airbag, side airbags for driver and front passenger and head/shoulder airbags (iC) for all occupants
- Ambient lighting
- Attention warning
- Exhaust system with two chrome-plated tailpipes
- Outdoor temperature display
- Hill Descent Control (HDC)
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- Brake energy recuperation
- Brake lights, adaptive
- Chrome applications on the rear of the vehicle
- City Safety
- Connected Safety
- Aluminum roof rails (integrated)
- Roof spoiler
- Digital Instrumentation
- Drive Mode (driving mode settings for engine, transmission, steering, brakes and suspension)
- Electronic differential lock
- Electronic stability control
- Automatic emergency braking
- Luggage compartment partition net
- Transmission: 8-speed Geartronic automatic transmission
- Automatic tailgate
- Heated rear window
- Interior and exterior mirrors automatically dimming
- Intelligent driver information system
- IntelliSafe Surround (Blind Spot Information System (BLIS) - Cross Traffic Alert (CTA) - Rear Impact Mitigation)
- Keyless Start
- Automatic climate control with separate temperature control for driver and passenger side
- Front headrests
- Cargo area roller blind (semi-automatic)
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Front center armrest including cup holder
- Sensus navigation system
- Package: Winter Package (front seat heating - steering wheel heating)
- Upholstery: Leather comfort seats
- Radio accessories: Smartphone integration Apple CarPlay and Android Auto
- Rain sensor
- Tire pressure monitoring system
- Road Sign Information (RSI) - Traffic Sign Recognition
- Wheels: 20" alloy wheels, 10-spoke design, diamond cut/black



- Seats: Adjustable (electric) leg rest for driver and front passenger seats
- Seats: Driver and passenger seats electrically adjustable
- Sun blinds for the rear side windows (integrated)
- Start/Stop technology
- Textile floor mats
- Glazing: Colored glazing
- Volvo On Call with Wi-Fi hotspot
- Immobiliser
- Central locking system with two remote controls and integrated emergency key

### Extra equipment

- Alarm system (with motion/tilt sensor, safety locking and private locking (separate glove compartment and trunk locking))
- Paint finish: Metallic paint
- Package: Lighting Package (LED fog lights (integrated into the front spoiler) - headlight cleaning system - full LED "Thor's Hammer" Active High Beam headlights with extended high beam, dynamic cornering lights, intelligent high beam assist with adaptive headlight range control and integrated LED daytime running lights - ambient lighting (multicolored) front and rear; on the doors - exit lights in the rear doors - rear footwell lighting - illuminated front cup holders - work light on the tailgate)
- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)
- Upholstery: Nappa leather comfort seats, (front seats perforated) (Inscription) (with active ventilation and electrically adjustable side bolsters for driver and front passenger seats including rear center armrest (2nd row of seats) - real wood inlay: GREY ASH or BLACK ASH)
- Seats: Massage function for driver and front passenger seats
- Seats: Heated rear seats (outer seats of the 2nd row)
- Glazing: Side and rear windows tinted (from the B-pillar back)
- winter tires

- Gearshift lever made of Swedish crystal glass by Orrefors
- Sensus Connect infotainment system
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Electrically adjustable driver's seat (8-way)
- Seats: Lumbar support (4-way electrically adjustable) for driver and front passenger seats
- Power socket
- First aid kit and warning triangle
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- WHIPS whiplash protection system

- roof box
- Automatic climate control with 4-zone temperature control (Individual climate control for driver, front passenger and rear passengers left and right (2nd row of seats) including climate display for the 2nd row of seats)
- Package: Winter Package Pro P0009
- Package: Xenium Package (5-seater) (Automatic climate control with 4-zone temperature control - Panoramic glass sunroof with tilt function and integrated, continuously adjustable sunshade (electric) - Sun blinds for the rear side windows (integrated) - High Performance Sound Pro audio system by Harman/Kardon: - 600 watts of power - 14 speakers - Fresh Air Subwoofer - Dirac Unison sound optimization - Enhanced air quality system with fine dust filtration according to PM2.5 air quality standard)
- Parking camera with 360° surround view
- Radio: Sensus Connect infotainment system with Premium Sound by Bowers & Wilkins (9" touchscreen (22.9 cm diagonal) - 1,400 watts - 19 speakers - Nautilus tweeters - midrange with aramid fiber cone - woofers with carbon/cellulose cone - Fresh Air subwoofer with mica cone - USB port compatible with Apple iPod/iPhone/iPad - Dirac Unison sound optimization - Bluetooth hands-free system including audio streaming - Internet access including internet radio and apps - Voice control - Room Modes - Connected Service Booking - Digital vehicle owner's manual)

### Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |



## Value reducing factors

| No. | Component group             | Description                                                                |
|-----|-----------------------------|----------------------------------------------------------------------------|
| 1   | Equipment                   | Tirefit filler - Expired - Replace                                         |
| 2   | Wheel / tyres               | Alloy rim - front right side - Scratched - Loss in value                   |
| 3   | Wheel / tyres               | Alloy rim - rear right side - Scratched - Loss in value                    |
| 4   | Wheel / tyres               | Alloy rim - rear left side - Scratched - Loss in value                     |
| 5   | Rear bumper                 | Bumper with Parktronic - Scratched - Smart repair                          |
| 6   | Side panel - rear left side | Side panel - dent(s) - Smart repair                                        |
| 7   | Door - rear left side       | Door - Deformed - Repair and paint                                         |
| 8   | Bonnet                      | Bonnet - Scratch(es) - Paint                                               |
| 9   | Front bumper                | Bumper with Parktronic (Inkl. Kotflügelverkleidung VR) - Scratched - Paint |

## Wear and tear

| No. | Component group        | Description                                |
|-----|------------------------|--------------------------------------------|
| 1   | Misc.                  | Misc. (Dachbox) - Scratched - No deduction |
| 2   | Door - rear right side | Door - dent(s) - Smooth repair work        |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.





**Figure 1:** Diagonal front (left)




**Figure 2:** Diagonal front (right)




**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)

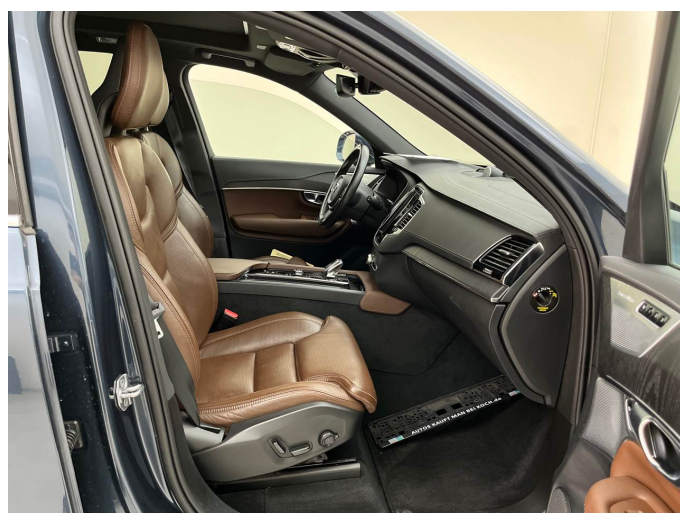

**Figure 5:** Interior - front

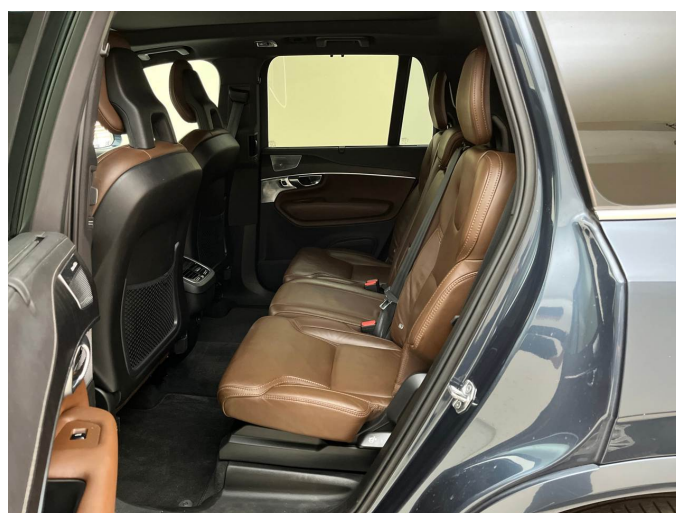

**Figure 6:** Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

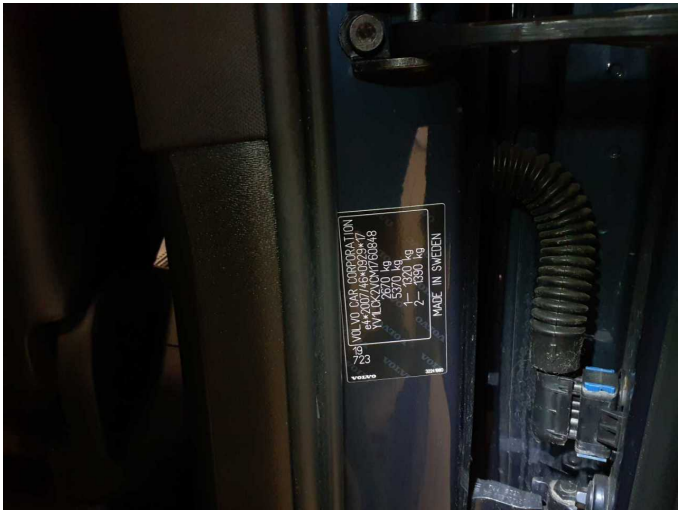


Figure 11: VIN



Figure 12: Mounted tyres





Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

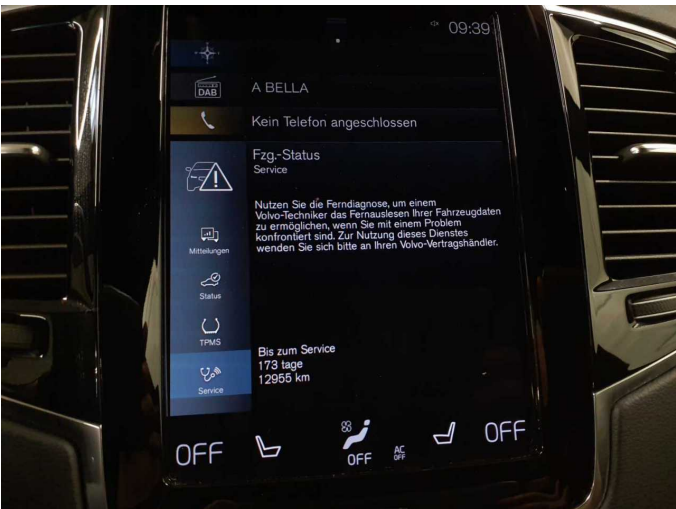


Figure 17: Misc.



Figure 18: Misc.





Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace





**Damage 2:** Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



**Damage 2:** Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



**Damage 2:** Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



**Damage 3:** Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



**Damage 3:** Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




**Damage 3:** Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



**Damage 3:** Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




**Damage 4:** Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value

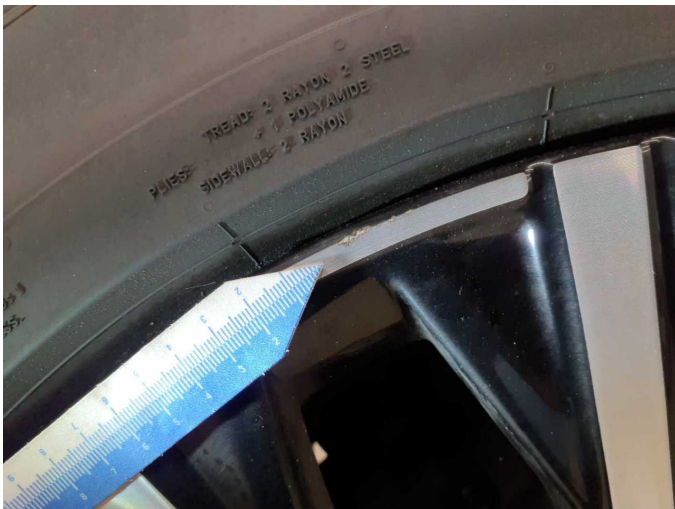

**Damage 4:** Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



**Damage 5:** Rear bumper: Bumper with Parktronic - Scratched - Smart repair

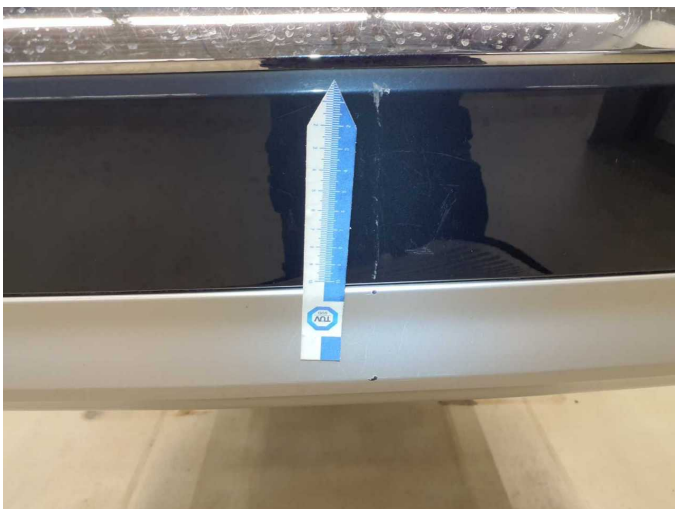

**Damage 5:** Rear bumper: Bumper with Parktronic - Scratched - Smart repair



**Damage 5:** Rear bumper: Bumper with Parktronic - Scratched - Smart repair







**Damage 5:** Rear bumper: Bumper with Parktronic - Scratched - Smart repair




**Damage 5:** Rear bumper: Bumper with Parktronic - Scratched - Smart repair

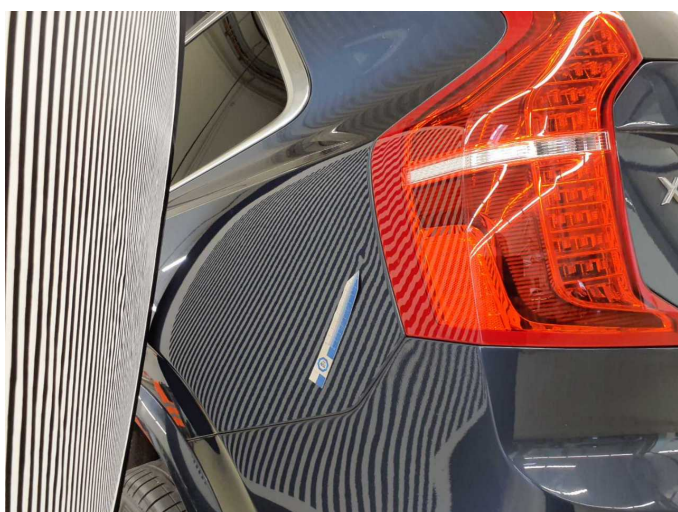

**Damage 6:** Side panel - rear left side: Side panel - dent(s) - Smart repair

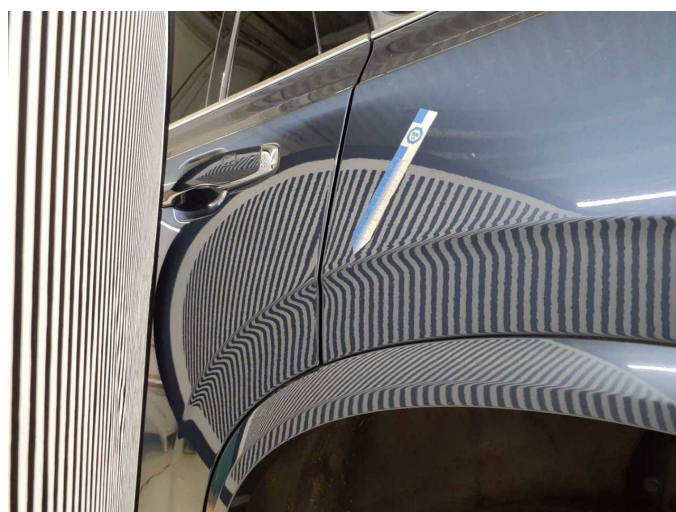

**Damage 6:** Side panel - rear left side: Side panel - dent(s) - Smart repair

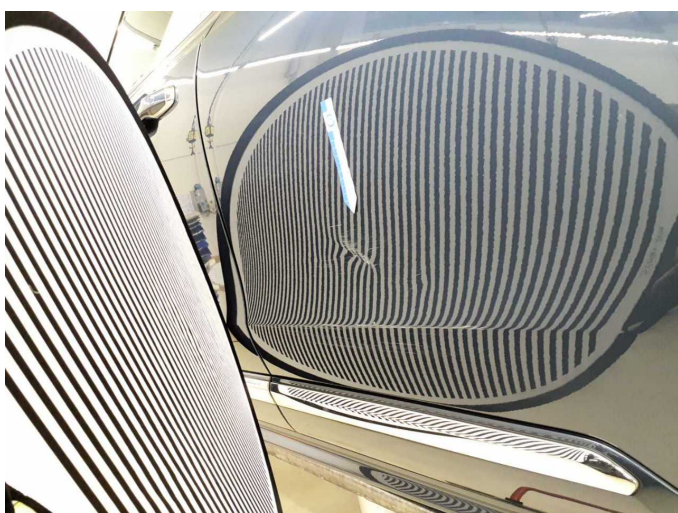


**Damage 7:** Door - rear left side: Door - Deformed - Repair and paint



**Damage 7:** Door - rear left side: Door - Deformed - Repair and paint




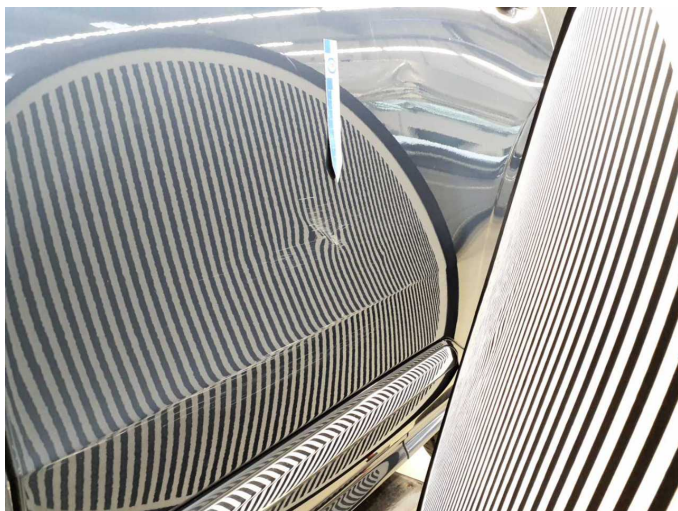

**Damage 7:** Door - rear left side: Door - Deformed - Repair and paint



**Damage 7:** Door - rear left side: Door - Deformed - Repair and paint

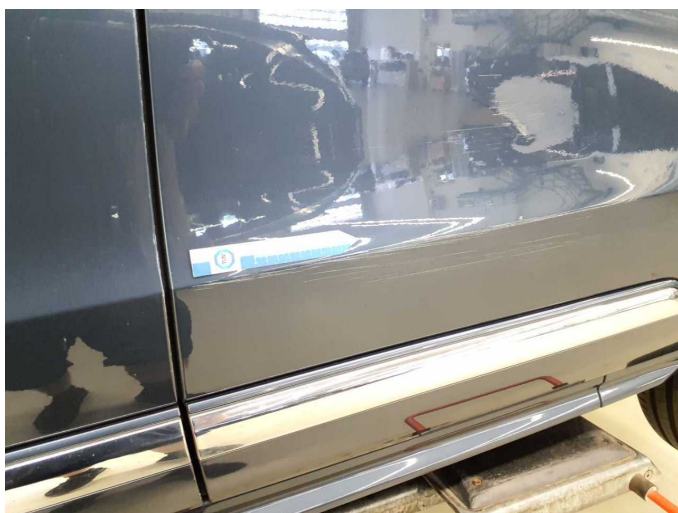


**Damage 7:** Door - rear left side: Door - Deformed - Repair and paint



**Damage 7:** Door - rear left side: Door - Deformed - Repair and paint




**Damage 8:** Bonnet: Bonnet - Scratch(es) - Paint

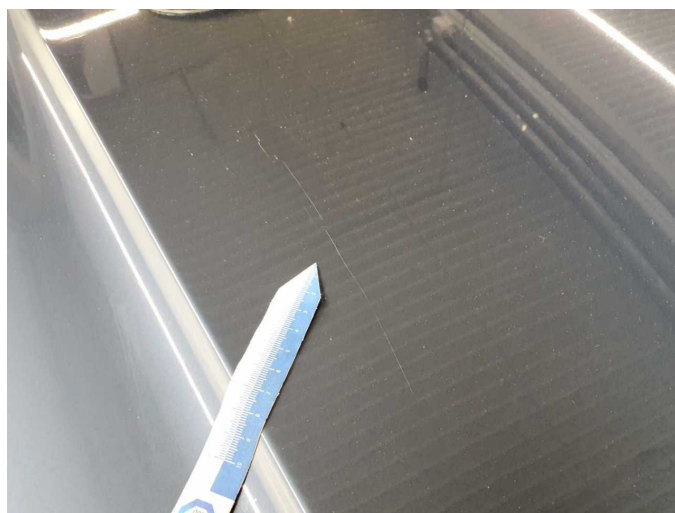

**Damage 8:** Bonnet: Bonnet - Scratch(es) - Paint




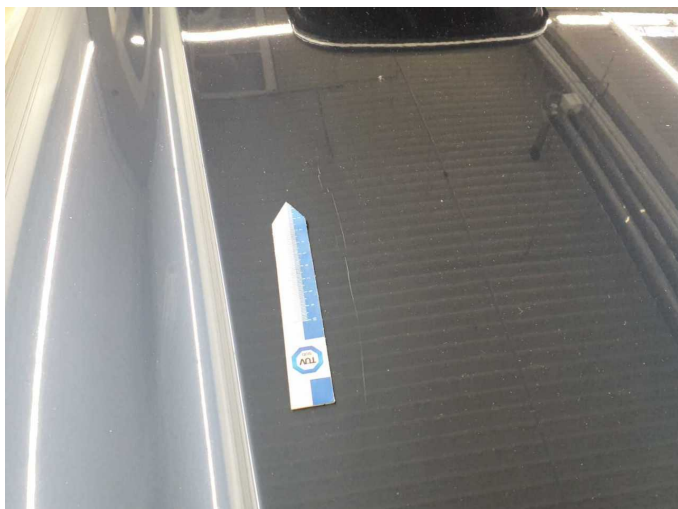


**Damage 8:** Bonnet: Bonnet - Scratch(es) - Paint




**Damage 9:** Front bumper: Bumper with Parktronic (Inkl. Kotflügelverkleidung VR) - Scratched - Paint

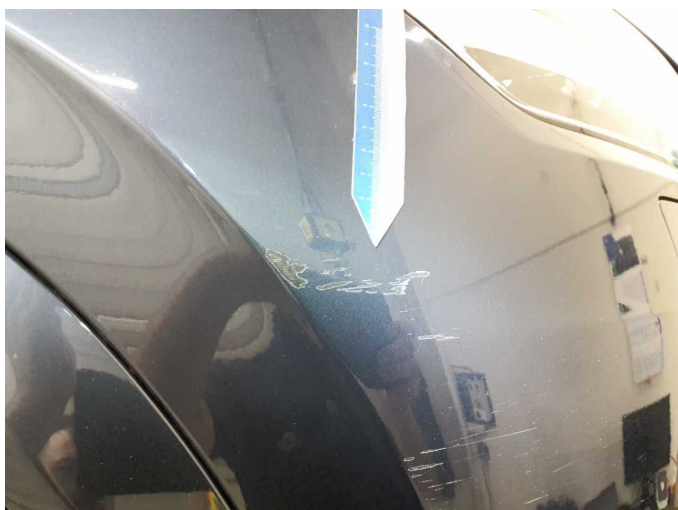


**Damage 9:** Front bumper: Bumper with Parktronic (Inkl. Kotflügelverkleidung VR) - Scratched - Paint

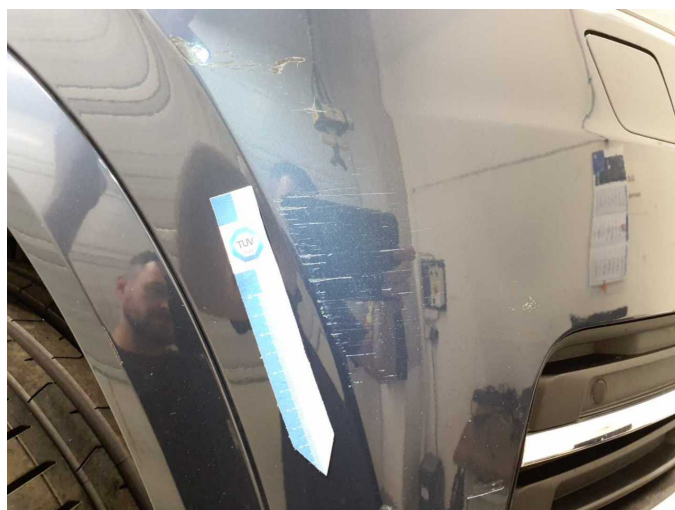

**Damage 9:** Front bumper: Bumper with Parktronic (Inkl. Kotflügelverkleidung VR) - Scratched - Paint

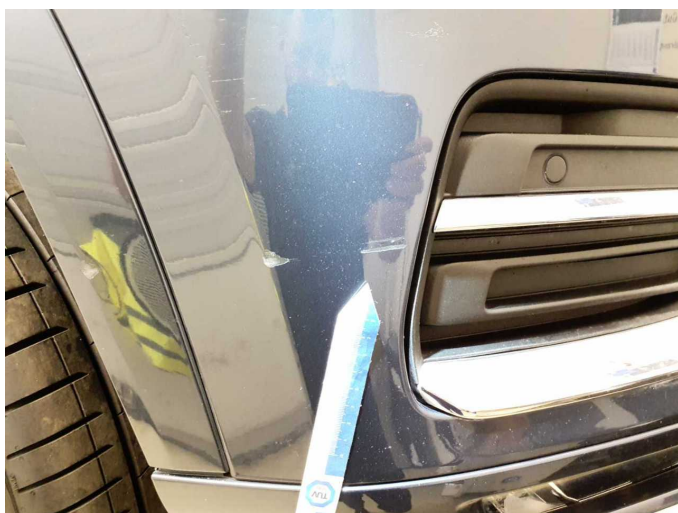


**Damage 9:** Front bumper: Bumper with Parktronic (Inkl. Kotflügelverkleidung VR) - Scratched - Paint

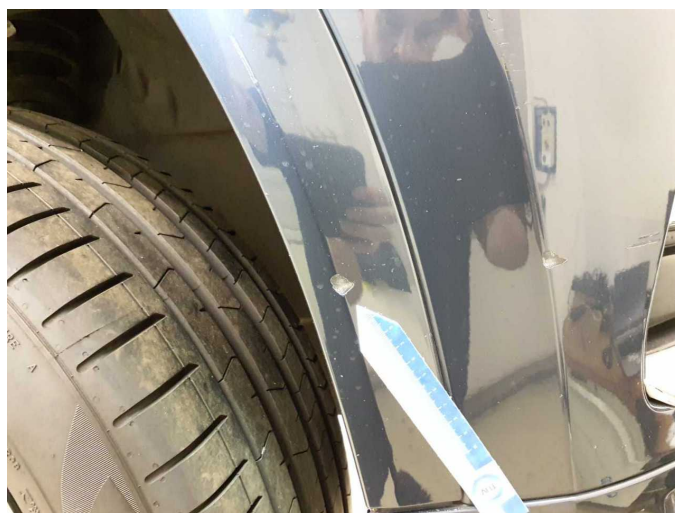

**Damage 9:** Front bumper: Bumper with Parktronic (Inkl. Kotflügelverkleidung VR) - Scratched - Paint



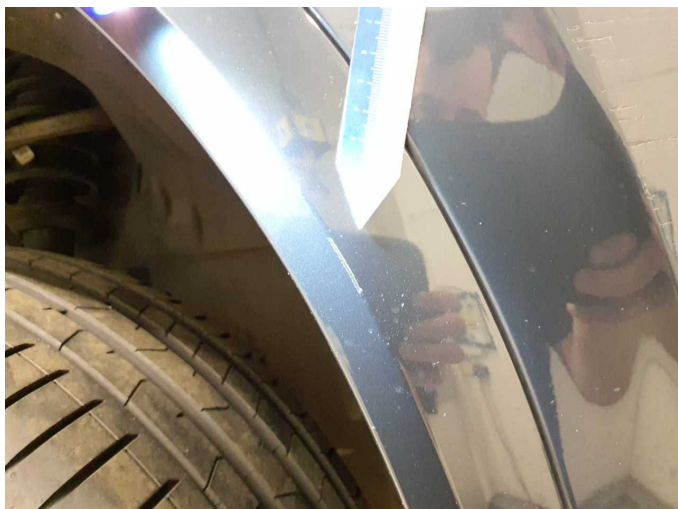

**Damage 9:** Front bumper: Bumper with Parktronic (Inkl. Kotflügelverkleidung VR) - Scratched - Paint



**Damage 9:** Front bumper: Bumper with Parktronic (Inkl. Kotflügelverkleidung VR) - Scratched - Paint



**Wear and tear 1:** Misc.: Misc. (Dachbox) - Scratched - No deduction



**Wear and tear 1:** Misc.: Misc. (Dachbox) - Scratched - No deduction



**Wear and tear 1:** Misc.: Misc. (Dachbox) - Scratched - No deduction



**Wear and tear 1:** Misc.: Misc. (Dachbox) - Scratched - No deduction





**Wear and tear 1:** Misc.: Misc. (Dachbox) - Scratched - No deduction



**Wear and tear 1:** Misc.: Misc. (Dachbox) - Scratched - No deduction



**Wear and tear 1:** Misc.: Misc. (Dachbox) - Scratched - No deduction



**Wear and tear 1:** Misc.: Misc. (Dachbox) - Scratched - No deduction



**Wear and tear 2:** Door - rear right side: Door - dent(s) - Smooth repair work



**Wear and tear 2:** Door - rear right side: Door - dent(s) - Smooth repair work