



Expertise

Protocol number: 46913658
Order No. / Reference: 26761397
Inspection date: 6 Aug 2026

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG Highline

VIN: WVGZZZ1TZNW010756



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Touran 2.0 TDI SCR DSG Highline	
Vehicle Identification number	WVGZZZ1TZNW010756
Mileage (Read)	123,360 km
First registration	28 Mar 2022
Number of holders	1
Next periodical technical inspection	04/2027
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Reflexsilber-metallic (A7W)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	9,800 km
Last service on / at	05/2026 at 120,023 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ049451
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BWS 00717		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Hankook	6mm / 6mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Hankook	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Continental	3mm / 4mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Continental	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 USB-C ports on the front
- Storage compartments in the overhead console
- Airbag, head airbag system for front and rear passengers
- Electrically adjustable and heated exterior mirrors
- third brake light
- Headliner in Storm Grey
- Decorative inlays "Piano Black"
- Tachometer
- Electronic parking brake including auto-hold function
- Windscreen in heat-insulating glass
- Baggage management package
- Additional luggage compartment lighting
- Speed limiter
- Glove compartment with cooling option
- Rear window wiper with intermittent function
- ISOFIX mounting points on rear seats
- Air conditioning system "Air Care Climatronic"
- Front headrests
- Paint finish: Solid
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- "Premium" multifunction display with multicolor screen
- Fog lights and cornering lights
- Emergency braking assistant "Front Assist"
- Package: Ambient lighting
- Upholstery: Cloth
- Radio
- Radio accessories: 8 speakers
- Tire pressure monitoring system (passive)
- Wheels: Tire Mobility Set omitted
- Automatically heated front windshield washer nozzles
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear
- Seats: Front passenger seat backrest folds down completely
- Seats: Top comfort seats in the front
- Start-stop system
- Bumpers in body color
- First aid kit, warning triangle and high-visibility vest
- Prepared for later activation: Discover Media navigation function incl. streaming & internet
- Electronic immobilizer
- Green thermal insulation glazing
- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger
- Airbag: Side airbags for the outer rear seats
- Exterior mirror housings and door handles in body color
- Chrome trim on the side windows
- Roof rails, silver anodized
- Diesel particulate filter
- Parking assistance
- Electronic Stability Program (ESP) with counter-steering support
- luggage compartment cover
- Height-adjustable luggage compartment floor
- Transmission: 7-speed DSG
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Headrests (3) in the 2nd row of seats
- Black radiator grille with chrome strips on the slats
- LED headlights
- Illuminated makeup mirrors in the sun visors
- front center armrest
- Fatigue detection
- Non-smoking version
- Emergency call service
- Package: Winter Package
- Proactive occupant protection system in conjunction with "Front Assist"
- Radio accessories: Digital radio reception DAB+
- Wheels: 4 light alloy wheels 6.5 J x 17 "Alexandria"
- Gearshift knob in leather
- Headlight cleaning system
- electromechanical power steering
- Seats: 3 individual seats in the 2nd row
- Seats: Folding tables on the backs of the front seats
- Seats: Lumbar support in the front
- Seats: Front seats are height-adjustable
- 12V power outlet on the rear of the center console
- Textile floor mats
- Prepared for "We Connect" and "We Connect Plus"
- Washer fluid level warning light
- Warning tone and light for unfastened seat belts front and rear
- Central locking without safe locking, with remote control and 2 remote folding keys



Extra equipment

- Towbar, foldable with electric release
- Digital Cockpit Pro (instrument cluster as TFT display with interactive display - various information profiles are selectable (e.g. consumption & range, navigation, driver assistance, efficiency))
- Package: Driver Assistance Package "Plus" (DSG) (Automatic Distance Control ACC "stop & go", Dynamic High Beam Control "Dynamic Light Assist", Automatic Headlights, Daytime Running Lights, "Leaving Home" Function and Manual "Coming Home" Function, Pedestrian Detection + Active Front Folding Mirror, Automatically Dimming Interior Mirror, LED Headlights with LED Daytime Running Lights and Cornering Lights, Dynamic Headlight Range Control with Dynamic Cornering Function, Multifunction Camera, Lane Change Assist "Side Assist Plus" including "Lane Assist" and Parking Assist, Rain Sensor)
- Package: "Easy Open" incl. Safe locking (luggage compartment lid with sensor-controlled opening and electric closing - keyless locking and starting system "Keyless Access")
- Rear side windows and rear window tinted
- Seats: 2 child seats (2 child seats with side support and side headrest, foldable, left and right in the 2nd row of seats)
- Seats: ergoActive seat with 14-way adjustment and massage function in the front (ergoActive front seats height-adjustable, seat and backrest tilt adjustable - lumbar support in the front electrically adjustable and with massage function - no drawers under the front seats - seat center panels in microfleece "ArtVelours" - top comfort seats in the front - heated front seats)
- Anti-theft alarm system (with interior monitoring, backup horn and tow-away protection)
- Paint finish: Metallic
- Navigation system "Discover Pro" incl. "Streaming & Internet" (App-Connect incl. App-Connect Wireless for Apple CarPlay - screen diagonal 23.4 cm - touchscreen - FM radio reception - dual tuner with phase diversity - MP3 - USB-C with Apple compatibility - output power 4x20 watts - map with 2D display - traffic sign display - telephone interface - 3-way sound control - voice control - digital radio reception DAB+)
- Package: Mirror package in conjunction with driver assistance package "Plus" (electrically folding exterior mirrors, dimming on the driver's side, ambient lighting and passenger exterior mirror lowering - automatic headlight control with daytime running lights, "Leaving home" function and manual "Coming home" function - automatically dimming interior mirror - rain sensor)
- Rear View reversing camera (displays the rear of the vehicle in real time on the radio/navigation system display)
- LED taillights
- Seats: 2 individual seats in the 3rd row, foldable into the luggage compartment floor (3 individual seats in the 2nd row with armrest, 2 individual seats in the 3rd row, with headrests and "Easy Fold" folding function)
- "Comfort" telephone interface with inductive charging function (hands-free system)
- Traffic sign recognition
- Prepared for "We Connect" and "We Connect Plus" (online information is transmitted directly to the car (e.g. navigation with point-of-interest search, online traffic information, parking information, etc.))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
2	Front bumper	Front bumper - Scratch(es) - Smart repair
3	Rear bumper	Rear bumper - Scratched - Repair and paint



Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - No deduction
2	Wheel / tyres	Alloy rim - front left side - Scratch(es) - No deduction
3	2nd wheel set	2 tyres - Worn - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

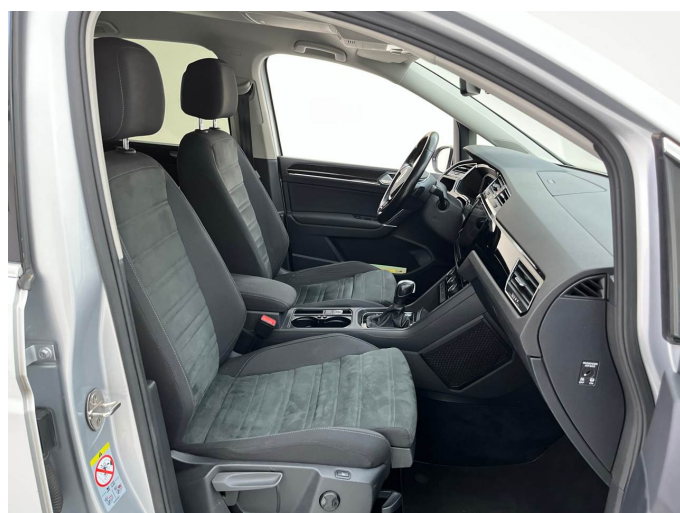


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

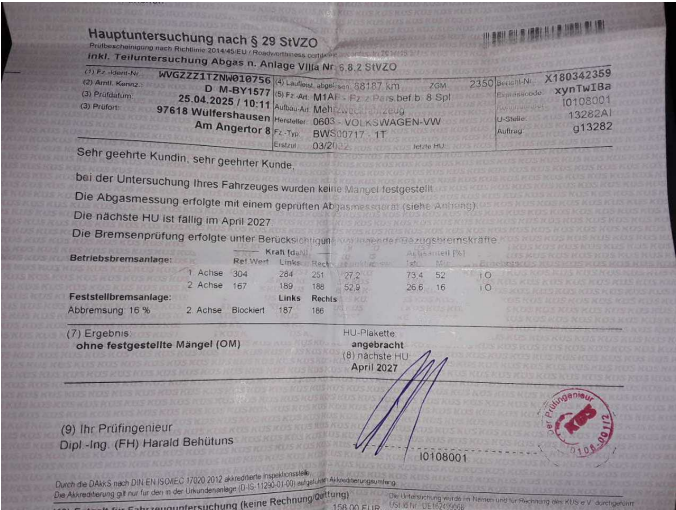


Figure 13: Documents

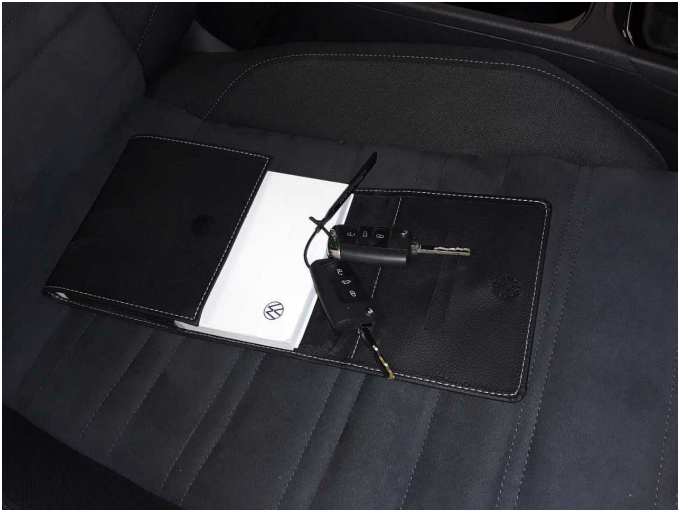


Figure 14: Documents

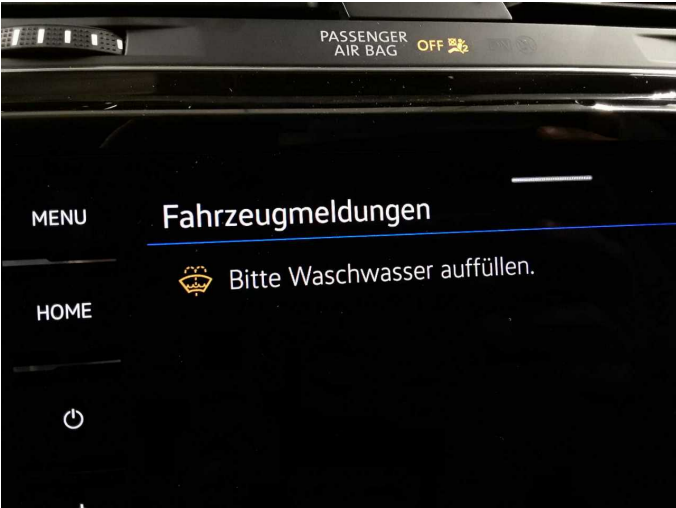


Figure 15: Documents

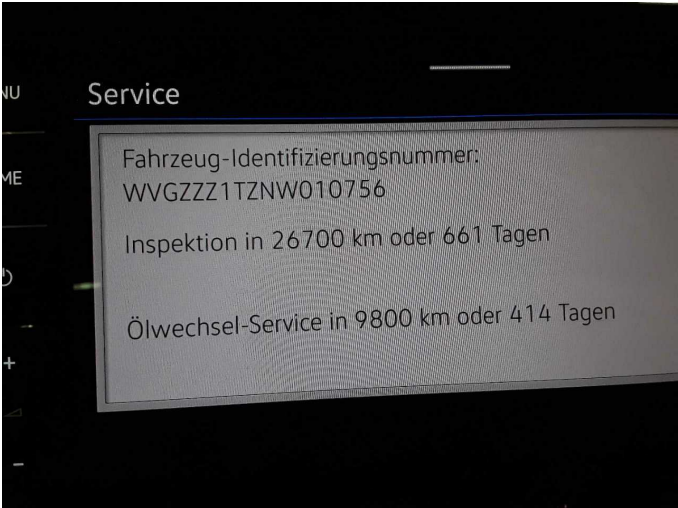


Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.

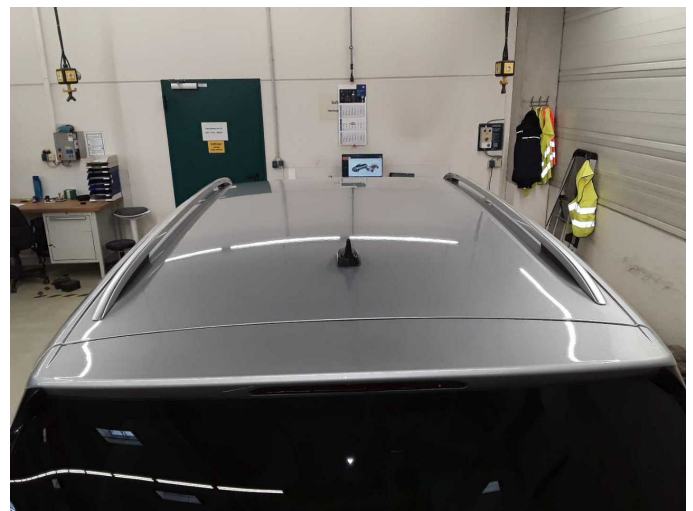


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

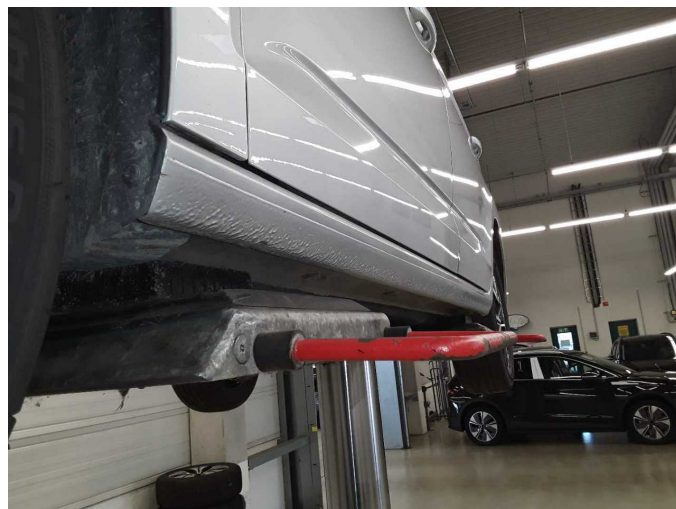


Figure 26: Misc.



Figure 27: Misc.

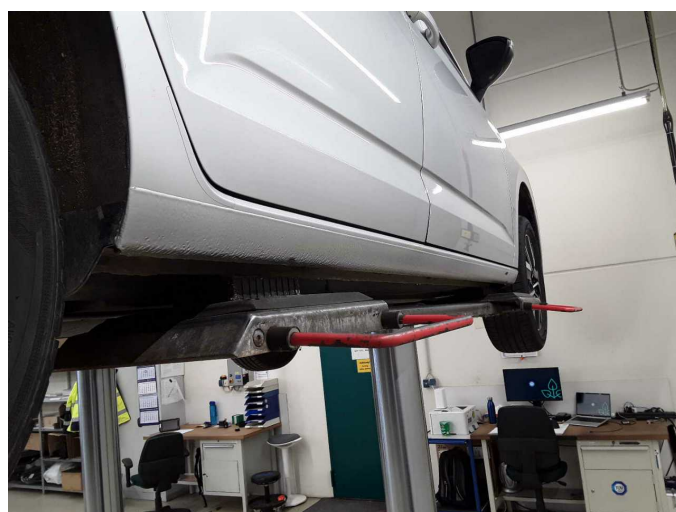


Figure 28: Misc.



Figure 29: Verschmutzung



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

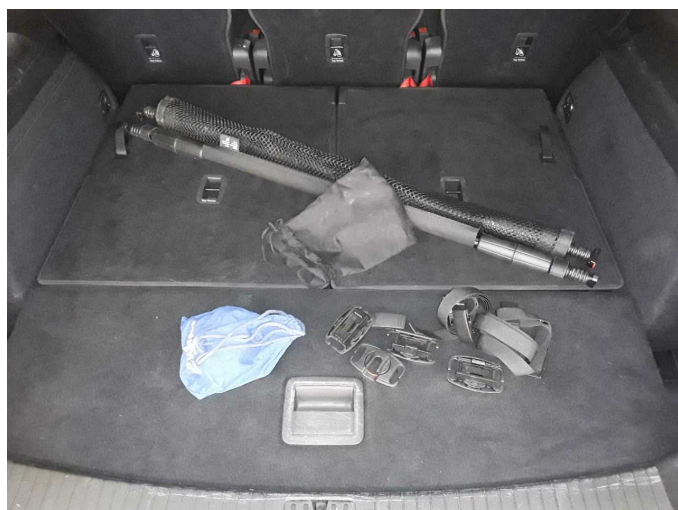


Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.




Figure 38: Misc.



Figure 39: Misc.



Damage 1: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

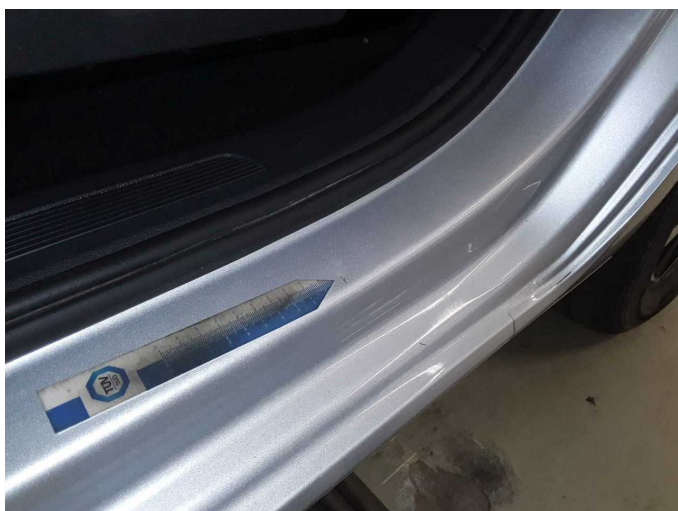

Damage 1: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 2: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 2: Front bumper: Front bumper - Scratch(es) - Smart repair




Damage 3: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage 3: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 3: Rear bumper: Rear bumper - Scratched - Repair and paint

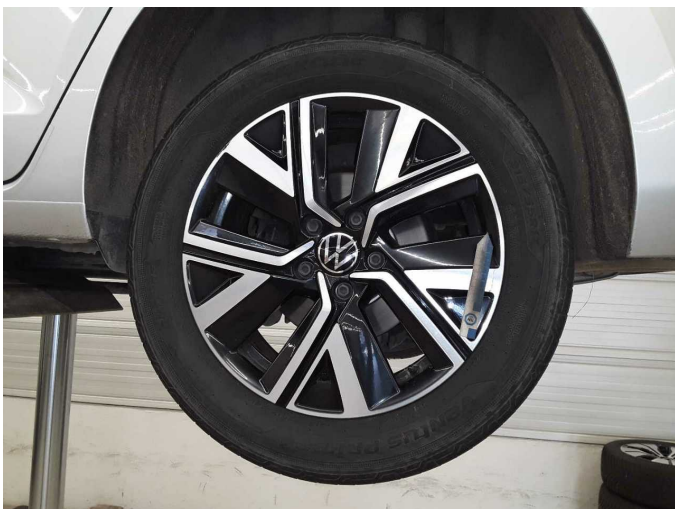

Wear and tear 1: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - No deduction

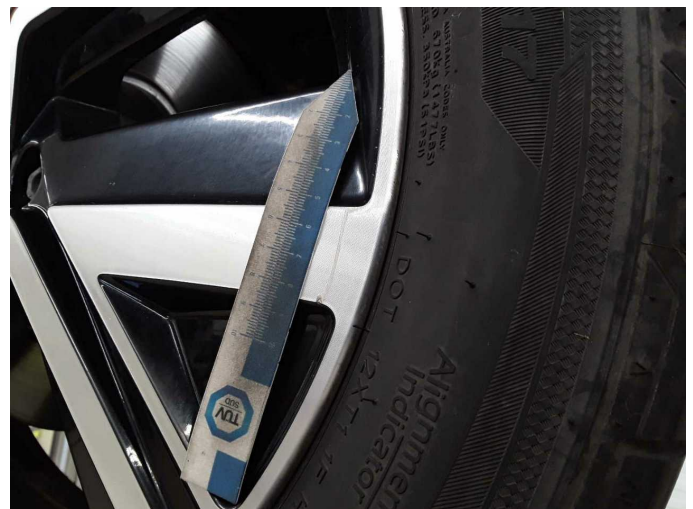

Wear and tear 1: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - No deduction



Wear and tear 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - No deduction



Wear and tear 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1TZNW010756

Hersteller / Modell: VOLKSWAGEN VW Touran 2.0 TDI SCR DSG Highline

Datum	KM-Stand	Beschreibung
29.05.2026	120.023	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Getriebeöl ern/ prüfen; Regelwartungsdienst; Wartung Sonstiges
16.01.2026	109.917	Ladeluftschlauch ern; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
01.12.2025	105.903	Regelwartungsdienst; Systemtest/Eigendiagnose
28.11.2025	105.903	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
03.06.2025	92.005	Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges
25.04.2025	88.864	HU + AU
10.12.2024	78.663	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
06.11.2024	74.196	Systemtest/Eigendiagnose
07.06.2024	61.860	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Systemtest/ Eigendiagnose
26.02.2024	52.053	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
28.06.2023	32.099	Bremsscheiben + Klötze v; Regelwartungsdienst
09.03.2023	23.620	Motoröl b. Wartung; Ölwechsel