



Expertise

Protocol number: 46826774
Order No. / Reference: 26578211
Inspection date: 30 Jul 2026

Manufacturer: Skoda
VIN: TMBLN9NS8N8054037

Model: Kodiahq 2.0 TDI 4x4 DSG Tour



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiahq 2.0 TDI 4x4 DSG Tour	
Vehicle Identification number	TMBLN9NS8N8054037
Mileage (Read)	160,782 km
First registration	1 Jul 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Lava-Blau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	19,200 km
Last service on / at	07/2026 at 153,208 km		
Key is / should be	2 / 2	FZG documents	Registration and title documents unavailable
		Letter No.	GJ923822
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AVW 00397		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,410 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 103W	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	235/50 R19 103W	Summer tyres on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/55 R18 104H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaautomatik

|

Standard equipment

- 12V socket in the center console and in the trunk
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically folding exterior mirrors including interior and driver's side mirrors with automatic dimming
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Roof rails, black
- Anti-theft alarm system
- Tachometer
- Easy Start (start-stop button)
- Electric tailgate operation including comfort opening
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- High Beam Assist (Light Assist)
- front and rear floor mats
- Closed storage compartment on the driver's side
- Tinted windows
- Isofix anchorage on the outer rear seats including top tether
- Front and rear headrests are height-adjustable.
- LED taillights in crystal glass look & LED license plate lights
- Reading lights at the front of the headliner
- Rear center armrest with cup holders and pass-through option
- Multifunction display in the instrument cluster, color
- Fog lights with integrated LED daytime running lights
- Parking assist
- Upholstery: Cloth
- Radio: Amundsen infotainment system (tour)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink
- Wheels: 19" Procyon Aero alloy wheels, grey, diamond-cut finish
- Heated windshield washer nozzles, front
- Headlights washer / wiper system
- Kodiahq seat belts
- Seats: Adjustable lumbar support in the front seats
- Skoda Care Connect
- Sunshade roller blind for the rear side windows
- Sunset
- Front door sill trims
- Variable fastening concept in the trunk
- Immobiliser
- Storage compartment on the left wheel arch
- Option to opt out of standard extended warranty
- front aero windshield wipers
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Permanent all-wheel drive
- Traction control (ASR)
- Traveller Plus Assistance System (DSG)
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist (HBA)
- Grey headliner
- Decorative inlay Anodized Cross
- Diesel particulate filter
- Third brake light
- eCall
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Kessy - keyless entry and start-stop system
- Boot cover, roll-up and removable
- LED matrix headlights and dynamic high beam assist (Light Assist)
- Steering wheel: Sport leather steering wheel with multifunction buttons including paddle shifters.
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake
- Package: Family
- Front and rear parking sensors
- Wheel arch cover
- Radio accessories: 8 speakers
- Radio accessories: SmartLink
- Tire pressure monitoring
- Wheels: RunFlat tires with Seal technology
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Electromechanical power steering
- Seats: Heated front and outer rear seats
- Seats: Height-adjustable front seats
- Sun visor on driver and passenger side with illuminated vanity mirror
- Telephone: Convenient hands-free telephone system including phone box
- Lashing eyes in the trunk
- Central locking with remote control



Extra equipment

- Swiveling trailer hitch (with electric release, including trailer stabilization)
- Reversible boot mat
- Paint finish: Metallic / Pearl effect
- Package: Business Columbus (Tour) (Dynamic radio navigation system Columbus - 9.2" capacitive color display - Digital instrument cluster (Virtual Cockpit) - 230V socket and one USB charging port (Type-C) - Luggage net partition - Infotainment Online (3-year subscription))
- Seats: Remote release of the rear seat backrests (2nd row) in the boot
- Variable loading floor in the trunk
- ISOFIX anchorage on the front passenger seat
- Climatronic air conditioning (3-zone) (fully automatic, separately adjustable for driver, front passenger and rear seats)
- Package: Sleeping package (Outer headrests in the 2nd row of seats with sleeping function - sleeping blanket - Lounge Step comfort floor mats)
- Proactive occupant protection including rear side airbags
- Seats: Folding tables on the front seatbacks
- Auxiliary heating
- 360° surround view camera including reversing camera.
- Windscreen, wirelessly heated

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were not available.
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - Missing - No deduction
2	Boot lid / rear door	Boot lid - Glued / labelled - Remove
3	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
4	Front bumper	Cover bumper - front - Scratch(es) - Smart repair
5	Front bumper	Spoiler - Scratch(es) - Smart repair
6	Rear bumper	Rear bumper - Scratch(es) - Smart repair
7	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
8	Mudguard - left side	Wheel arch - Broken / torn - Replace
9	Front bumper	Front bumper - Scratch(es) - Repair and paint
10	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint



Wear and tear

No.	Component group	Description
1	Door - rear right side	Door - Scratch(es) - No deduction
2	Door - front right side	Door - Abrasion - No deduction
3	Headlight	Headlight - right side - Stone chips - No deduction
4	Side panel - rear left side	Side panel - Abrasion - No deduction
5	Misc.	Main inspection - No evidence - No deduction
6	Headlight	Headlight - left side - Stone chips - No deduction
7	Door - rear left side	Door - dent(s) - Smooth repair work
8	Door - front left side	Door edge - Scratch(es) - Smart repair
9	Trim / covers	Floor mats - Broken / torn - No deduction
10	Wing mirror - left side	Cap - Scratch(es) - Cover / polish

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 14 Oct 2022	987,99 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Der beiliegende Radsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung.

Fahrzeug ist lt. Rechnung ein Tour.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

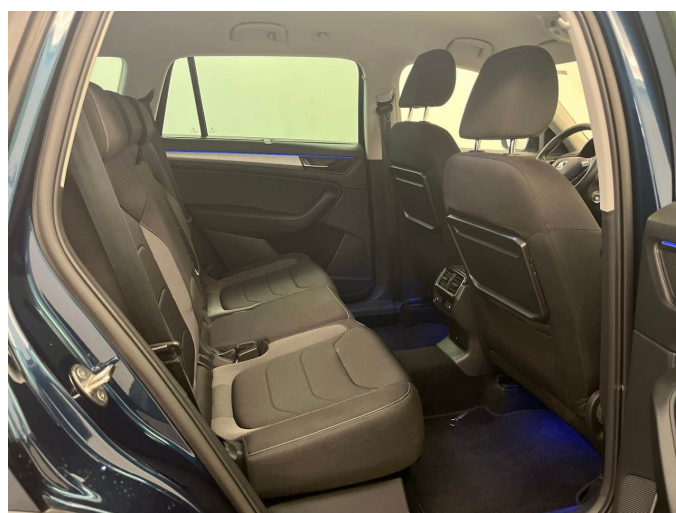


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

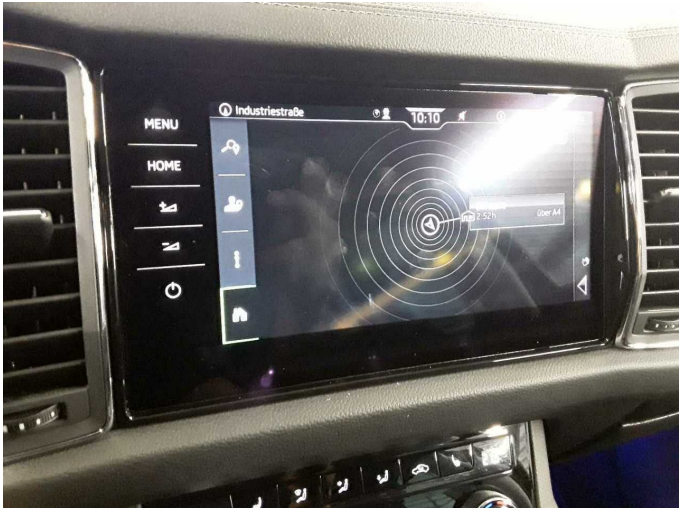


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

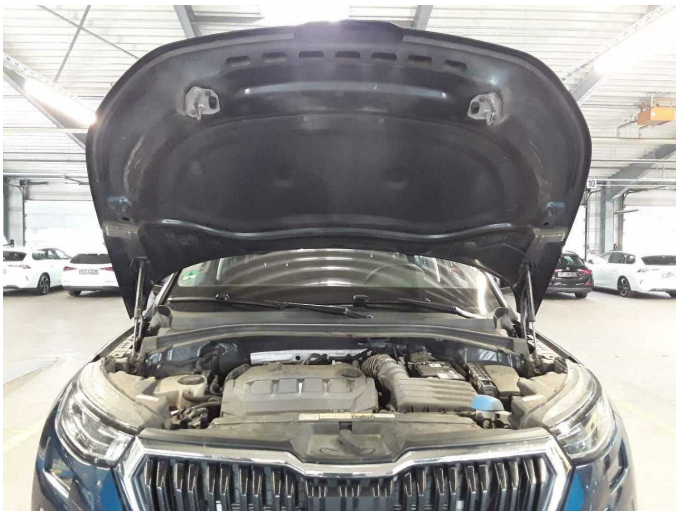


Figure 27: Misc.



Figure 28: Misc.

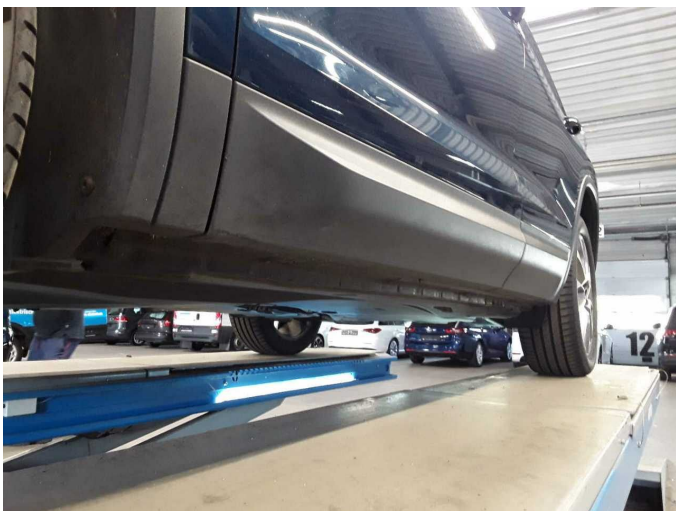


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.


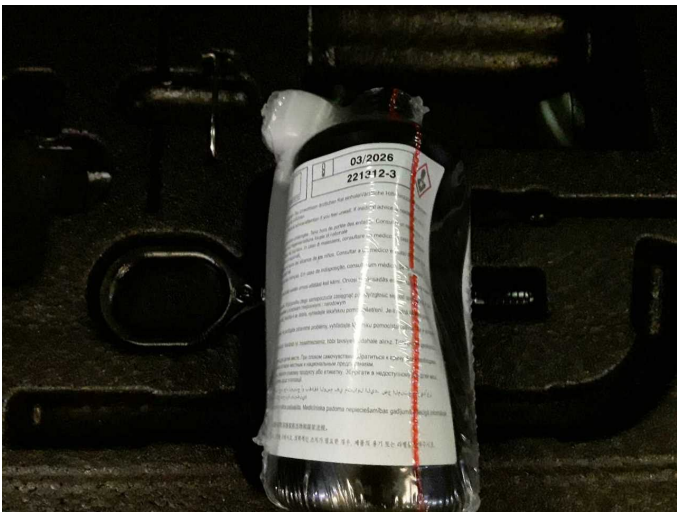


Figure 36: Misc.




Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - Remove

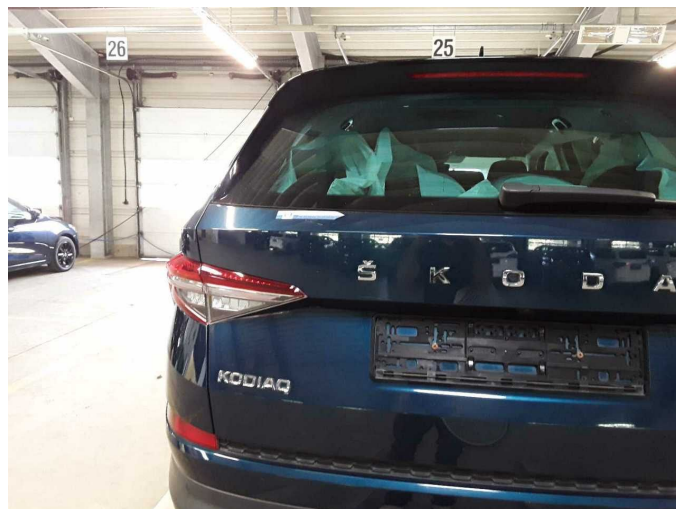

Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair




Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

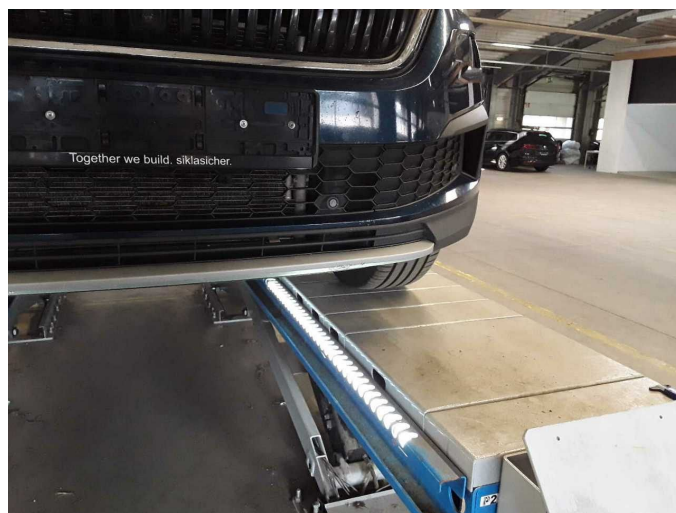

Damage 4: Front bumper: Cover bumper - front - Scratch(es) - Smart repair




Damage 4: Front bumper: Cover bumper - front - Scratch(es) - Smart repair

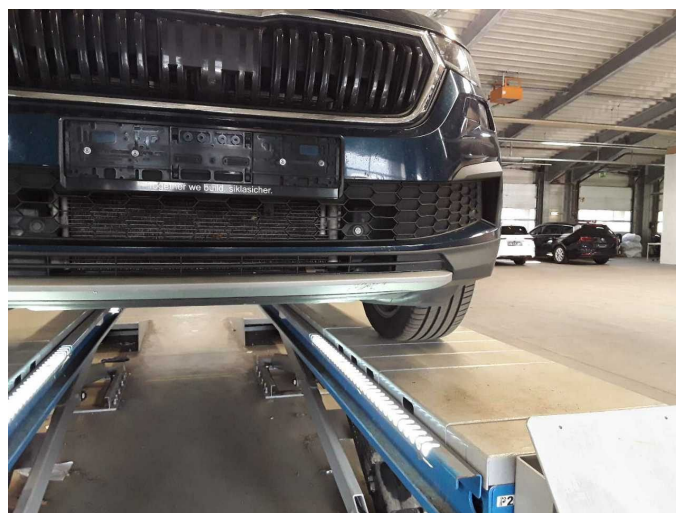

Damage 5: Front bumper: Spoiler - Scratch(es) - Smart repair




Damage 5: Front bumper: Spoiler - Scratch(es) - Smart repair

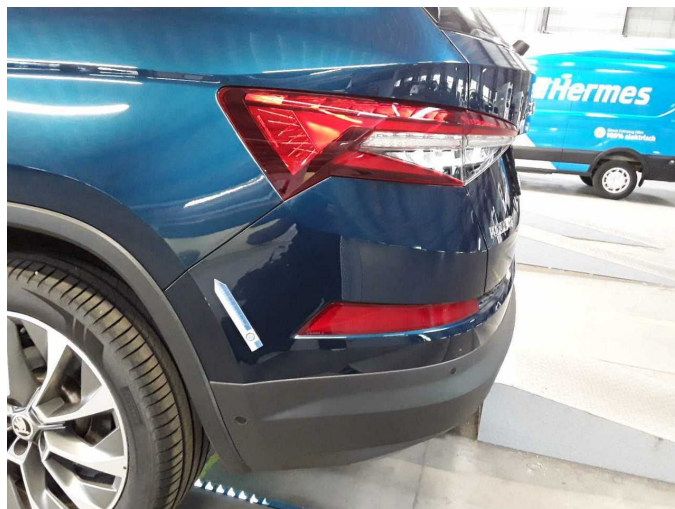


Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair

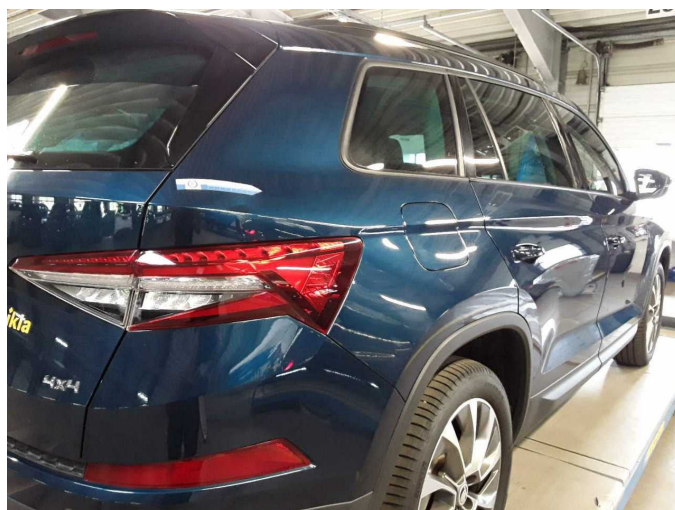


Damage 7: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

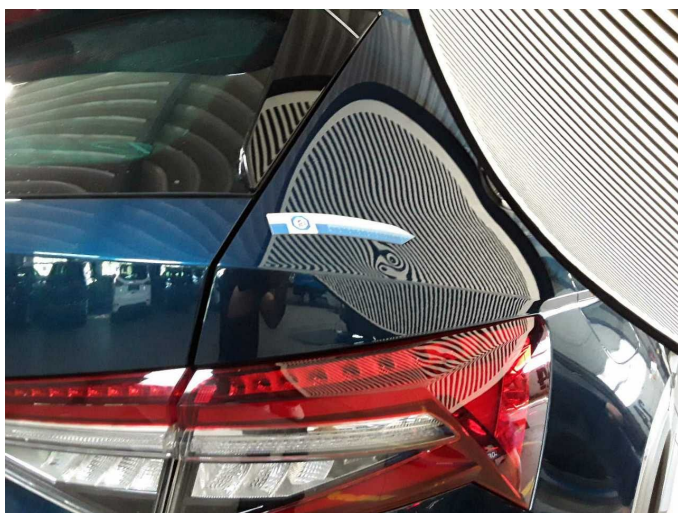


Damage 7: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 8: Mudguard - left side: Wheel arch - Broken / torn - Replace

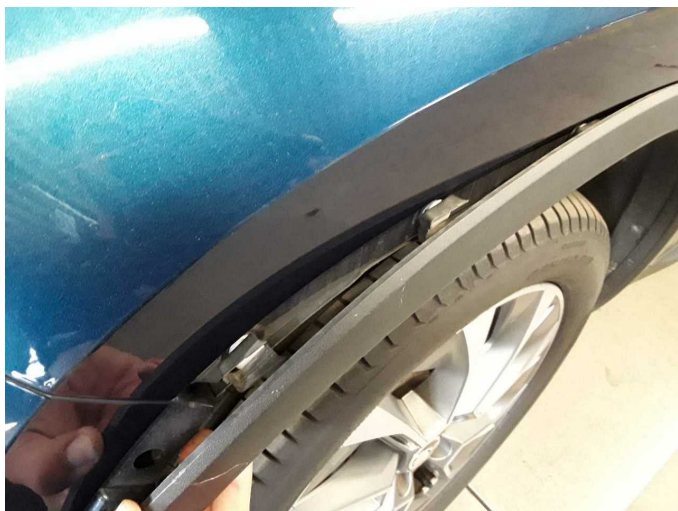


Damage 8: Mudguard - left side: Wheel arch - Broken / torn - Replace

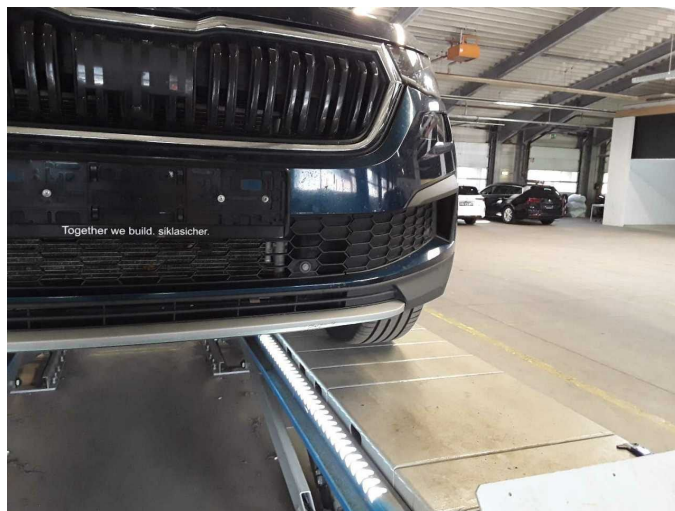


Damage 9: Front bumper: Front bumper - Scratch(es) - Repair and paint




Damage 9: Front bumper: Front bumper - Scratch(es) - Repair and paint

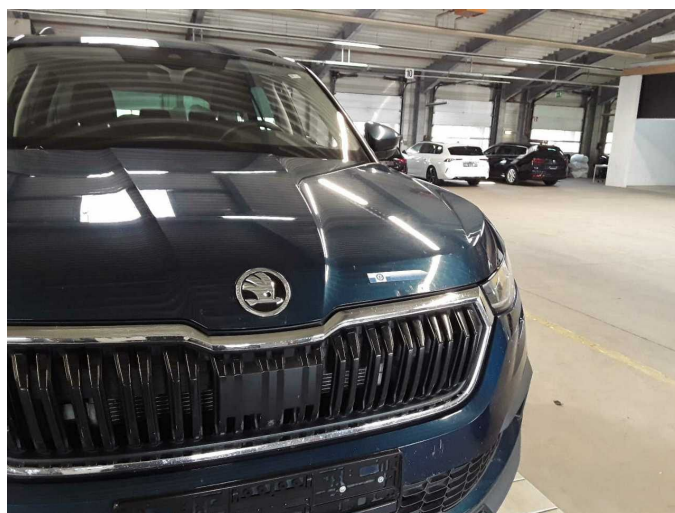

Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

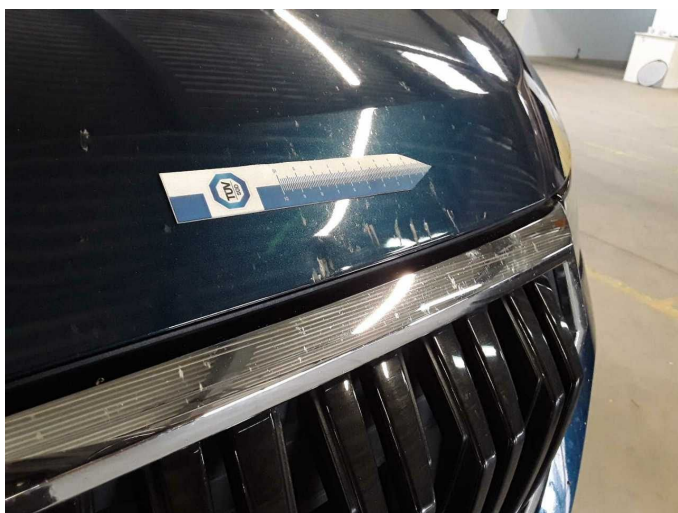

Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

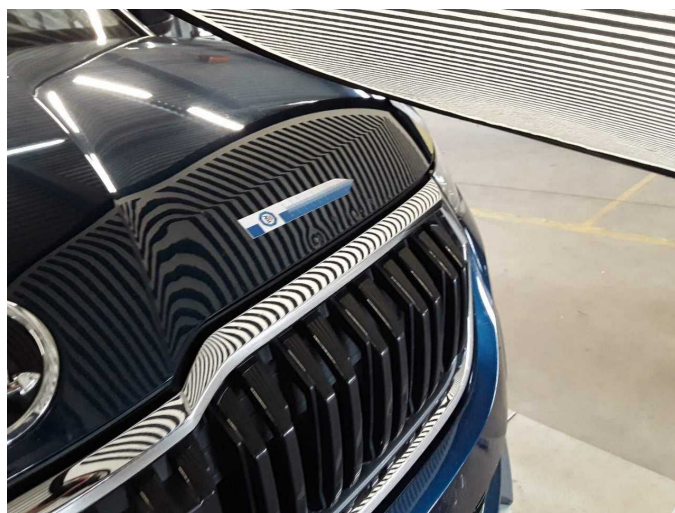

Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Wear and tear 1: Door - rear right side: Door - Scratch(es) - No deduction



Wear and tear 1: Door - rear right side: Door - Scratch(es) - No deduction




Wear and tear 7: Door - rear left side: Door - dent(s) - Smooth repair work

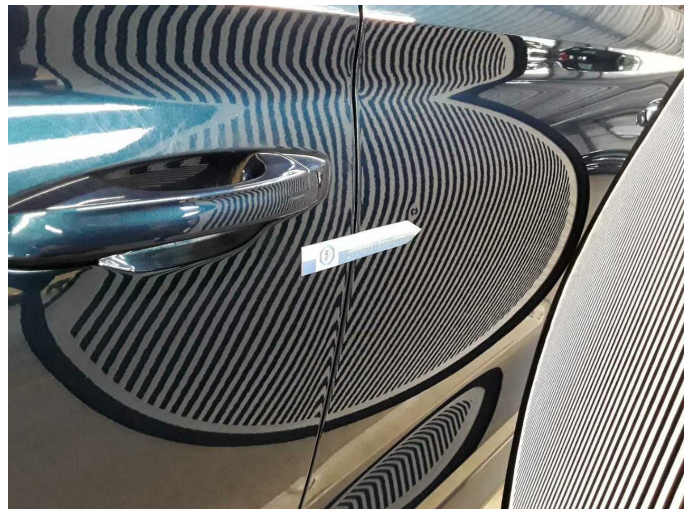

Wear and tear 7: Door - rear left side: Door - dent(s) - Smooth repair work



Wear and tear 8: Door - front left side: Door edge - Scratch(es) - Smart repair

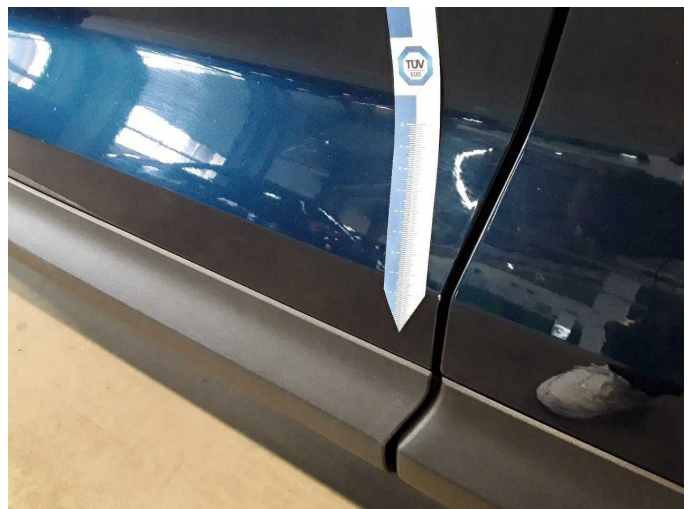

Wear and tear 8: Door - front left side: Door edge - Scratch(es) - Smart repair



Wear and tear 9: Trim / covers: Floor mats - Broken / torn - No deduction



Wear and tear 10: Wing mirror - left side: Cap - Scratch(es) - Cover / polish



Wear and tear 10: Wing mirror - left side: Cap - Scratch(es) - Cover / polish



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLN9NS8N8054037
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI 4x4 DSG Clever

Datum	KM-Stand	Beschreibung
24.07.2026	153.208	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
17.02.2026	140.739	Reparatur Sonstiges
23.12.2025	135.815	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne
25.11.2025	133.744	Batterie ern; Motoröl b. Wartung
19.08.2025	118.934	AU; Bremse Sonstiges; Bremsklötze hinten; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.11.2024	90.695	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
26.08.2024	84.936	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Ölwechsel - Hinterachse; Wartung Sonstiges
30.05.2024	49.790	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne
27.02.2024	62.358	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.06.2023	31.100	Motoröl b. Wartung; Regelwartungsdienst