



Expertise

Protocol number: 46555887
Order No. / Reference: 26543119
Inspection date: 14 Jul 2026

Manufacturer: Mercedes-Benz

Model: E 220 d T 9G-TRONIC AMG Line

VIN: W1K2132041A987991



Vehicle details

Manufacturer / Type / Model / Equipment

Mercedes-Benz E 220 d T 9G-TRONIC AMG Line

Vehicle Identification number W1K2132041A987991
Mileage (Read) 110,361 km
First registration 16 Jun 2021
Number of holders 1
Next periodical technical inspection 06/2028
(Report on hand)

Power / Engine displacement 143 kw / 1,950 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Automatic / 9
Type of drive Rear drive
Type of vehicle Station wagon

Colour / colour code Obsidianschwarz Metallic
Doors / Seats 5 / 5
Upholstery type Leather
Colour of upholstery Black

Re-import no
readiness to drive Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	336 Tag(e)
Last service on / at	06/2026 at 110,028 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC618607
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	2222 / AEA 00222		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,525 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/35 R20 95Y	Summer tires (with run-flat tires) on Light alloy	Goodyear	5mm / 5mm
2)	275/30 R20 97Y	Summer tires (with run-flat tires) on Light alloy	Goodyear	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100V	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	245/45 R18 100V	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with hill start assist, pre-filling and drying braking in wet conditions
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Premium ambient lighting with 64 colors and 3 color zones
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Foldable armrest for driver and front passenger
- Left and right exterior mirrors, heated and electrically adjustable, painted in body color
- Brake assist, active
- Diesel particulate filter
- Third brake light
- EASY-PACK cargo cover including EASY-PACK safety net
- Electronic Stability Program (ESP)
- Chassis: Air suspension on the rear axle with level control
- Electric window regulator with comfort operation and anti-pinch protection, 4-way
- rear window wiper
- Instrument panel and door sills in ARTICO man-made leather
- Communication module (LTE) for the use of Mercedes me connect services
- LED High Performance Headlights
- Steering wheel: Multifunction sports steering wheel in black Nappa leather
- Mercedes-Benz emergency call system
- Center console with on-the-fly storage compartment
- Navigation: Hard disk navigation
- Package: Storage
- Package: Seating comfort
- PRE-SAFE system
- Radio: Extended MBUX functions
- Radio: MBUX multimedia system
- Radio accessories: Digital radio
- Tire pressure monitoring system
- Remote Services Plus
- Power steering
- Seats: Rear seat backrests foldable, 40/20/40 split
- Power outlet: 12V socket in the cargo area
- High-visibility vest for drivers
- Green, heat-insulating glass all around
- Decorative elements: aluminum with longitudinal brushing, light finish
- AdBlue tank with a capacity of 23.5 liters
- Airbag for driver and front passenger
- Airbag: Kneebag for driver
- Airbag: Windowbags left/right
- AMG floor mats in black with AMG lettering
- Anti-lock braking system (ABS)
- Traction control (ASR)
- ATTENTION ASSIST
- Basic services
- On-board computer
- Brake system with larger brake discs on the front axle
- Tachometer
- DYNAMIC SELECT
- EASY-PACK tailgate
- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- Transmission: 9-speed automatic, 9G-TRONIC
- Heated rear window with timer
- Black fabric headliner
- KEYLESS START
- THERMATIC automatic climate control
- Headrests 5-way adjustable for driver and front passenger, 4-way adjustable, and 2-way adjustable in the rear.
- Steering column mechanically adjustable in height and length
- Center console piano black finish
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: AMG Line Exterior (-Radiator grille with integrated Mercedes star -AMG front apron, side skirts and rear apron in diffuser look -Brake system with larger brake discs on the front axle -Bullet edge trim and window surrounds in polished aluminum -Roof rails in polished aluminum -Hood with pronounced power domes -Exhaust system with 2 tailpipe trims)
- Windscreen wipers with rain sensor
- Seats: i-Size child seat attachment
- Seats: Front sports seats
- Touchpad
- Electronic immobilizer
- Central locking



Extra equipment

- Towbar with ESP trailer stabilization (fully electrically foldable and retractable)
- Package: KEYLESS-GO Comfort Package (HANDS-FREE ACCESS - KEYLESS-GO - Comfort closing of the trunk lid)
- Package: Parking package with reversing camera (The parking package with reversing camera makes it easier to find and select parking spaces, as well as to park and exit in parallel and perpendicular parking spaces or garages. The active parking assistant steers the vehicle into parking spaces, including speed control and automatic gear changes.)
- Wheels: 50.8 cm (20") AMG multi-spoke light-alloy wheels, painted titanium grey (gloss-turned front axle: 8 J x 20 ET 43, tire size 245/35 R 20 rear axle: 9 J x 20 ET 49, tire size 275/30 R 20 - including run-flat tires)
- Seats: Climate control for driver and front passenger (including seat heating and ventilation. Active ventilation quickly cools the seat surface to a comfortable temperature on hot days, creating a balanced seating climate. The switchable seat heating provides cozy warmth as desired during the colder months.)
- Type designation removed from trunk lid
- Decorative elements, metal structure
- Paint finish: Metallic
- Package: Business (MBUX High-End Package - Connectivity Package Navigation - Traffic Sign Assist - Smartphone Integration - Pre-installation for Car Sharing - Widescreen Cockpit - Wireless Charging System for Mobile Devices - MBUX Augmented Reality for Navigation - Heated Seats for Driver and Front Passenger - Parking Package with Rearview Camera - Fuel Tank with 66 Liter Capacity (916) (60l for Diesel Plug-in Hybrids).)
- Upholstery: Leather
- Radio accessories: Burmester surround sound system (13 high-performance speakers - 9-channel DSP amplifier with a total output of 590 W - Frontbass technology with woofers integrated into the body shell for powerful bass reproduction - Sound optimization for the front and rear seats - Noise cancellation (VNC) - Sound preset: Surround function to generate a virtual surround sound - Multi-channel format support for true surround sound)
- Glazing: Heat-insulating dark tinted glass all around from the B-pillar (the use of heat-insulating dark tinted glass for the rear side windows and rear window protects rear passengers from prying eyes and direct sunlight - the dark tint also emphasizes the sportiness of the vehicle)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Tyre - front left side (Flankenbeschädigung) - Damaged - Replace
2	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
3	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
4	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
5	Door - front left side	Door - Scratch(es) - Paint
6	Front bumper	Front bumper - Scratched - Repair and paint
7	Vehicle glazing	Windscreen (Mit Rissbildung im Randbereich) - Stone chips - Replace



Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Interior	Interior - Soiled - No deduction
3	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

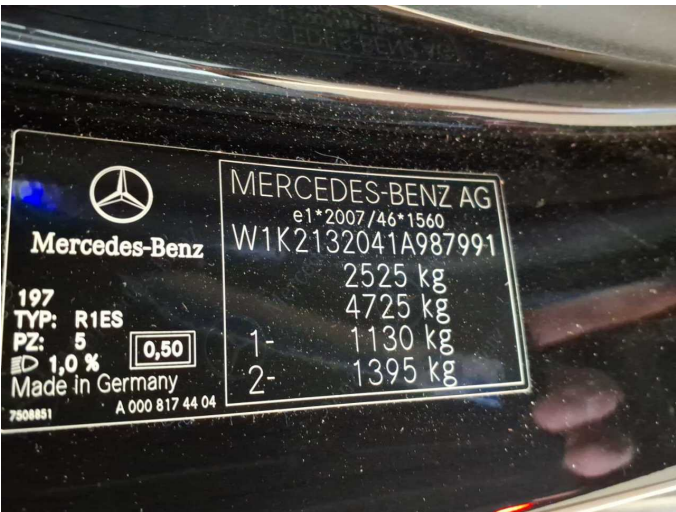


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

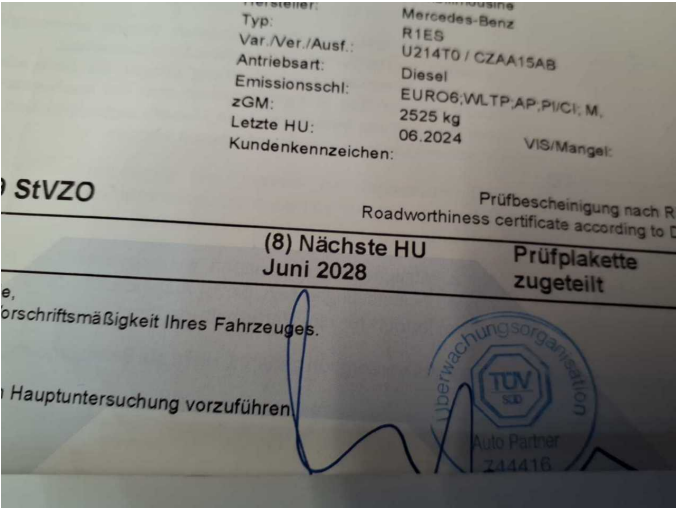


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

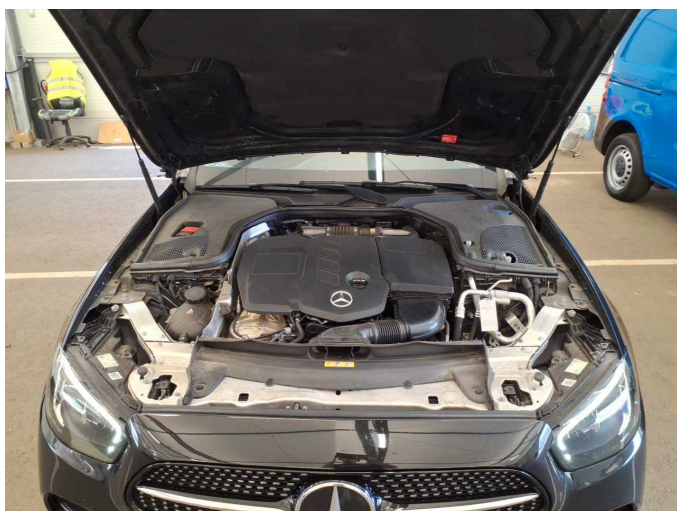


Figure 23: Misc.

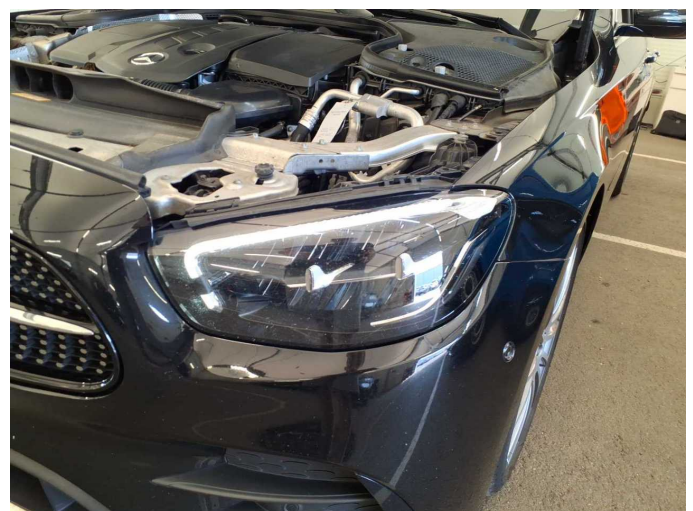


Figure 24: Misc.

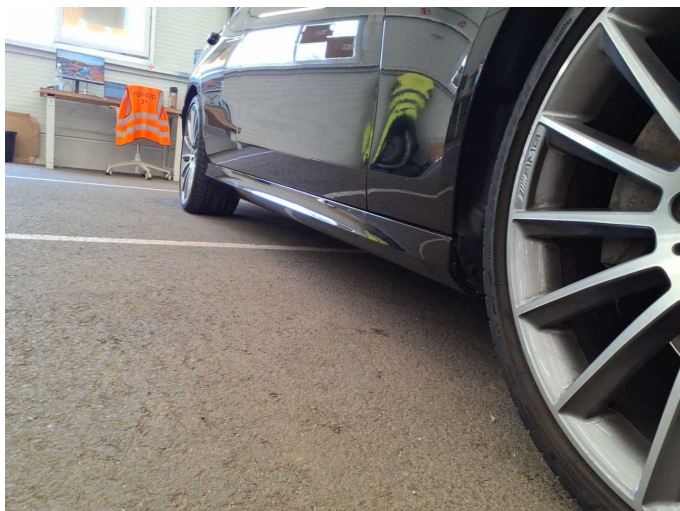


Figure 25: Misc.



Figure 26: Misc.

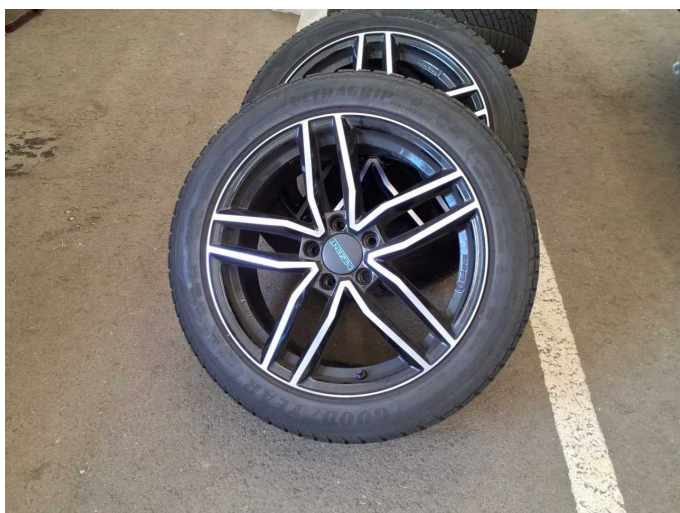


Figure 27: Misc.



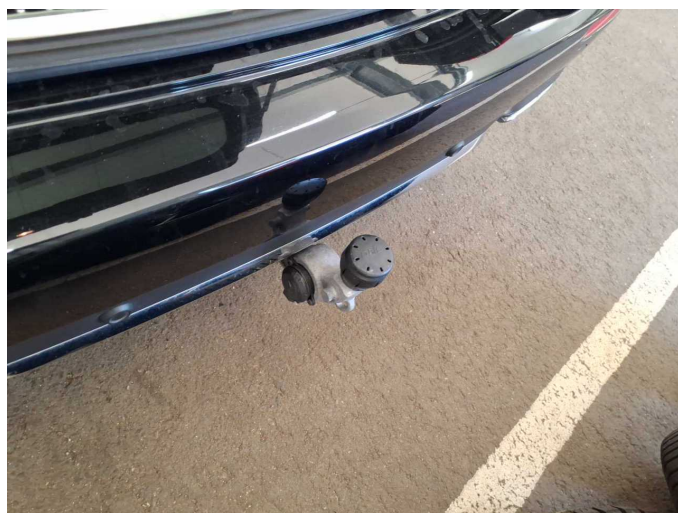


Figure 28: Misc.

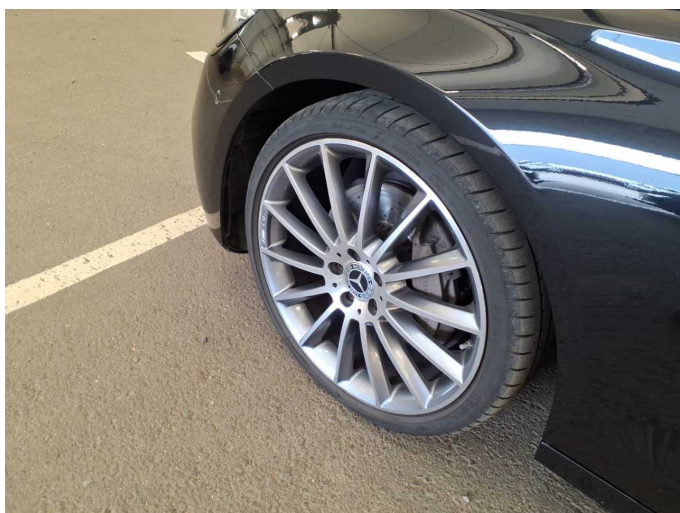

Damage 1: Wheel / tyres: Tyre - front left side (Flankenbeschädigung) - Damaged - Replace

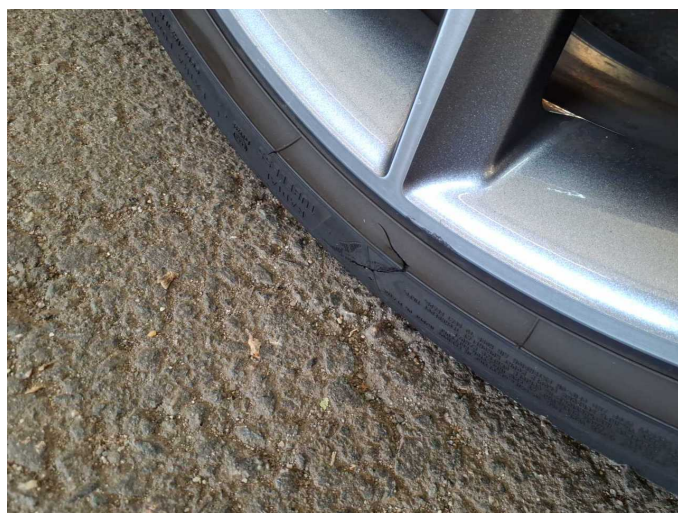

Damage 1: Wheel / tyres: Tyre - front left side (Flankenbeschädigung) - Damaged - Replace



Damage 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 5: Door - front left side: Door - Scratch(es) - Paint



Damage 5: Door - front left side: Door - Scratch(es) - Paint




Damage 6: Front bumper: Front bumper - Scratched - Repair and paint

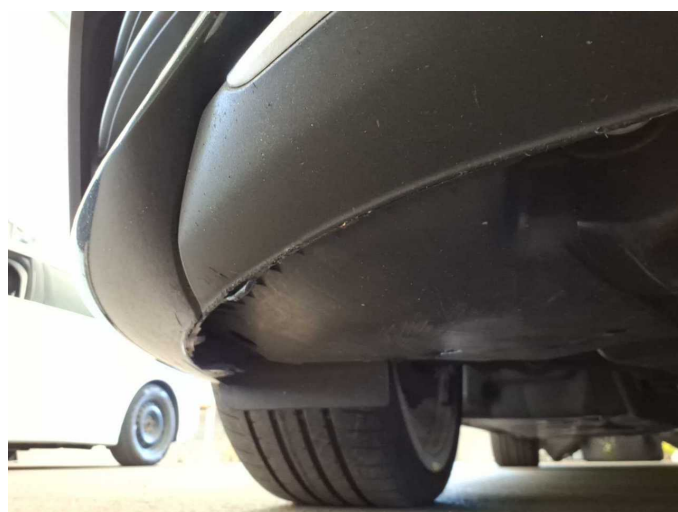


Damage 6: Front bumper: Front bumper - Scratched - Repair and paint



Damage 6: Front bumper: Front bumper - Scratched - Repair and paint

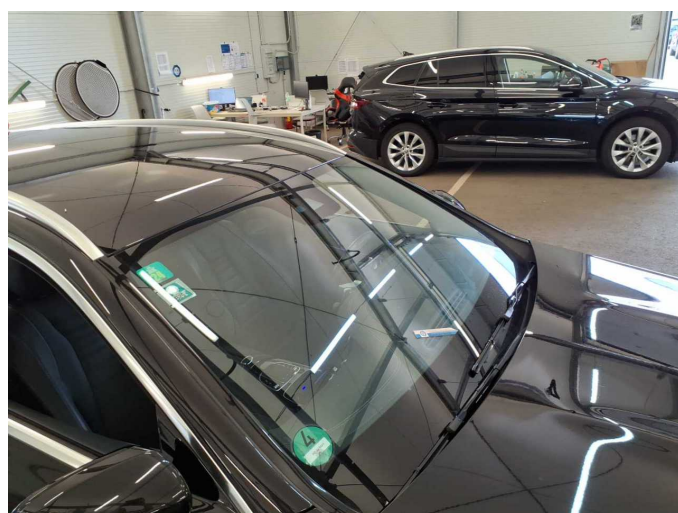

Damage 7: Vehicle glazing: Windscreen (Mit Rissbildung im Randbereich) - Stone chips - Replace

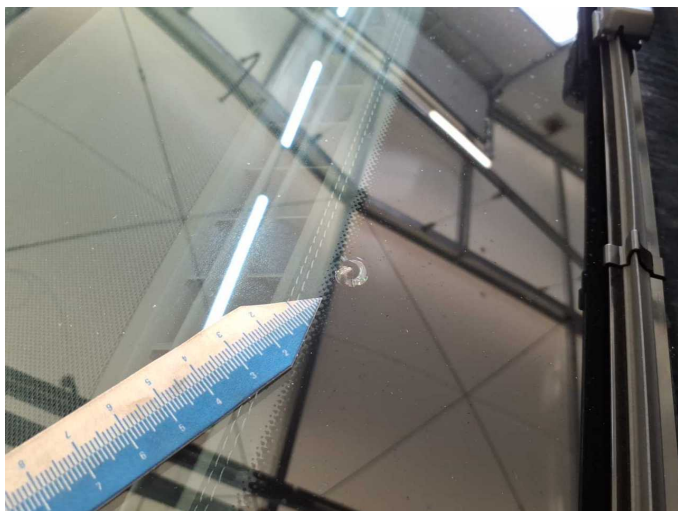

Damage 7: Vehicle glazing: Windscreen (Mit Rissbildung im Randbereich) - Stone chips - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K2132041A987991

Hersteller / Modell: MERCEDES-BENZ MB E 220 d T 9G-TRONIC AMG Line

Datum	KM-Stand	Beschreibung
15.06.2026	110.028	AU; HU + AU; Regelwartungsdienst
16.06.2025	88.223	Regelwartungsdienst
14.06.2024	67.681	AU; Bremsscheiben+Beläge v+h; Regelwartungsdienst
21.06.2023	42.377	Regelwartungsdienst
28.06.2022	19.635	Regelwartungsdienst