



Expertise

Protocol number: 46200553
Order No. / Reference: 26497126
Inspection date: 18 Jun 2026

Manufacturer: Volvo

Model: XC40 Recharge 69 kWh Single Motor Plus

VIN: YV1XZEFV6P2090624



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC40 Recharge 69 kWh Single Motor Plus	
Vehicle Identification number	YV1XZEFV6P2090624
Mileage (Read)	73,110 km
First registration	25 May 2023
Number of holders	1
Next periodical technical inspection	05/2026
(Report not on hand)	
Power / Engine displacement	80 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Silver Dawn Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Grey
Re-import	no
readiness to drive	Not roadworthy / moveable



Vehicle details			
Maintenance booklet / proof	Available / complete	Next maintenance in	21,317 km
Last service on / at	12/2025 at 64,427 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS764589
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	9101 / BUN 00002		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,480 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 103H	All-season tyres on Light alloy	Michelin	5mm / 5mm
2)	255/45 R19 104H	All-season tyres on Light alloy	Michelin	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R19 104V	Winter tyres on Light alloy	Goodyear	7mm / 7mm
2)	255/45 R19 104V	Winter tyres on Light alloy	Goodyear	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Waste bin integrated into center console (removable)
- Passenger side airbag can be deactivated
- Airbags (driver and front passenger airbags with two-stage deployment system - driver's knee airbag - driver and front passenger side airbags - head/shoulder airbags (IC) for all occupants)
- Android infotainment system (9" touchscreen (22.9 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - Over-the-air updates (OTA)
- Fold-out (bag) hook on the glove compartment
- Electrically folding exterior mirrors
- Heated exterior mirrors and rear window
- Hill start assist
- third brake light
- Anthracite headliner
- Roof edge spoiler
- Roof rails in high-gloss black (integrated)
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver Assistance (Adaptive Cruise Control - Emergency Stop Assist (automatic emergency stop system if warnings are ignored due to the driver's failure to steer, brake and accelerate, including activation of the hazard warning lights and automatic braking to a standstill) - Pilot Assist (lane guidance assistant with adaptive cruise control up to speeds of 130 km/h))
- Pass-through hatch behind the center armrest in the rear
- Front and rear parking sensors with automatic braking intervention (rear)
- Aluminum door sill plates with Recharge lettering, front
- Electronic Stability Control (ESC)
- Electronic differential lock
- Enhanced air purification system (with fine dust filtration according to air quality standard PM2.5)
- Electric windows front and rear (with auto-down and auto-up function)
- Warranty (includes a 3-year manufacturer's warranty on the vehicle and an 8-year manufacturer's warranty on the vehicle battery. Also valid in the event of premature change of ownership.)
- Front seat belt height adjustment
- Automatic tailgate (electric)
- rear window wiper
- Interior lighting (ambient lighting (white) front, illuminated make-up mirrors on driver and passenger side, welcome lighting front, headliner, front footwell, luggage compartment lighting on both sides, glove compartment, reading lights front and rear)
- Child safety lock for the rear doors (electric)
- Comfort opening/closing of the side windows via radio remote control
- Rear headrests fixed
- Acoustic Vehicle Alerting System (AVAS) (Acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Active safety belts with belt tensioners
- Alarm system with motion/tilt sensor and security lock
- Ambient lighting (Extended interior lighting with: - Ambient lighting front and rear - Exit lights front - Illuminated door pockets front - Illuminated decorative inserts (in dashboard and front doors) - Work light on the tailgate)
- Anti-lock braking system (ABS) with electronic brake force distribution
- Electrically adjustable exterior mirrors
- Hill descent control
- LED turn signals integrated into the exterior mirrors
- Convenient Entry and Start (vehicle start by pressing the brake pedal and engaging the forward (D) or reverse (R) gear)
- Digital Services including Google Maps navigation system (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data) - Volvo On Call (includes, among other things, contacting the Volvo On Call service center at the touch of a button and additional convenience services via the Volvo CarsApp) - Usage is time-limited and will be subject to charges thereafter. Further information on renewal is available from a Volvo dealer partner.)
- Driver Awareness (Blind Spot Information System (BLIS) - Blind Spot Assist including Lane Change Warning for rapidly approaching vehicles - Cross Traffic Alert (CTA) - Cross Traffic Warning with braking intervention - Warning of vehicles, cyclists and pedestrians approaching from the side when reversing out of a parking space, including braking to a standstill if warning signals are ignored - Rear Impact Mitigation - Preventive protection in case of impending rear-end collisions)
- Foldable cargo floor with fastening system for carrier bags in the luggage compartment
- Automatic emergency braking (locking the vehicle after the airbags or seatbelt pretensioners have been deployed to prevent secondary accidents.)
- Front luggage compartment (31 liters)
- Luggage compartment partition net
- Transmission: 1-speed direct drive
- Hooks for carrier bags in the luggage compartment (two on each side)
- Interior and exterior mirrors automatically dimming
- ISOFIX mounting points (for the front passenger seat and the outer rear seats)
- Keyless Drive (electronic access system) with sensor-controlled tailgate, illuminated door handles and puddle lights



- Front headrests
- Paint finish: Contrasting roof in Black Stone
- Charge control display (set current limit (from 6A) and charge level in steps of 10 % b to 100 %)
- Steering wheel adjustable for height and reach
- Steering wheel: Sports steering wheel
- Front center armrest with integrated storage compartment
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated below 10 km/h)
- Optical underride protection front and rear in high-gloss black
- Package: Winter Package (front seat heating - steering wheel heating - heat pump, support for air conditioning as well as heating or cooling of the high-voltage battery for range optimization)
- Radio accessories: Two USB-C ports in the center tunnel (front and rear)
- Recharge emblem on the C-pillar
- Rain sensor
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers including emergency call via Volvo On Call and door unlocking)
- Wheels: 19" 5-twin-spoke sport design alloy wheels (diamond cut/ high-gloss black with Recharge all-season tires 235/50 R19 (front) and 255/45 R19 (rear) 7.5 x 19" (front), 8.5 x 19" (rear) Volvo tire category A)
- Safety Assistance (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection braking assistant and emergency braking assistant for oncoming traffic - Connected Safety - Driver Alert - Attention warning - Variable speed limiter - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assistant - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition)
- Speed-sensitive power steering
- Seats: Passenger seat adjustable in height and length
- Seats: Adjustable (manual) leg rest for driver and front passenger seats
- Seats: Lumbar support (4-way adjustable) for driver and front passenger seats
- Sport pedals
- 12-volt socket at the front
- Textile floor mats front and rear
- Textile floor mats: Sport textile floor mats front and rear
- First aid kit and warning triangle
- Lashing eyes (four) in the luggage compartment
- Pre-conditioning of the vehicle interior (electrically, to 22°C (max. 30 minutes) - controlled via the menu)
- Immobiliser
- Automatic climate control with 2-zone temperature control (including separate temperature control for driver and front passenger, automatic blower control and air distribution including CleanZone air quality system with activated carbon filter)
- Paint finish: Solid
- LED headlights "Thor's Hammer" (with high beam assist and integrated LED daytime running lights)
- Steering wheel: Multifunction buttons on the steering wheel
- Illuminated makeup mirror for driver and front passenger
- Fog light
- One Pedal Drive (acceleration and deceleration to a standstill via the accelerator pedal - activation/deactivation via the menu - recuperation (brake energy recovery) as soon as the foot is taken off the accelerator pedal, to optimize the range)
- Electric parking brake
- Upholstery: Textile (Rivel Chine) (incl. rear center armrest - insert: Origin - headliner: Anthracite)
- Radio: Audio system High Performance Sound (250 Watt power - 8 speakers - Air Woofer Technology)
- Recharge emblem on the rear of the vehicle
- Recharge Pure Electric front grille and grille surround in body color
- Roadside Assistance (free mobility promise, 3 years and almost throughout Europe. Covers, for example, mechanical or electrical defects, tire problems, traffic accidents in which the vehicle is so badly damaged that it is unroadworthy, etc. Also applies in the event of premature change of ownership.)
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)
- Rear view camera
- Rear seats can be folded down in a 60/40 split or completely.
- Gearshift lever made of Swedish crystal glass (with center console surround in high-gloss black)
- Whiplash Protection System (WHIPS) (including immersion protection on all seats and energy-absorbing front seat cushions)
- Side window surround in high-gloss black (bottom)
- Service, maintenance and wear and tear (includes vehicle maintenance according to manufacturer specifications as well as the replacement of wear parts. Covers a maximum of 100,000 km or 3 years, remains linked to the vehicle even if ownership changes. Billing is done via QW90.)
- Seats: Driver's seat height and length adjustable including tilt adjustment
- Sport exterior mirrors in high-gloss black
- Sport front and rear apron
- Electric auxiliary heater with timer
- Phone: Inductive smartphone charging system (Wirelessly charges smartphones that support the Qi standard on a charging pad)
- Glazing: Colored glazing
- Preparation for Trailer Stability Assist (TSA)
- Warning tone/indicator when seat belts are not fastened (for all seats)



- Central locking with two remote controls and integrated emergency key (including automatic locking of the doors while driving (can be deactivated))

Extra equipment

- Towbar (semi-electric)
- Charging cable Type 2/Type 2 (Mode 3) (6 m length, 3-phase, 16A (for connection to a charging station with Type 2 connector))
- Paint finish: Metallic paint
- Upholstery: Tailored Wool (incl. rear center armrest - Backlit inlay: Topography - Headliner: Anthracite)
- Glazing: Side and rear windows tinted (from the B-pillar back)

Retrofitted equipment

- Accessories: Bicycle carrier for towbar
- Accessories: Luggage compartment grille
- Accessories: Luggage compartment reversible mat
- Accessories: Highline load carrier

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Tyres - complete set - Differs from the original configuration - No deduction
2	Door - rear left side	Door - dent(s) - Smooth repair work
3	Rear bumper	Spoiler - Scratched - Smart repair
4	Misc.	Main inspection - No evidence - Perform
5	Wheel / tyres	Alloy rim - front left side - Scratched - Loss in value
6	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
7	Wheel / tyres	Tyre - front left side - Damaged - Replace
8	Wheel / tyres	Tyre - rear right side - Damaged - Replace
9	Rear bumper	Rear bumper (Links und rechts) - Scratched - Smart repair
10	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint
11	Boot lid / rear door	Rear spoiler - Scratched - Repair and paint

Missing parts

Description

Equipment - Equipment (Gepäckraumgitter)



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

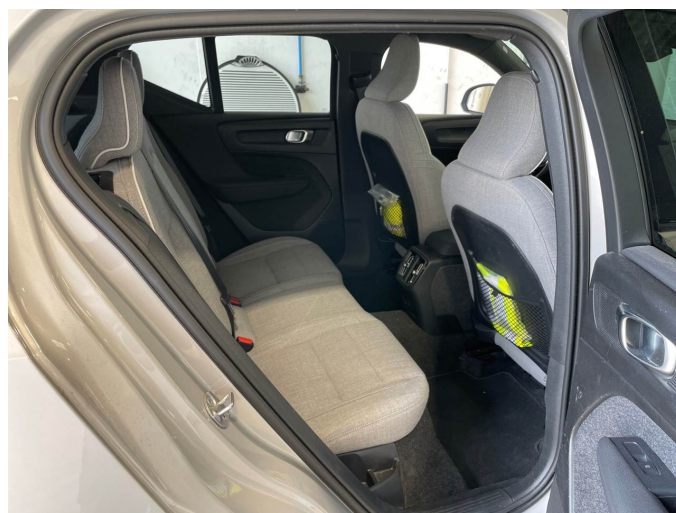


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

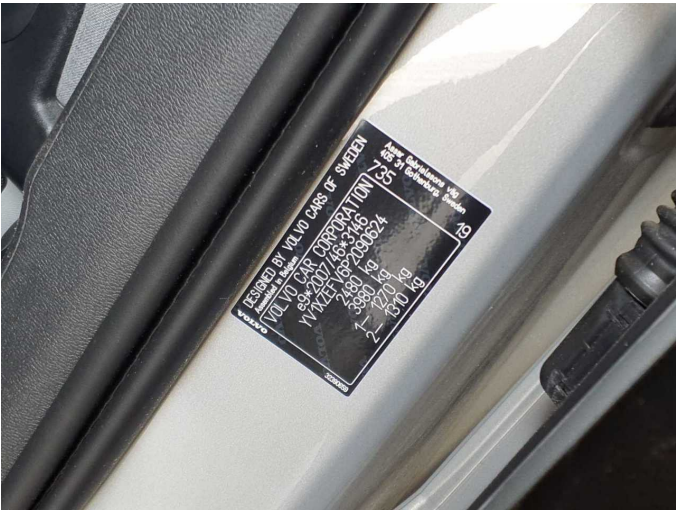


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres

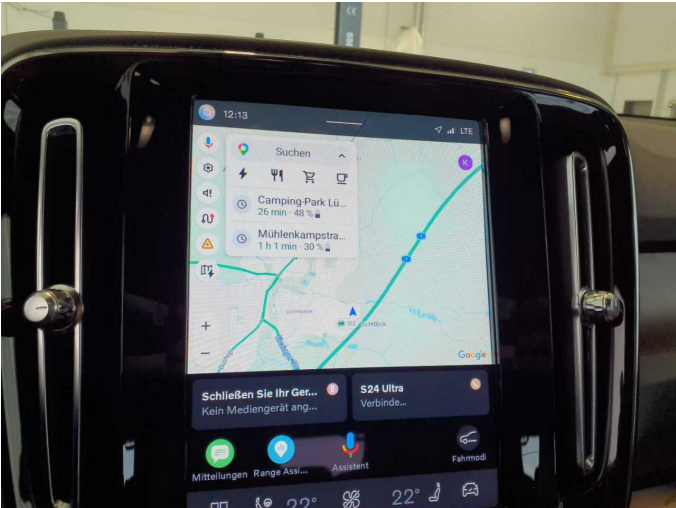


Figure 15: Navigation

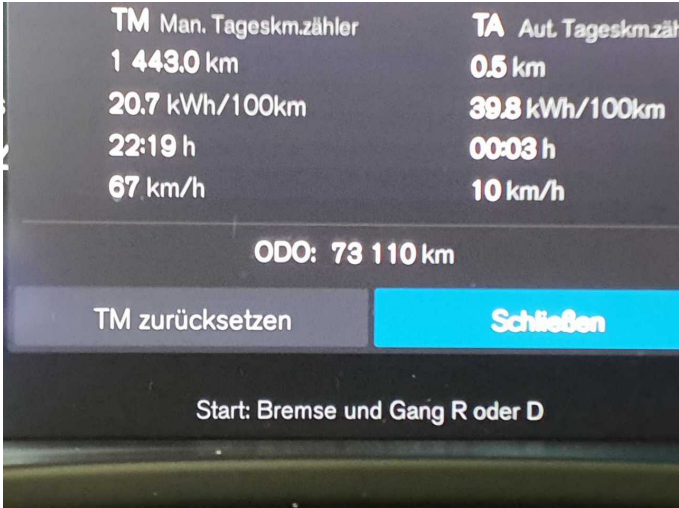


Figure 16: Misc.

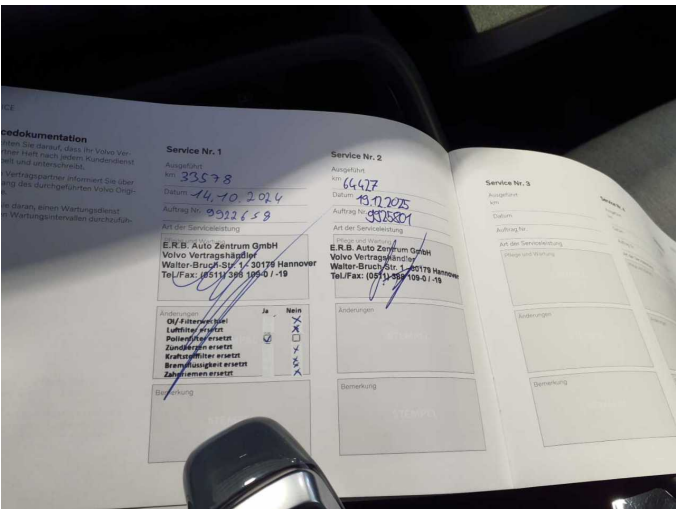


Figure 17: Misc.

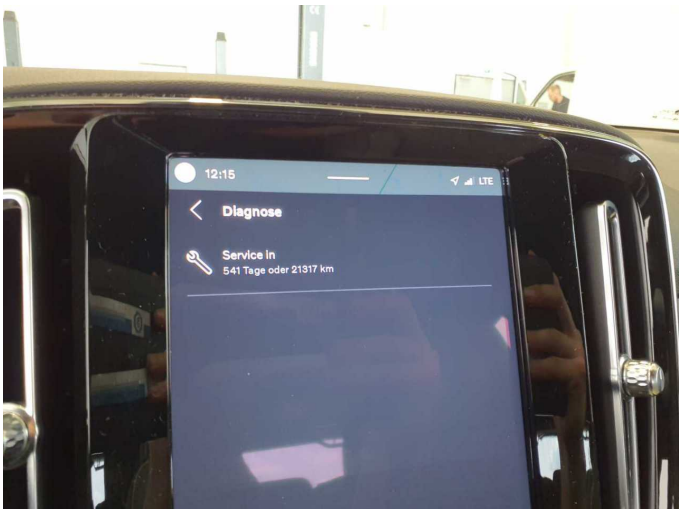


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

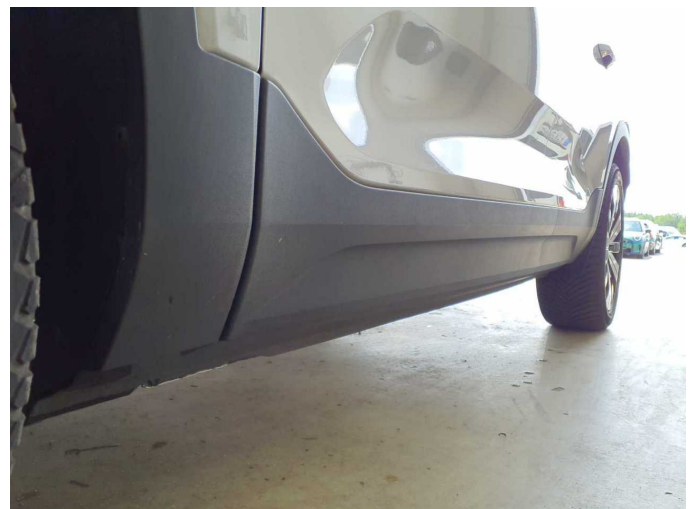


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

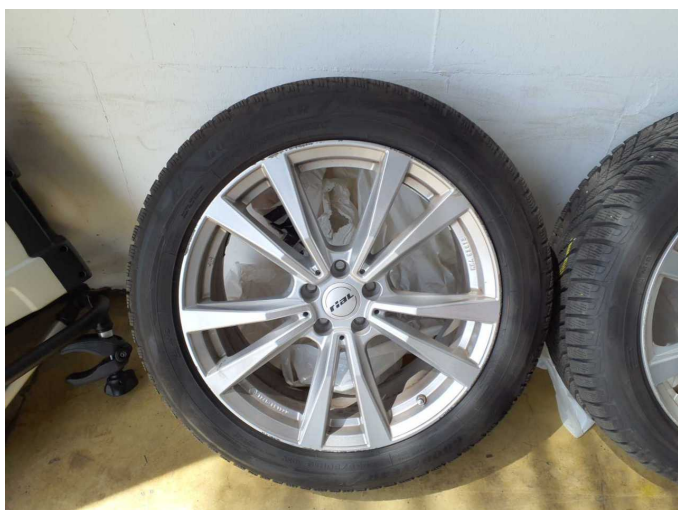



Figure 33: Misc.



Figure 34: Misc.



Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work

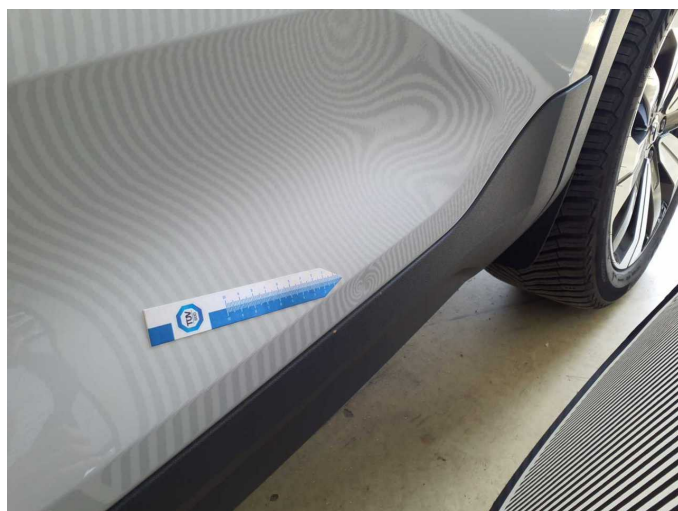

Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 3: Rear bumper: Spoiler - Scratched - Smart repair




Damage 3: Rear bumper: Spoiler - Scratched - Smart repair



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value

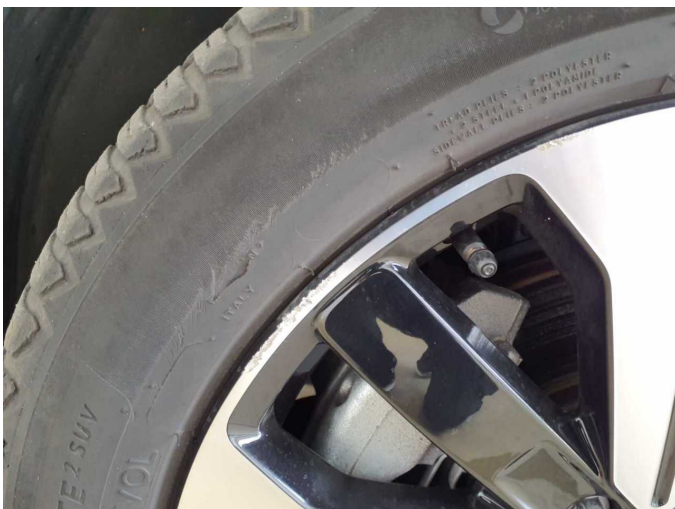

Damage 5: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 7: Wheel / tyres: Tyre - front left side - Damaged - Replace



Damage 7: Wheel / tyres: Tyre - front left side - Damaged - Replace



Damage 8: Wheel / tyres: Tyre - rear right side - Damaged - Replace



Damage 8: Wheel / tyres: Tyre - rear right side - Damaged - Replace



Damage 8: Wheel / tyres: Tyre - rear right side - Damaged - Replace



Damage 9: Rear bumper: Rear bumper (Links und rechts) - Scratched - Smart repair




Damage 9: Rear bumper: Rear bumper (Links und rechts) - Scratched - Smart repair



Damage 9: Rear bumper: Rear bumper (Links und rechts) - Scratched - Smart repair



Damage 9: Rear bumper: Rear bumper (Links und rechts) - Scratched - Smart repair

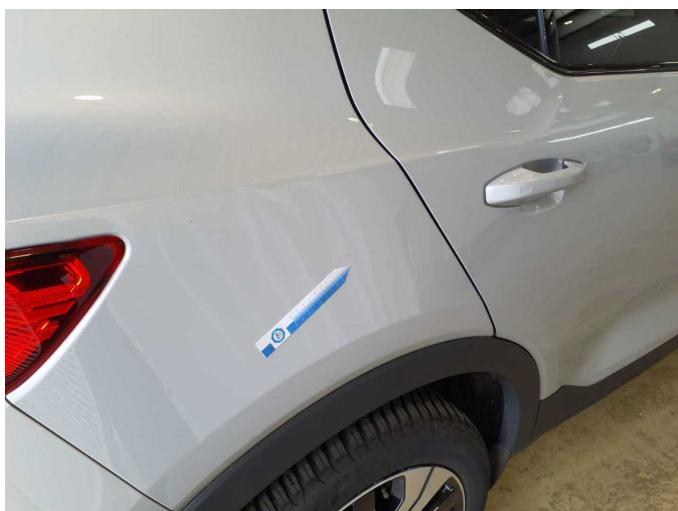

Damage 10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 11: Boot lid / rear door: Rear spoiler - Scratched - Repair and paint




Damage 11: Boot lid / rear door: Rear spoiler - Scratched - Repair and paint

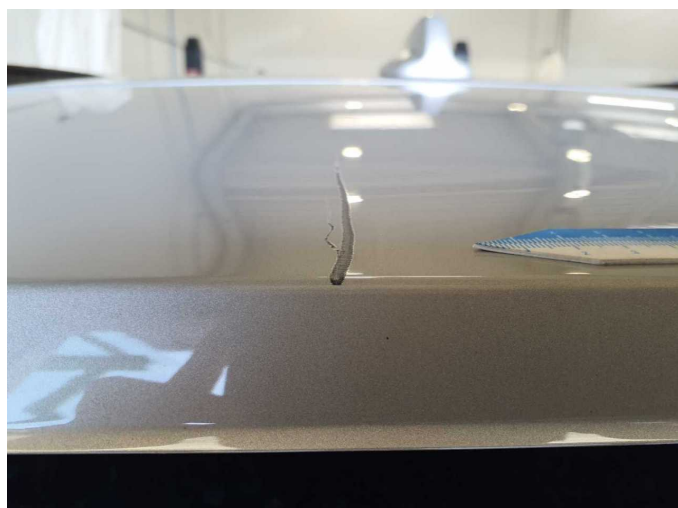

Damage 11: Boot lid / rear door: Rear spoiler - Scratched - Repair and paint



Damage 11: Boot lid / rear door: Rear spoiler - Scratched - Repair and paint

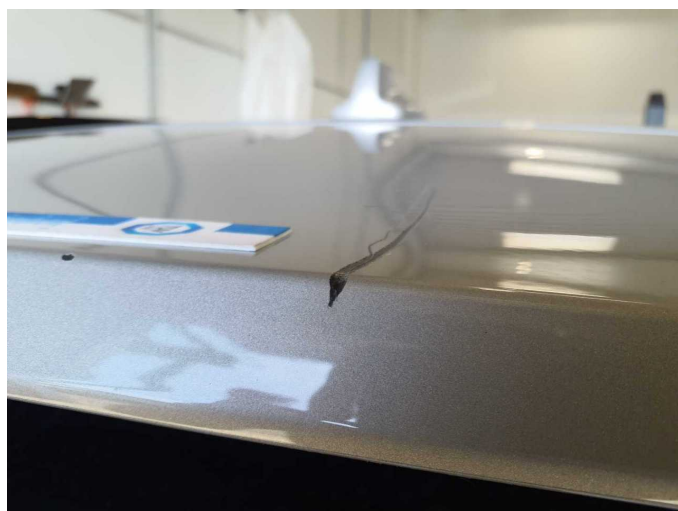

Damage 11: Boot lid / rear door: Rear spoiler - Scratched - Repair and paint