



Expertise

Protocol number: 46628723
Order No. / Reference: 26631783
Inspection date: 14 Jul 2026

Manufacturer: Skoda
VIN: TMBJJ8NX8NY029003

Model: Octavia Combi 2.0 TDI DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI DSG Style	
Vehicle Identification number	TMBJJ8NX8NY029003
Mileage (Read)	169,348 km
First registration	20 Oct 2021
Number of holders	1
Next periodical technical inspection	11/2026
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Brillant-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	3,200 km
Last service on / at	01/2026 at 158,125 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD081378
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWL 00093		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,990 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Nokian	5mm / 5mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Continental	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 95V	Summer tyres on Light alloy	Nokian	6mm / 6mm
2)	205/55 R17 95V	Summer tyres on Light alloy	Nokian	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Ambient lighting (dashboard, front trim strips and footwell with selectable color climate) in the interior as well as logo projector on the outside)
- Automatically dimming exterior mirror (driver's side)
- Exterior mirrors with memory function (boarding spots in the exterior mirrors as well as memory function and mirror lowering)
- Hill start assist including auto-hold function
- Glasses compartment in the headliner
- Roof rails, anodized
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant (Coming Home / Leaving Home function)
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec: Start/stop system including brake energy recuperation
- Heated rear window
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Electronic child safety lock
- Removable boot cover
- Headrests (5) front and rear height adjustable
- LED fog lights
- LED taillights
- LED headlights with LED daytime running lights
- Steering wheel: height and reach adjustable
- Manual headlight range adjustment
- Rear center armrest with pass-through option
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Upholstery: Cloth
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: 8 speakers
- Radio accessories: Voice control
- Tire pressure monitoring
- Wheels: 17" alloy wheels Rotare AERO (7J x 17, ET 46 with tires 205/55 R17)
- Safety lights in the front side doors
- Seats: Electrically adjustable front seats with memory function
- Seats: Rear seat backrest split 60:40, foldable
- Speed limiter
- Lane keeping assistant (Lane Assist)
- Storage compartments (Four roof grab handles, rear with coat hooks; holder for the warning vest under the driver's seat; storage compartments in the front door panels with 1.5l bottle holders; storage compartments in the rear door panels with 0.5l bottle holders; ticket holder on the windshield; coat hooks on the B-pillars; storage compartments in the doors with felt lining)
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Center section of the dashboard with fabric covering
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Hydraulic brake assist (HBA)
- Grey headliner
- Diesel particulate filter
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Driving profile selection
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system
- Tinted windows
- Rear lights with crystal glass look and animated turn signals
- Rear window wiper including windshield washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger and anti-allergen filter & activated carbon filter - air-conditioned and illuminated glove compartment)
- LED license plate lights
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Leather steering wheel with multifunction buttons and paddle shifters (leather steering wheel and gearshift lever with leather elements - infotainment and driver assistance system operation)
- Front and rear parking sensors
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire mobility kit (tire repair spray incl. compressor)
- Electromechanical power steering
- Seat belts (Three three-point seat belts in the rear)
- Seats: Heated front seats
- Seats: Height-adjustable driver and passenger seats (including lumbar support)



- Lane change and parking assist
- 12V socket in the trunk
- Telephone: Phonebox with inductive charging function (connection via external antenna)
- Phone: SmartLink (MirrorLink, Apple CarPlay, Android Auto)
- Phone: Wireless SmartLink for Apple CarPlay
- Bluetooth hands-free phone system
- Immobiliser

- SKODA Care Connect (SOS emergency call function (Emergency Call incl. automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions relating to vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Lashing eyes in the trunk
- Central locking including remote control integrated into the key and EASY Start

Extra equipment

- Swiveling trailer hitch including trailer stabilization and adapter
- Package: Parking & Visibility (cornering lights in the fog lights - headlight cleaning system - LED ambient lighting - LED matrix headlights and dynamic high beam assist (AFS) - crystal glass look taillights and animated turn signals - reversing camera - parking assist)
- Panoramic sunroof, electric (deletion of the glasses compartment in the headliner)
- Seats: Manually adjustable ergonomic front seats (massage function - electrically adjustable lumbar support - extendable leg rest)
- Heated windscreen
- Paint finish: Metallic
- Package: Infotainment Columbus Plus (Combi) (Columbus navigation system - Infotainment Online (3-year term) - Head-Up Display - Luggage net partition)
- Package: Travel (DSG) (Traveller assistance system: - Traffic sign recognition - Predictive and adaptive cruise control (pACC) - Adaptive lane keeping assist - Emergency and traffic jam assist - Capacitive steering wheel with hands-off detection - Adaptive cruise control (ACC) (control range 210 km/h) - Driver fatigue detection - Driving profile selection - Automatically dimming exterior mirror (driver's side))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Indicator - front	Mirror - right side - Broken / torn - Replace
3	Seat - front	Seat cover - left side - Abrasion - Loss in value
4	Mudguard - left side	Mudguard - left side - dent(s) - Smart repair
5	Side panel - rear left side	Sill - dent(s) - Smart repair
6	Interior	Interior (Modrig) - Odour - Ozone treatment
7	Side panel - rear left side	Side panel - dent(s) - Smart repair
8	Side panel - rear right side	Elbow - Dent / paintcoat damage - Smart repair
9	2nd wheel set	2 alloy rims - Scratch(es) - Loss in value
10	Interior	Interior - Scratch(es) - Loss in value
11	Door - front right side	Door - Broken / torn - Replace
12	Door - rear right side	Door - Scratch(es) - Paint
13	Front bumper	Front bumper - Scratch(es) - Paint
14	Roof	Roof hatch / sliding roof - seal - Broken / torn - Replace
15	Trim / covers	Roof lining - Holes - Replace
16	Roof	Roof - Deformed - Repair and paint
17	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
18	Boot lid / rear door	Boot lid (Mit Korrosion) - Dent / paintcoat damage - Repair and paint
19	Rear bumper	Rear bumper - Dent / paintcoat damage - Replace

Wear and tear

No.	Component group	Description
1	Interior	Interior - Soiled - No deduction
2	Trim / covers	Floor mats - Holes - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Sill - right side	Sill - dent(s) - No deduction
5	Sill - left side	Sill - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Umbrella

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Professionally repaired, Invoice of repair done Non-existent, from 19 Nov 2024	2.769,59 €

Repainting

No. Repainting

1	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
---	--

Paint coat thickness measurement

Side panel - rear left side	57 µm
-----------------------------	-------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

Der montierte Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

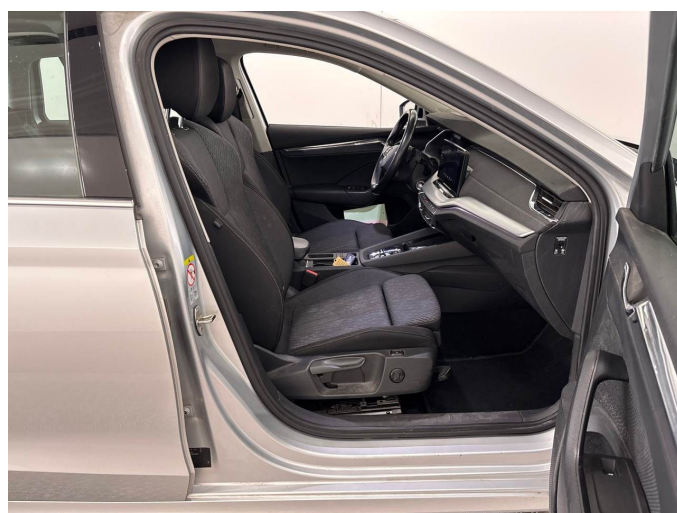


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

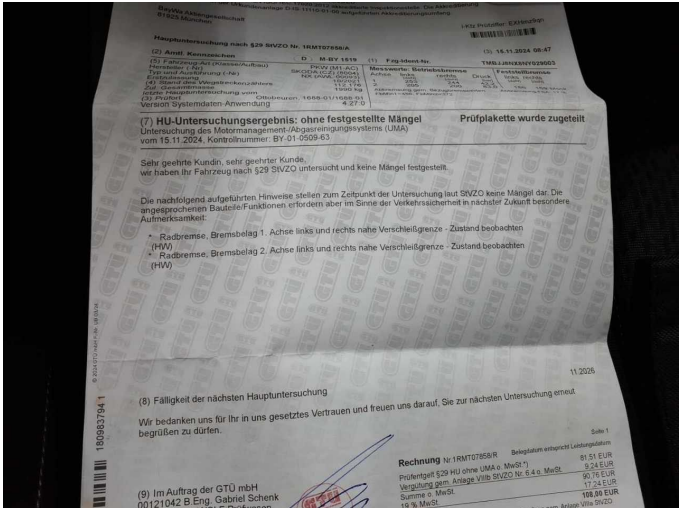


Figure 14: Documents

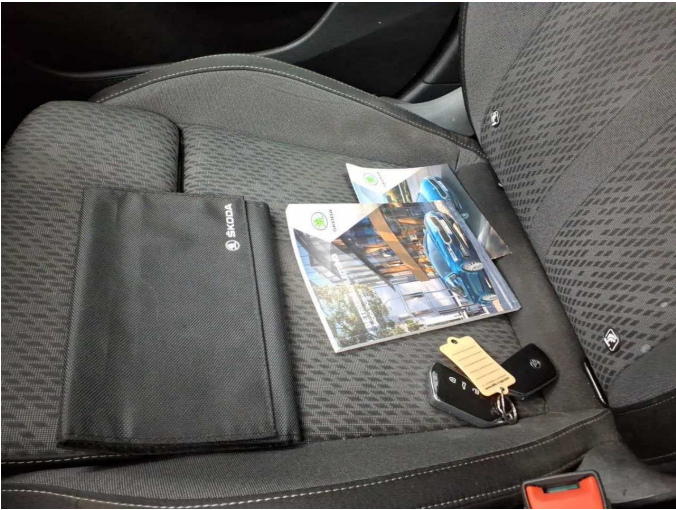


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

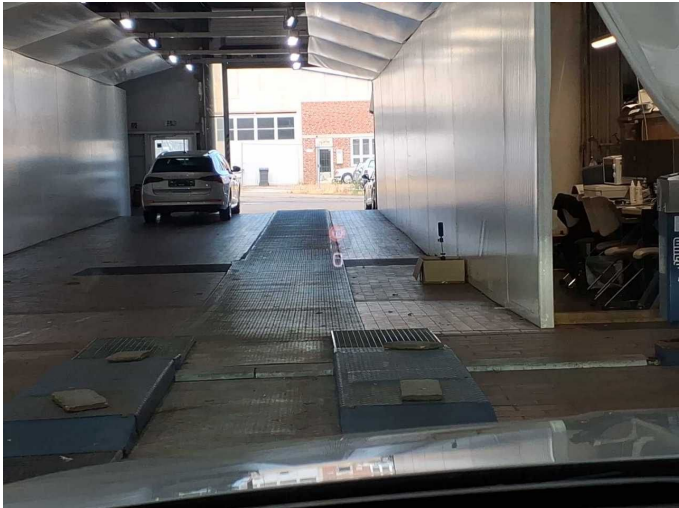


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

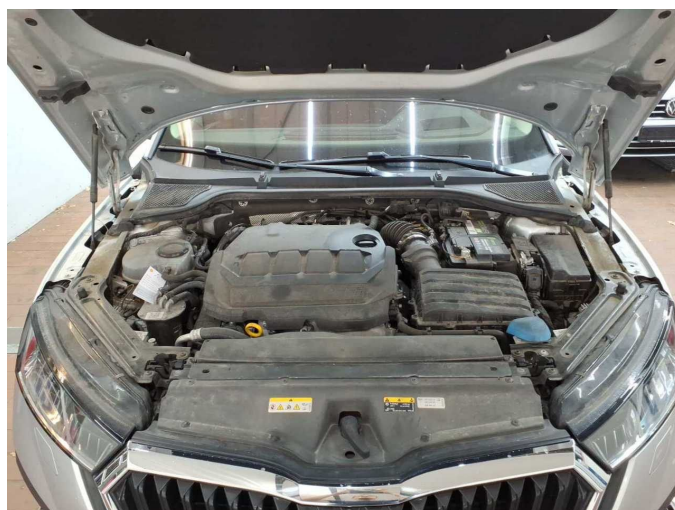


Figure 28: Misc.



Figure 29: Misc.

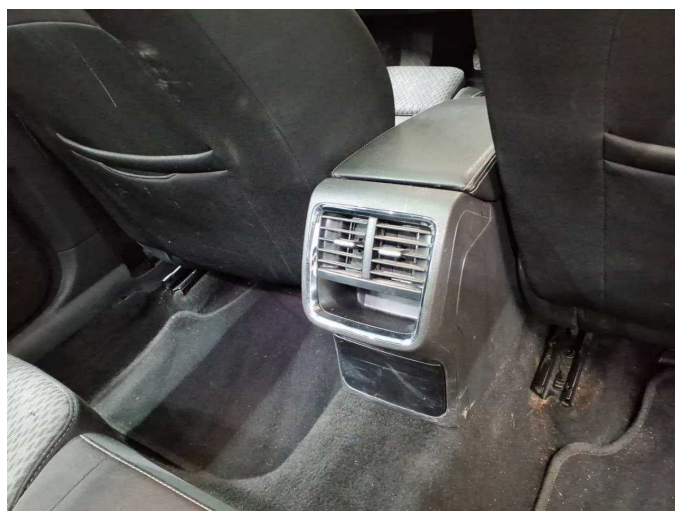


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

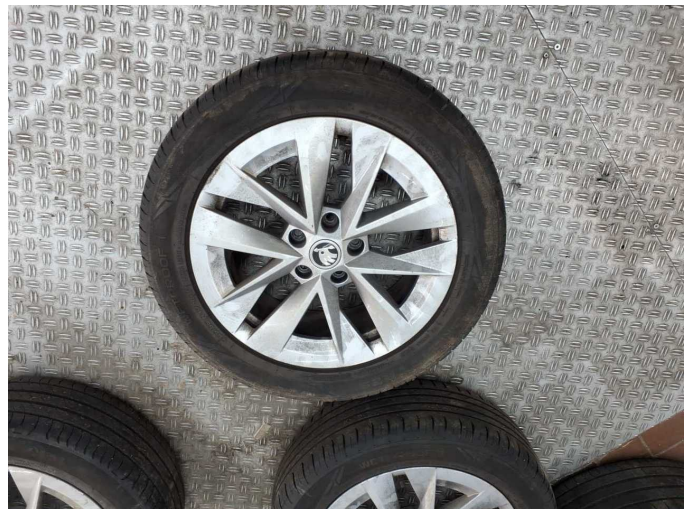


Figure 34: Misc.



Figure 35: Misc.

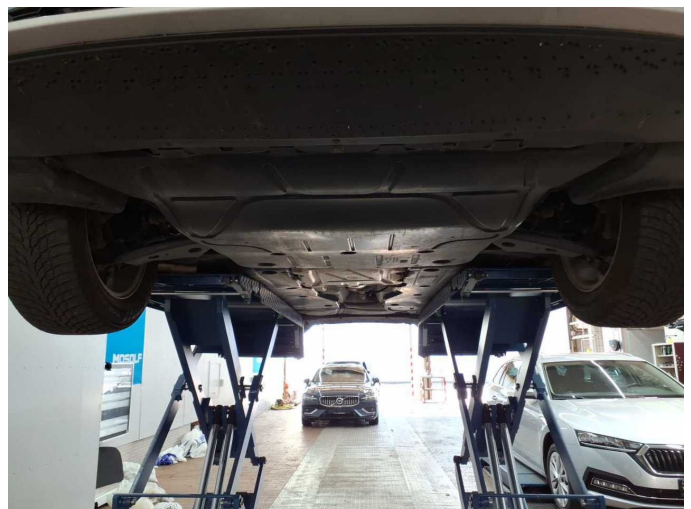


Figure 36: Misc.



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Indicator - front: Mirror - right side - Broken / torn - Replace



Damage 2: Indicator - front: Mirror - right side - Broken / torn - Replace

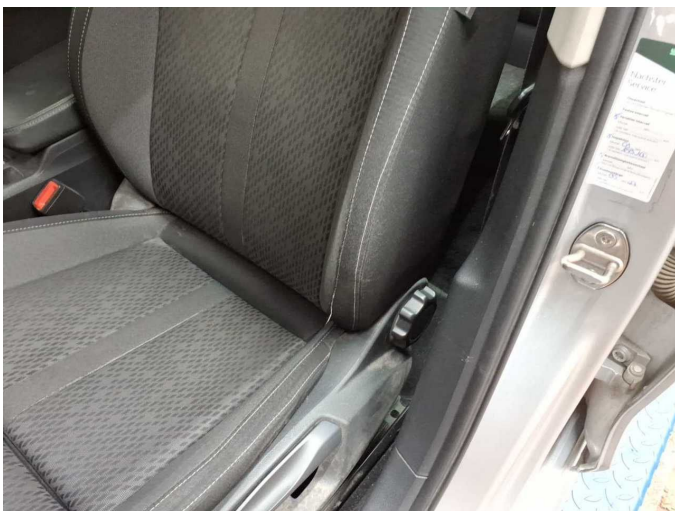

Damage 3: Seat - front: Seat cover - left side - Abrasion - Loss in value




Damage 3: Seat - front: Seat cover - left side - Abrasion - Loss in value



Damage 4: Mudguard - left side: Mudguard - left side - dent(s) - Smart repair



Damage 4: Mudguard - left side: Mudguard - left side - dent(s) - Smart repair

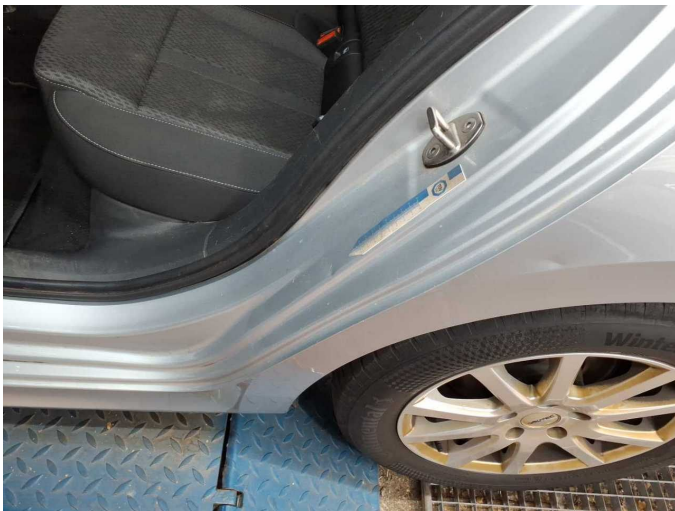

Damage 5: Side panel - rear left side: Sill - dent(s) - Smart repair



Damage 5: Side panel - rear left side: Sill - dent(s) - Smart repair



Damage 7: Side panel - rear left side: Side panel - dent(s) - Smart repair




Damage 7: Side panel - rear left side: Side panel - dent(s) - Smart repair




Damage 8: Side panel - rear right side: Elbow - Dent / paintcoat damage
- Smart repair




Damage 8: Side panel - rear right side: Elbow - Dent / paintcoat damage
- Smart repair

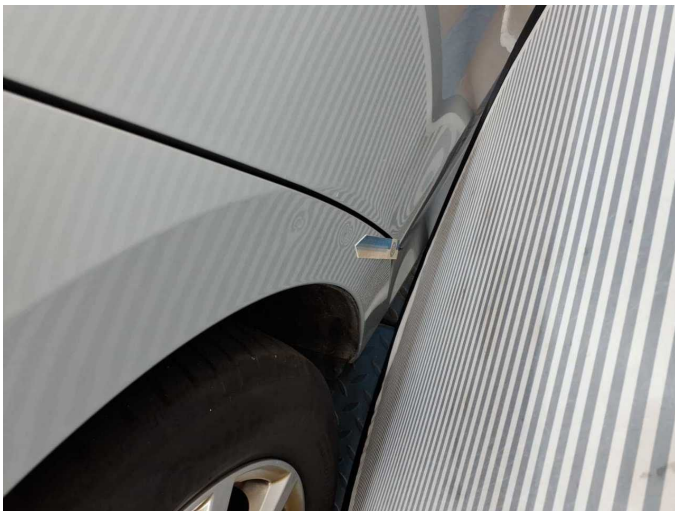


Damage 8: Side panel - rear right side: Elbow - Dent / paintcoat damage
- Smart repair

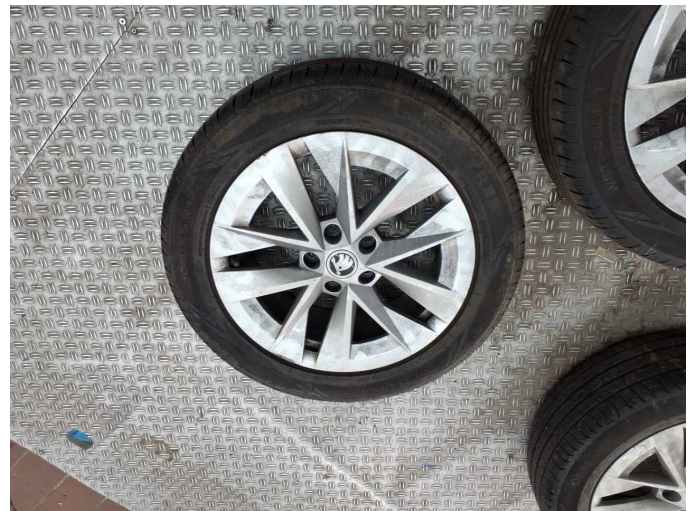

Damage 9: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value

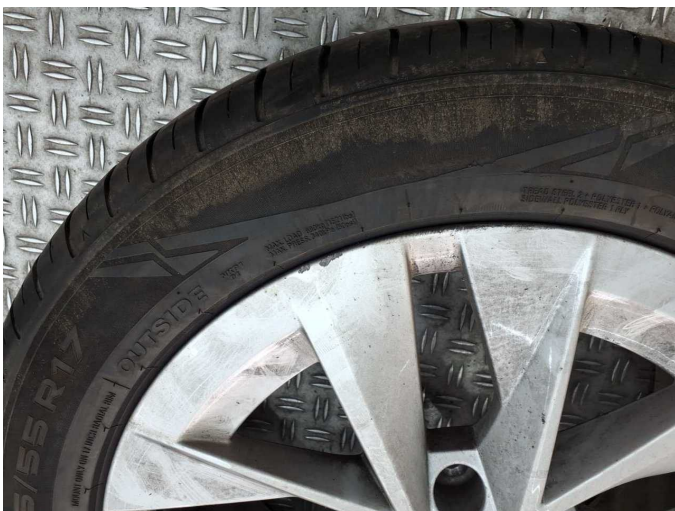

Damage 9: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value

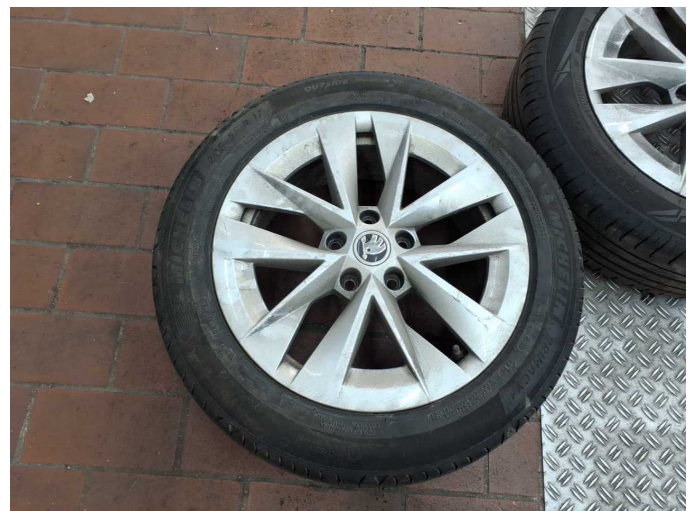


Damage 9: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 9: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 10: Interior: Interior - Scratch(es) - Loss in value

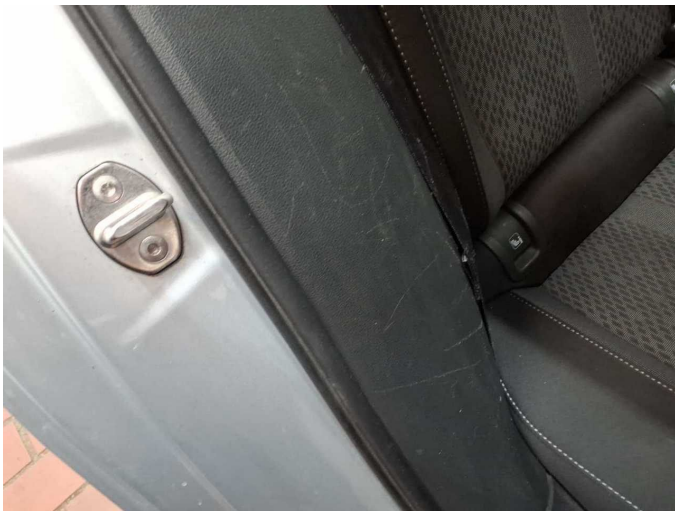


Damage 10: Interior: Interior - Scratch(es) - Loss in value



Damage 10: Interior: Interior - Scratch(es) - Loss in value



Damage 10: Interior: Interior - Scratch(es) - Loss in value

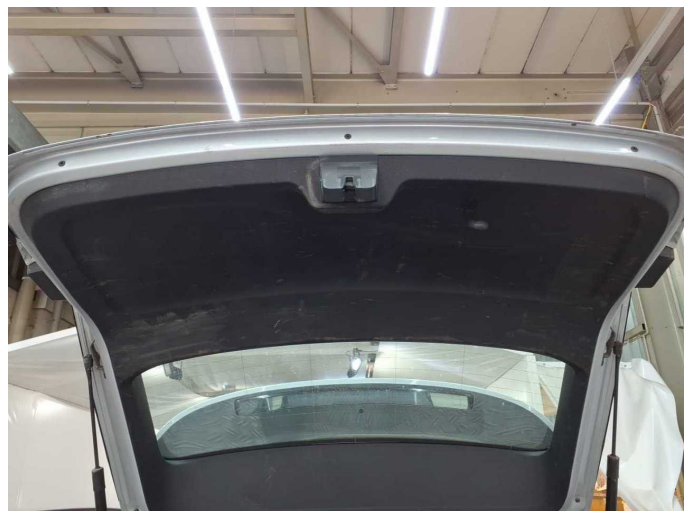

Damage 10: Interior: Interior - Scratch(es) - Loss in value




Damage 10: Interior: Interior - Scratch(es) - Loss in value



Damage 10: Interior: Interior - Scratch(es) - Loss in value



Damage 10: Interior: Interior - Scratch(es) - Loss in value

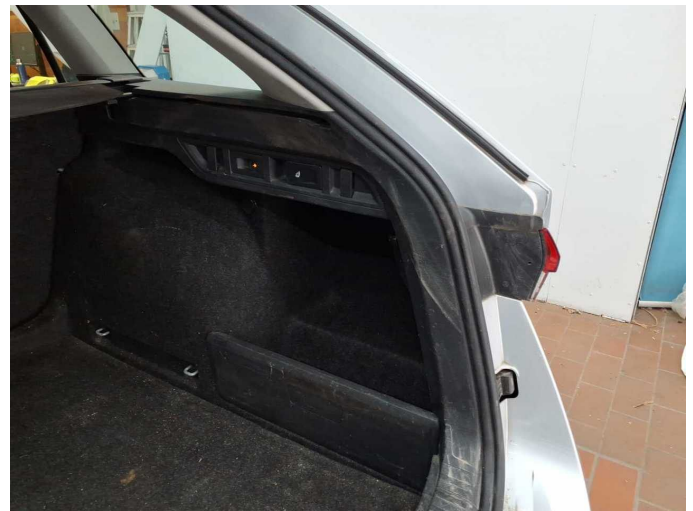

Damage 10: Interior: Interior - Scratch(es) - Loss in value



Damage 10: Interior: Interior - Scratch(es) - Loss in value




Damage 10: Interior: Interior - Scratch(es) - Loss in value



Damage 10: Interior: Interior - Scratch(es) - Loss in value



Damage 10: Interior: Interior - Scratch(es) - Loss in value

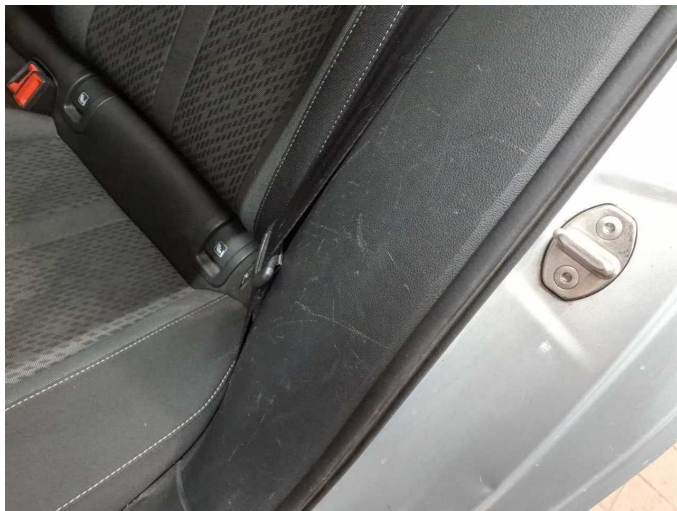


Damage 10: Interior: Interior - Scratch(es) - Loss in value



Damage 10: Interior: Interior - Scratch(es) - Loss in value



Damage 10: Interior: Interior - Scratch(es) - Loss in value

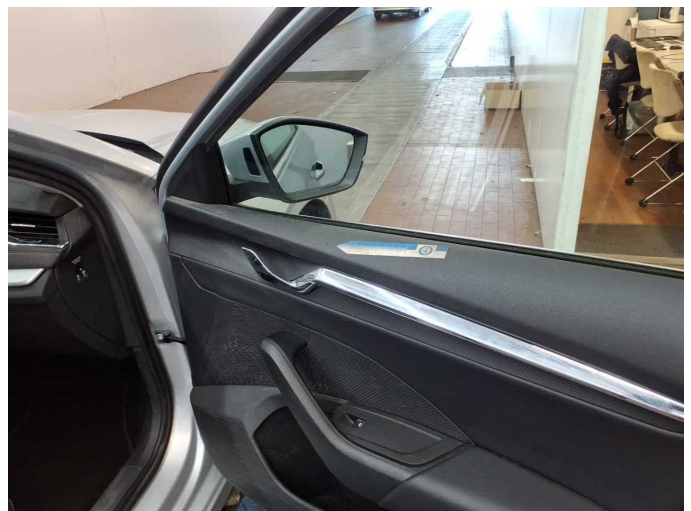

Damage 11: Door - front right side: Door - Broken / torn - Replace



Damage 11: Door - front right side: Door - Broken / torn - Replace



Damage 11: Door - front right side: Door - Broken / torn - Replace



Damage 11: Door - front right side: Door - Broken / torn - Replace



Damage 12: Door - rear right side: Door - Scratch(es) - Paint



Damage 12: Door - rear right side: Door - Scratch(es) - Paint



Damage 12: Door - rear right side: Door - Scratch(es) - Paint



Damage 12: Door - rear right side: Door - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint




Damage 14: Roof: Roof hatch / sliding roof - seal - Broken / torn - Replace



Damage 14: Roof: Roof hatch / sliding roof - seal - Broken / torn - Replace



Damage 14: Roof: Roof hatch / sliding roof - seal - Broken / torn - Replace

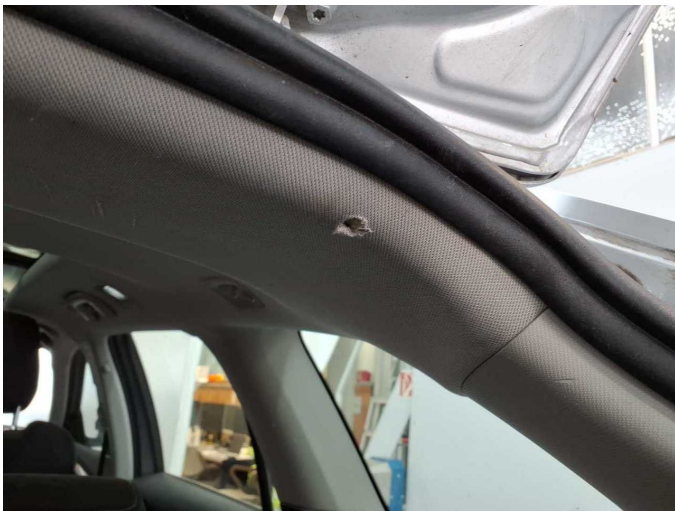

Damage 15: Trim / covers: Roof lining - Holes - Replace



Damage 15: Trim / covers: Roof lining - Holes - Replace



Damage 16: Roof: Roof - Deformed - Repair and paint



Damage 16: Roof: Roof - Deformed - Repair and paint



Damage 16: Roof: Roof - Deformed - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 18: Boot lid / rear door: Boot lid (Mit Korrosion) - Dent / paintcoat damage - Repair and paint



Damage 18: Boot lid / rear door: Boot lid (Mit Korrosion) - Dent / paintcoat damage - Repair and paint



Damage 18: Boot lid / rear door: Boot lid (Mit Korrosion) - Dent / paintcoat damage - Repair and paint



Damage 18: Boot lid / rear door: Boot lid (Mit Korrosion) - Dent / paintcoat damage - Repair and paint



Damage 19: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace



Damage 19: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace



Damage 19: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace



Damage 19: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace



Damage 19: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace




Damage 19: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace




Damage 19: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace



Damage 19: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace

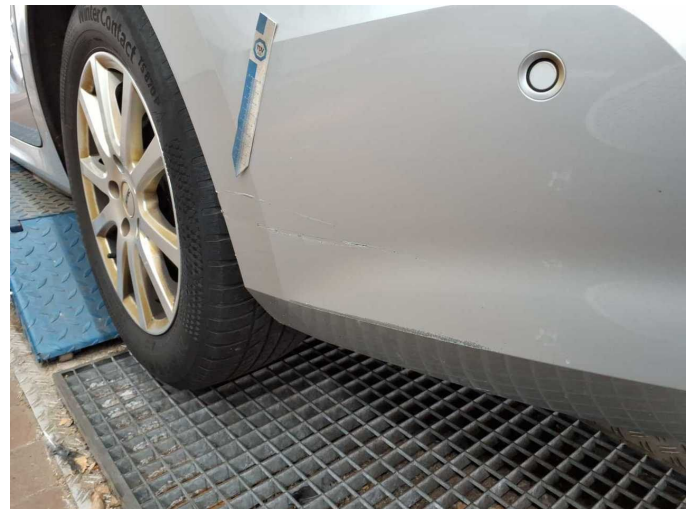

Damage 19: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace

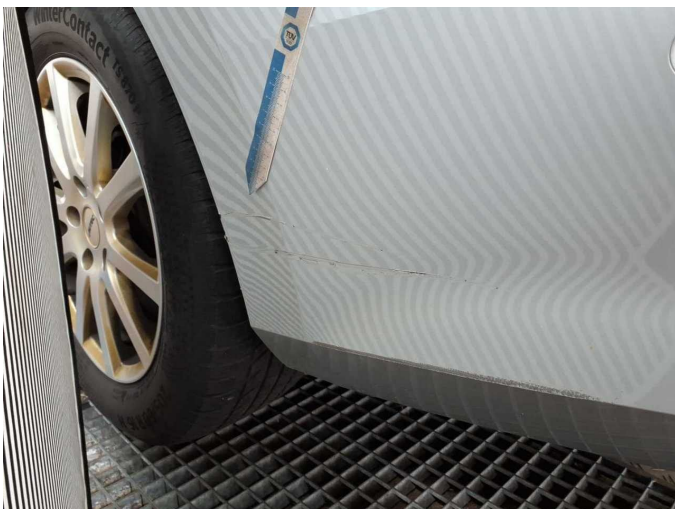

Damage 19: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace



Repainting 1: Side panel - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ8NX8NY029003
Hersteller / Modell: SKODA SKODA Octavia Combi 2.0 TDI DSG Style

Datum	KM-Stand	Beschreibung
19.01.2026	158.125	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
24.09.2025	155.200	Systemtest/Eigendiagnose
12.09.2025	142.545	Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose
16.07.2025	133.994	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
17.03.2025	123.799	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen
15.11.2024	112.176	AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
24.05.2024	93.462	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
06.03.2024	80.387	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose
06.10.2023	68.546	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
20.06.2023	58.262	Bremsklötze hinten; Bremsscheiben + Klötze v; Lackschaden beseitigen
16.02.2023	48.238	Motoröl b. Wartung; Regelwartungsdienst
08.07.2022	25.749	Motoröl b. Wartung; Regelwartungsdienst