


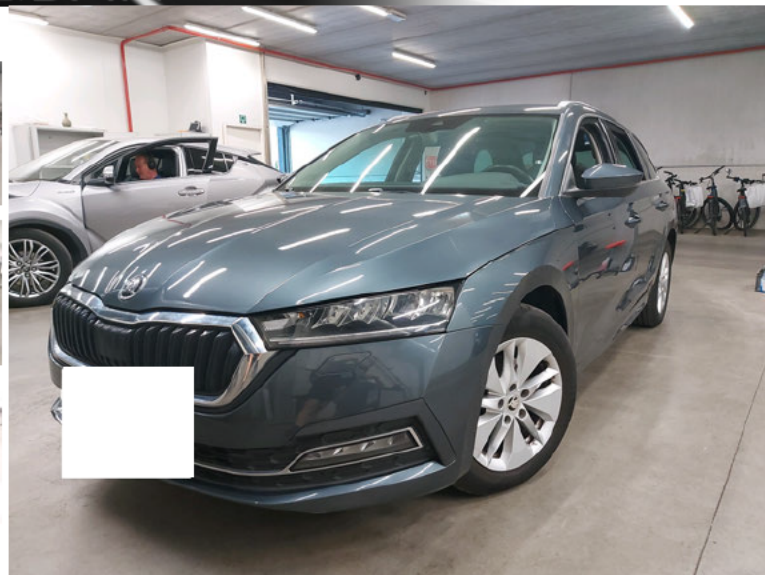

Skoda Octavia:

Vinnumber:	TMBJJ7NX6MY149195	Versionname:	
First Registrationdate:	22/10/2021	Fiscalpower:	
Expertise Mileage:	147994	Power Kw:	
Bodytype:		Body colour	Grey
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	3401
Fueltype:	Diesel		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Seats F heated		Type of Tow bar	No Tow bar
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Tyres

205/60/16/92 H			
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.
	Re.L.	Michelin: 5 mm	Re.R.
Tyre profile depth FL			5.0
Tyre profile depth FR			5.0
Tyre profile depth RL			5.0
Tyre profile depth RR			5.0
Tyre size FL			205/60 R 16 92 H
Tyre size FR			205/60 R 16 92 H
Tyre size RL			205/60 R 16 92 H
Tyre size RR			205/60 R 16 92 H
Tyre type FL			Summer
Tyre type FR			Summer
Tyre type RL			Summer
Tyre type RR			Summer
Tyre make FL			256
Tyre make FR			256
Tyre make RL			261
Tyre make RR			261

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2539,23
Seat cover FL, Stain, Cleaning	29,16



Centre console, Hole, Replace

36,49



Bumper F, Dent(s) and scratch(es), Repair and paint (complete)

296,58



Bumper R, Scratch(es), Repair and paint (complete)

356,09



Rear window, Scratch(es), Polish

0,00



Tailgate / Boot, Not original part, Acceptable

0,00



Alloy rim FR, Scratch(es), Repair and paint (complete)

133,03



Wing FR, Scratch(es), Acceptable

0,00



Door RR, Dent(s) and scratch(es), Repair and paint (complete)

445,79



Sill trim R, Scratch(es), Repair and paint (complete)

434,80



Alloy rim RR, Scratch(es), Repair and paint (complete)

133,03



Roof pillar R, Dent(s), Acceptable	0,00
------------------------------------	------



Roof, Dent(s) and scratch(es), Repair and paint (complete)	674,26
--	--------



Roof rail R, Deformed / Strained, Acceptable	0,00
--	------

