

Expertise

Protocol number: 46260776
Order No. / Reference: 26508177-1
Inspection date: 16 Jun 2026

Manufacturer: Mazda

Model: 2 SKYACTIV G 90 M HYBRID Homura

VIN: JMZDJ6HC601450978



Vehicle details

Manufacturer / Type / Model / Equipment

Mazda 2 SKYACTIV G 90 M HYBRID Homura

Vehicle Identification number	JMZDJ6HC601450978
Mileage (Read)	11,051 km
First registration	15 May 2023
Number of holders	1
Next periodical technical inspection (Report on hand)	05/2028

Power / Engine displacement	66 kw / 1,496 ccm
------------------------------------	-------------------

Fuel type / Cylinder	Hybrid Petrol / E / 4
-----------------------------	-----------------------

Gearbox / Number of gears	Manual / 6
----------------------------------	------------

Type of drive	Front drive
----------------------	-------------

Type of vehicle	Saloon car
------------------------	------------

Colour / colour code	Deep Crystal Blue Mica
-----------------------------	------------------------

Doors / Seats	5 / 5
----------------------	-------

Upholstery type	Cloth
------------------------	-------

Colour of upholstery	Black
-----------------------------	-------



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HH046247
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	7118 / AIO 00040		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,540 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	185/60 R16 86H	Summer tyres on Light alloy	Toyo	6mm / 6mm
2)	185/60 R16 86H	Summer tyres on Light alloy	Toyo	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	185/65 R15 88T	Winter tyres on Steel	Falken	7mm / 7mm
2)	185/65 R15 88T	Winter tyres on Steel	Falken	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 08/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Inspection location
Hartmann Fleet Professionals GmbH
Industriestraße 11
36272 Niederaula



Equipment



Standard equipment

- Front airbag (side airbags)
- Airbag head/shoulder airbags front and rear
- Anti-lock braking system with electronic brake force distribution (EBD) and brake assist (EBA)
- Electrically folding exterior mirrors - automatically when the door is locked
- Exterior mirror caps in black
- Third brake light mounted higher
- Colored glazing, heat-insulating
- Coming/leaving home light function
- Roof spoiler in car color
- Dynamic Stability Control (DSC) with Traction Control System (TCS)
- Wheels: 16" alloy wheels in black - 185/60 R16 Toyo Tires Proxes R55A tires
- Electric windows, front and rear, with comfort function for the driver's window
- luggage compartment cover
- Transmission: 6-speed manual transmission
- rear window wiper
- Automatic air conditioning
- Rear headrests (3), height adjustable
- radiator grille honeycomb radiator grille
- Steering wheel: Leather steering wheel, leather gearshift knob and handbrake lever
- Steering wheel heating
- Front reading lights (2)
- Red air vent rings
- Makeup mirrors for driver and front passenger
- Engine start/stop button
- Emergency Stop Signaling (ESS)
- Package: CONVENIENCE PACKAGE - Rear Cross Traffic Alert (RCTA) - Smart City Brake Support (SCBS F) with Pedestrian Detection - Rear Parking Sensors - Automatic Climate Control - Light and Rain Sensor - Heated Seats for Driver and Front Passenger - Blind Spot Monitoring (BSM)
- Radio accessories: Android Auto and Wireless Apple CarPlay
- Radio accessories: Hands-free system with voice control and Bluetooth audio streaming
- Rear view camera
- Rear side windows and rear window tinted
- Electric power steering
- Seats: Passenger seat height adjustable
- Seats: Driver's seat height adjustable
- Seats: ISOFIX child seat anchors - on the outer rear seats
- Seats: Heated seats for driver and front passenger
- Lane Change Assist Plus (BSM)
- Exterior door handles painted in car color
- Full LED headlights with LED light signature
- Electronic immobilizer
- Airbag for driver and front passenger; passenger airbag, deactivatable
- Rear Cross Traffic Alert (RCTA)
- Heated exterior mirrors
- Electrically adjustable exterior mirrors with integrated side indicators
- Hill Start Assist (HLA)
- City emergency braking assistant SCBS (Smart City Brake Support) with pedestrian detection
- Shark Fin roof antenna
- Digital tachometer, analog speedometer
- Rear parking sensors
- Driving dynamics control: G-Vectoring Control Plus (GVC) Optimized steering precision and higher driving dynamics, less steering effort and fatigue, more natural and comfortable driving characteristics for all passengers thanks to reduced centrifugal forces
- Cruise control system with speed limiter (Cruisematic)
- Back window, heater
- i-stop: Intelligent Mazda engine stop/start system
- Comfort turn signal function
- Front headrests are height-adjustable
- LED daytime running lights
- Steering wheel: Steering wheel control buttons for audio source and volume - Hands-free system and cruise control
- Steering column adjustable in height and length
- light sensor
- M-Hybrid System
- Mobility kit compressor and tire sealant
- Multi-information display with outside temperature display and touring computer
- Upholstery: Cloth
- Radio: Mazda audio system with radio - 20.3 cm (8-inch) high-resolution color display, usable as a touchscreen when the vehicle is stationary - Multi Commander for convenient and safe operation - Digital radio tuner (DAB+) - Two USB ports and AUX input - Internet radio application: via the aha and Stitcher apps - 6 speakers
- Rain sensor
- Tire pressure monitoring system indirectly via ABS
- Rear seat backrest asymmetrically split and foldable (60:40)
- Seat belts: 3-point automatic seat belts for all seats - height-adjustable in the front - belt tensioners with belt force limiters, front and rear - warning light and sound for unfastened seat belts
- Lane Keeping Assist - Active with Steering Support (LAS) - Warns the driver of an unintentional lane change and can also provide support by actively steering the vehicle back into the lane.
- Central locking with remote control



Extra equipment

- Paint finish: Metallic
- Navigation: Mazda SD navigation system - 3D map display, high resolution - Destination input via contact data from a smartphone possible - Expandable with online services (fee applies) - Arrow navigation also displayed in the head-up display (optional on Sports-Line trim)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

Restlaufservice nicht auslesbar.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

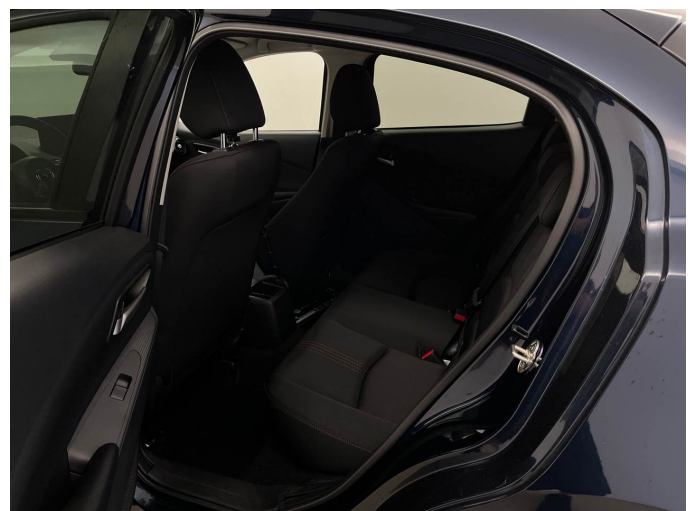


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

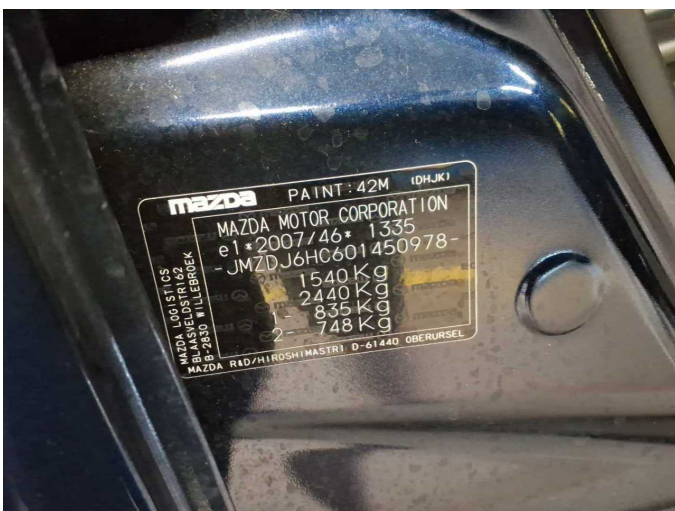


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

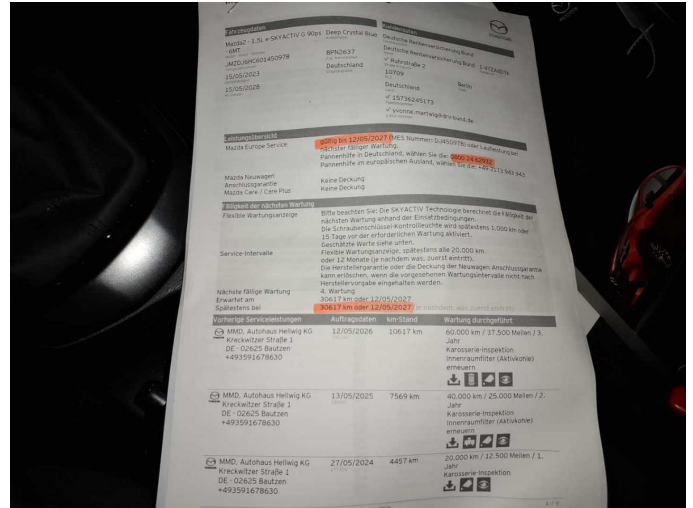


Figure 14: Documents

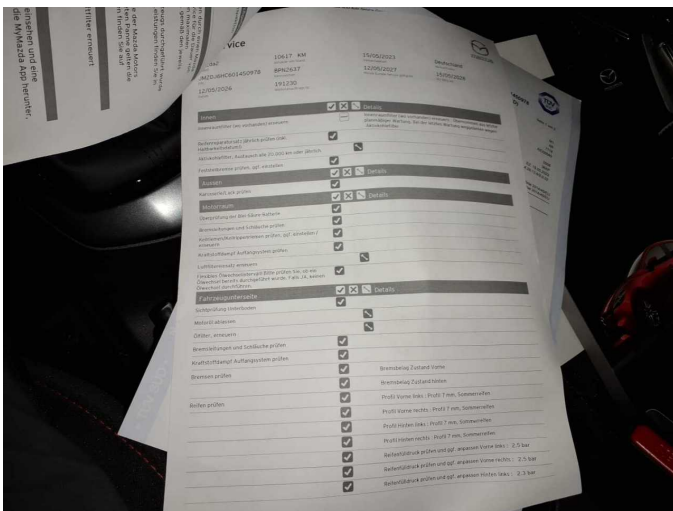


Figure 15: Documents



Figure 16: Documents

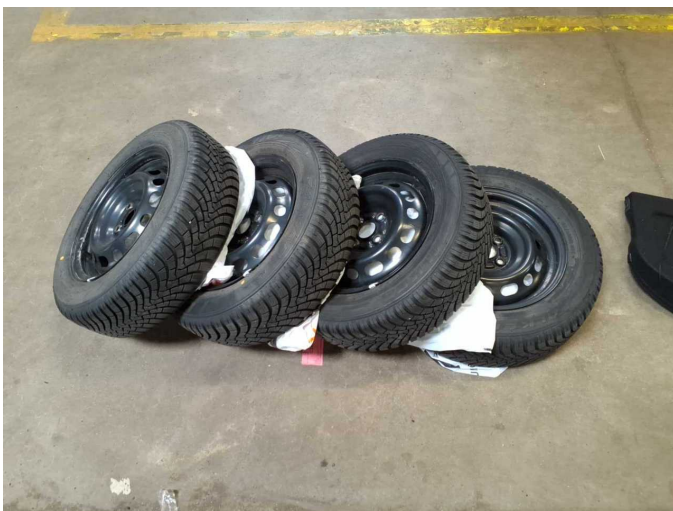


Figure 17: Additional tyres

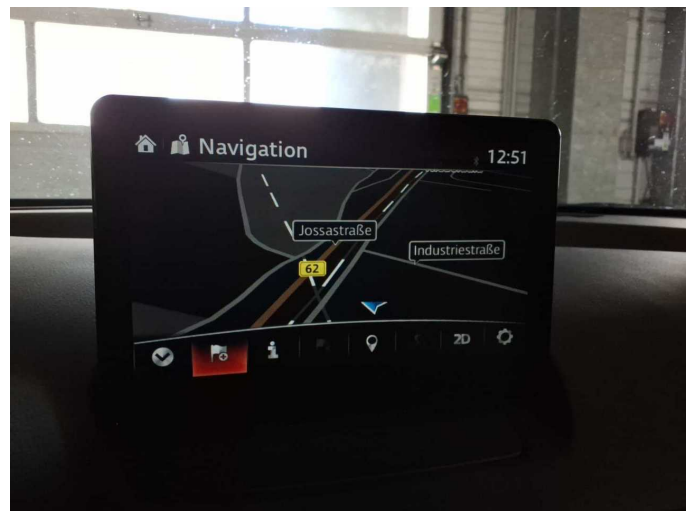


Figure 18: Navigation



Figure 19: Misc.

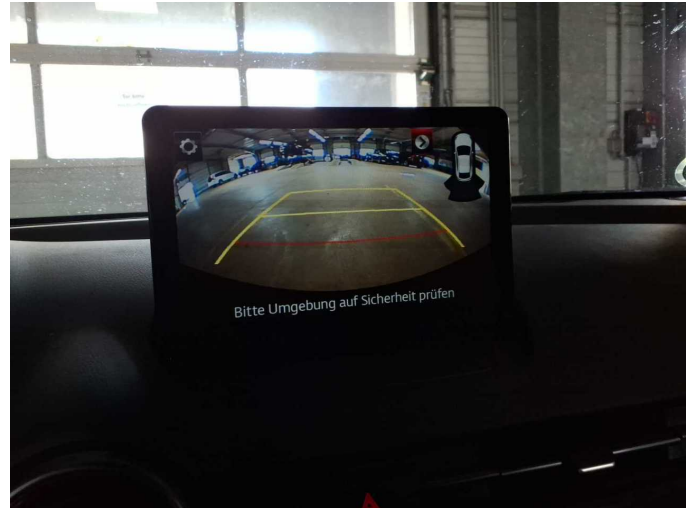


Figure 20: Misc.

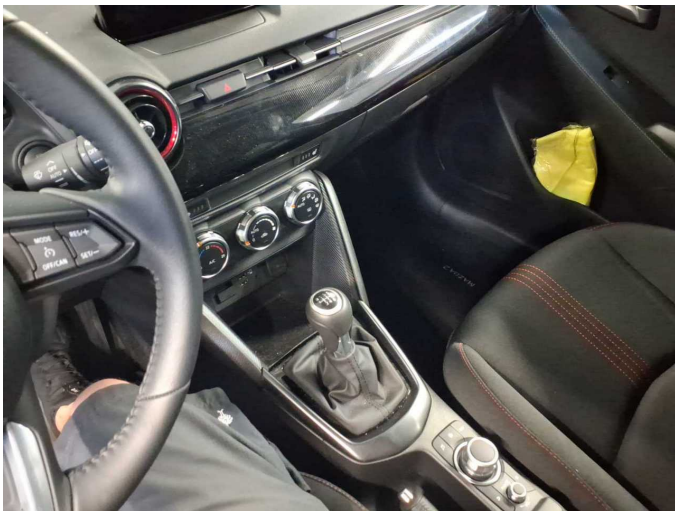


Figure 21: Misc.

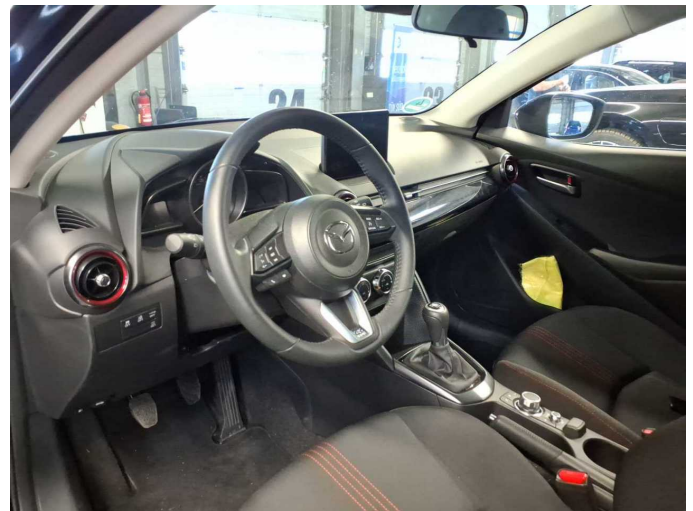


Figure 22: Misc.

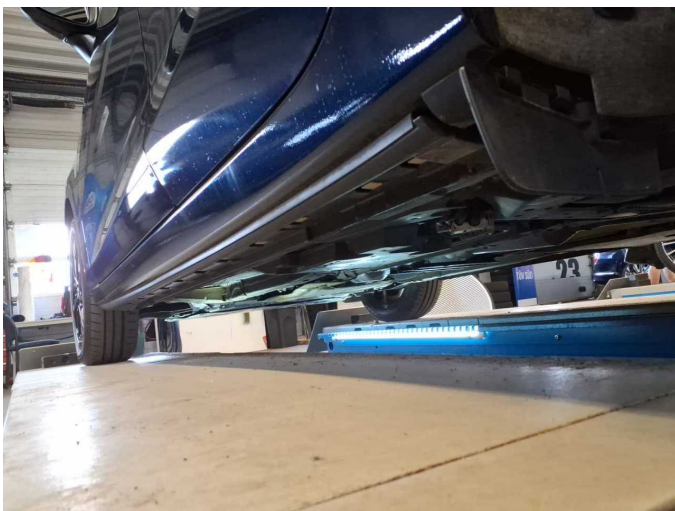


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

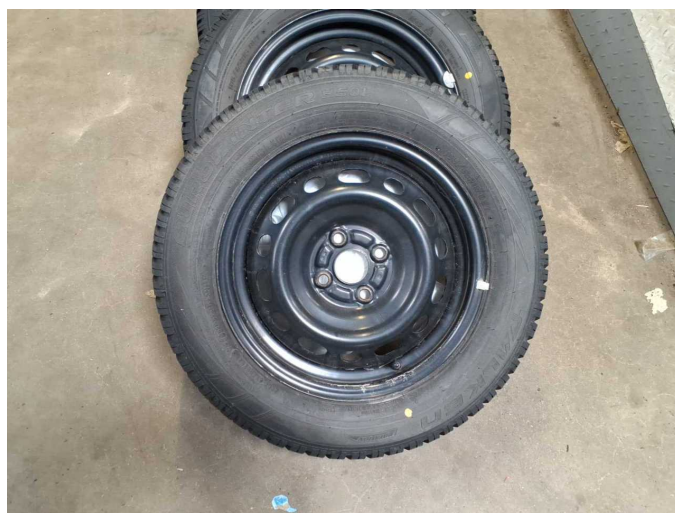


Figure 28: Misc.