




2-FAJ-897

2-FAJ-897 · Move! 1.0 TSI 110cv DSG unicolor · 30 June 2026 · Zaventem (BE)

Specifications

License Plate Number	2-FAJ-897	Fuel Type	Gasoline
Manufacturer	SEAT	VIN	VSSZZZKJ9RR085371
Model	Arona	Cylinder Capacity	999 ^{cm³}
Model Versions	Move! 1.0 TSI 110cv DSG unicolor	Transmission Type	Automatisch geschakelde Transmissie
Body Type	5 door hatchback	First Admission	06-03-2024
Color	Black	Odometer	81.233 ^{km}
Paint Type	Metallic	Numer Of Keys	2
Production Year	2024	Interior	Grey
KW	81	Number Headrests	5

Images

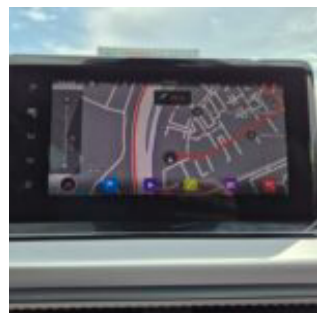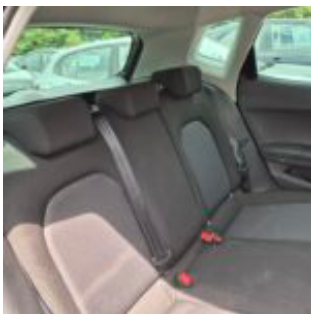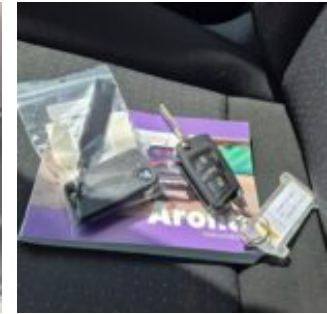



Accessories

ABS

Airbags

Alloy wheels

Audio System

Automatic air conditioning

Bluetooth car kit

Central door locking

Centre armrest

Cruise control

Electric rear windows

Electric windows front

Electrically adjustable exterior mirrors

Front & rear parking sensors

Leather steering wheel

Navigation system

Rear view camera

Seat heating

Steering wheel multifunction

Condition

Condition exterior Adequate

Condition interior Adequate

Last Maintenance Unknown


Previous Repairs

Unknown

Tire Specifications

Tire	Profile	Brand	Width	Aspect Ratio	Radial	Type
Front Left	1 ^{mm}	Hankook	205 ^{mm}	60 ^{mm}	16 ^{inch}	All Season
Rear Left	3 ^{mm}	Hankook	205 ^{mm}	60 ^{mm}	16 ^{inch}	All Season
Front Right	1 ^{mm}	Hankook	205 ^{mm}	60 ^{mm}	16 ^{inch}	All Season
Rear Right	3 ^{mm}	Hankook	205 ^{mm}	60 ^{mm}	16 ^{inch}	All Season
Spare Tire Type	Compressor					

Damages

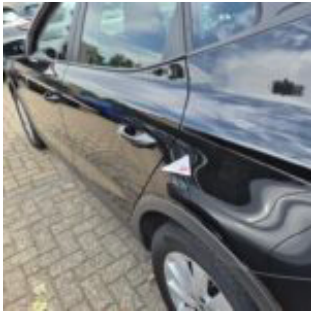

Damage Part

Damage Type

Repair Type

Acceptable

Fender - Rear Left

Small dent(s)

Restyle

No



Damage Part

Damage Type

Repair Type

Acceptable

Hood

Stonechipping

Acceptable

Yes



Damage Part

Damage Type

Repair Type

Acceptable

Bumper - Front

Scratch(es)

Spray

No



Damage Part
Frontdoor - Right

Damage Type
Small scratch(es)

Repair Type
Spray

Acceptable
No



Damage Part
Fender - Rear Right

Damage Type
Small dent(s)

Repair Type
Restyle

Acceptable
No




Damage Part
Tailgate

Damage Type
Dent(s) & Scratch(es)

Repair Type
Panelbeating & Spray

Acceptable
No

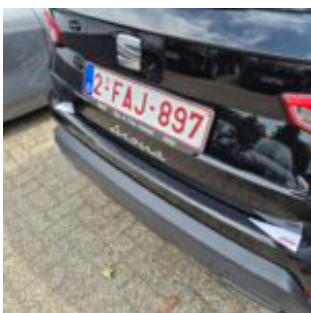

Damage Part	Damage Type	Repair Type	Acceptable
Bumper - Rear	Scratch(es)	Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Rear seat	Stains & dirt	Cleaning	No



Damage Part	Damage Type	Repair Type	Acceptable
Trunkshelf	Missing	Replace	No