



BMW X1

XDRIVE25E

|                          |                   |
|--------------------------|-------------------|
| VIN                      | WBA21EF0205341605 |
| Primera matriculación    | 8/7/2025          |
| Kilometraje del vehículo | 27.933 km         |

DETALLES DE LA INSPECCIÓN

|                        |                    |                                           |                 |
|------------------------|--------------------|-------------------------------------------|-----------------|
| Fecha de la inspección | 12/8/2026 11:08:17 | Descripción de la dirección de inspección | Hartmann GIRONA |
|------------------------|--------------------|-------------------------------------------|-----------------|

INFORMACIÓN DEL VEHÍCULO

|        |                   |                       |            |
|--------|-------------------|-----------------------|------------|
| Marca  | BMW               | Primera matriculación | 8/7/2025   |
| Modelo | X1                | Tipo de carrocería    | Todocamino |
| VIN    | WBA21EF0205341605 | Tipo de combustible   | Híbrido    |

DOCUMENTOS Y MANTENIMIENTO

|                         |    |                                |                       |
|-------------------------|----|--------------------------------|-----------------------|
| Núm llaves              | 1  | Documento de matriculación     | No                    |
| Ficha Técnica           | No | Tipo de libro de mantenimiento | Mantenimiento digital |
| Manual de instrucciones | No |                                |                       |

ACCESORIOS

|                           |    |                                          |   |
|---------------------------|----|------------------------------------------|---|
| Cable de carga            | Sí | Número de cables de carga (carga rápida) | 1 |
| Número de cables de carga | 1  |                                          |   |

NEUMÁTICOS

Neumáticos montados

| Ubicación | Posición  | Banda de rodadura | Fabricante | Dimensiones       | Temporada de neumáticos | Tipo de llantas | Neumáticos Runflat |
|-----------|-----------|-------------------|------------|-------------------|-------------------------|-----------------|--------------------|
| Delantera | Izquierda | 5,0 mm            | Nexen      | 205/65 R 17 100 Y | Verano                  | Aluminio        | No aplica          |
| Delantera | Derecha   | 5,0 mm            | Nexen      | 205/65 R 17 100 Y | Verano                  | Aluminio        | No aplica          |
| Trasera   | Izquierda | 6,0 mm            | Nexen      | 205/65 R 17 100 Y | Verano                  | Aluminio        | No aplica          |
| Trasera   | Derecha   | 6,0 mm            | Nexen      | 205/65 R 17 100 Y | Verano                  | Aluminio        | No aplica          |


DAMAGES

Interior




1 | Ignition key

|             |         |
|-------------|---------|
| Damage type | Missing |
| Repair mode | Replace |

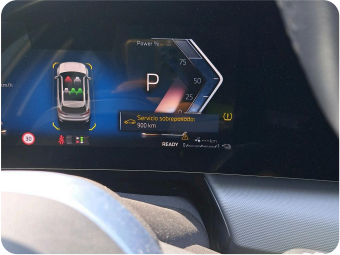

2 | Warning indicator

|             |           |
|-------------|-----------|
| Damage type | Lights up |
| Repair mode | Check     |

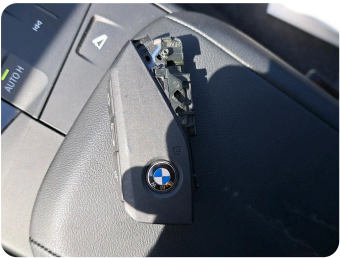

3 | Ignition key

|             |         |
|-------------|---------|
| Damage type | Broken  |
| Repair mode | Replace |



4 | Interior

|             |          |
|-------------|----------|
| Damage type | Dirty    |
| Repair mode | Cleaning |



8 | Boot lid covering R

|             |                           |
|-------------|---------------------------|
| Damage type | Scratch(es)               |
| Repair mode | Repair/replace (lump sum) |

Exterior



5 | Bumper F

|             |             |
|-------------|-------------|
| Damage type | Scratch(es) |
| Repair mode | Paint       |



6 | Outside rear-view mirror housing L

|             |             |
|-------------|-------------|
| Damage type | Scratch(es) |
| Repair mode | Paint       |



7 | Bumper R

|             |             |
|-------------|-------------|
| Damage type | Scratch(es) |
| Repair mode | Paint       |



9 | Bumper trim R

|             |                             |
|-------------|-----------------------------|
| Damage type | Scratch(es)                 |
| Repair mode | Repair and paint (complete) |



10 | Bumper moulding R

|             |             |
|-------------|-------------|
| Damage type | Scratch(es) |
| Repair mode | Acceptable  |



11 | Bumper moulding RR

|             |         |
|-------------|---------|
| Damage type | Forced  |
| Repair mode | Replace |



12 | Door RR

|             |                             |
|-------------|-----------------------------|
| Damage type | Dent(s) and scratch(es)     |
| Repair mode | Repair and paint (complete) |



13 | Wing FR

|             |                             |
|-------------|-----------------------------|
| Damage type | Dent(s) and scratch(es)     |
| Repair mode | Repair and paint (complete) |



14 | Wing trim FR

|             |         |
|-------------|---------|
| Damage type | Forced  |
| Repair mode | Replace |



15 | Outside rear-view mirror housing R

|             |             |
|-------------|-------------|
| Damage type | Scratch(es) |
| Repair mode | Acceptable  |



16 | Bodywork

|             |                  |
|-------------|------------------|
| Damage type | Glue residues    |
| Repair mode | Remove lettering |



17 | Alloy rim FL

|             |                           |
|-------------|---------------------------|
| Damage type | Scratch(es)               |
| Repair mode | Repair/replace (lump sum) |





18 | Alloy rim RR

|             |                           |
|-------------|---------------------------|
| Damage type | Scratch(es)               |
| Repair mode | Repair/replace (lump sum) |



19 | Alloy rim FR

|             |                           |
|-------------|---------------------------|
| Damage type | Scratch(es)               |
| Repair mode | Repair/replace (lump sum) |

COMENTARIOS

Comentarios del pedido

HORARIO DE 8.30H A 13.30H Y DE 15.30H A 18.00H (VIERNES DE 8.30H A 16.30H)

**Commercial photos**

