



Expertise

Protocol number: 46505713
Order No. / Reference: 26466691
Inspection date: 8 Jul 2026

Manufacturer: Skoda
VIN: TMBJW8NX5PY101084

Model: Octavia Combi 1.4 TSI iV DSG RS



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 1.4 TSI iV DSG RS	
Vehicle Identification number	TMBJW8NX5PY101084
Mileage (Read)	91,159 km
First registration	2 May 2023
Number of holders	1
Power / Engine displacement	110 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext.auf / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Red



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	1,000 km
Last service on / at	11/2025 at 78,713 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ561609
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWJ 00064		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,090 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 91Y	Summer tyres on Light alloy	Bridgestone	3mm / 3mm
2)	225/45 R18 91Y	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 95V	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	205/55 R17 95V	Winter tyres on Light alloy	Dunlop	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Airbag, driver and passenger
- Airbag, head airbags
- Airbag: Center airbag front
- Trailer hitch preparation including trailer stabilization
- Traction control (ASR)
- Automatically dimming exterior mirror (driver's side)
- Electrically adjustable and heated exterior mirrors
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Glasses compartment in the headliner
- Roof rails, black
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant
- Chassis: Sport chassis
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Transmission: 6-speed direct-shift gearbox (DSG)
- Green tec: Start/stop system including brake energy recuperation
- Rear spoiler
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (2-zone)
- LED fog lights
- LED license plate lights
- LED matrix headlights and dynamic high beam assist (AFS)
- Steering wheel: height and reach adjustable
- Rear center armrest with pass-through option
- Front center armrest, including storage compartment
- Emergency charging cable (Mode 2 charging cable, Schuko, 10A)
- Upholstery: Cloth
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Bluetooth hands-free system
- Radio accessories: SmartLink
- Rain sensor
- Tire mobility kit
- Safety lights in the front side doors
- Seats: Height-adjustable driver and passenger seats
- Seats: Sports seats with integrated headrests in the front and height-adjustable headrests in the rear.
- Lane keeping assistant (Lane Assist)
- Sunset (rear window and rear side windows tinted dark)
- Phone: Wireless SmartLink for Apple CarPlay
- Textile floor mats
- Lashing eyes in the trunk
- Central locking including remote control integrated into the key and EASY Start
- Storage compartments
- Acoustic Vehicle Alerting System (AVAS)
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Ambient lighting
- Anti-lock braking system (ABS)
- Center section of the dashboard with microfiber cover in black and red decorative stitching
- Electrically folding exterior mirrors
- Hill start assist including auto-hold function
- Hydraulic brake assist (HBA)
- black headliner
- Dark Carbon decorative trim
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Driving profile selection
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system
- Tinted windows
- Heated rear window
- Rear window wiper including windshield washer system
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Child safety lock for the rear doors and windows
- Removable boot cover
- LED taillights in crystal glass look and animated turn signals
- LED headlights with LED daytime running lights
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Leather steering wheel in sporty design with multifunction buttons including paddle shifters.
- Engine drag torque control (MSR)
- Front and rear parking sensors
- Pedals in stainless steel look
- Progressive steering
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Voice control
- Tire pressure monitoring
- Seat belts
- Seats: Heated front seats
- Seats: Rear seat backrest split 60:40, foldable
- SKODA Care Connect
- Speed limiter
- 12V socket in the trunk
- Telephone: Phonebox with inductive charging function (connection via external antenna)
- Front door sill trims



- Immobiliser

Extra equipment

- Swiveling trailer hitch including trailer stabilization and adapter
- Package: Comfort (RS, Sportline) (3-zone Climatronic - Acoustic glazing in the front side windows - Heated front and outer rear seats - Heated steering wheel)
- Paint finish: Pearl effect
- Package: Columbus infotainment package (Style, RS, Scout) (Columbus navigation system - Infotainment Online (3-year term) - 3 USB charging ports)
- Wheels: 18" Comet alloy wheels, black gloss turned (7.5J x 18, ET 48 with 225/45 R18 tires)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Bonnet	Bonnet - dent(s) - Smooth repair work
2	Bonnet	Radiator grille - Scratched - Replace
3	Rear bumper	Rear bumper - Scratch(es) - Paint
4	Vehicle glazing	Windscreen (Mit Rissbildung im Randbereich) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 26 Aug 2025	940,80 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)

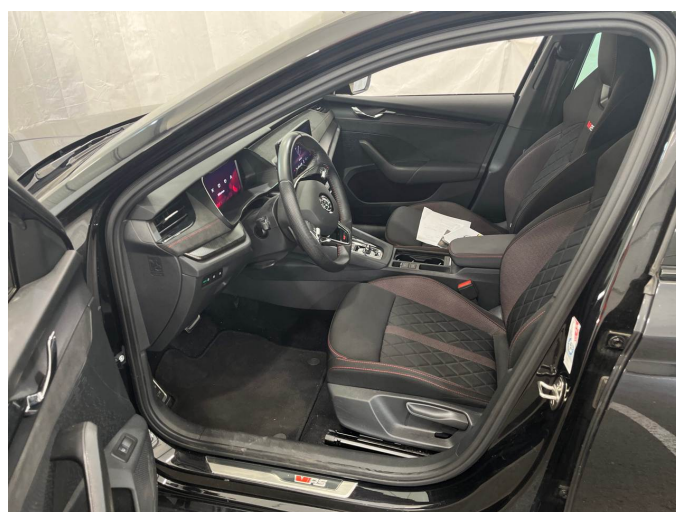


Figure 4: Interior - front



Figure 5: Interior - rear



Figure 6: Instrument cluster



Figure 7: Instrument panel



Figure 8: Interior 360° view

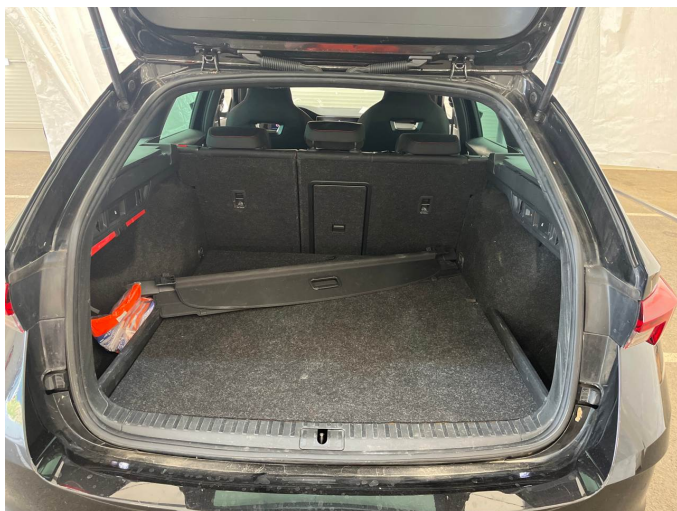


Figure 9: Cargo area



Figure 10: VIN



Figure 11: Mounted tyres



Figure 12: Documents

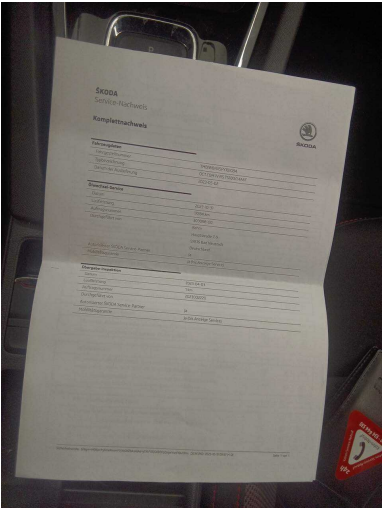


Figure 13: Documents

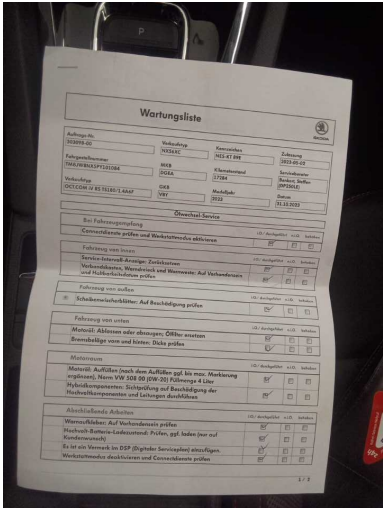


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation

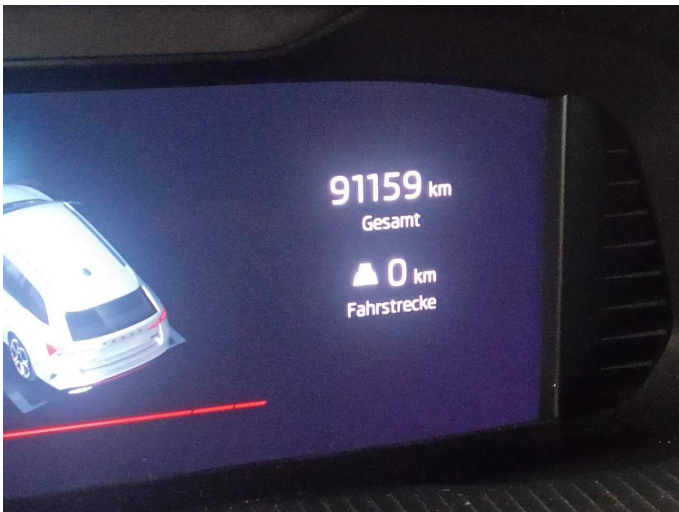


Figure 18: Misc.

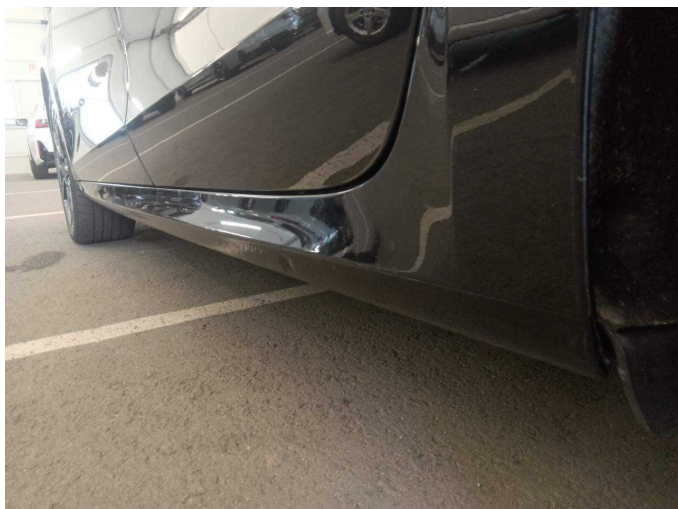


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.


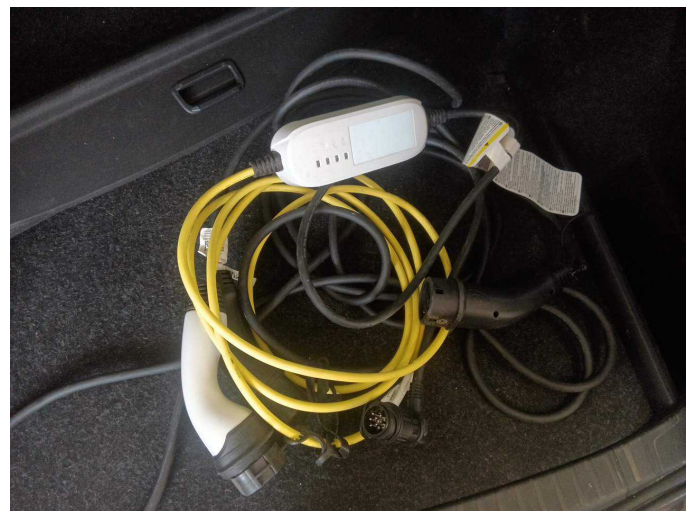


Figure 30: Misc.



Damage 1: Bonnet: Bonnet - dent(s) - Smooth repair work

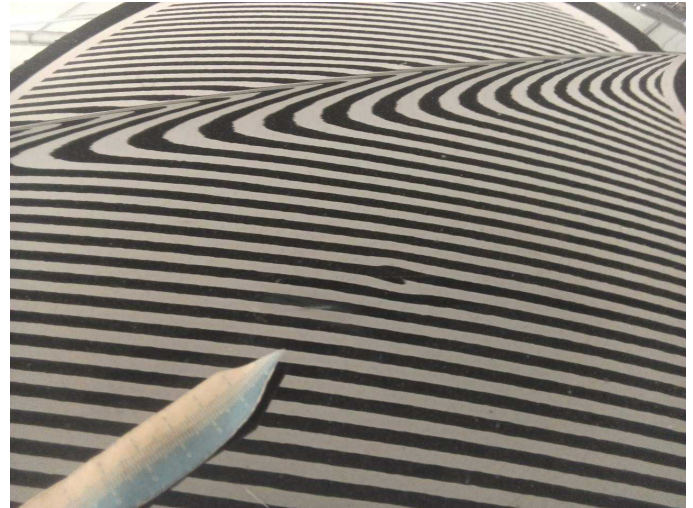

Damage 1: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 2: Bonnet: Radiator grille - Scratched - Replace




Damage 2: Bonnet: Radiator grille - Scratched - Replace



Damage 2: Bonnet: Radiator grille - Scratched - Replace




Damage 3: Rear bumper: Rear bumper - Scratch(es) - Paint

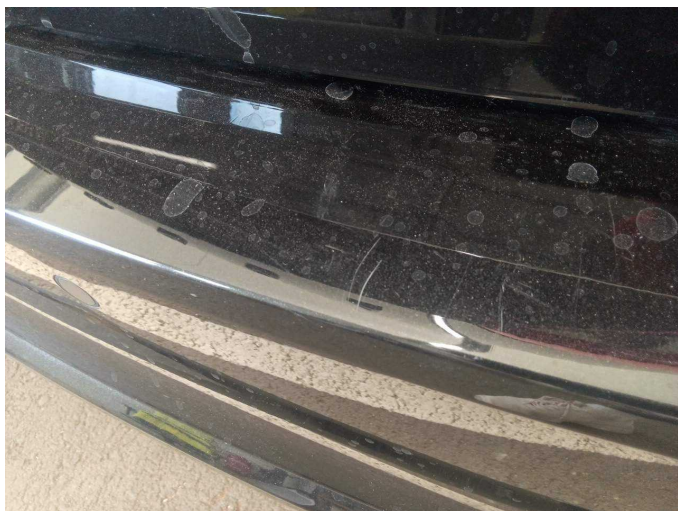

Damage 3: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 3: Rear bumper: Rear bumper - Scratch(es) - Paint

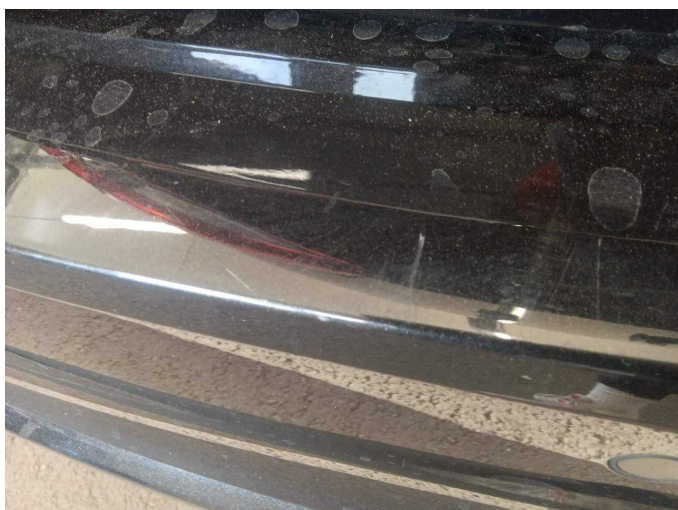

Damage 3: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Vehicle glazing: Windscreen (Mit Rissbildung im Randbereich) - Stone chips - Replace

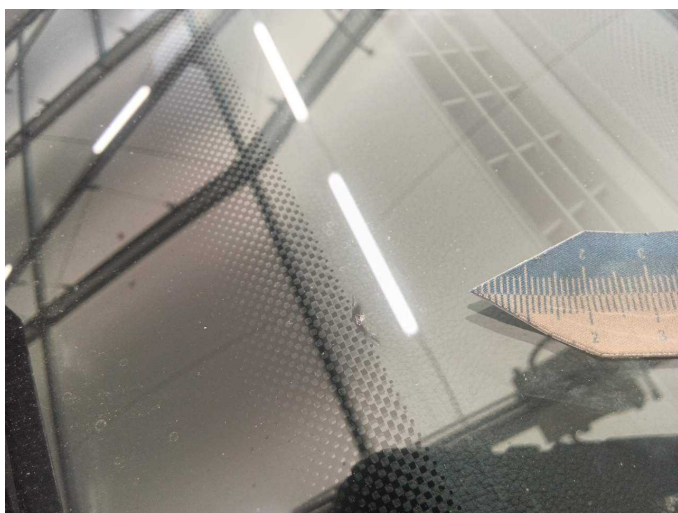

Damage 4: Vehicle glazing: Windscreen (Mit Rissbildung im Randbereich) - Stone chips - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJW8NX5PY101084

Hersteller / Modell: SKODA SKODA Octavia Combi 1.4 TSI iV DSG RS

Datum	KM-Stand	Beschreibung
27.05.2026	90.889	AU
18.11.2025	78.713	Motoröl b. Wartung; Ölfilter ern; Ölfilter ern; Ölwechsel; Ölwechsel; Ölwechsel; Wartung Sonstiges; Wartung Sonstiges
30.04.2025	62.072	Bremsflüssigkeit ern; Bremsklötze hinten; Getriebeöl ern/prüfen; Motoröl b. Wartung; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
07.10.2024	48.099	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
19.03.2024	30.570	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
31.10.2023	17.284	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges