



Expertise

Protocol number: 46473873
Order No. / Reference: 26673427
Inspection date: 10 Jul 2026

Manufacturer: Skoda
VIN: TMBJJ8NX8RY133884

Model: Octavia Combi 2.0 TDI DSG Sportline



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI DSG Sportline	
Vehicle Identification number	TMBJJ8NX8RY133884
Mileage (Read)	136,823 km
First registration	26 Mar 2024
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black Magic Pearlescent (F9R)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	13,800 km
Last service on / at	04/2026 at 122,276 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HB676337
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWL 00390		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,990 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 91Y	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	225/45 R18 91Y	Summer tyres on Light alloy	Pirelli	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment in the luggage compartment
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag: Center airbag front
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Automatically dimming exterior mirror (driver's side)
- Exterior mirrors painted black, door handles in body color
- Hill start assist
- Four roof grab handles (rear with coat hooks, ticket holder on the windshield)
- AERO roof rails in gloss black
- Digital Cockpit Plus
- Third brake light
- Electronic parking brake including auto-hold function
- Electronic Stability Control (ESC)
- Chassis: Sport chassis (sporty damper tuning, ground clearance reduced by approximately 15mm)
- High beam assist
- Front and rear footwell lighting
- Removable luggage roller blind
- Cruise control system (cruise control) including speed limiter
- Rear window wiper including windshield washer system
- Interior mirror automatically dimming
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Child safety lock for the rear doors and windows
- Black radiator grille frame
- LED taillights in crystal glass look
- LED headlights with LED daytime running lights
- Steering wheel: Height and reach adjustable leather steering wheel with multifunction buttons including paddle shifters.
- Manual headlight range adjustment
- Engine drag torque control (MSR)
- Fatigue detection
- Pedals in stainless steel look
- Radio: Infotainment system (with infotainment display 10")
- Radio accessories: 2 x USB charging ports in the rear and USB charging port in the rearview mirror
- Radio accessories: Digital radio reception DAB+
- Umbrella and broom compartments in the front doors
- Rain sensor and driving light assistant (Easy Light Assist)
- Tire mobility kit (tire repair spray incl. compressor)
- Reversing camera including rear lights in crystal glass look
- Seat belts (Height-adjustable three-point seat belts in the front, with belt tensioners - Three three-point seat belts in the rear - Seat belt reminder indicators in all seats)
- Storage compartments (storage compartments in the front door panels with 1.5l bottle holders, storage compartments in the rear door panels with 0.5l bottle holders, storage compartments in the doors with felt lining)
- Airbag, front side airbags
- Ambient lighting (dashboard, front trim strips and footwell with selectable color climate) in the interior as well as logo projector on the outside)
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors
- Glasses compartment in the headliner
- black headliner
- AERO roof rails in black
- Diesel particulate filter
- Tachometer
- Ice scraper in the fuel filler flap
- Electronic transverse differential lock (XDS+)
- Driving profile selection
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection (including evasive steering and turning assistant)
- Transmission: 7-speed dual-clutch transmission (DSG)
- Heated rear window
- Interior features: Design Selection Sportline (fabric and Thermoflux interior combined with high-quality materials - grey decorative stitching in the interior - piano black trim strip)
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, and with anti-allergen filter & activated carbon filter)
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Sport design steering wheel
- Two reading lights at the front (including reading lights at the rear - trunk lighting)
- Front center armrest, including storage compartment
- Multi-collision brake
- Front and rear parking sensors
- Progressive steering
- Radio accessories: 2 USB ports at the front
- Radio accessories: 8 speakers
- Radio accessories: Bluetooth hands-free system
- Radio accessories: Wireless & Wired SmartLink (Apple CarPlay, Android Auto)
- Tire pressure monitoring
- Wheels: 18" Vega AERO alloy wheels, black gloss turned (7.5J x 18, ET 48 with 225/45 R18 tires)
- Electromechanical power steering
- Safety lights in the front side doors



- Seats: Sports seats with integrated headrests in the front and height-adjustable headrests in the rear.
- Seats: Front seats are height-adjustable (with adjustable lumbar support)
- Sun visors with illuminated make-up mirror on driver and passenger side
- Lane keeping assistant (Lane Assist)
- 12V socket in the trunk
- Telephone: Phonebox with inductive charging function (connection via external antenna)
- Front door sill trims
- Glazing: Acoustic glazing in the front side windows and Sunset (dark tinted rear window and rear side windows)
- Traffic sign recognition
- Immobiliser
- Seats: Heated front seats
- Seats: Rear seat backrest split 60:40 and foldable (with center armrest and pass-through option)
- Seats: Pockets on the backs of the front seats including smartphone pockets
- SKODA Care Connect (SOS emergency call function (eCall+ including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection option for rapid assistance in case of breakdown) - Information service (connection option to the hotline for all questions relating to vehicle functions) - Free remote vehicle access for 3 years (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Lashing eyes in the trunk
- Central locking including remote control integrated into the key and EASY Start

Extra equipment

- Comfort Plus equipment package
- wirelessly heated windshield
- Paint finish: Pearl effect
- Parking & Lighting Equipment Package
- Business Columbus infotainment package

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wing mirror - left side	Cap - Scratch(es) - Smart repair
2	Bonnet	Bonnet - dent(s) - Smooth repair work
3	Trim / covers	Boot lid - interior trim - Scratched - Replace
4	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Umbrella



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Roof, Rear, Professionally repaired, Invoice of repair done Non-existent, from 3 Jun 2025	2.173,90 €
2	Side right, Professionally repaired, Invoice of repair done Non-existent, from 29 Jan 2026	12.845,29 €

Repainting

No.	Repainting
1	Roof, Professionally carried out, Invoice of repair done Non-existent
2	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof	203 µm	Side panel - rear right side	217 µm
------	--------	------------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

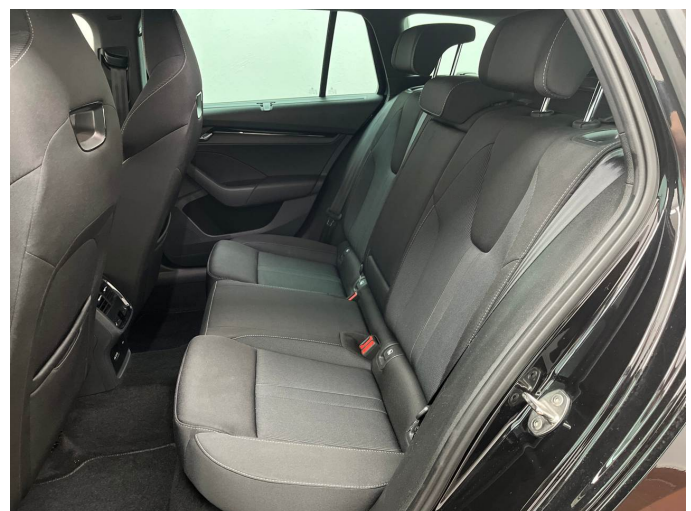


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation

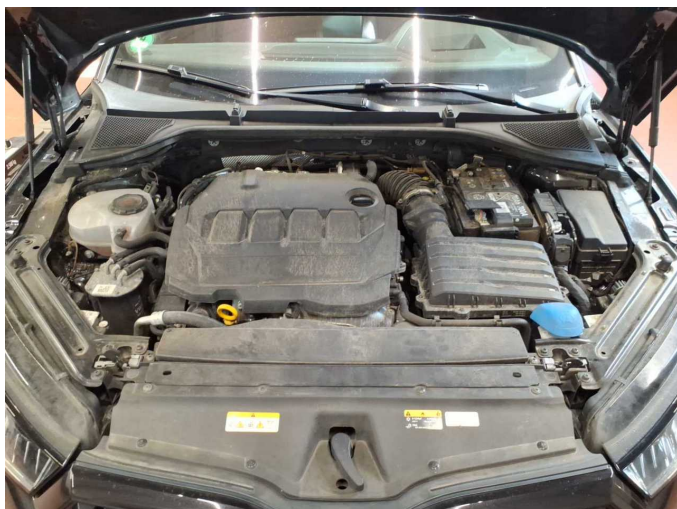


Figure 17: Misc.

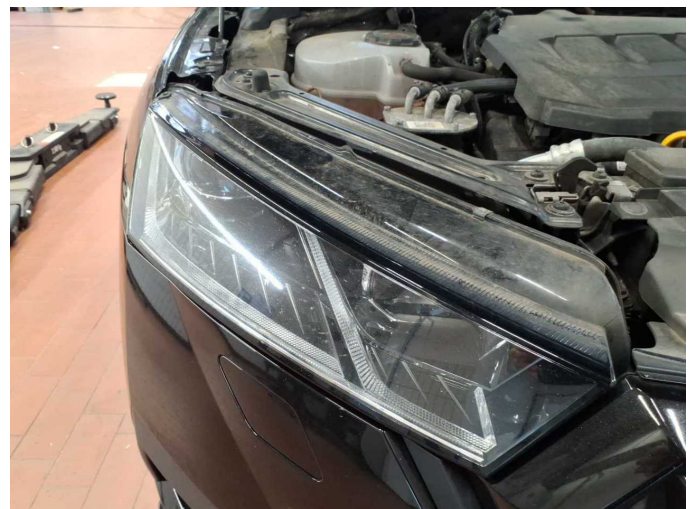


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.

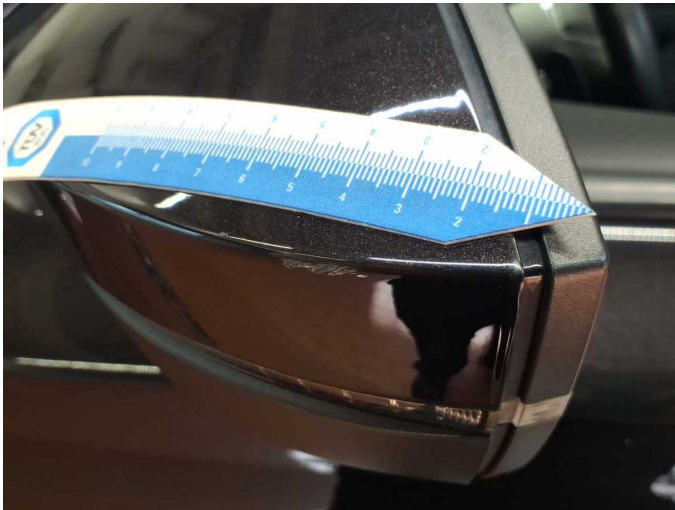

Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair

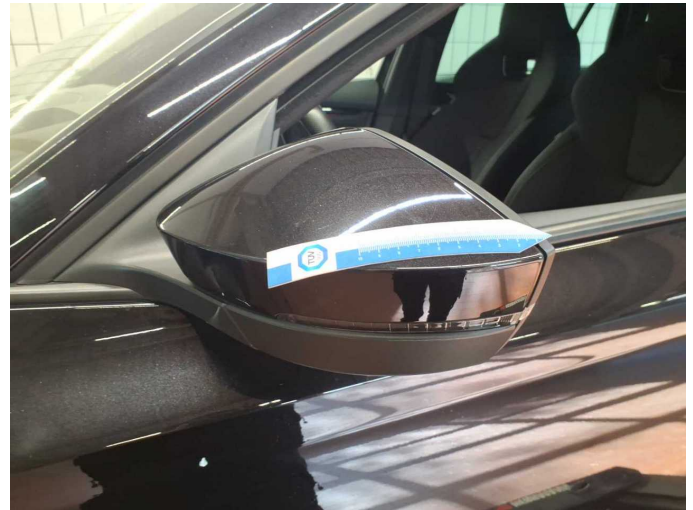

Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 2: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 2: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 2: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 3: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 3: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Repainting 1: Roof



Repainting 2: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ8NX8RY133884

Hersteller / Modell: SKODA SKODA Octavia Combi 2.0 TDI DSG Sportline

Datum	KM-Stand	Beschreibung
15.04.2026	123.310	Systemtest/Eigendiagnose
02.04.2026	122.276	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.09.2025	95.663	Bremse Sonstiges; Bremsklötze hinten
22.08.2025	90.857	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
06.06.2025	78.031	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
13.02.2025	60.949	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
16.08.2024	31.063	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges