

Volkswagen ID.4 '21 BEV



Vehicle information




Make:	Volkswagen	License:	
Gearbox:	Automatic	Body color:	
Model:	ID.4 '21 BEV	VIN:	WVGZZZE2ZMP017353
Fuel type:	Electric	Power:	150 kW
Version:	ID.4 77kWh 1st	First registration:	18/05/2021
Mileage:	156537 km	N° of doors:	

Damage summary

Front	③
Interior	①
Left	⑤
Rear	②
Right	④

Commercial pictures

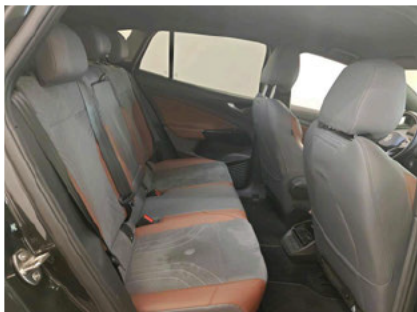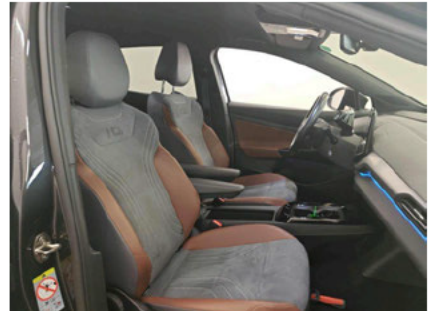

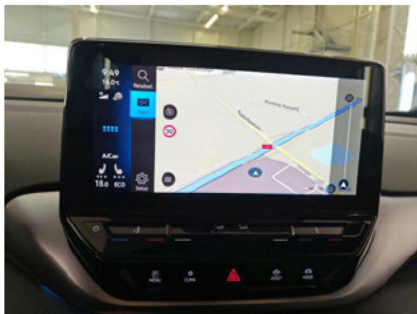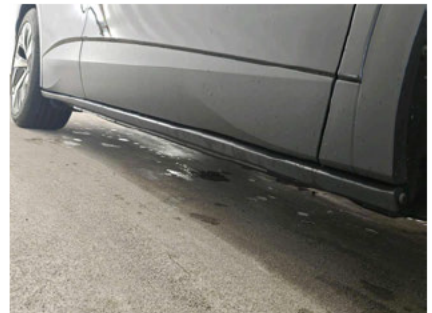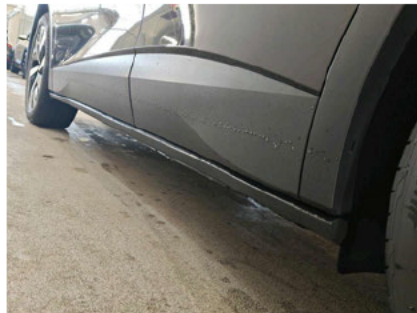

Batterijcertificaat
Datum van diagnose: 15/06/2026

90%
Status van de gezondheid (SOH)*

Volkswagen ID4
VIN: WVGZZZE2ZMP017353
Kilometerstand: 156.537 km

* SOH gebaseerd op basis van fabrieksgedrag, informatie om rekening mee houden voor de fabrieksgarantie

www.get-meba.com
www.get-meba.com

CARA



Options according to the inspector

Central console F
Radio multimedia

Yes GPS
Yes Telephone equipment

Yes Headlights Xenon/LED/Laser
Yes

Yes

Damages

Alloy rim RL

Scratch(es)
Repair and paint (complete)
Left



Alloy rim RR

Scratch(es)
Repair and paint (complete)
Right



Bonnet

Stone chip(s)
Repair and paint (complete)
Front




Boot lid covering R

Scratch(es)
Smart repair
Rear



Bumper F

Scratch(es)
Repair and paint (partial)
Front

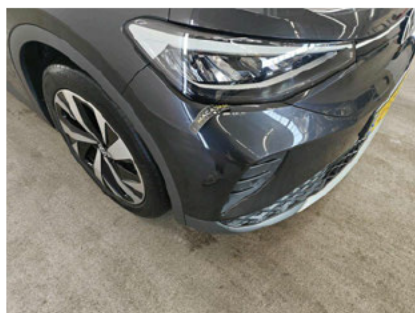

Charging cable (normal)

Missing
Replace
Rear




Door FL

Scratch(es)
Repair and paint (partial)
Left



Door FR

Dent(s) and scratch(es)
Repair and paint (complete)
Right

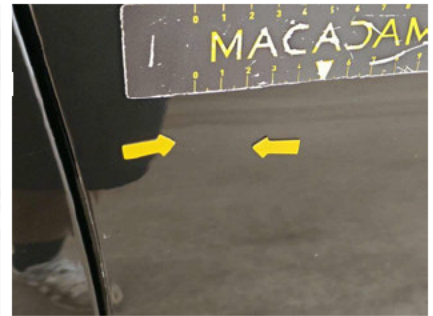

Door RL

Scratch(es)
Repair and paint (partial)
Left



Door RR

Scratch(es)

Repair and paint (partial)

Right



Interior

Stain

Cleaning

Interior



Windscreen

Stone chip(s)

Windscreen repair

Front



Wing RL

Scratch(es)

Repair and paint (complete)

Left



Wing RL

Scratch(es)

Repair and paint (complete)

Left



Wing RR

Dent(s)

Repair and paint (complete)

Right



Tyres

Front Left

Summer

255/45/20/101/T

Bridgestone

4.4 mm

Front Right

Summer

255/45/20/101/T

Bridgestone

4.4 mm

Rear Left

Summer

255/45/20/101/T

Hankook

5.5 mm

Rear Right

Summer

255/45/20/101/T

Hankook

5.6 mm

Checks

Certificate of Conformity	No CO2 Emission	0
Customer data reset (contacts, e-mails, messages)	Yes Digital maintenance	Yes
GPS storage	Yes GPS storage	HD
Luggage cover	Yes Number head rests	5
Number of charging cables (normal)	0 Number of charging cables (rapid charge)	1
Number of keys total	2 Service book	N/A
User's manual	Yes	

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non-disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.