



Volkswagen Caddy				
Vinnumber:	WV2ZZZSK6PX058360		Versionname:	
First Registrationdate:	7/02/2023		Fiscalpower:	
Expertise Mileage:	175119		Power Kw:	90
Bodytype:			Body colour	Grey
Gearbox:	Automatic		Type of rims (mounted)	Steel
Transmission:			Parking lot	2433
Fueltype:	Diesel			
Type of rims (mounted)	Steel			
Certificate of Conformity	Yes			
Category	Passenger Car			
Registration Certificate Car (BE)	Yes			
Registration Certificate Home (BE)	No			
Options				
Number of keys total	1	Front parking sensors		
Cruise Control		Rear parking sensors		
Steering wheel multifunctional		Type of Tow bar		Tow bar fixed
Radio multimedia				
Type of headlighting	Headlighting LED			
Type of GPS	GPS big screen color			
Type of Lining	Lining artificial leather			
Type of climate control	Autom climate control			
Limited Technical Inspection				
Tyres				
Winter tyres:	215/55/17/98 V			
	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				215/55 R 17 98 V
Tyre size FR				215/55 R 17 98 V
Tyre size RL				215/55 R 17 98 V
Tyre size RR				215/55 R 17 98 V
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261
Assistance equipment				
Spare wheel	Yes	Jack		Yes
Number of charging cables (normal)	0			
Number of charging cables (rapid charge)	0			
Total cost ex VAT				1287,75
Ignition key, Missing, Replace				262,56



Bonnet, Dent(s), Paintless dent repair	95,47
--	-------



Wing FL, Scratch(es), Acceptable	0,00
----------------------------------	------



Wheel cover FL, Scratch(es), Acceptable	0,00
---	------



Door RL, Dent(s) and scratch(es), Repair and paint (complete)	334,34
---	--------




Outer sill L, Dent(s) and scratch(es), Spot repair	148,33
--	--------



Wing RL, Scratch(es), Spot repair	148,33
-----------------------------------	--------




Wheel cover RL, Scratch(es), Replace	22,50
--------------------------------------	-------

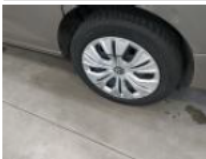

Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------



Wheel cover FR, Broken, Replace	22,50
---------------------------------	-------

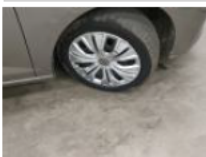

Wing FR, Dent(s) and scratch(es), Repair and paint (complete)	231,22
---	--------



Sliding door R, Scratch(es), Acceptable

0,00



Wheel cover RR, Scratch(es), Replace

22,50



Wing RR, Scratch(es), Acceptable

0,00

